

City of Tustin

Americans with Disabilities Act

Transition Plan and Self-Evaluation –

Public Rights-of-Way (PROW)



City of Tustin
Public Works Department
300 Centennial Way
Tustin, CA 92780
714.573.3150

TABLE OF CONTENTS

TABLE OF CONTENTS.....	1
SECTION I: EXECUTIVE SUMMARY	2
INTRODUCTION: DEVELOPMENT OF ADA TRANSITION PLAN (PROW) ...	2
OVERVIEW: ACCESS COMPLIANCE SURVEYS OF THE PUBLIC RIGHTS- OF-WAY (PROW)	3
PRIORITIZATION CRITERIA FOR BARRIER MITIGATION – PUBLIC RIGHTS-OF-WAY	4
OFFICIAL(S) RESPONSIBLE.....	4
PUBLIC INPUT	5
TRANSITION PLAN IMPLEMENTATION	5
IMPLEMENTATION POLICIES	6
NOTICE OF COMPLIANCE UNDER ADA & CALIFORNIA STATE LAW	6
ADA GRIEVANCE PROCEDURE	6
SECTION II: APPENDIX	7
Appendix A: CITYWIDE ZONES MAP	
Appendix B: LIST OF SIDEWALK DISTRESS INVENTORY	
Appendix C: LIST OF CURB RAMPS WITHOUT DETECTABLE WARNING SURFACE	

SECTION I: EXECUTIVE SUMMARY

INTRODUCTION: DEVELOPMENT OF ADA TRANSITION PLAN (PROW)

The Americans with Disabilities Act (ADA) OF 1990 provides comprehensive civil rights protections to qualified individuals with disabilities in the areas of employment, public accommodations, State and local government services, and telecommunications. A primary goal of the ADA is to ensure equal participation on public life for all Americans with disabilities. Title II of the Act covers programs, services and activities of public entities, such as the City of Tustin.

This ADA Transition Plan has been updated to reflect current City practices, ongoing Capital Improvement Projects, and state and federal grant-funded improvements. The Plan is intended to be a living document and will be updated periodically as accessibility improvements are completed and as new needs are identified.

The ADA defines “disability as:

- a) A physical or mental impairment that substantially limits one or more major life activities;
- b) Having a record of such an impairment; or
- c) Being regarded as having such an impairment.

If an individual meets any one of these tests, they are considered to be an individual with a disability for purposes of the ADA.

Under Title II, a public entity may not deny the benefits of its programs, services, and/or activities to individuals with disabilities by maintaining inaccessible facilities which house these programs, services and activities. The City’s programs, services and activities, when viewed in their entirety, must be made accessible to and usable by individuals with disabilities, except where to do so would result in a fundamental alteration in the nature of the program, result in undue financial and administrative burdens, or threaten or destroy the historic significance of a historic property.

Section 35.150 requires that each program, service or activity conducted by a City, when viewed in its entirety, be readily accessible to and usable by individuals with disabilities. The regulation makes clear, however, that a City is not required to make each of its existing facilities accessible (35.150(a)(1)). Unlike Title III of the ADA, which requires public accommodations to remove architectural barriers where such removal is “readily achievable”, or to provide goods and services through alternative methods, where those methods are “readily achievable”, Title II requires a City to make its programs accessible in all cases, except where to do so would result in a fundamental alteration in the nature of the program or in undue financial and administrative burdens. The US Congress intended the “undue burden” standard in Title II to be significantly higher than the “readily achievable” standard in Title III. Thus, although Title II may not require removal of barriers in some cases where removal would be required under Title III, the program access requirement of Title II

should enable individuals with disabilities to participate in and benefit from the programs, services or activities of cities in all but the most unusual cases. The City is not required to take any action that is “technically infeasible”. As to alterations, an item is technically infeasible when something has little likelihood of being accomplished because existing structural conditions would require removing or altering a load-bearing member that is part of the structural frame, existing physical or site constraints prohibit modification or addition of elements, spaces, or features that are in full and strict compliance with minimum requirements. When technical infeasibility is encountered, ADA compliance is required to the maximum extent feasible. As to terrain, full compliance is “structurally impracticable” when the unique characteristics of terrain prevent the incorporation of accessibility features. Any portion of the facility that can be made accessible shall be made accessible to the extent that it is not structurally impracticable.

To comply with the Title II requirements for accessibility to City programs, services and activities, this Transition Plan:

- Identifies physical obstacles in the public entity’s Public Rights-of-Way that limit the accessibility of its programs or activities to individuals with disabilities;
- Describes the methods that will be used to make the Public Rights-of-Way accessible;
- Specifies the steps necessary to achieve compliance;
- Provides a schedule for barrier removal/mitigation;
- Sets priorities for barrier elimination; and
- Indicates the official responsible for implementation of the plan.

OVERVIEW: ACCESS COMPLIANCE SURVEYS OF THE PUBLIC RIGHTS-OF-WAY

Barden v. City of Sacramento, 292 F. 3d 1073 established that sidewalks and intersections constitute a service, program, or activity provided by a City; therefore, they are subject to accessibility regulations and should be addressed as part of the City’s ADA Transition Plan.

The City of Tustin contracted with Bucknam Infrastructure Group to conduct a review of infrastructure in the City Public Rights-of-Way to demonstrate the City’s commitment to complying with the tenets of Title II of the Americans with Disabilities Act. This report was completed in 2023. This update to the ADA Transition Plan focuses primarily on the public right-of-way, including sidewalks, curb ramps, pedestrian crossings, and related pedestrian infrastructure. Accessibility improvements to City buildings, parks, and facilities are addressed through separate City programs, capital improvement projects, and facility-specific upgrades. The features surveyed in the PROW included sidewalk, curb/gutter and ADA ramps. The information collected included asset type, surface type, distress type, and displacement measurements. Traditional measuring and smart-level equipment were used to collect measurements for these surveys.

Detailed sidewalk and curb ramp inventory information supporting this Transition Plan (The Access Compliance Survey Reports from the field surveys of the PROW) is provided in Section II: Appendix for *Citywide Zones Map*, *Sidewalk Distress Inventory* and *List of Ramps without Detectable Warning Surface*.

PRIORITIZATION CRITERIA FOR BARRIER MITIGATION – PUBLIC RIGHTS-OF-WAY

A requirement of an ADA Transition Plan is to create a schedule that the City shall follow which addresses the order in which barriers shall be mitigated. This schedule shall be a public document and shall be made available for public inspection, maintained, and updated for the duration of the Transition Planning period. The maintaining and updating of this document shall mark the City's good-faith efforts in transitioning from a state of noncompliance to compliance regarding accessibility.

The City of Tustin will construct or reconstruct, as many curb ramps, sidewalks, traffic signal upgrades and signal warning devices as City Council approved funding allows as part of the City's annual budget and the City's Capital Improvement Program (CIP) ADA funding, until the City is fully ADA compliant, citywide.

The highest priority for ADA corrective improvements will be given to locations requested by people with disabilities, as funds are available.

The City is divided into seven citywide zones with one (1) zone targeted each year for ADA improvements in the Public Rights-of-Way utilizing a rolling seven-year cycle. Deficient items in the current zone will be repaired/replaced as funds allow. Please see Section II: Appendix for *Citywide Zones Map*, *Sidewalk Distress Inventory* and *List of Curb Ramps without Detectable Warning Surface*.

As part of capital and developer projects, curb ramps will be installed or reconstructed at locations where adjacent street work is being performed (excluding regular street maintenance), if existing ramps are not in compliance with the ADA standards.

Curb ramps, sidewalks, traffic signals, and other ADA access facilities, which are not ADA compliant and are not adjacent to developer or capital projects, will be installed or reconstructed, as required, under other approved City street improvement projects.

Generally, missing curb ramps have priority over missing sidewalks because ramps provide the means for a user to enter and exit a roadway.

OFFICIALS(S) RESPONSIBLE

It is the US DOJ's view that compliance with 28 CFR 35.150(a), like compliance with the corresponding provisions of the section 504 regulations for public programs, would in most cases not result in undue financial and administrative burdens on a typical city. In

determining undue financial and administrative burdens, all City resources available for use in the funding and operation of City services, programs and activities would need to be considered.

The burden of proving that compliance with paragraph (a) of 28 CFR 35.150 would either fundamentally alter the nature of a service, program or activity OR would result in undue financial and administrative burdens rests with the City. The decision that compliance would result in such alteration and/or burden must be made by the head of the public entity or their designee and must be accompanied by a written statement of the reasons reaching that conclusion.

The ADA requires that an official be identified as responsible for the implementation of the Transition Plan. In the City of Tustin, the official responsible is the ADA Coordinator, Erica N. Yasuda (City Clerk).

ADA Coordinator:
Erica N. Yasuda
300 Centennial Way
Tustin CA 92780
714.573.3025
eyasuda@tustinca.org

PUBLIC INPUT

The ADA Transition Plan and Self-Evaluation - Public Rights-of-Way is available on the City website. The public may direct any concerns to the ADA Coordinator, Erica N. Yasuda (City Clerk).

TRANSITION PLAN IMPLEMENTATION

The document should be maintained and updated throughout the transition planning period and will be made available for public inspection.

The ADA Transition Plan is a living document and will be updated as accessibility barriers are removed or modified through City projects. City officials and project managers responsible for implementing barrier-removal projects will document completed ADA improvements and upgrades. Where compliance is determined to be technically infeasible, supporting documentation will be prepared and retained in the City's records.

ADA improvements are implemented on an ongoing basis through annual ADA funding, street rehabilitation projects, development projects, and state and federal grant-funded programs. Barriers are prioritized based on requests from individuals with disabilities, access to public facilities and transit, safety considerations, and coordination with scheduled capital projects.

Documentation and verification of completed barrier-mitigation efforts will be incorporated into the ADA Transition Plan on a regular basis to ensure the Plan remains current and

reflects progress toward improved accessibility.

IMPLEMENTATION POLICIES

The City proposes the following implementation policies for transition of its Public Rights-of-Way into compliance with the ADA.

1. The City will appropriate funding for the mitigation of barriers identified in the Transition plan on a yearly basis unless financially imprudent to do so.
2. The City will continue to seek out sources of funding beyond the accounts at present, including funds associated with the City's Capital Improvement Project funds.

NOTICE OF COMPLIANCE UNDER ADA AND CALIFORNIA STATE LAW

In accordance with the requirements of Title II of the Americans with Disabilities Act (ADA) of 1990, the Americans with Disabilities Act of 2008, the Fair Employment & Housing Act (FEHA), California Government Code Section 11135 and other applicable codes, the City does not discriminate against individuals on the basis of disability in its services, programs or activities.

ADA GRIEVANCE PROCEDURE

This grievance procedure is established to meet the requirements of the Americans with Disabilities Act of 1990 ("ADA").

The public may direct any grievances/concerns to the ADA Coordinator, Erica N. Yasuda (City Clerk).

ADA Coordinator:
Erica N. Yasuda
300 Centennial Way
Tustin CA 92780
714.573.3025
eyasuda@tustinca.org



SECTION II: APPENDICES

Appendix A: *CITYWIDE ZONES MAP*

Appendix B: *LIST OF SIDEWALK DISTRESS INVENTORY (SUPPORTING INVENTORIES)*


Appendix C: *LIST OF CURB RAMPS WITHOUT DETECTABLE WARNING SURFACE (SUPPORTING INVENTORIES)*

Appendix A:

Citywide Zones Map

City of Tustin, CA

Citywide Zones

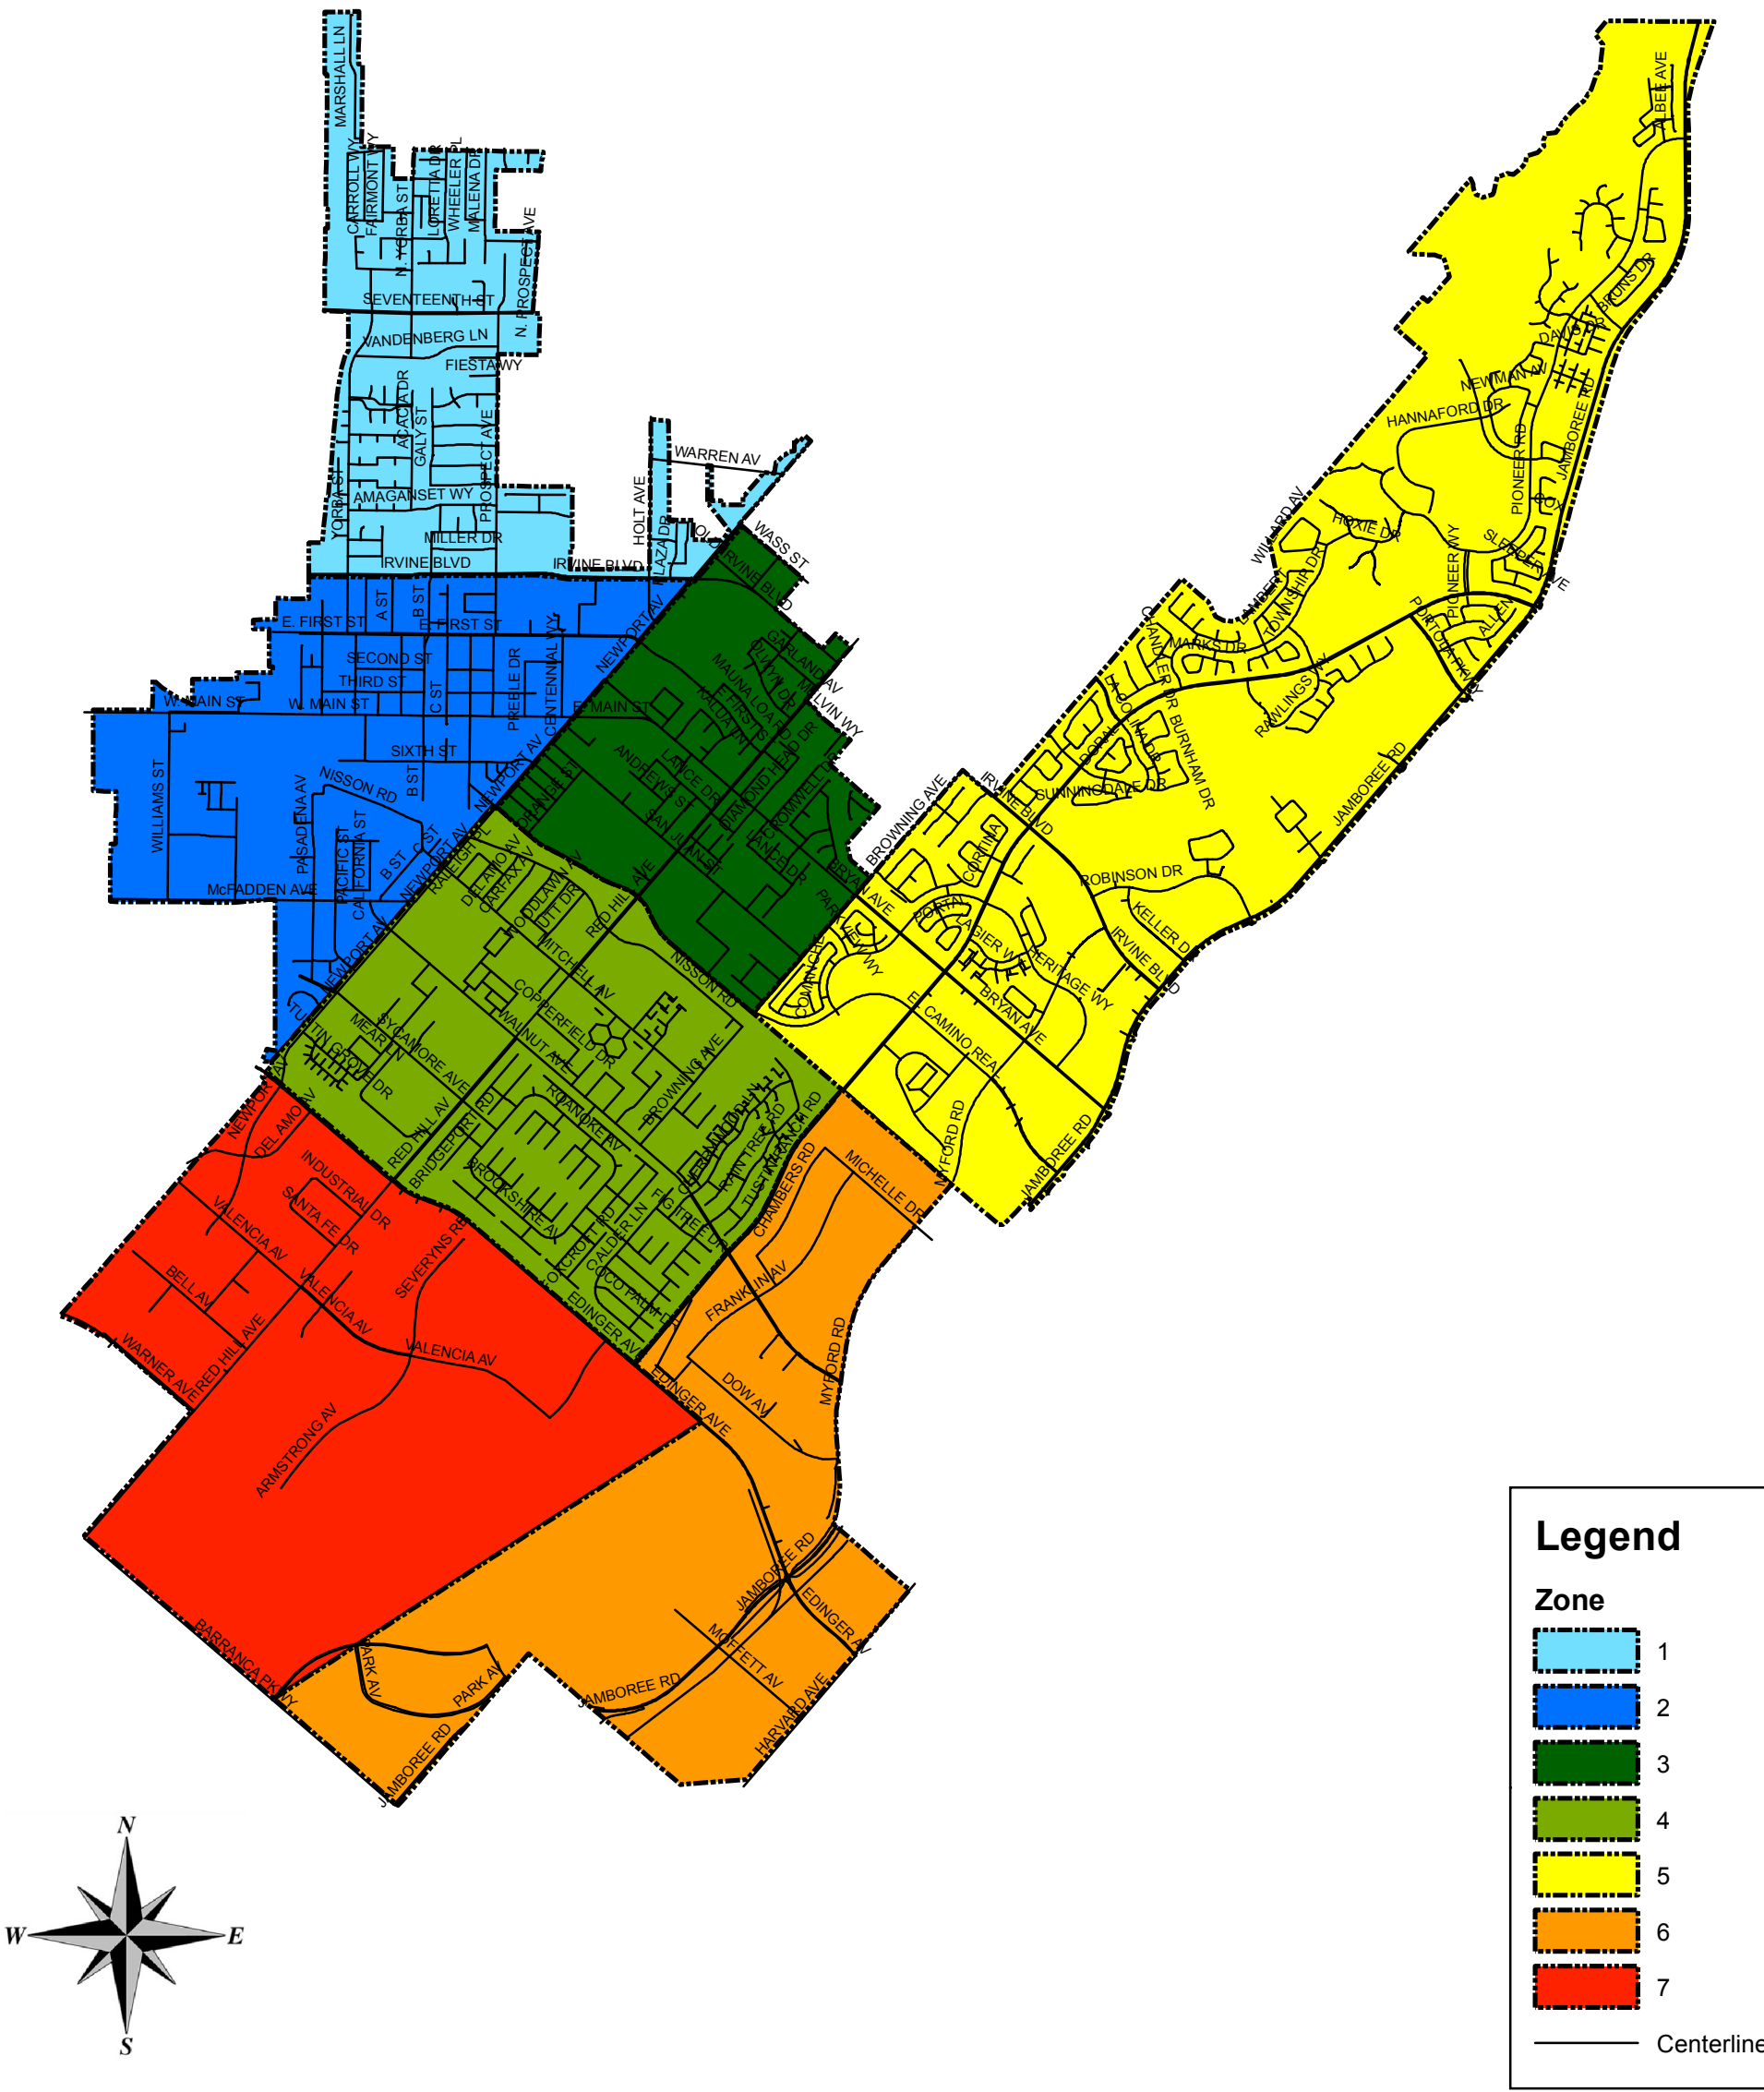

City of Tustin, CA

Citywide Zones Map



ArcGIS 10.1 Bucknam & Associates
July 2013

Source: City of Tustin AutoCAD Dwg
Created in ArcGIS 10.1 using ArcMap

Appendix B:

List of Sidewalk Distress Inventory (Supporting Inventories)

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
Zone 1																	
10169	ACACIA DRIVE	14221	401-231-28	B3	1	1504	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	3		No			Grind	
10168	ACACIA DRIVE	14221	401-231-28	B3	1	1504	Curb/Gutter	PCC	Spalling	1/2" to 1"	3		No			Replace C&G	
10167	ACACIA DRIVE	14222	401-231-29	B3	1	1504	Driveway	PCC	Linear Cracking	1/4" to 1/2"	3		No			Grind	
10170	ACACIA DRIVE	14231	401-231-27	B3	1	1504	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	3		No			Grind	
10171	ACACIA DRIVE	14231	401-231-27	B3	1	1504	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	3		No			Grind	
10172	ACACIA DRIVE	14251	401-231-25	B3	1	1504	Sidewalk	PCC	Spalling	1/2" to 1"	2		No			Replace C&G	
10166	ACACIA DRIVE	14292	401-231-34	B3	1	1504	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	30		No			Grind	
10165	ACACIA DRIVE	14302	401-231-35	C3	1	1504	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10163	ACACIA DRIVE	14321	401-232-29	C3	1	1504	Curb/Gutter	PCC	Spalling	1" to 2"	1		No			Patch	
10287	ACACIA DRIVE	14382	401-111-17	C3	1	1503	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	
10350	ACACIA DRIVE	14391	401-112-17	C3	1	1503	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
10288	ACACIA DRIVE	14422	401-111-20	C3	1	1503	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10289	ACACIA DRIVE	14422	401-111-20	C3	1	1503	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10325	ACACIA DRIVE	14451	401-113-17	C3	1	1503	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	
10326	ACACIA DRIVE	14451	401-113-17	C3	1	1503	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
10290	ACACIA DRIVE	14532	401-494-03	C3	1	1503	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10291	ACACIA DRIVE	14532	401-494-03	C3	1	1503	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
10292	ACACIA DRIVE	14542	401-494-04	C3	1	1502	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	
10300	ACACIA DRIVE	14571	401-492-17	C3	1	1502	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
10293	ACACIA DRIVE	14572	401-494-06	C3	1	1502	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	
10294	ACACIA DRIVE	14572	401-494-06	C3	1	1502	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	
10295	ACACIA DRIVE	14572	401-494-06	C3	1	1502	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10296	ACACIA DRIVE	14582	401-494-07	C3	1	1502	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10299	ACACIA DRIVE	14591	401-492-19	C3	1	1502	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10298	ACACIA DRIVE	14591	401-492-19	C3	1	1502	Sidewalk	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
10297	ACACIA DRIVE	14592	401-494-08	C3	1	1502	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
10349	ACACIA DRIVE	17501	401-112-18	C3	1	1503	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
10164	ACACIA DRIVE	17507	401-111-14	C3	1	1504	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
10416	AMAGANSET WAY	14591	401-492-19	C3	1	1514	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
10415	AMAGANSET WAY	14592	401-494-08	C3	1	1515	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10414	AMAGANSET WAY	14592	401-494-08	C3	1	1515	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
10413	AMAGANSET WAY	14592	401-494-08	C3	1	1515	Sidewalk	PCC	Spalling	1" to 2"	2		Yes			Patch	
10123	AMAGANSET WAY	14601	401-101-23	C2	1	1513	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
10125	AMAGANSET WAY	14621	401-101-30	C2	1	1513	Sidewalk	PCC	Faulting	1/2" to 1"	6		Yes			Ramp	Prev grind
10126	AMAGANSET WAY	14621	401-101-30	C2	1	1513	Ramp	PCC	Divided Slab	No Displacement	12		No			Replace Slab(s)	
10124	AMAGANSET WAY	17281	401-101-25	C2	1	1513	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
10428	AMAGANSET WAY	17331	401-492-37	C2	1	1514	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10130	AMAGANSET WAY	17331	401-492-37	C2	1	1514	Cross Gutter	PCC	Linear Cracking	1/2" to 1"	8		No			Replace Slab(s)	
10465	AMAGANSET WAY	17332	401-493-01	C2	1	1514	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10129	AMAGANSET WAY	17332	401-493-01	C2	1	1514	Cross Gutter	PCC	Linear Cracking	1/2" to 1"	9		No			Replace Slab(s)	
10128	AMAGANSET WAY	17332	401-493-01	C2	1	1514	Cross Gutter	PCC	Linear Cracking	1/4" to 1/2"	14		No			Grind	
10427	AMAGANSET WAY	17341	401-492-36	C2	1	5014	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10426	AMAGANSET WAY	17361	401-492-34	C2	1	5014	Sidewalk	PCC	Linear Cracking	1" to 2"	3		Yes			Replace Slab	
10425	AMAGANSET WAY	17371	401-492-33	C2	1	5014	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	5		Yes			Grind	
10423	AMAGANSET WAY	17381	401-492-32	C3	1	1514	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10424	AMAGANSET WAY	17381	401-492-32	C2	1	1514	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10421	AMAGANSET WAY	17391	401-492-31	C3	1	5015	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
10422	AMAGANSET WAY	17391	401-492-31	C3	1	1514	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
10467	AMAGANSET WAY	17402	401-493-05	C3	1	1514	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
10466	AMAGANSET WAY	17402	401-493-05	C3	1	1514	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
10468	AMAGANSET WAY	17402	401-493-05	C3	1	1514	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10420	AMAGANSET WAY	17431	401-492-27	C3	1	5015	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10469	AMAGANSET WAY	17442	401-493-08	C3	1	1514	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
10470	AMAGANSET WAY	17452	401-493-09	C3	1	1514	Sidewalk	PCC	Linear Cracking	1/2" to 1"	4		Yes			Grind	
10471	AMAGANSET WAY	17472	401-493-11	C3	1	1514	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
10472	AMAGANSET WAY	17482	401-493-12	C3	1	1514	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
10419	AMAGANSET WAY	17501	401-492-20	C3	1	5016	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	
10418	AMAGANSET WAY	17501	401-492-20	C3	1	5016	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
10417	AMAGANSET WAY	17501	401-492-20	C3	1	1514	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
10473	AMAGANSET WAY	17512	401-493-15	C3	1	1515	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	
10474	AMAGANSET WAY	17522	401-493-16	C3	1	1515	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
10475				C3	1	1515	Sidewalk	PCC	Faulting	1" to 2"	4		Yes			Replace Slab	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
10476	AMAGANSET WAY	17542	401-032-02	C3	1	1515	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
10477	AMAGANSET WAY	17542	401-032-02	C3	1	1515	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10411	AMAGANSET WAY	17551	401-031-04	C3	1	1515	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		Yes			Grind	
10412	AMAGANSET WAY	17551	401-031-04	C3	1	1515	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10479	AMAGANSET WAY	17602	401-033-02	C3	1	1515	Sidewalk	PCC	Faulting	1" to 2"	3		Yes			Replace Slab	
10478	AMAGANSET WAY	17602	401-033-02	C3	1	1515	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
10409	AMAGANSET WAY	17631	401-031-09	C3	1	1515	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10410	AMAGANSET WAY	17631	401-031-09	C3	1	1515	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
10408	AMAGANSET WAY	17631	401-031-09	C3	1	1515	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
10480	AMAGANSET WAY	17632	401-033-04	C3	1	1515	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
10407	AMAGANSET WAY	17651	401-031-10	C3	1	1515	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10361	AMAGANSET WAY	17652	401-033-05	C3	1	1515	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		Yes			Grind	
10406	AMAGANSET WAY	17671	401-031-11	C3	1	1515	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
10405	AMAGANSET WAY	17711	401-031-13	C3	1	1515	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
10404	AMAGANSET WAY	17731	401-031-14	C3	1	1515	Sidewalk	PCC	Faulting	1" to 2"	4		Yes			Replace Slab	
10403	AMAGANSET WAY	17731	401-031-14	C3	1	1515	Sidewalk	PCC	Linear Cracking	Over 2"	4		Yes			Replace Slab	
10247	AMBERWICK LANE	14482	401-022-13	C3	1	1516	Sidewalk	PCC	Faulting	1/2" to 1"	2		Yes			Ramp	
10248	AMBERWICK LANE	14482	401-022-13	C3	1	1516	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
10251	AMBERWICK LANE	17626	401-023-10	C3	1	1516	Sidewalk	PCC	Faulting	1/2" to 1"	5		Yes			Ramp	
10250	AMBERWICK LANE	17626	401-023-10	C3	1	1516	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
3588	ANGLIN DRIVE	17321	395-311-15	B2	1	1522	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
3589	ANGLIN DRIVE	17321	395-311-15	B2	1	1522	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	7		Yes			Grind	
3587	ANGLIN DRIVE	17331	395-311-14	B2	1	1522	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
3586	ANGLIN DRIVE	17341	395-311-13	B3	1	1522	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
9945	ANGLIN LANE	13752	395-163-02	B3	1	1523	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
9946	ANGLIN LANE	13752	395-163-02	B3	1	1523	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
10058	ANGLIN LANE	13771	395-291-37	B3	1	1523	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10059	ANGLIN LANE	13771	395-291-37	B3	1	1523	Sidewalk	PCC	Spalling	1" to 2"	1		No			Patch	
9811	ANGLIN LANE	13772	395-291-24	B3	1	1523	Ramp	PCC	Faulting	1/2" to 1"	2		No			Grind Ramp	
10054	ANGLIN LANE	13772	395-162-61	B3	1	1523	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
9944	ANGLIN LANE	17661	395-292-11	B3	1	1523	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
9943	ANGLIN LANE	17681	395-292-09	B3	1	1523	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
10056	ANGLIN LANE	17682	395-291-41	B3	1	1523	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
10055	ANGLIN LANE	17682	395-291-41	B3	1	1523	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
9942	ANGLIN LANE	17691	395-292-08	B3	1	1523	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
10057	ANGLIN LANE	17702	395-291-39	B3	1	1523	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
9941	ANGLIN LANE	17721	395-292-05	B3	1	1523	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
9940	ANGLIN LANE	17741	395-292-03	B3	1	1523	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
9939	ANGLIN LANE	17751	395-292-02	B3	1	1523	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
9938	ANGLIN LANE	17761	395-292-01	B3	1	1523	Sidewalk	PCC	Faulting	1/4" to 1/2"	6		No			Grind	Prev grind
9937	ANGLIN LANE	17761	395-292-01	B3	1	1523	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	14		Yes			Replace Slab	
5576	ARBOLADA WAY	17575	401-382-07	B3	1	1526	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight displacement
5578	ARBOLADA WAY	17582	401-382-08	B3	1	1526	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	Prev grind
5577	ARBOLADA WAY	17582	401-382-08	B3	1	1526	Sidewalk	PCC	Linear Cracking	No Displacement	4		Yes			Joint Seal	Slight displacement
5575	ARBOLADA WAY	17591	401-382-05	B3	1	1526	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
5579	ARBOLADA WAY	17592	401-382-09	B3	1	1526	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	Prev grind
5580	ARBOLADA WAY	17612	401-382-10	B3	1	1526	Sidewalk	PCC	Faulting	1" to 2"	2		Yes			Replace Slab	Prev grind
5581	ARBOLADA WAY	17612	401-382-10	B3	1	1526	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
5582	ARBOLADA WAY	17612	401-382-10	B3	1	1526	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
5574	ARBOLADA WAY	17621	401-382-03	B3	1	1526	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
5583	ARBOLADA WAY	17622	401-382-11	B3	1	1526	Sidewalk	PCC	Buckled Slab	1" to 2"	6		Yes			Replace Slab	
5584	ARBOLADA WAY	17622	401-382-11	B3	1	1526	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
5573	ARBOLADA WAY	17631	401-382-02	B3	1	1526	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight displacement
5572	ARBOLADA WAY	17651	401-382-01	B3	1	1526	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
11548	B STREET	14741	401-041-04	C3	1	1542	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No		Yes	Grind	
11550	B STREET	14741	401-041-04	C3	1	1542	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No		Yes	Grind	
11546	B STREET	14741	401-032-07	C3	1	1542	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No		Yes	Grind	
11547	B STREET	14741	401-032-07	C3	1	1542	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No		Yes	Grind	
11549	B STREET	14741	401-041-04	C3	1	1542	Driveway	PCC	Linear Cracking	No Displacement	10		No		Yes	Joint Seal	
11551	B STREET	14741	401-041-04	C3	1	1542	Sidewalk	PCC	Linear Cracking	No Displacement	15		No		Yes	Joint Seal	
11552	B STREET	17541	401-041-03	C3	1	1542	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No		Yes	Grind	
10391	B STREET	17571	401-045-01	C3	1	1542	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10383	B STREET	17572	401-044-01	C3	1	1542	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10392				C3	1	1542	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
11272	BENETA WAY	17952	401-131-13	C3	1	1546	Sidewalk	PCC	Faulting	1/2" to 1"	3		No		Yes	Ramp	
11264	BENETA WAY	17952	401-131-13	C3	1	1546	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes		Yes	Grind	
11265	BENETA WAY	17952	401-131-13	C3	1	1546	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes		Yes	Grind	
11266	BENETA WAY	17952	401-131-13	C3	1	1546	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes		Yes	Grind	
11267	BENETA WAY	17952	401-131-13	C3	1	1546	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		Yes		Yes	Grind	
11268	BENETA WAY	17952	401-131-13	C3	1	1546	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No		Yes	Grind	
11269	BENETA WAY	17952	401-131-13	C3	1	1546	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No		Yes	Grind	
11270	BENETA WAY	17952	401-131-13	C3	1	1546	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No		Yes	Grind	
11273	BENETA WAY	17952	401-131-13	C3	1	1546	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes		Yes	Grind	
11274	BENETA WAY	17952	401-131-13	C3	1	1546	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No		Yes	Grind	
11271	BENETA WAY	17952	401-131-13	C3	1	1546	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	10		No		Yes	Grind	
11315	BENETA WAY		401-242-06	C3	1	1546	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes		Yes	Grind	Prev grind
11276	BENETA WAY		401-242-05	C3	1	1546	Sidewalk	PCC	Faulting	1/2" to 1"	4		No		Yes	Ramp	
11277	BENETA WAY		401-242-05	C3	1	1546	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes		Yes	Ramp	
11275	BENETA WAY		401-477-02	C3	1	1546	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No		Yes	Grind	
11261	BENETA WAY		401-131-14	C3	1	1546	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No		Yes	Grind	
11262	BENETA WAY		401-131-14	C3	1	1546	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No		Yes	Grind	
11263	BENETA WAY		401-131-14	C3	1	1546	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No		Yes	Grind	
11278	BENETA WAY		401-242-06	C3	1	1546	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		Yes		Yes	Grind	
11279	BENETA WAY		401-242-06	C3	1	1546	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No		Yes	Grind	
11281	BENETA WAY		401-242-06	C3	1	1546	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes		Yes	Grind	
11282	BENETA WAY		401-242-06	C3	1	1546	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No		Yes	Grind	
11283	BENETA WAY		401-242-06	C3	1	1546	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No		Yes	Grind	
11314	BENETA WAY		401-242-06	C3	1	1546	Sidewalk	PCC	Faulting	1/4" to 1/2"	4.5		No		Yes	Grind	
11317	BENETA WAY		401-242-03	C3	1	1546	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No		Yes	Grind	
11280	BENETA WAY		401-242-06	C3	1	1546	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	15		No		Yes	Grind	
11316	BENETA WAY		401-242-03	C3	1	1546	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	4		No		Yes	Grind	
11556	BERGEN CIRCLE	14631	401-101-31	C2	1	1548	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
11562	BERGEN CIRCLE	14661	401-101-38	C2	1	1548	Sidewalk	PCC	Faulting	1/2" to 1"	4		No			Ramp	Prev grind
11561	BERGEN CIRCLE	14661	401-101-38	C2	1	1548	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
12045	BERGEN CIRCLE	14661	401-101-38	C2	1	1548	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
11563	BERGEN CIRCLE	14661	401-101-38	C2	1	1548	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	3		No			Grind	
11560	BERGEN CIRCLE	17271	401-101-34	C2	1	1548	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
11559	BERGEN CIRCLE	17281	401-101-33	C2	1	1548	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
12044	BERGEN CIRCLE	17282	401-101-36	C2	1	1548	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	Prev grind
11557	BERGEN CIRCLE	17291	401-101-32	C2	1	1548	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
11558	BERGEN CIRCLE	17291	401-101-32	C2	1	1548	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
3562	BONNER DRIVE	13762	395-141-17	B3	1	1559	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	5		No			Grind	
3564	BONNER DRIVE	13762	395-141-17	B3	1	1559	Ramp	PCC	Sidewalk Curb Separation	1/4" to 1/2"	3		No			Grind	
5406	BONNER DRIVE	13772	395-162-41	B3	1	1560	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
3595	BONNER DRIVE	17321	395-311-21	B2	1	1558	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
3597	BONNER DRIVE	17321	395-311-21	B2	1	1558	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Prev grind
3596	BONNER DRIVE	17321	395-311-21	B2	1	1558	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
3592	BONNER DRIVE	17322	395-311-16	B2	1	1558	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
3594	BONNER DRIVE	17331	395-311-20	B3	1	1558	Sidewalk	PCC	Spalling	1/2" to 1"	3		No			Replace C&G	
3593	BONNER DRIVE	17332	395-311-17	B2	1	1558	Driveway	PCC	Faulting	1/4" to 1/2"	3		No			Grind Driveway	
3544	BONNER DRIVE	17391	395-141-19	B3	1	1559	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
3543	BONNER DRIVE	17411	395-141-18	B3	1	1559	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
3542	BONNER DRIVE	17451	395-141-02	B3	1	1559	Sidewalk	PCC	Linear Cracking	No Displacement	4		Yes			Joint Seal	Slight displacement
12063	BONNER DRIVE	17451	395-141-02	B3	1	1559	Driveway	PCC	Sidewalk Curb Separation	1/2" to 1"	5		No			Patch	
3560	BONNER DRIVE	17471	395-141-01	B3	1	1559	Cross Gutter	PCC	Divided Slab	1/4" to 1/2"			No			Replace Slab	Low
3563	BONNER DRIVE	17471	395-141-01	B3	1	1559	Cross Gutter	PCC	Other - Leave Comment	No Displacement			No			Field Assess-Monitor	Scaling/Popouts on all slabs of cross gutter
3540	BONNER DRIVE	17471	395-141-01	B3	1	1559	Driveway	PCC	Linear Cracking	No Displacement	5		No			Joint Seal	Spall
3541	BONNER DRIVE	17471	395-141-01	B3	1	1559	Sidewalk	PCC	Linear Cracking	No Displacement	4		Yes			Joint Seal	Spall
3561	BONNER DRIVE	17471	395-141-01	B3	1	1559	Cross Gutter	PCC	Linear Cracking	1/4" to 1/2"	5		No			Grind	
3539	BONNER DRIVE	17471	395-141-01	B3	1	1559	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	13		No			Grind	
12062	BONNER DRIVE	17471	395-141-01	B3	1	1559	Ramp	PCC	Sidewalk Curb Separation	1/4" to 1/2"	4		No			Grind	
5296	BONNER DRIVE	17531	395-161-03	B3	1	1560	Sidewalk	PCC	Linear Cracking	No Displacement	4		Yes			Joint Seal	Slight displacement
5300	BONNER DRIVE	17562	395-162-05	B3	1	1560	Curb/Gutter	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
5292	BONNER DRIVE	17571	395-161-07	B3	1	1560	Driveway	PCC	Linear Cracking	1/4" to 1/2"	7		No			Grind	
5302	BONNER DRIVE	17572	395-162-06	B3	1	1560	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
5304	BONNER DRIVE	17572	395-162-06	B3	1	1560	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
5306	BONNER DRIVE	17572	395-162-06	B3	1	1560	Driveway	PCC	Sidewalk Curb Separation	1/2" to 1"	3		Yes			Patch	
5460				A3	1	1564	Driveway	PCC	Linear Cracking	No Displacement	5		No			Joint Seal	Slight displacement

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
5459	BRENT LANE	17511	395-262-07	A3	1	1564	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight displacement
5461	BRENT LANE	17511	395-262-07	A3	1	1564	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
5465	BRENT LANE	17512	395-262-08	A3	1	1564	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	Prev grind
5466	BRENT LANE	17512	395-262-08	A3	1	1564	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	Prev grind
5462	BRENT LANE	17512	395-262-08	A3	1	1564	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
5463	BRENT LANE	17512	395-262-08	A3	1	1564	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
5464	BRENT LANE	17512	395-262-08	A3	1	1564	Driveway	PCC	Linear Cracking	No Displacement	5		No			Joint Seal	Slight displacement
5456	BRENT LANE	17521	395-262-06	A3	1	1564	Sidewalk	PCC	Faulting	1/2" to 1"	6		No			Ramp	
5458	BRENT LANE	17521	395-262-06	A3	1	1564	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
5457	BRENT LANE	17521	395-262-06	A3	1	1564	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
5467	BRENT LANE	17532	395-262-10	A3	1	1564	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
5468	BRENT LANE	17532	395-262-10	A3	1	1564	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
5469	BRENT LANE	17532	395-262-10	A3	1	1564	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	4		No			Grind	
5471	BRENT LANE	17552	395-262-11	A3	1	1564	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
5454	BRENT LANE	17561	395-262-03	A3	1	1564	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
5455	BRENT LANE	17561	395-262-03	A3	1	1564	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
5470	BRENT LANE	17562	395-262-12	A3	1	1564	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
5472	BRENT LANE	17562	395-262-12	A3	1	1564	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
5452	BRENT LANE	17571	395-262-02	A3	1	1564	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight displacement
5453	BRENT LANE	17571	395-262-02	A3	1	1564	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight displacement
5451	BRENT LANE	17581	395-262-01	A3	1	1564	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
5450	BRENT LANE	17581	395-262-01	A3	1	1564	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
5448	BRENT LANE	17581	395-262-01	A3	1	1564	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	5		No			Grind	
5449	BRENT LANE	17581	395-262-01	A3	1	1564	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	10		No			Grind	
5473	BRENT LANE	17582	395-262-14	A3	1	1564	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
10376	BROOKLINE WAY	14661	401-032-03	C3	1	1568	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10377	BROOKLINE WAY	14681	401-032-04	C3	1	1568	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10375	BROOKLINE WAY	14682	401-033-17	C3	1	1568	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10379	BROOKLINE WAY	14701	401-032-05	C3	1	1568	Sidewalk	PCC	Faulting	1/2" to 1"	3		No			Ramp	
10378	BROOKLINE WAY	14701	401-032-05	C3	1	1568	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
3446	CARROLL WAY	13522	395-021-48	A3	1	1595	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	10		No			Grind	
3445	CARROLL WAY	13552	395-021-47	A3	1	1595	Driveway	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
3444	CARROLL WAY	13592	395-021-52	A3	1	1595	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
3447	CARROLL WAY	13611	395-022-07	A2	1	1595	Driveway	PCC	Linear Cracking	No Displacement	6		No			Joint Seal	
3443	CARROLL WAY	13612	395-021-39	A3	1	1595	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
3448	CARROLL WAY	13621	395-022-08	A2	1	1595	Driveway	PCC	Linear Cracking	No Displacement	6		No			Joint Seal	
3449	CARROLL WAY	13631	395-022-09	A2	1	1595	Driveway	PCC	Linear Cracking	1/4" to 1/2"	5		No			Grind	
3450	CARROLL WAY	13641	395-022-10	A2	1	1595	Driveway	PCC	Linear Cracking	No Displacement	5		No			Joint Seal	Slight displacement
3442	CARROLL WAY	13642	395-021-23	A3	1	1595	Driveway	PCC	Linear Cracking	No Displacement	5		No			Joint Seal	
3441	CARROLL WAY	13642	395-021-23	A3	1	1595	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	
3451	CARROLL WAY	13651	395-022-11	A2	1	1595	Driveway	PCC	Linear Cracking	No Displacement	5		No			Joint Seal	Slight displacement
3439	CARROLL WAY	13652	395-021-22	A3	1	1595	Driveway	PCC	Linear Cracking	No Displacement	5		No			Joint Seal	
3440	CARROLL WAY	13652	395-021-22	A3	1	1595	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
3452	CARROLL WAY	13661	395-022-12	A2	1	1595	Driveway	PCC	Linear Cracking	No Displacement	5		No			Joint Seal	Slight displacement
3438	CARROLL WAY	13662	395-021-21	A3	1	1595	Driveway	PCC	Linear Cracking	No Displacement	5		No			Joint Seal	
3437	CARROLL WAY	13672	395-021-20	A3	1	1595	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
3453	CARROLL WAY	13681	395-022-13	A2	1	1595	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
3435	CARROLL WAY	13682	395-021-19	A3	1	1595	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
3436	CARROLL WAY	13682	395-021-19	A3	1	1595	Curb/Gutter	PCC	Sidewalk Curb Separation	1" to 2"	6		No			Replace Curb	
3454	CARROLL WAY	13691	395-022-14	B2	1	1595	Driveway	PCC	Linear Cracking	1/4" to 1/2"	5		No			Grind	Spall
3456	CARROLL WAY	13701	395-022-15	B2	1	1595	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	10		No			Grind	Prev grind
3455	CARROLL WAY	13701	395-022-15	B2	1	1595	Sidewalk	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
3605	CARROLL WAY	13951	395-311-38	B3	1	1594	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes		Yes	Ramp	Prev grind
3604	CARROLL WAY	13951	395-311-38	B3	1	1594	Driveway	PCC	Linear Cracking	No Displacement	8		No		Yes	Joint Seal	Slight displacement
3603	CARROLL WAY	13951	395-311-38	B3	1	1594	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes		Yes	Grind	
3606	CARROLL WAY	13951	395-311-38	B3	1	1594	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	14		Yes		Yes	Grind	
3607	CARROLL WAY	13951	395-311-38	B3	1	1594	Curb/Gutter	PCC	Spalling	1/2" to 1"	1		No		Yes	Replace C&G	
3608	CARROLL WAY	17241	395-311-01	B3	1	1594	Driveway	PCC	Divided Slab	1/4" to 1/2"			No		Yes	Replace Slab(s)	Med
3609	CARROLL WAY	17241	395-311-01	B3	1	1594	Driveway	PCC	Spalling	1/2" to 1"	0.5		No		Yes	Replace C&G	
3613	CARROLL WAY	17245	395-142-08	B3	1	1594	Curb/Gutter	PCC	Spalling	Over 2"	1		No		Yes	Replace C&G	Drain
3612	CARROLL WAY	17245	395-142-08	B3	1	1594	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	5		Yes		Yes	Grind	
3611	CARROLL WAY	17245	395-142-08	B3	1	1594	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	5		Yes		Yes	Grind	
3602	CARROLL WAY	17342	395-311-37	B3	1	1594	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes		Yes	Grind	
3434					;	B3	1	1595	Sidewalk	PCC			No			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
3615	CARROLL WAY	17395	395-142-09	B3	1	1594	Sidewalk	PCC	Spalling	1/4" to 1/2"	7		No			Grind	Small spalls by mailbox
3616	CARROLL WAY	17395	395-142-09	B3	1	1594	Sidewalk	PCC	Faulting	1" to 2"	6		Yes			Replace Slab	
3617	CARROLL WAY	17395	395-142-09	B3	1	1594	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
3619	CARROLL WAY	17395	395-142-09	B3	1	1594	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		Yes			Grind	
3614	CARROLL WAY	17395	395-142-09	B3	1	1594	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	13		Yes		Yes	Replace Slab	
3620	CARROLL WAY	17395	395-142-09	B3	1	1594	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	8		No			Grind	
3618	CARROLL WAY	17395	395-142-09	B3	1	1594	Curb/Gutter	PCC	Spalling	1/2" to 1"	4		No		Yes	Replace C&G	
10249	CHATHAM DRIVE	17515	401-022-02	C3	1	1611	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	
9908	ENDERLE CENTER DRIVE	14032	401-253-03	B3	1	1661	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		Yes			Grind	Prev grind
9907	ENDERLE CENTER DRIVE	14032	401-253-03	B3	1	1661	Driveway	PCC	Linear Cracking	1/4" to 1/2"	6		No			Grind	
9912	ENDERLE CENTER DRIVE	17502	401-253-02	B3	1	1661	Sidewalk	PCC	Other - Leave Comment	1" to 2"	1		No			Ramp	Hole
9909	ENDERLE CENTER DRIVE	17502	401-253-02	B3	1	1661	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		Yes			Grind	
9911	ENDERLE CENTER DRIVE	17502	401-253-02	B3	1	1661	Driveway	PCC	Linear Cracking	1/4" to 1/2"	6		No			Grind	
9910	ENDERLE CENTER DRIVE	17502	401-253-02	B3	1	1661	Curb/Gutter	PCC	Spalling	1" to 2"	1		No			Patch	
10373	EVANSTON CIRCLE	14681	401-033-12	C3	1	1665	Sidewalk	PCC	Linear Cracking	1/2" to 1"	4		Yes			Grind	
10371	EVANSTON CIRCLE	14702	401-033-10	C3	1	1665	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	
10372	EVANSTON CIRCLE	14702	401-033-10	C3	1	1665	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
10370	EVANSTON CIRCLE	14722	401-033-09	C3	1	1665	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
3491	FAIRMONT WAY	13531	395-021-46	A3	1	1668	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
3493	FAIRMONT WAY	13532	395-011-40	A3	1	1668	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
3397	FAIRMONT WAY	13551	395-021-50	A3	1	1668	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
3399	FAIRMONT WAY	13551	395-021-50	A3	1	1668	Driveway	PCC	Linear Cracking	No Displacement	5		No			Joint Seal	
3398	FAIRMONT WAY	13551	395-021-50	A3	1	1668	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	7		No			Grind	
3494	FAIRMONT WAY	13552	395-011-52	A3	1	1668	Sidewalk	PCC	Spalling	1/2" to 1"	2		No			Replace C&G	Prev grind
3495	FAIRMONT WAY	13552	395-011-52	A3	1	1668	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
3400	FAIRMONT WAY	13561	395-021-04	A3	1	1668	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
3401	FAIRMONT WAY	13561	395-021-04	A3	1	1668	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
3402	FAIRMONT WAY	13571	395-021-05	A3	1	1668	Sidewalk	PCC	Faulting	1/2" to 1"	4		No			Ramp	
3404	FAIRMONT WAY	13571	395-021-05	A3	1	1668	Driveway	PCC	Linear Cracking	1/4" to 1/2"	5		No			Grind	
3403	FAIRMONT WAY	13571	395-021-05	A3	1	1668	Driveway	PCC	Sidewalk Curb Separation	1/2" to 1"	4		No			Patch	
3405	FAIRMONT WAY	13571	395-021-05	A3	1	1668	Driveway	PCC	Spalling	1/4" to 1/2"	4		No			Grind	
3496	FAIRMONT WAY	13572	395-011-36	A3	1	1668	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
3497	FAIRMONT WAY	13572	395-011-36	A3	1	1668	Driveway	PCC	Linear Cracking	No Displacement			No			Joint Seal	Spalled
3408	FAIRMONT WAY	13591	395-021-06	A3	1	1668	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
3406	FAIRMONT WAY	13591	395-021-06	A3	1	1668	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
3407	FAIRMONT WAY	13591	395-021-06	A3	1	1668	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
3409	FAIRMONT WAY	13601	395-021-07	A3	1	1668	Driveway	PCC	Linear Cracking	No Displacement	6		No			Joint Seal	
3498	FAIRMONT WAY	13602	395-011-38	A3	1	1668	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
3499	FAIRMONT WAY	13602	395-011-38	A3	1	1668	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
3410	FAIRMONT WAY	13611	395-021-08	A3	1	1668	Driveway	PCC	Linear Cracking	No Displacement	6		No			Joint Seal	
3500	FAIRMONT WAY	13612	395-011-37	A3	1	1668	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
3412	FAIRMONT WAY	13621	395-021-09	A3	1	1668	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
3411	FAIRMONT WAY	13621	395-021-09	A3	1	1668	Driveway	PCC	Linear Cracking	No Displacement	6		No			Joint Seal	
3413	FAIRMONT WAY	13631	395-021-10	A3	1	1668	Driveway	PCC	Linear Cracking	No Displacement	6		No			Joint Seal	
3414	FAIRMONT WAY	13641	395-021-11	A3	1	1668	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
3415	FAIRMONT WAY	13641	395-021-11	A3	1	1668	Sidewalk	PCC	Linear Cracking	No Displacement	4		Yes			Joint Seal	
3417	FAIRMONT WAY	13651	395-021-12	A3	1	1668	Sidewalk	PCC	Divided Slab	No Displacement			No			Replace Slab	Low
3418	FAIRMONT WAY	13651	395-021-12	A3	1	1668	Sidewalk	PCC	Divided Slab	No Displacement			No			Replace Slab	Low
3419	FAIRMONT WAY	13651	395-021-12	A3	1	1668	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight displacement
3416	FAIRMONT WAY	13651	395-021-12	A3	1	1668	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
3420	FAIRMONT WAY	13661	395-021-13	A3	1	1668	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
3501	FAIRMONT WAY	13672	395-011-15	A3	1	1668	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
3545	FAIRMONT WAY	13761	395-141-22	B3	1	1666	Sidewalk	PCC	Buckled Slab	Over 2"			Yes			Replace Slab	Repaired new slab
12064	FAIRMONT WAY	13771	395-141-23	B3	1	1666	Sidewalk	PCC	Corner Break	1/4" to 1/2"	2		No			Grind	
3546	FAIRMONT WAY	13771	395-141-23	B3	1	1666	Sidewalk	PCC	Spalling	1/4" to 1/2"	0.5		No			Grind	
3552	FAIRMONT WAY	13772	395-141-32	B3	1	1666	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
3550	FAIRMONT WAY	13792	395-141-30	B3	1	1666	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
3551	FAIRMONT WAY	13792	395-141-30	B3	1	1666	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
3547	FAIRMONT WAY	13811	395-141-26	B3	1	1666	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Prev grind
3549	FAIRMONT WAY	13812	395-141-29	B3	1	1666	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
3548	FAIRMONT WAY	13831	395-141-27	B3	1	1666	Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	6		No			Grind	
3423	FAIRMONT WAY	17371	395-021-16	B3	1	1667	Sidewalk	PCC	Faulting	1/2" to 1"	4		No			Ramp	Prev grind
3422	FAIRMONT WAY	17371	395-021-16	B3	1	1667	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
3424				i	B3	1	1667	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No		Grind	Prev grind

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
3425	FAIRMONT WAY	17371	395-021-16	B3	1	1667	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
3421	FAIRMONT WAY	17371	395-021-16	B3	1	1667	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		Yes			Grind	
10227	FIESTA WAY	17592	401-382-22	B3	1	1681	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
10226	FIESTA WAY	17622	401-382-24	B3	1	1681	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
10228	FIESTA WAY	17631	401-382-15	B3	1	1681	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
10229	FIESTA WAY	17631	401-382-15	B3	1	1681	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
10230	FIESTA WAY	17631	401-382-15	B3	1	1681	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		Yes			Grind	
10225	FIESTA WAY	17632	401-382-25	B3	1	1681	Sidewalk	PCC	Faulting	1/2" to 1"	4		No			Ramp	
10231	FIESTA WAY	17651	401-382-14	B3	1	1681	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
11240	FIESTA WAY	17652	401-382-26	B3	1	1681	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
10239	GALY STREET	14252	401-391-11	B3	1	1692	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		Yes			Grind	
10240	GALY STREET	14401	401-011-08	C3	1	1692	Sidewalk	PCC	Faulting	1/2" to 1"	5		Yes			Ramp	
10241	GALY STREET	14401	401-011-08	C3	1	1692	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
10242	GALY STREET	14491	401-024-05	C3	1	1692	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
10255	GALY STREET	17501	401-022-01	C3	1	1692	Sidewalk	PCC	Faulting	1/2" to 1"	5		Yes			Ramp	
10256	GALY STREET	17501	401-022-01	C3	1	1692	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
10254	GALY STREET	17502	401-023-01	C3	1	1692	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
10267	GALY STREET	17512	401-013-01	C3	1	1692	Sidewalk	PCC	Faulting	1/2" to 1"	4		No			Ramp	
10268	GALY STREET	17512	401-013-01	C3	1	1692	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
10269	GALY STREET	17512	401-013-01	C3	1	1692	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
10207	GALY STREET	17512	401-392-01	B3	1	1692	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
10277	GALY STREET	17512	401-392-01	C3	1	1692	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10266	GALY STREET	17512	401-013-01	C3	1	1692	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
10257	GALY STREET	17512	401-014-01	C3	1	1692	Sidewalk	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
5389	GROVESITE DRIVE	13771	395-162-28	B3	1	1702	Sidewalk	PCC	Sidewalk Curb Separation	No Displacement	25	1"	No			Field Assess-Monitor	
5391	GROVESITE DRIVE	13781	395-162-29	B3	1	1702	Curb/Gutter	PCC	Spalling	1/2" to 1"	0.5		No			Replace C&G	
5386	GROVESITE DRIVE	13792	395-162-25	B3	1	1702	Driveway	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
5384	GROVESITE DRIVE	13792	395-162-25	B3	1	1702	Curb/Gutter	PCC	Spalling	1/2" to 1"	2		No			Replace C&G	
5393	GROVESITE DRIVE	13801	395-162-31	B3	1	1702	Curb/Gutter	PCC	Spalling	1/2" to 1"	0.5		No			Replace C&G	
5395	GROVESITE DRIVE	13841	395-162-34	B3	1	1702	Sidewalk	PCC	Spalling	1/2" to 1"	0.5		No			Replace C&G	
5382	GROVESITE DRIVE	13842	395-162-21	B3	1	1702	Sidewalk	PCC	Spalling	1/4" to 1/2"	20		No			Grind	
5380	GROVESITE DRIVE	13852	395-162-20	B3	1	1702	Sidewalk	PCC	Sidewalk Curb Separation	No Displacement	20	1"	No			Field Assess-Monitor	
10112	HEIGHTS DRIVE	14411	401-101-11	C2	1	1710	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
10111	HEIGHTS DRIVE	14432	401-101-07	C2	1	1710	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
10113	HEIGHTS DRIVE	14451	401-101-13	C2	1	1710	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
10110	HEIGHTS DRIVE	14462	401-101-05	C2	1	1710	Driveway	PCC	Linear Cracking	1/4" to 1/2"	3		No			Grind	
10114	HEIGHTS DRIVE	14471	401-101-15	C2	1	1710	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
10115	HEIGHTS DRIVE	14511	401-101-18	C2	1	1710	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
10116	HEIGHTS DRIVE	14511	401-101-18	C2	1	1710	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
10117	HEIGHTS DRIVE	14531	401-101-19	C2	1	1710	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
10119	HEIGHTS DRIVE	14531	401-101-19	C2	1	1710	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	Prev grind
10118	HEIGHTS DRIVE	14531	401-101-19	C2	1	1710	Sidewalk	PCC	Faulting	1/4" to 1/2"	6		No			Grind	
10120	HEIGHTS DRIVE	14601	401-101-23	C2	1	1710	Sidewalk	PCC	Faulting	1/4" to 1/2"	14		No	Yes		Grind	
5332	HENSTRIDGE CIRCLE	13811	395-162-72	B3	1	1711	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
5328	HENSTRIDGE CIRCLE	13812	395-162-73	B3	1	1711	Sidewalk	PCC	Spalling	1/2" to 1"	4		Yes			Replace C&G	Prev grind
5329	HENSTRIDGE CIRCLE	13812	395-162-73	B3	1	1711	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	6		Yes			Grind	
5356	HENSTRIDGE CIRCLE	17541	395-162-70	B3	1	1711	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
5357	HENSTRIDGE CIRCLE	17541	395-162-70	B3	1	1711	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		Yes			Grind	
5359	HENSTRIDGE CIRCLE	17541	395-162-70	B3	1	1711	Sidewalk	PCC	Spalling	1/4" to 1/2"	2		No			Grind	
5326	HENSTRIDGE CIRCLE	17561	395-162-75	B3	1	1711	Sidewalk	PCC	Divided Slab	No Displacement			No			Replace Slab	Low
5325	HENSTRIDGE CIRCLE	17561	395-162-75	B3	1	1711	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
3151	HOLT AVENUE	14332	401-122-11	C4	1	1087	Sidewalk	PCC	Corner Break	No Displacement	2		No			Patch	
3150	HOLT AVENUE	14382	401-122-13	C4	1	1087	Driveway	PCC	Linear Cracking	1/4" to 1/2"	6		No			Grind	
3047	HOLT AVENUE	14762	401-282-06	C4	1	1089	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
3046	HOLT AVENUE	14782	401-282-08	C4	1	1089	Driveway	PCC	Linear Cracking	No Displacement	6		No			Joint Seal	
3149	HOLT AVENUE	18261	401-122-20	C4	1	1087	Curb/Gutter	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
3116	HOLT AVENUE	18271	401-271-45	C4	1	1089	Sidewalk	PCC	Buckled Slab	1" to 2"	4		Yes			Replace Slab	Also temp ramps
3117	HOLT AVENUE	18271	401-271-45	C4	1	1089	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	6		Yes			Replace Slab	
3119	HOLT AVENUE	18271	401-271-45	C4	1	1089	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	5		Yes			Grind	
3118	HOLT AVENUE	18271	401-271-45	C4	1	1089	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
3044	HOLT AVENUE	18301	401-282-18	C4	1	1089	Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"			No			Grind	Metal util cover raised
3045	HOLT AVENUE	18301	401-282-18	C4	1	1089	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
3132	HOLT AVENUE		401-276-11	C4	1	1088	Sidewalk	PCC	Buckled Slab	1" to 2"	4		Yes			Replace Slab	Also temp ramps
3120				i	C4	1	1089	Sidewalk	PCC	Other - Leave Comment	Over 2"			No		Replace Slab	Broken util cover

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
3137	HOLT AVENUE		401-278-24	C4	1	1088	Sidewalk	PCC	Patch / Utility Cut	1" to 2"	3		No			Ramp	Pole base
3136	HOLT AVENUE		401-278-24	C4	1	1088	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
3124	HOLT AVENUE		401-275-10	C4	1	1089	Sidewalk	PCC	Linear Cracking	No Displacement	4		Yes			Joint Seal	Slight displacement
3127	HOLT AVENUE		401-651-13	C4	1	1089	Curb/Gutter	PCC	Spalling	1/4" to 1/2"	6		No			Grind	Spall and cracks
3138	HOLT AVENUE		401-278-04	C4	1	1088	Driveway	PCC	Linear Cracking	1/4" to 1/2"	8		No			Grind	
3126	HOLT AVENUE		401-271-35	C4	1	1089	Driveway	PCC	Linear Cracking	No Displacement	6		No			Joint Seal	
3122	HOLT AVENUE		401-274-06	C4	1	1089	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	12		Yes			Replace Slab	
3123	HOLT AVENUE		401-275-10	C4	1	1089	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	12		Yes			Replace Slab	
3128	HOLT AVENUE		401-651-14	C4	1	1089	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	15	1.5"	Yes			Replace Slab	
3134	HOLT AVENUE		401-278-24	C4	1	1088	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	10		Yes			Grind	
3129	HOLT AVENUE		401-651-14	C4	1	1088	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	10	1"	Yes			Grind	
3139	HOLT AVENUE		401-278-04	C4	1	1088	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	12		No			Grind	
3131	HOLT AVENUE		401-276-11	C4	1	1088	Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	14	1"	Yes			Replace Slab(s)	
3133	HOLT AVENUE		401-278-24	C4	1	1088	Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	7		Yes			Replace Slab(s)	
3135	HOLT AVENUE		401-278-24	C4	1	1088	Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	8		Yes			Replace Slab(s)	
3121	HOLT AVENUE		401-277-06	C4	1	1089	Curb/Gutter	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
3130	HOLT AVENUE		401-651-14	C4	1	1088	Curb/Gutter	PCC	Spalling	Over 2"	1		No			Replace C&G	
3125	HOLT AVENUE		401-275-10	C4	1	1089	Sidewalk	PCC	Temporary Ramp	Over 2"	4		Yes			Replace Slab	
11091	IRVINE BLVD	17241	401-301-02	C2	1	1092	Sidewalk	PCC	Faulting	1/2" to 1"	7		No			Ramp	
11092	IRVINE BLVD	17241	401-301-02	C2	1	1092	Sidewalk	PCC	Faulting	1/2" to 1"	4		No			Ramp	
11093	IRVINE BLVD	17241	401-301-02	C2	1	1092	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	3		No			Grind	
11088	IRVINE BLVD	17291	401-301-01	C2	1	1092	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
11089	IRVINE BLVD	17291	401-301-01	C2	1	1092	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
11090	IRVINE BLVD	17291	401-301-01	C2	1	1092	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
11087	IRVINE BLVD	17321	401-511-01	C2	1	1094	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		Yes			Ramp	
11086	IRVINE BLVD	17341	401-511-02	C2	1	1094	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
11085	IRVINE BLVD	17341	401-511-02	C2	1	1094	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	6		No			Grind	
11084	IRVINE BLVD	17371	401-511-03	C3	1	1094	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
11083	IRVINE BLVD	17401	401-511-04	C3	1	1094	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
11082	IRVINE BLVD	17411	401-511-05	C3	1	1094	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	Prev grind
11081	IRVINE BLVD	17411	401-511-05	C3	1	1094	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
11080	IRVINE BLVD	17491	401-511-08	C3	1	1094	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
11077	IRVINE BLVD	17501	401-511-09	C3	1	1094	Sidewalk	PCC	Faulting	1" to 2"	4		Yes			Replace Slab	
11076	IRVINE BLVD	17501	401-511-09	C3	1	1094	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
11078	IRVINE BLVD	17501	401-511-09	C3	1	1094	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
11079	IRVINE BLVD	17501	401-511-09	C3	1	1094	Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	5		Yes			Replace Slab(s)	
11075	IRVINE BLVD	17541	401-041-03	C3	1	1094	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
11074	IRVINE BLVD	17581	401-044-19	C3	1	1096	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
11072	IRVINE BLVD	17621	401-044-20	C3	1	1096	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
11073	IRVINE BLVD	17621	401-044-20	C3	1	1096	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
11071	IRVINE BLVD	17621	401-044-20	C3	1	1096	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	8		Yes			Grind	
11066	IRVINE BLVD	17671	401-044-18	C3	1	1096	Sidewalk	PCC	Faulting	1/2" to 1"	5		No			Ramp	
11067	IRVINE BLVD	17671	401-044-18	C3	1	1096	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
11069	IRVINE BLVD	17671	401-044-18	C3	1	1096	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
11070	IRVINE BLVD	17671	401-044-18	C3	1	1096	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
11068	IRVINE BLVD	17671	401-044-18	C3	1	1096	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	4		Yes			Grind	
11065	IRVINE BLVD	17671	401-044-18	C3	1	1096	Curb/Gutter	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
11054	IRVINE BLVD	17952	401-131-13	C3	1	1097	Sidewalk	PCC	Pothole	1/4" to 1/2"	2		No		Yes	Grind	Pole removed
11056	IRVINE BLVD	17952	401-131-13	C3	1	1097	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No		Yes	Grind	Prev grind
11053	IRVINE BLVD	17952	401-131-13	C3	1	1097	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No		Yes	Grind	
11059	IRVINE BLVD	17952	401-131-13	C3	1	1097	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No		Yes	Grind	
11055	IRVINE BLVD	17952	401-131-13	C3	1	1097	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	3		No		Yes	Grind	
11052	IRVINE BLVD	17952	401-131-13	C3	1	1097	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	8		No		Yes	Grind	
11057	IRVINE BLVD	17952	401-131-13	C3	1	1097	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	10		No		Yes	Grind	
11058	IRVINE BLVD	17952	401-131-13	C3	1	1097	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	20		No		Yes	Grind	
11051	IRVINE BLVD	18001	401-161-09	C3	1	1097	Sidewalk	PCC	Faulting	1/2" to 1"	1		No			Ramp	
11050	IRVINE BLVD	18071	401-161-06	C3	1	1097	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
11049	IRVINE BLVD	18091	401-161-05	C3	1	1100	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Prev grind
11047	IRVINE BLVD	18111	401-161-04	C3	1	1100	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
11048	IRVINE BLVD	18111	401-161-04	C3	1	1100	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	15		No			Grind	
11046	IRVINE BLVD	18121	401-161-03	C3	1	1100	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
11045	IRVINE BLVD	18141	401-161-02	C3	1	1100	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
11044	IRVINE BLVD	18141	401-161-02	C3	1	1100	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	25		No			Grind	
11043				;	C4	1	1101	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No		Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
11236	IRVINE BLVD	18351	401-281-08	C4	1	1101	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No		Yes	Grind	
11060	IRVINE BLVD		401-044-21	C3	1	1096	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
11062	IRVINE BLVD		401-044-21	C3	1	1096	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
11064	IRVINE BLVD		401-044-21	C3	1	1096	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
11235	IRVINE BLVD		401-281-10	C4	1	1101	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No		Yes	Grind	
11063	IRVINE BLVD		401-044-21	C3	1	1096	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	5		Yes			Replace Slab	
11061	IRVINE BLVD		401-044-21	C3	1	1096	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	10		No			Grind	
10364	IVERNESS WAY	14701	401-033-07	C3	1	1719	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
10366	IVERNESS WAY	14721	401-033-08	C3	1	1719	Sidewalk	PCC	Faulting	1" to 2"	4		Yes			Replace Slab	
10365	IVERNESS WAY	14721	401-033-08	C3	1	1719	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	
10363	IVERNESS WAY	17652	401-033-05	C3	1	1719	Sidewalk	PCC	Faulting	1" to 2"	3		Yes			Replace Slab	
10362	IVERNESS WAY	17652	401-033-05	C3	1	1719	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		Yes			Grind	
10183	JACARANDA AVENUE	14242	401-231-09	B3	1	2003	Cross Gutter	PCC	Faulting	1/2" to 1"	4		No			Replace Cross Gutter	
10179	JACARANDA AVENUE	14251	401-231-10	B3	1	2003	Cross Gutter	PCC	Faulting	1/2" to 1"	3		Yes			Replace Cross Gutter	
10175	JACARANDA AVENUE	14251	401-231-17	B3	1	2003	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
10176	JACARANDA AVENUE	14251	401-231-17	B3	1	2003	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
10174	JACARANDA AVENUE	14251	401-231-17	B3	1	2003	Cross Gutter	PCC	Linear Cracking	1/4" to 1/2"	5		No			Grind	
10181	JACARANDA AVENUE	14251	401-231-10	B3	1	2003	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	35		Yes			Grind	
10182	JACARANDA AVENUE	14251	401-231-10	B3	1	2003	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	9		Yes			Grind	
10173	JACARANDA AVENUE	14252	401-231-24	B3	1	2003	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	5		No			Grind	
10161	JACARANDA AVENUE	14282	401-232-25	B3	1	2004	Cross Gutter	PCC	Faulting	1/2" to 1"	4		No			Replace Cross Gutter	
10162	JACARANDA AVENUE	14282	401-232-25	B3	1	2004	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
10160	JACARANDA AVENUE	14292	401-232-18	B3	1	2004	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	15		Yes			Replace Slab	
10189	JACARANDA AVENUE	17331	401-231-02	B2	1	2003	Cross Gutter	PCC	Divided Slab	No Displacement	15		No			Replace Slab(s)	
10188	JACARANDA AVENUE	17331	401-231-02	B2	1	2003	Driveway	PCC	Linear Cracking	1/4" to 1/2"	3		No			Grind	
10187	JACARANDA AVENUE	17331	401-231-02	B2	1	2003	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	3		No			Grind	
10152	JACARANDA AVENUE	17332	401-232-04	B2	1	2004	Cross Gutter	PCC	Linear Cracking	1/4" to 1/2"	15		No			Grind	
10186	JACARANDA AVENUE	17351	401-231-03	B2	1	2003	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
10185	JACARANDA AVENUE	17351	401-231-03	B2	1	2003	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	20		Yes			Grind	
10153	JACARANDA AVENUE	17362	401-232-06	B2	1	2004	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
10154	JACARANDA AVENUE	17362	401-232-06	B3	1	2004	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
10184	JACARANDA AVENUE	17371	401-231-04	B3	1	2003	Sidewalk	PCC	Linear Cracking	1/2" to 1"	4		No			Grind	
10155	JACARANDA AVENUE	17382	401-232-12	B3	1	2004	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	10		Yes			Grind	Prev grind
10156	JACARANDA AVENUE	17382	401-232-12	B3	1	2004	Curb/Gutter	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind C&G	
10157	JACARANDA AVENUE	17382	401-232-12	B3	1	2004	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
10158	JACARANDA AVENUE	17402	401-232-13	B3	1	2004	Sidewalk	PCC	Divided Slab	1/4" to 1/2"	7		No			Replace Slab	
10159	JACARANDA AVENUE	17402	401-232-13	B3	1	2004	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	20		Yes			Grind	
10178	JACARANDA AVENUE	17421	401-231-16	B3	1	2003	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
10180	JACARANDA AVENUE	17421	401-231-16	B3	1	2003	Cross Gutter	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
10177	JACARANDA AVENUE	17421	401-231-16	B3	1	2003	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	10		Yes			Grind	
3502	LAURIE LANE	13672	395-011-15	B3	1	1743	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
3504	LAURIE LANE	13672	395-011-15	B3	1	1743	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
3505	LAURIE LANE	13672	395-011-15	B3	1	1743	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
3503	LAURIE LANE	13672	395-011-15	B3	1	1743	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	5		No			Grind	
9990	LAURIE LANE	13691	395-272-14	B3	1	1745	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
9991	LAURIE LANE	13691	395-272-14	B3	1	1745	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	Prev grind
9989	LAURIE LANE	13691	395-272-14	B3	1	1745	Sidewalk	PCC	Linear Cracking	No Displacement	6		No			Joint Seal	Slight displacement
5190	LAURIE LANE	13691	395-263-17	B3	1	1744	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
5192	LAURIE LANE	13691	395-263-17	B3	1	1744	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
5188	LAURIE LANE	13691	395-263-17	B3	1	1744	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	7		No			Grind	
5193	LAURIE LANE	13692	395-263-16	B3	1	1744	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
5194	LAURIE LANE	13692	395-263-16	B3	1	1744	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
5195	LAURIE LANE	13692	395-263-16	B3	1	1744	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
3516	LAURIE LANE	13701	395-012-13	B3	1	1743	Cross Gutter	PCC	Linear Cracking	No Displacement	8		No			Joint Seal	Slight displacement
3517	LAURIE LANE	13701	395-012-13	B3	1	1743	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No			Grind	
3457	LAURIE LANE	13701	395-022-15	B2	1	1742	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
3460	LAURIE LANE	13702	395-022-16	B2	1	1742	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	Prev grind
3458	LAURIE LANE	13702	395-022-16	B2	1	1742	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
3511	LAURIE LANE	13702	395-012-07	B3	1	1743	Cross Gutter	PCC	Other - Leave Comment	1/4" to 1/2"			No			Patch	Scaling/Popouts
3518	LAURIE LANE	13702	395-012-05	B3	1	1743	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
3521	LAURIE LANE	13702	395-012-05	B3	1	1743	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
3459	LAURIE LANE	13702	395-022-16	B2	1	1742	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
3519	LAURIE LANE	13702	395-012-05	B3	1	1743	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
3520				B3	1	1743	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
3461	LAURIE LANE	13702	395-022-16	B2	1	1742	Sidewalk	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
10032	LAURIE LANE	13721	395-273-19	B3	1	1745	Sidewalk	PCC	Faulting	1" to 2"	4		Yes			Replace Slab	Prev grind
10031	LAURIE LANE	13721	395-273-19	B3	1	1745	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10033	LAURIE LANE	13721	395-273-19	B3	1	1745	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
3522	LAURIE LANE	13722	395-012-06	B3	1	1742	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
3533	LAURIE LANE	17282	395-023-08	B2	1	1742	Sidewalk	PCC	Other - Leave Comment	1/2" to 1"	4		No			Grind	Vegetation growing in joint
3534	LAURIE LANE	17282	395-023-08	B2	1	1742	Sidewalk	PCC	Other - Leave Comment	1/2" to 1"	4		No			Grind	Vegetation growing in joint
3531	LAURIE LANE	17282	395-023-08	B2	1	1742	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
3529	LAURIE LANE	17302	395-023-07	B2	1	1742	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
3530	LAURIE LANE	17302	395-023-07	B2	1	1742	Sidewalk	PCC	Spalling	Over 2"	2		Yes			Patch	Prev grind
3528	LAURIE LANE	17342	395-023-04	B3	1	1742	Sidewalk	PCC	Temporary Ramp	1" to 2"	1		No			Replace Slab	Filled spall
3432	LAURIE LANE	17351	395-021-18	B3	1	1742	Sidewalk	PCC	Faulting	1/4" to 1/2"	8		No			Grind	
3433	LAURIE LANE	17351	395-021-18	B3	1	1742	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
3527	LAURIE LANE	17352	395-023-03	B3	1	1742	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
3535	LAURIE LANE	17361	395-021-17	B3	1	1742	Sidewalk	PCC	Faulting	Over 2"	6		No			Replace Slab	Driveway severe
3427	LAURIE LANE	17361	395-021-17	B3	1	1742	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
3431	LAURIE LANE	17361	395-021-17	B3	1	1742	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
3430	LAURIE LANE	17361	395-021-17	B3	1	1742	Sidewalk	PCC	Linear Cracking	1/2" to 1"	5		No			Grind	
3429	LAURIE LANE	17361	395-021-17	B3	1	1742	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	5		Yes			Grind	
3428	LAURIE LANE	17361	395-021-17	B3	1	1742	Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	20		Yes			Replace Slab(s)	
3525	LAURIE LANE	17362	395-023-02	B3	1	1742	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Patch	Also spalled
3526	LAURIE LANE	17362	395-023-02	B3	1	1742	Sidewalk	PCC	Divided Slab	No Displacement			No			Replace Slab	Low
3426	LAURIE LANE	17371	395-021-16	B3	1	1742	Sidewalk	PCC	Divided Slab	No Displacement			No			Replace Slab	Low
3523	LAURIE LANE	17392	395-012-03	B3	1	1742	Sidewalk	PCC	Linear Cracking	No Displacement	4		Yes			Joint Seal	
3524	LAURIE LANE	17392	395-012-03	B3	1	1742	Sidewalk	PCC	Spalling	1" to 2"	1		No			Patch	
3506	LAURIE LANE	17421	395-011-16	B3	1	1743	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
3507	LAURIE LANE	17441	395-011-17	B3	1	1743	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
3508	LAURIE LANE	17451	395-011-18	B3	1	1743	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
3509	LAURIE LANE	17471	395-011-19	B3	1	1743	Cross Gutter	PCC	Divided Slab	No Displacement			No			Replace Slab	Low
3510	LAURIE LANE	17471	395-011-19	B3	1	1743	Cross Gutter	PCC	Other - Leave Comment	1/4" to 1/2"			No			Patch	Scaling/Popouts
9994	LAURIE LANE	17661	395-272-15	B3	1	1745	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
9993	LAURIE LANE	17661	395-272-15	B3	1	1745	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
9992	LAURIE LANE	17661	395-272-15	B3	1	1745	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
10030	LAURIE LANE	17662	395-273-18	B3	1	1745	Driveway	PCC	Faulting	1/4" to 1/2"	4		No			Grind Driveway	
9971	LAURINDA WAY	13502	395-281-20	A3	1	1747	Sidewalk	PCC	Linear Cracking	1/2" to 1"	4		No			Grind	
9968	LAURINDA WAY	13521	395-282-02	A3	1	1747	Sidewalk	PCC	Linear Cracking	1/2" to 1"	4		No			Grind	
9970	LAURINDA WAY	13522	395-281-19	A3	1	1747	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
9969	LAURINDA WAY	13571	395-282-04	A3	1	1747	Sidewalk	PCC	Buckled Slab	Over 2"			Yes			Replace Slab	
9884	LAURINDA WAY	13811	395-291-15	B3	1	1746	Sidewalk	PCC	Divided Slab	1" to 2"	6		Yes			Replace Slab(s)	
9883	LAURINDA WAY	13811	395-291-15	B3	1	1746	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
9881	LAURINDA WAY	13812	395-291-14	B3	1	1746	Sidewalk	PCC	Divided Slab	No Displacement	12		No			Replace Slab(s)	
9879	LAURINDA WAY	13812	395-291-14	B3	1	1746	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
9880	LAURINDA WAY	13812	395-291-14	B3	1	1746	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
9878	LAURINDA WAY	13822	395-291-13	B3	1	1746	Sidewalk	PCC	Buckled Slab	Over 2"	5		Yes			Replace Slab	Raised
9886	LAURINDA WAY	13841	395-291-17	B3	1	1746	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Prev grind
9885	LAURINDA WAY	13841	395-291-17	B3	1	1746	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
9876	LAURINDA WAY	13842	395-291-12	B3	1	1746	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
9877	LAURINDA WAY	13842	395-291-12	B3	1	1746	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
9887	LAURINDA WAY	13851	395-291-18	B3	1	1746	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	
9873	LAURINDA WAY	13852	395-291-11	B3	1	1746	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
9874	LAURINDA WAY	13852	395-291-11	B3	1	1746	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
9875	LAURINDA WAY	13852	395-291-11	B3	1	1746	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
9888	LAURINDA WAY	13871	395-291-19	B3	1	1746	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
9870	LAURINDA WAY	13932	395-291-07	B3	1	1746	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
9872	LAURINDA WAY	13932	395-291-07	B3	1	1746	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
9869	LAURINDA WAY	13952	395-291-06	B3	1	1746	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	Prev grind
9891	LAURINDA WAY	17771	395-291-47	B3	1	1746	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
9889	LAURINDA WAY	17771	395-291-47	B3	1	1746	Driveway	PCC	Punchout	Over 2"	7		No			Replace Slab(s)	
9890	LAURINDA WAY	17771	395-291-47	B3	1	1746	Driveway	PCC	Sidewalk Curb Separation	1/4" to 1/2"	6		No			Grind	
9882	LAURINDA WAY		999-000-58	B3	1	1746	Driveway	PCC	Sidewalk Curb Separation	1/4" to 1/2"	12		No			Grind	
5491	LEAFWOOD LANE	17511	395-262-21	A3	1	1748	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
5492	LEAFWOOD LANE	17511	395-262-21	A3	1	1748	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
5493	LEAFWOOD LANE	17512	395-263-07	A3	1	1748	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
5494				A3	1	1748	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
5490	LEAFWOOD LANE	17531	395-262-19	A3	1	1748	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	Prev grind
5489	LEAFWOOD LANE	17531	395-262-19	A3	1	1748	Sidewalk	PCC	Buckled Slab	1/4" to 1/2"	4		Yes			Replace Slab	Slabs raised, prev grind
5488	LEAFWOOD LANE	17531	395-262-19	A3	1	1748	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
5495	LEAFWOOD LANE	17532	395-263-05	A3	1	1748	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
5496	LEAFWOOD LANE	17552	395-263-04	A3	1	1748	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
5497	LEAFWOOD LANE	17552	395-263-04	A3	1	1748	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight displacement
5498	LEAFWOOD LANE	17552	395-263-04	A3	1	1748	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
5486	LEAFWOOD LANE	17561	395-262-17	A3	1	1748	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
5487	LEAFWOOD LANE	17561	395-262-17	A3	1	1748	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
5485	LEAFWOOD LANE	17561	395-262-17	A3	1	1748	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
5152	LEAFWOOD LANE	17562	395-263-03	A3	1	1748	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
5484	LEAFWOOD LANE	17571	395-262-16	A3	1	1748	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
5154	LEAFWOOD LANE	17572	395-263-02	A3	1	1748	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
5483	LEAFWOOD LANE	17581	395-262-15	A3	1	1748	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
5160	LEAFWOOD LANE	17582	395-263-01	A3	1	1748	Cross Gutter	PCC	Divided Slab	No Displacement	15		No			Replace Slab(s)	Low
5157	LEAFWOOD LANE	17582	395-263-01	A3	1	1748	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
5499	LIMETREE WAY	13932	395-301-26	B3	1	1752	Driveway	PCC	Linear Cracking	1/2" to 1"	10		No			Grind	
5507	LIMETREE WAY	17651	395-301-20	B3	1	1752	Driveway	PCC	Linear Cracking	No Displacement	10		No			Joint Seal	Slight displacement
5506	LIMETREE WAY	17651	395-301-20	B3	1	1752	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
5505	LIMETREE WAY	17661	395-301-21	B3	1	1752	Curb/Gutter	PCC	Other - Leave Comment	1" to 2"	2		No			Replace C&G	Broken
5508	LIMETREE WAY	17662	395-301-18	B3	1	1752	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
5509	LIMETREE WAY	17662	395-301-18	B3	1	1752	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
5504	LIMETREE WAY	17671	395-301-22	B3	1	1752	Driveway	PCC	Linear Cracking	1/4" to 1/2"	10		No			Grind	
5510	LIMETREE WAY	17672	395-301-17	B3	1	1752	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
5511	LIMETREE WAY	17672	395-301-17	B3	1	1752	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	9		Yes			Grind	
5512	LIMETREE WAY	17672	395-301-17	B3	1	1752	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	15		Yes			Replace Slab	
5503	LIMETREE WAY	17681	395-301-23	B3	1	1752	Curb/Gutter	PCC	Other - Leave Comment	Over 2"	2		No			Replace C&G	Broken
5501	LIMETREE WAY	17681	395-301-23	B3	1	1752	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
5502	LIMETREE WAY	17681	395-301-23	B3	1	1752	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	12		Yes			Grind	
5500	LIMETREE WAY	17691	395-301-24	B3	1	1752	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
5266	LINDA LANE	13651	395-264-08	A3	1	1753	Driveway	PCC	Linear Cracking	1/4" to 1/2"	7		No			Grind	
5271	LINDA LANE	13651	395-264-08	A3	1	1753	Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	3		Yes			Replace Slab	
5261	LINDA LANE	13652	395-264-09	A3	1	1753	Sidewalk	PCC	Faulting	1/2" to 1"	3		No			Ramp	Prev grind
5243	LINDA LANE	13652	395-264-09	A3	1	1753	Sidewalk	PCC	Linear Cracking	No Displacement	9		No			Joint Seal	Slight displacement
5263	LINDA LANE	13652	395-264-09	A3	1	1753	Sidewalk	PCC	Spalling	1/4" to 1/2"	3		No			Grind	
5213	LINDA LANE	17501	395-263-08	A3	1	1753	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
5237	LINDA LANE	17501	395-263-08	A3	1	1753	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
5211	LINDA LANE	17501	395-263-08	A3	1	1753	Sidewalk	PCC	Corner Break	1/4" to 1/2"	1		No			Grind	
5239	LINDA LANE	17501	395-263-08	A3	1	1753	Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	18		No			Replace Slab(s)	
5210	LINDA LANE	17501	395-263-08	A3	1	1753	Sidewalk	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
5208	LINDA LANE	17521	395-263-09	A3	1	1753	Driveway	PCC	Linear Cracking	1/4" to 1/2"	7		No			Grind	
5206	LINDA LANE	17521	395-263-09	A3	1	1753	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	3		No			Grind	
5446	LORETTA DRIVE	13502	395-261-01	A3	1	1757	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
5444	LORETTA DRIVE	13522	395-261-02	A3	1	1757	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
5445	LORETTA DRIVE	13522	395-261-02	A3	1	1757	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Prev grind
5443	LORETTA DRIVE	13532	395-261-03	A3	1	1757	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight displacement
5441	LORETTA DRIVE	13562	395-261-05	A3	1	1757	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
5442	LORETTA DRIVE	13562	395-261-05	A3	1	1757	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
5440	LORETTA DRIVE	13572	395-261-06	A3	1	1757	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
5439	LORETTA DRIVE	13572	395-261-06	A3	1	1757	Curb/Gutter	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
5438	LORETTA DRIVE	13582	395-261-07	A3	1	1757	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight displacement
5436	LORETTA DRIVE	13582	395-261-07	A3	1	1757	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
5437	LORETTA DRIVE	13582	395-261-07	A3	1	1757	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
5434	LORETTA DRIVE	13602	395-261-08	A3	1	1757	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
5435	LORETTA DRIVE	13602	395-261-08	A3	1	1757	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
5432	LORETTA DRIVE	13612	395-261-09	A3	1	1757	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
5431	LORETTA DRIVE	13612	395-261-09	A3	1	1757	Driveway	PCC	Linear Cracking	1/4" to 1/2"	7		No			Grind	
5433	LORETTA DRIVE	13612	395-261-09	A3	1	1757	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
5430	LORETTA DRIVE	13612	395-261-09	A3	1	1757	Curb/Gutter	PCC	Sidewalk Curb Separation	1" to 2"	5		No			Replace Curb	
5169	LORETTA DRIVE	13621	395-263-22	A3	1	1757	Sidewalk	PCC	Corner Break	1/4" to 1/2"	2		No			Grind	
5171	LORETTA DRIVE	13621	395-263-22	A3	1	1757	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
5167	LORETTA DRIVE	13621	395-263-22	A3	1	1757	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
5424	LORETTA DRIVE	13622	395-261-10	A3	1	1757	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
5428				)	A3	1	1757	Driveway	PCC	Faulting	1/4" to 1/2"	6		No		Grind Driveway	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
5422	LORETTA DRIVE	13622	395-261-10	A3	1	1757	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
5423	LORETTA DRIVE	13622	395-261-10	A3	1	1757	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
5429	LORETTA DRIVE	13622	395-261-10	A3	1	1757	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
5427	LORETTA DRIVE	13622	395-261-10	A3	1	1757	Driveway	PCC	Linear Cracking	1/4" to 1/2"	7		No			Grind	
5426	LORETTA DRIVE	13622	395-261-10	A3	1	1757	Sidewalk	PCC	Linear Cracking	1/2" to 1"	4		No			Grind	
5425	LORETTA DRIVE	13622	395-261-10	A3	1	1757	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
5173	LORETTA DRIVE	13641	395-263-21	A3	1	1757	Driveway	PCC	Linear Cracking	1/4" to 1/2"	6		No			Grind	
5419	LORETTA DRIVE	13642	395-261-11	A3	1	1757	Sidewalk	PCC	Divided Slab	1/2" to 1"	12		Yes			Replace Slab(s)	Med
5420	LORETTA DRIVE	13642	395-261-11	A3	1	1757	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight displacement
5421	LORETTA DRIVE	13642	395-261-11	A3	1	1757	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	10		No			Grind	
5180	LORETTA DRIVE	13661	395-263-20	A3	1	1757	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	Prev grind
5174	LORETTA DRIVE	13661	395-263-20	A3	1	1757	Driveway	PCC	Faulting	1/2" to 1"	6		No			Grind Driveway	
5178	LORETTA DRIVE	13661	395-263-20	A3	1	1757	Sidewalk	PCC	Faulting	1/2" to 1"	4		No			Ramp	
5176	LORETTA DRIVE	13661	395-263-20	A3	1	1757	Driveway	PCC	Sidewalk Curb Separation	1/2" to 1"	12		No			Replace Driveway	
5418	LORETTA DRIVE	13662	395-261-12	A3	1	1757	Sidewalk	PCC	Divided Slab	No Displacement	12		No			Replace Slab(s)	Low
5417	LORETTA DRIVE	13662	395-261-12	A3	1	1757	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	7		No			Grind	
5183	LORETTA DRIVE	13671	395-263-19	A3	1	1757	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
5185	LORETTA DRIVE	13671	395-263-19	A3	1	1757	Driveway	PCC	Sidewalk Curb Separation	1/2" to 1"	18		No			Replace Driveway	
5416	LORETTA DRIVE	13672	395-261-13	A3	1	1757	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
5186	LORETTA DRIVE	13681	395-263-18	B3	1	1757	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
5414	LORETTA DRIVE	13682	395-261-14	B3	1	1757	Sidewalk	PCC	Linear Cracking	No Displacement	4		Yes			Joint Seal	Prev grind
5415	LORETTA DRIVE	13682	395-261-14	A3	1	1757	Sidewalk	PCC	Linear Cracking	No Displacement	4		Yes			Joint Seal	Slight displacement
5413	LORETTA DRIVE	13692	395-261-15	B3	1	1757	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
5412	LORETTA DRIVE	13702	395-261-16	B3	1	1757	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight displacement
5411	LORETTA DRIVE	13702	395-261-16	B3	1	1757	Sidewalk	PCC	Spalling	1/4" to 1/2"	0.5		No			Grind	
5408	LORETTA DRIVE	13712	395-261-19	B3	1	1757	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	Prev grind
5410	LORETTA DRIVE	13712	395-261-19	B3	1	1757	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
5409	LORETTA DRIVE	13712	395-261-19	B3	1	1757	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
5407	LORETTA DRIVE	13762	395-162-42	B3	1	1756	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	Prev grind
5405	LORETTA DRIVE	13772	395-162-41	B3	1	1756	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
5309	LORETTA DRIVE	13801	395-162-08	B3	1	1756	Driveway	PCC	Sidewalk Curb Separation	1/4" to 1/2"	3		No			Grind	
5403	LORETTA DRIVE	13816	395-162-37	B3	1	1756	Driveway	PCC	Sidewalk Curb Separation	1/2" to 1"	6		Yes			Replace Driveway	
5404	LORETTA DRIVE	13816	395-162-37	B3	1	1756	Curb/Gutter	PCC	Spalling	1" to 2"	1		No			Patch	
5311	LORETTA DRIVE	13831	395-162-10	B3	1	1756	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
5402	LORETTA DRIVE	13832	395-162-36	B3	1	1756	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	14		Yes			Grind	
5313	LORETTA DRIVE	13841	395-162-11	B3	1	1756	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
5314	LORETTA DRIVE	13841	395-162-11	B3	1	1756	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No			Grind	Prev grind
5401	LORETTA DRIVE	13842	395-162-35	B3	1	1756	Ramp	PCC	Spalling	1" to 2"	1		Yes			Patch	
5480	LORETTA DRIVE	17581	395-262-15	A3	1	1757	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
5477	LORETTA DRIVE	17581	395-262-15	A3	1	1757	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
5478	LORETTA DRIVE	17581	395-262-15	A3	1	1757	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
5479	LORETTA DRIVE	17581	395-262-15	A3	1	1757	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
5482	LORETTA DRIVE	17581	395-262-15	A3	1	1757	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
5447	LORETTA DRIVE	17581	395-262-01	A3	1	1757	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
5290	LORETTA DRIVE	17581	395-161-08	B3	1	1756	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5481	LORETTA DRIVE	17581	395-262-15	A3	1	1757	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
5286	LORETTA DRIVE	17582	395-264-01	B3	1	1757	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
5474	LORETTA DRIVE	17582	395-262-14	A3	1	1757	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	Prev grind
5285	LORETTA DRIVE	17582	395-264-01	B3	1	1757	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
5165	LORETTA DRIVE	17582	395-263-01	A3	1	1757	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
5475	LORETTA DRIVE	17582	395-262-14	A3	1	1757	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
5476	LORETTA DRIVE	17582	395-262-14	A3	1	1757	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
5162	LORETTA DRIVE	17582	395-263-01	A3	1	1757	Sidewalk	PCC	Linear Cracking	No Displacement	4		Yes			Joint Seal	
5289	LORETTA DRIVE		395-264-18	B3	1	1757	Sidewalk	PCC	Divided Slab	No Displacement			No			Replace Slab	Low
11302	LUCERO WAY	17761	401-241-07	C3	1	1758	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
11301	LUCERO WAY	17781	401-241-08	C3	1	1758	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	Prev grind
11300	LUCERO WAY	17781	401-241-08	C3	1	1758	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
11303	LUCERO WAY	17802	401-241-06	C3	1	1758	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
11304	LUCERO WAY	17802	401-241-06	C3	1	1758	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
11299	LUCERO WAY	17811	401-241-10	C3	1	1758	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
11298	LUCERO WAY	17831	401-241-11	C3	1	1758	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
11305	LUCERO WAY	17832	401-241-04	C3	1	1758	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
11306	LUCERO WAY	17842	401-241-03	C3	1	1758	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
11308				C3	1	1758	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
11307	LUCERO WAY	17852	401-241-02	C3	1	1758	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
11309	LUCERO WAY	17852	401-241-02	C3	1	1758	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
11310	LUCERO WAY	17852	401-241-02	C3	1	1758	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
11297	LUCERO WAY	17881	401-241-15	C3	1	1758	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
11296	LUCERO WAY	17901	401-241-16	C3	1	1758	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
11295	LUCERO WAY	17911	401-241-17	C3	1	1758	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	1.5		Yes			Grind	
11289	LUCERO WAY	17912	401-241-28	C3	1	1758	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	Prev grind
11294	LUCERO WAY	17931	401-241-18	C3	1	1758	Sidewalk	PCC	Faulting	1/2" to 1"	4		No			Ramp	
11290	LUCERO WAY	17942	401-241-26	C3	1	1758	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
11293	LUCERO WAY	17951	401-241-20	C3	1	1758	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
11292	LUCERO WAY	17981	401-241-22	C3	1	1758	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
11291	LUCERO WAY	17982	401-241-23	C3	1	1758	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9973	MALENA DRIVE	13501	395-272-01	A3	1	1761	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
9974	MALENA DRIVE	13501	395-272-01	A3	1	1761	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No			Grind	
9972	MALENA DRIVE	13501	395-272-01	A3	1	1761	Driveway	PCC	Linear Cracking	1/4" to 1/2"	6		No			Grind	
9967	MALENA DRIVE	13502	395-271-01	A3	1	1761	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Prev grind
9965	MALENA DRIVE	13502	395-271-01	A3	1	1761	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Prev grind
9975	MALENA DRIVE	13521	395-272-02	A3	1	1761	Sidewalk	PCC	Faulting	1/2" to 1"	4		No			Ramp	
9966	MALENA DRIVE	13522	395-271-02	A3	1	1761	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
9976	MALENA DRIVE	13531	395-272-03	A3	1	1761	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Prev grind
9977	MALENA DRIVE	13551	395-272-04	A3	1	1761	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	Prev grind
9963	MALENA DRIVE	13552	395-271-04	A3	1	1761	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	Prev grind
9964	MALENA DRIVE	13552	395-271-04	A3	1	1761	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
9978	MALENA DRIVE	13561	395-272-05	A3	1	1761	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
9979	MALENA DRIVE	13561	395-272-05	A3	1	1761	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
9980	MALENA DRIVE	13561	395-272-05	A3	1	1761	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
9962	MALENA DRIVE	13562	395-271-05	A3	1	1761	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	
9961	MALENA DRIVE	13562	395-271-05	A3	1	1761	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
9981	MALENA DRIVE	13591	395-272-07	A3	1	1761	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
9982	MALENA DRIVE	13591	395-272-07	A3	1	1761	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
9983	MALENA DRIVE	13591	395-272-07	A3	1	1761	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
9960	MALENA DRIVE	13592	395-271-07	A3	1	1761	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
9984	MALENA DRIVE	13601	395-272-08	A3	1	1761	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
9985	MALENA DRIVE	13601	395-272-08	A3	1	1761	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
9959	MALENA DRIVE	13602	395-271-08	A3	1	1761	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
9986	MALENA DRIVE	13611	395-272-09	A3	1	1761	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
9957	MALENA DRIVE	13622	395-271-10	A3	1	1761	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
9958	MALENA DRIVE	13622	395-271-10	A3	1	1761	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
9956	MALENA DRIVE	13642	395-271-11	A3	1	1761	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
9987	MALENA DRIVE	13671	395-272-13	A3	1	1761	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
9988	MALENA DRIVE	13691	395-272-14	B3	1	1761	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
9955	MALENA DRIVE	13692	395-271-14	B3	1	1761	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
9953	MALENA DRIVE	13702	395-271-15	B3	1	1761	Sidewalk	PCC	Faulting	1" to 2"	4		Yes			Replace Slab	
9954	MALENA DRIVE	13702	395-271-15	B3	1	1761	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
10034	MALENA DRIVE	13721	395-273-19	B3	1	1760	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
9951	MALENA DRIVE	13722	395-271-16	B3	1	1760	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	Prev grind
9950	MALENA DRIVE	13722	395-271-16	B3	1	1760	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
9952	MALENA DRIVE	13722	395-271-16	B3	1	1760	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
10035	MALENA DRIVE	13741	395-162-44	B3	1	1760	Sidewalk	PCC	Divided Slab	No Displacement	6		No			Replace Slab(s)	
10036	MALENA DRIVE	13741	395-162-44	B3	1	1760	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
9948	MALENA DRIVE	13742	395-163-01	B3	1	1760	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
9949	MALENA DRIVE	13742	395-163-01	B3	1	1760	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
10037	MALENA DRIVE	13751	395-162-45	B3	1	1760	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
9947	MALENA DRIVE	13752	395-163-02	B3	1	1760	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
10038	MALENA DRIVE	13761	395-162-46	B3	1	1760	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
10039	MALENA DRIVE	13761	395-162-46	B3	1	1760	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
10040	MALENA DRIVE	13761	395-162-46	B3	1	1760	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
10041	MALENA DRIVE	13771	395-162-47	B3	1	1760	Sidewalk	PCC	Faulting	Over 2"	4		Yes			Replace Slab	Prev grind
10042	MALENA DRIVE	13791	395-162-49	B3	1	1760	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
10053	MALENA DRIVE	13792	395-162-59	B3	1	1760	Sidewalk	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
10043	MALENA DRIVE	13811	395-162-50	B3	1	1760	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
10044	MALENA DRIVE	13811	395-162-50	B3	1	1760	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
10051	MALENA DRIVE	13812	395-162-58	B3	1	1760	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10052				B3	1	1760	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
10045	MALENA DRIVE	13821	395-162-51	B3	1	1760	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
10050	MALENA DRIVE	13822	395-162-57	B3	1	1760	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10047	MALENA DRIVE	13831	395-162-52	B3	1	1760	Driveway	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
10046	MALENA DRIVE	13831	395-162-52	B3	1	1760	Sidewalk	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
10049	MALENA DRIVE	13832	395-162-56	B3	1	1760	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
10048	MALENA DRIVE	13832	395-162-56	B3	1	1760	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
5556	MALENA DRIVE	13952	395-301-28	B3	1	1759	Sidewalk	PCC	Faulting	1" to 2"	4		Yes			Replace Slab	Borderline 2"
5554	MALENA DRIVE	13952	395-301-28	B3	1	1759	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
5555	MALENA DRIVE	13952	395-301-28	B3	1	1759	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
5553	MALENA DRIVE	13992	395-301-32	B3	1	1759	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
5518	MALENA DRIVE	17672	395-301-11	B3	1	1759	Sidewalk	PCC	Faulting	1/2" to 1"	2		Yes			Ramp	
3380	MARSHALL LANE	13022	395-191-55	A2	1	1766	Curb/Gutter	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
3378	MARSHALL LANE	13122	395-191-60	A2	1	1766	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Util cover
3377	MARSHALL LANE	13142	395-191-62	A2	1	1766	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
3384	MARSHALL LANE	13201	395-582-01	A2	1	1766	Sidewalk	PCC	Faulting	1/4" to 1/2"	6		No			Grind	
3376	MARSHALL LANE	13202	395-581-05	A2	1	1766	Sidewalk	PCC	Faulting	1/4" to 1/2"	15		Yes			Grind	
3385	MARSHALL LANE	13211	395-582-02	A2	1	1766	Sidewalk	PCC	Divided Slab	1/4" to 1/2"	4		No			Replace Slab	Util cover
3386	MARSHALL LANE	13211	395-582-02	A2	1	1766	Curb/Gutter	PCC	Spalling	1" to 2"	0.5		No			Patch	
3387	MARSHALL LANE	13241	395-582-05	A2	1	1766	Driveway	PCC	Sidewalk Curb Separation	1/2" to 1"	7		No			Replace Driveway	
3388	MARSHALL LANE	13251	395-582-06	A2	1	1766	Sidewalk	PCC	Faulting	1/2" to 1"	4		No			Ramp	
3389	MARSHALL LANE	13271	395-582-08	A2	1	1766	Curb/Gutter	PCC	Spalling	1" to 2"	1		No			Patch	
3375	MARSHALL LANE	13292	395-581-12	A2	1	1766	Driveway	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Small spall
3374	MARSHALL LANE	13302	395-581-13	A2	1	1766	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Util cover
3373	MARSHALL LANE	13302	395-581-13	A2	1	1766	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	5		No			Grind	
3371	MARSHALL LANE	13312	395-581-14	A2	1	1766	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	3		No			Grind	
3372	MARSHALL LANE	13312	395-581-14	A2	1	1766	Curb/Gutter	PCC	Spalling	1/2" to 1"	1.5		No			Replace C&G	
3390	MARSHALL LANE	13321	395-582-13	A2	1	1766	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	Prev grind
3368	MARSHALL LANE	13342	395-581-16	A2	1	1766	Sidewalk	PCC	Linear Cracking	No Displacement	4		Yes			Joint Seal	Slight displacement
3369	MARSHALL LANE	13342	395-581-16	A2	1	1766	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	3		Yes			Grind	
3370	MARSHALL LANE	13342	395-581-16	A2	1	1766	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	3		No			Grind	
3392	MARSHALL LANE	13351	395-582-16	A2	1	1766	Sidewalk	PCC	Faulting	1/2" to 1"	3		No			Ramp	Prev grind
3393	MARSHALL LANE	13351	395-582-16	A2	1	1766	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
3391	MARSHALL LANE	13351	395-582-16	A2	1	1766	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
3486	MARSHALL LANE	13542	395-022-29	A2	1	1765	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight displacement
3485	MARSHALL LANE	13562	395-022-28	A2	1	1765	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
3484	MARSHALL LANE	13592	395-022-26	A2	1	1765	Driveway	PCC	Faulting	1/4" to 1/2"	4		No			Grind Driveway	
3483	MARSHALL LANE	13592	395-022-26	A2	1	1765	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
3482	MARSHALL LANE	13602	395-022-25	A2	1	1765	Sidewalk	PCC	Faulting	1/2" to 1"	5		No			Ramp	
3480	MARSHALL LANE	13602	395-022-25	A2	1	1765	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
3481	MARSHALL LANE	13602	395-022-25	A2	1	1765	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
3479	MARSHALL LANE	13602	395-022-25	A2	1	1765	Sidewalk	PCC	Spalling	1/4" to 1/2"	2		Yes			Grind	
3478	MARSHALL LANE	13612	395-022-24	A2	1	1765	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
3477	MARSHALL LANE	13622	395-022-23	A2	1	1765	Sidewalk	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
3475	MARSHALL LANE	13632	395-022-22	A2	1	1765	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
3476	MARSHALL LANE	13632	395-022-22	A2	1	1765	Driveway	PCC	Linear Cracking	1/4" to 1/2"	5		No			Grind	
3472	MARSHALL LANE	13642	395-022-21	A2	1	1765	Driveway	PCC	Linear Cracking	1/4" to 1/2"	5		No			Grind	Spalled
3473	MARSHALL LANE	13642	395-022-21	A2	1	1765	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	Spalled
3474	MARSHALL LANE	13642	395-022-21	A2	1	1765	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
3471	MARSHALL LANE	13652	395-022-20	A2	1	1765	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight displacement
3470	MARSHALL LANE	13662	395-022-19	A2	1	1765	Sidewalk	PCC	Spalling	1" to 2"	2		No			Patch	
3469	MARSHALL LANE	13682	395-022-18	A2	1	1765	Driveway	PCC	Linear Cracking	1/4" to 1/2"	5		No			Grind	Spalled
3468	MARSHALL LANE	13692	395-022-17	B2	1	1765	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
3466	MARSHALL LANE	13692	395-022-17	B2	1	1765	Driveway	PCC	Linear Cracking	No Displacement	5		No			Joint Seal	Slight displacement
3465	MARSHALL LANE	13692	395-022-17	B2	1	1765	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
3467	MARSHALL LANE	13692	395-022-17	B2	1	1765	Sidewalk	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
3462	MARSHALL LANE	13702	395-022-16	B2	1	1765	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
3463	MARSHALL LANE	13702	395-022-16	B2	1	1765	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
3464	MARSHALL LANE	13702	395-022-16	B2	1	1765	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	10		No			Grind	
3599	MARSHALL LANE	13771	395-311-26	B2	1	1764	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Prev grind
3600	MARSHALL LANE	13801	395-311-29	B2	1	1764	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
3532	MARSHALL LANE	17282	395-023-08	B2	1	1765	Sidewalk	PCC	Other - Leave Comment	1/2" to 1"	4		No			Grind	Vegetation growing in joint
3598	MARSHALL LANE	17301	395-311-23	B2	1	1764	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
3584	MARSHALL LANE	17321	395-311-09	B2	1	1764	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	5		No			Grind	
3591				B2	1	1764	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
3590	MARSHALL LANE	17322	395-311-16	B2	1	1764	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	6		Yes			Replace Slab	
3585	MARSHALL LANE	17322	395-311-10	B2	1	1764	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	5		No			Grind	
3379	MARSHALL LANE		999-000-63	A2	1	1766	Driveway	PCC	Linear Cracking	1" to 2"	5		No			Replace Driveway	Just outside boundary
3394	MARSHALL LANE		999-000-60	A2	1	1766	Sidewalk	PCC	Faulting	1/2" to 1"	5		Yes			Ramp	
3395	MARSHALL LANE		999-000-60	A2	1	1766	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
3381	MARSHALL LANE		999-000-62	A2	1	1766	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
3383	MARSHALL LANE		999-000-62	A2	1	1766	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	7		Yes			Replace Slab	
3396	MARSHALL LANE		999-000-60	A2	1	1766	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	4		No			Grind	
3382	MARSHALL LANE		999-000-62	A2	1	1766	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	4		Yes			Grind	
3582	MEDFORD AVENUE	13831	395-141-27	B3	1	1771	Sidewalk	PCC	Spalling	1/4" to 1/2"	3		No			Grind	By metal drain cover
3577	MEDFORD AVENUE	13831	395-141-11	B3	1	1771	Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	7		No			Grind	
3581	MEDFORD AVENUE	13831	395-141-27	B3	1	1771	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	5		Yes			Grind	
3573	MEDFORD AVENUE	13832	395-141-12	B3	1	1771	Ramp	PCC	Divided Slab	No Displacement			No			Replace Slab	Low
3575	MEDFORD AVENUE	13832	395-141-12	B3	1	1771	Sidewalk	PCC	Corner Break	1/4" to 1/2"	2		Yes			Grind	
3576	MEDFORD AVENUE	13832	395-141-12	B3	1	1771	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
3578	MEDFORD AVENUE	13832	395-141-28	B3	1	1771	Sidewalk	PCC	Faulting	1/4" to 1/2"	8		No			Grind	
3574	MEDFORD AVENUE	13832	395-141-12	B3	1	1771	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	6		Yes			Replace Slab	
3580	MEDFORD AVENUE	13832	395-141-28	B3	1	1771	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	5		Yes			Grind	
3579	MEDFORD AVENUE	13832	395-141-28	B3	1	1771	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	5		Yes			Grind	
5316	MEDFORD AVENUE	13841	395-162-11	B3	1	1773	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	4		No			Grind	
5398	MEDFORD AVENUE	13841	395-162-34	B3	1	1774	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	6		No			Grind	
5396	MEDFORD AVENUE	13841	395-162-34	B3	1	1774	Sidewalk	PCC	Spalling	1/2" to 1"	0.5		No			Replace C&G	
5400	MEDFORD AVENUE	13842	395-162-35	B3	1	1774	Curb/Gutter	PCC	Spalling	1" to 2"	1		No			Patch	
3625	MEDFORD AVENUE	13901	395-142-04	B3	1	1771	Sidewalk	PCC	Corner Break	1/4" to 1/2"	2		No			Grind	
3583	MEDFORD AVENUE	17331	395-311-08	B2	1	1772	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
3601	MEDFORD AVENUE	17342	395-311-37	B3	1	1772	Sidewalk	PCC	Other - Leave Comment	Over 2"		5"	No			Replace Slab	Hole
3623	MEDFORD AVENUE	17395	395-142-09	B3	1	1771	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	10		Yes			Grind	
3621	MEDFORD AVENUE	17395	395-142-09	B3	1	1771	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	8		Yes			Replace Slab	
3622	MEDFORD AVENUE	17395	395-142-09	B3	1	1771	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	4		No			Grind	
3624	MEDFORD AVENUE	17395	395-142-09	B3	1	1771	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	15		No			Grind	
5364	MEDFORD AVENUE	17532	395-162-66	B3	1	1773	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
5363	MEDFORD AVENUE	17532	395-162-66	B3	1	1773	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
5366	MEDFORD AVENUE	17532	395-162-66	B3	1	1773	Sidewalk	PCC	Spalling	1/2" to 1"	0.5		Yes			Replace C&G	
5368	MEDFORD AVENUE	17542	395-162-65	B3	1	1773	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
5370	MEDFORD AVENUE	17552	395-162-64	B3	1	1773	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
5322	MEDFORD AVENUE	17561	395-162-75	B3	1	1773	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Prev grind
5323	MEDFORD AVENUE	17561	395-162-75	B3	1	1773	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5320	MEDFORD AVENUE	17581	395-162-76	B3	1	1773	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Prev grind
5318	MEDFORD AVENUE	17581	395-162-76	B3	1	1773	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
5372	MEDFORD AVENUE	17592	395-162-13	B3	1	1773	Sidewalk	PCC	Spalling	1/4" to 1/2"	0.5		No			Grind	
5374	MEDFORD AVENUE	17602	395-162-14	B3	1	1774	Driveway	PCC	Sidewalk Curb Separation	1/2" to 1"	8		No			Replace Driveway	
5376	MEDFORD AVENUE	17652	395-162-18	B3	1	1774	Curb/Gutter	PCC	Spalling	1/2" to 1"	2		No			Replace C&G	
10384	MILLER DRIVE	17632	401-044-06	C3	1	1778	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
10385	MILLER DRIVE	17632	401-044-06	C3	1	1778	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
10386	MILLER DRIVE	17662	401-044-08	C3	1	1778	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10390	MILLER DRIVE	17731	401-045-14	C3	1	1778	Sidewalk	PCC	Spalling	1" to 2"	1		No			Patch	
10387	MILLER DRIVE	17732	401-044-14	C3	1	1778	Sidewalk	PCC	Spalling	Over 2"	1		No			Patch	
10388	MILLER DRIVE	17742	401-044-15	C3	1	1778	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
10389	MILLER DRIVE	17751	401-045-16	C3	1	1778	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
10356	MIMOSA LANE	14372	401-112-08	C3	1	1781	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	
10355	MIMOSA LANE	14372	401-112-08	C3	1	1781	Sidewalk	PCC	Linear Cracking	1" to 2"	7		Yes			Replace Slab(s)	
10357	MIMOSA LANE	14392	401-112-06	C3	1	1781	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No			Grind	
10447	MIMOSA LANE	14651	401-501-13	C3	1	1780	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
10448	MIMOSA LANE	14682	401-501-20	C3	1	1780	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
10460	MIMOSA LANE	14711	401-502-07	C3	1	1779	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10461	MIMOSA LANE	14711	401-502-07	C3	1	1779	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
10450	MIMOSA LANE	14742	401-501-25	C3	1	1779	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	
10451	MIMOSA LANE	14742	401-501-25	C3	1	1779	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
10449	MIMOSA LANE	14742	401-501-25	C3	1	1779	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
10446	MIMOSA LANE	17401	401-501-12	C3	1	1780	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
9212	NEWPORT AVENUE	12575	401-191-35	C4	1	1158	Sidewalk	PCC	Faulting	1/2" to 1"	6		Yes			Ramp	
9213	NEWPORT AVENUE	12575	401-191-35	C4	1	1158	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	
9215	NEWPORT AVENUE	12581	401-181-22	C4	1	1158	Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	8		No			Grind	Util cover
9214				C4	1	1158	Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	8		No			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
9218	NEWPORT AVENUE	12631	401-181-51	C4	1	1158	Sidewalk	PCC	Patch / Utility Cut	1" to 2"	2		No			Ramp	
9217	NEWPORT AVENUE	12631	401-181-51	C4	1	1158	Sidewalk	PCC	Spalling	1" to 2"	1		No			Patch	
9216	NEWPORT AVENUE	12631	401-181-51	C4	1	1158	Sidewalk	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
9220	NEWPORT AVENUE	12651	401-181-52	C4	1	1158	Sidewalk	PCC	Divided Slab	No Displacement	12		No			Replace Slab(s)	
9219	NEWPORT AVENUE	12651	401-181-52	C4	1	1158	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	25		Yes			Replace Slab	
9221	NEWPORT AVENUE	12651	401-181-52	C4	1	1158	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	14		No			Grind	
9225	NEWPORT AVENUE	12681	401-211-69	C4	1	1158	Sidewalk	PCC	Other - Leave Comment	1" to 2"		2"	No			Ramp	Hole
9232	NEWPORT AVENUE	12791	401-211-73	C4	1	1158	Sidewalk	PCC	Spalling	1/2" to 1"	4		No			Replace C&G	
9235	NEWPORT AVENUE	12805	401-221-21	C4	1	1158	Sidewalk	PCC	Faulting	1/2" to 1"	4		No			Ramp	
9234	NEWPORT AVENUE	12805	401-221-21	C4	1	1158	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
9233	NEWPORT AVENUE	12805	401-221-21	C4	1	1158	Sidewalk	PCC	Spalling	1/2" to 1"	2		No			Replace C&G	
9236	NEWPORT AVENUE	12821	401-221-15	C4	1	1158	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
9238	NEWPORT AVENUE	12821	401-221-15	C4	1	1158	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No		Yes	Grind	
9237	NEWPORT AVENUE	12821	401-221-15	C4	1	1158	Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	10		No			Grind	
9243	NEWPORT AVENUE	12881	401-221-27	C4	1	1159	Sidewalk	PCC	Other - Leave Comment	1/2" to 1"		2"	No		Yes	Grind	Hole
9247	NEWPORT AVENUE	12881	401-221-27	C4	1	1159	Curb/Gutter	PCC	Faulting	1/2" to 1"	1		No		Yes	Replace C&G	
9239	NEWPORT AVENUE	12881	401-221-27	C4	1	1159	Sidewalk	PCC	Patch / Utility Cut	1/2" to 1"	6		No		Yes	Grind	
9240	NEWPORT AVENUE	12881	401-221-27	C4	1	1159	Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	6		No		Yes	Grind	
9241	NEWPORT AVENUE	12881	401-221-27	C4	1	1159	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	8		No		Yes	Grind	
9244	NEWPORT AVENUE	12881	401-221-27	C4	1	1159	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	15		No		Yes	Grind	
9242	NEWPORT AVENUE	12881	401-221-27	C4	1	1159	Curb/Gutter	PCC	Spalling	1" to 2"	1		No		Yes	Patch	
9246	NEWPORT AVENUE	12881	401-221-27	C4	1	1159	Sidewalk	PCC	Spalling	1" to 2"	1		No		Yes	Patch	
9245	NEWPORT AVENUE	12881	401-221-27	C4	1	1159	Sidewalk	PCC	Spalling	1/2" to 1"	2		No		Yes	Replace C&G	
9255	NEWPORT AVENUE	13011	401-221-25	C4	1	1159	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No		Yes	Grind	
9253	NEWPORT AVENUE	13011	401-221-25	C4	1	1159	Sidewalk	PCC	Spalling	1" to 2"	1		No		Yes	Patch	
9254	NEWPORT AVENUE	13011	401-221-25	C4	1	1159	Sidewalk	PCC	Spalling	1/4" to 1/2"	2		No		Yes	Grind	
9250	NEWPORT AVENUE		401-221-28	C4	1	1159	Driveway	PCC	Faulting	1/2" to 1"	4		No		Yes	Grind Driveway	
9230	NEWPORT AVENUE		401-211-67	C4	1	1158	Driveway	PCC	Faulting	1/4" to 1/2"	4		No			Grind Driveway	
9227	NEWPORT AVENUE		401-211-67	C4	1	1158	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9228	NEWPORT AVENUE		401-211-67	C4	1	1158	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
9229	NEWPORT AVENUE		401-211-67	C4	1	1158	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
9231	NEWPORT AVENUE		401-211-67	C4	1	1158	Driveway	PCC	Linear Cracking	1/2" to 1"	6		No			Grind	
9226	NEWPORT AVENUE		401-211-67	C4	1	1158	Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	5		No			Grind	
9252	NEWPORT AVENUE		401-221-28	C4	1	1159	Driveway	PCC	Spalling	1" to 2"	6		No		Yes	Patch	
9248	NEWPORT AVENUE		401-221-28	C4	1	1159	Curb/Gutter	PCC	Spalling	1/2" to 1"	1		No		Yes	Replace C&G	
9249	NEWPORT AVENUE		401-221-28	C4	1	1159	Curb/Gutter	PCC	Spalling	1/2" to 1"	1		No		Yes	Replace C&G	
9251	NEWPORT AVENUE		401-221-28	C4	1	1159	Driveway	PCC	Spalling	1/2" to 1"	4		No		Yes	Replace C&G	
10351	NORWOOD PARK PLACE	14371	401-112-15	C3	1	1808	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10358	NORWOOD PARK PLACE	14371	401-112-03	C3	1	1808	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10359	NORWOOD PARK PLACE	14371	401-112-03	C3	1	1808	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10360	NORWOOD PARK PLACE	14371	401-112-03	C3	1	1808	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
10354	NORWOOD PARK PLACE	14372	401-112-08	C3	1	1808	Sidewalk	PCC	Faulting	1/2" to 1"	5		Yes			Ramp	
10353	NORWOOD PARK PLACE	14372	401-112-08	C3	1	1808	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		Yes			Grind	
10100	NORWOOD PARK PLACE	17281	401-321-18	C2	1	1807	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		Yes			Grind	
10101	NORWOOD PARK PLACE	17282	401-321-19	C2	1	1807	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
10099	NORWOOD PARK PLACE	17291	401-321-17	C2	1	1807	Driveway	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
10102	NORWOOD PARK PLACE	17292	401-321-20	C2	1	1807	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
10097	NORWOOD PARK PLACE	17301	401-321-16	C2	1	1807	Driveway	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind Driveway	
10098	NORWOOD PARK PLACE	17301	401-321-16	C2	1	1807	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	8		Yes			Replace Slab	
10143	NORWOOD PARK PLACE	17331	401-111-01	C2	1	1808	Cross Gutter	PCC	Linear Cracking	1/4" to 1/2"	10		No			Grind	
10281	NORWOOD PARK PLACE	17351	401-111-02	C2	1	1808	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		Yes			Grind	
10284	NORWOOD PARK PLACE	17361	401-111-03	C2	1	1808	Sidewalk	PCC	Faulting	1" to 2"	5		Yes			Replace Slab	
10282	NORWOOD PARK PLACE	17361	401-111-03	C2	1	1808	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
10283	NORWOOD PARK PLACE	17361	401-111-03	C2	1	1808	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10285	NORWOOD PARK PLACE	17381	401-111-04	C3	1	1808	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
10286	NORWOOD PARK PLACE	17391	401-111-05	C3	1	1808	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10265	NORWOOD PARK PLACE	17511	401-013-24	C3	1	1809	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
10264	NORWOOD PARK PLACE	17551	401-013-21	C3	1	1809	Sidewalk	PCC	Faulting	1/2" to 1"	5		Yes			Ramp	
10258	NORWOOD PARK PLACE	17592	401-014-06	C3	1	1809	Sidewalk	PCC	Faulting	1/2" to 1"	5		Yes			Ramp	
10263	NORWOOD PARK PLACE	17621	401-013-17	C3	1	1809	Sidewalk	PCC	Faulting	1/2" to 1"	5		Yes			Ramp	
10261	NORWOOD PARK PLACE	17661	401-013-14	C3	1	1809	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
10262	NORWOOD PARK PLACE	17661	401-013-14	C3	1	1809	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
10259	NORWOOD PARK PLACE	17671	401-013-13	C3	1	1809	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10260					1	1809	Sidewalk	PCC	Linear Cracking	1/2" to 1"	4		Yes			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
11243	NORWOOD PARK PLACE	17672	401-014-12	C3	1	1809	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
10218	OLIVE TREE CIRCLE	14241	401-392-10	B3	1	1810	Sidewalk	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
10219	OLIVE TREE CIRCLE	14261	401-392-11	B3	1	1810	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
10220	OLIVE TREE CIRCLE	14262	401-392-15	B3	1	1810	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
10221	OLIVE TREE CIRCLE	17632	401-392-16	B3	1	1810	Sidewalk	PCC	Faulting	1/2" to 1"	4		No			Ramp	
10222	OLIVE TREE CIRCLE	17632	401-392-16	B3	1	1810	Curb/Gutter	PCC	Sidewalk Curb Separation	1" to 2"	10		No			Replace Curb	
10276	ORANGE TREE LANE	17551	401-012-04	C3	1	1814	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10270	ORANGE TREE LANE	17552	401-013-04	C3	1	1814	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10271	ORANGE TREE LANE	17572	401-013-05	C3	1	1814	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10272	ORANGE TREE LANE	17602	401-013-07	C3	1	1814	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		Yes			Grind	
10275	ORANGE TREE LANE	17621	401-012-09	C3	1	1814	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
10274	ORANGE TREE LANE	17671	401-012-12	C3	1	1814	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	
10273	ORANGE TREE LANE	17672	401-013-12	C3	1	1814	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
10439	PACIFIC STREET	14631	401-501-05	C2	1	1821	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10441	PACIFIC STREET	14632	401-501-06	C2	1	1821	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	
10442	PACIFIC STREET	14632	401-501-06	C3	1	1821	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	
10440	PACIFIC STREET	14632	401-501-06	C2	1	1821	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
10438	PACIFIC STREET	14651	401-501-02	C2	1	1821	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
10437	PACIFIC STREET	14651	401-501-02	C2	1	1821	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	3		Yes			Grind	
10443	PACIFIC STREET	14652	401-501-08	C2	1	1821	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	
10436	PACIFIC STREET	17341	401-501-04	C2	1	1821	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10444	PACIFIC STREET	17361	401-501-09	C2	1	1821	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
3513	PALACE WAY	13701	395-012-13	B3	1	1823	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Prev grind
3514	PALACE WAY	13701	395-012-13	B3	1	1823	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
3515	PALACE WAY	13701	395-012-13	B3	1	1823	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
3512	PALACE WAY	13702	395-012-07	B3	1	1823	Cross Gutter	PCC	Other - Leave Comment	No Displacement			No			Field Assess-Monitor	Scaling/Popouts
3557	PALACE WAY	13762	395-141-17	B3	1	1822	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
3558	PALACE WAY	13762	395-141-17	B3	1	1822	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
3559	PALACE WAY	13762	395-141-17	B3	1	1822	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	6		No			Grind	
3553	PALACE WAY	13781	395-141-08	B3	1	1822	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
3554	PALACE WAY	13791	395-141-09	B3	1	1822	Sidewalk	PCC	Spalling	1/4" to 1/2"	1.5		No			Grind	
3556	PALACE WAY	13792	395-141-14	B3	1	1822	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
3555	PALACE WAY	13811	395-141-10	B3	1	1822	Sidewalk	PCC	Linear Cracking	1/2" to 1"	4		Yes			Grind	Prev grind
12061	PALACE WAY	13811	395-141-10	B3	1	1822	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
10327	PARKER DRIVE	14441	401-113-16	C3	1	1828	Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	20		Yes			Replace Slab(s)	
10140	PARKER DRIVE	17331	401-112-33	C2	1	1828	Sidewalk	PCC	Linear Cracking	1/2" to 1"	14		No			Grind	
10340	PARKER DRIVE	17352	401-113-02	C2	1	1828	Sidewalk	PCC	Spalling	1" to 2"	1		Yes			Patch	
10341	PARKER DRIVE	17381	401-112-28	C2	1	1828	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10342	PARKER DRIVE	17381	401-112-28	C3	1	1828	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
10338	PARKER DRIVE	17382	401-113-05	C3	1	1828	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
10339	PARKER DRIVE	17382	401-113-05	C3	1	1828	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
10343	PARKER DRIVE	17391	401-112-27	C3	1	1828	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
10337	PARKER DRIVE	17422	401-113-08	C3	1	1828	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	
10336	PARKER DRIVE	17422	401-113-08	C3	1	1828	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10344	PARKER DRIVE	17431	401-112-23	C3	1	1828	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
10345	PARKER DRIVE	17431	401-112-23	C3	1	1828	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10332	PARKER DRIVE	17432	401-113-09	C3	1	1828	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
10333	PARKER DRIVE	17432	401-113-09	C3	1	1828	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
10335	PARKER DRIVE	17432	401-113-09	C3	1	1828	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10334	PARKER DRIVE	17432	401-113-09	C3	1	1828	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	10		Yes			Grind	
10346	PARKER DRIVE	17441	401-112-22	C3	1	1828	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		Yes			Grind	
10331	PARKER DRIVE	17442	401-113-10	C3	1	1828	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	
10329	PARKER DRIVE	17442	401-113-10	C3	1	5011	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	3		Yes			Grind	
10330	PARKER DRIVE	17442	401-113-10	C3	1	1828	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	20		Yes			Replace Slab	
10328	PARKER DRIVE	17452	401-113-11	C3	1	5011	Sidewalk	PCC	Divided Slab	1/2" to 1"	7		Yes			Replace Slab(s)	
10347	PARKER DRIVE	17461	401-112-21	C3	1	1828	Sidewalk	PCC	Faulting	1" to 2"	5		Yes			Replace Slab	
10348	PARKER DRIVE	17491	401-112-19	C3	1	1828	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
3101	PLAZA DRIVE	14681	401-271-41	C4	1	1852	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
3102	PLAZA DRIVE	14681	401-271-41	C4	1	1852	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
3099	PLAZA DRIVE	14682	401-271-36	C4	1	1852	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight displacement
3098	PLAZA DRIVE	14682	401-271-36	C4	1	1852	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
3100	PLAZA DRIVE	14682	401-271-36	C4	1	1852	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
3104	PLAZA DRIVE	14691	401-271-42	C4	1	1852	Sidewalk	PCC	Faulting	1/2" to 1"	1		No			Ramp	Prev grind
3103				C4	1	1852	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
3097	PLAZA DRIVE	14692	401-271-37	C4	1	1852	Sidewalk	PCC	Other - Leave Comment	1/4" to 1/2"			No			Grind	Popouts
3096	PLAZA DRIVE	14692	401-271-37	C4	1	1852	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
3095	PLAZA DRIVE	14702	401-271-38	C4	1	1852	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
3093	PLAZA DRIVE	14712	401-271-39	C4	1	1852	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
3094	PLAZA DRIVE	14712	401-271-39	C4	1	1852	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
3091	PLAZA DRIVE	14722	401-271-40	C4	1	1852	Driveway	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
3092	PLAZA DRIVE	14722	401-271-40	C4	1	1852	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
3088	PLAZA DRIVE	14742	401-281-06	C4	1	1852	Sidewalk	PCC	Linear Cracking	No Displacement	5		Yes			Joint Seal	Slight displacement
3084	PLAZA DRIVE	14742	401-281-06	C4	1	1852	Driveway	PCC	Divided Slab	1/2" to 1"			No			Replace Slab(s)	High
3090	PLAZA DRIVE	14742	401-281-06	C4	1	1852	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	10		Yes			Replace Slab	
3085	PLAZA DRIVE	14742	401-281-06	C4	1	1852	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	6		Yes			Grind	
3087	PLAZA DRIVE	14742	401-281-06	C4	1	1852	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	6		Yes			Grind	
3086	PLAZA DRIVE	14742	401-281-06	C4	1	1852	Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	6		Yes			Replace Slab(s)	
3089	PLAZA DRIVE	14742	401-281-06	C4	1	1852	Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	10		Yes			Replace Slab(s)	
3075	PLAZA DRIVE	14772	401-281-07	C4	1	1852	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
3080	PLAZA DRIVE	14772	401-281-07	C4	1	1852	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	6		Yes			Replace Slab	
3081	PLAZA DRIVE	14772	401-281-07	C4	1	1852	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	6		Yes			Replace Slab	
3082	PLAZA DRIVE	14772	401-281-07	C4	1	1852	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	6		Yes			Replace Slab	
3083	PLAZA DRIVE	14772	401-281-07	C4	1	1852	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	6		Yes			Replace Slab	
3078	PLAZA DRIVE	14772	401-281-07	C4	1	1852	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	4		Yes			Grind	
3079	PLAZA DRIVE	14772	401-281-07	C4	1	1852	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	4		Yes			Grind	
3076	PLAZA DRIVE	14772	401-281-07	C4	1	1852	Driveway	PCC	Spalling	1/4" to 1/2"	4		No			Grind	
3077	PLAZA DRIVE	14772	401-281-07	C4	1	1852	Sidewalk	PCC	Spalling	1/4" to 1/2"	2		No			Grind	
3107	PLAZA DRIVE	18321	401-271-28	C4	1	1852	Sidewalk	PCC	Other - Leave Comment	1/4" to 1/2"	2	18"	No			Patch	Scaling
3105	PLAZA DRIVE	18321	401-271-28	C4	1	1852	Sidewalk	PCC	Linear Cracking	1/2" to 1"	4		Yes			Grind	
3106	PLAZA DRIVE	18321	401-271-28	C4	1	1852	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
3071	PLAZA DRIVE	18331	401-281-09	C4	1	1852	Sidewalk	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	Some curb sep also
3074	PLAZA DRIVE	18331	401-281-09	C4	1	1852	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	5		Yes			Grind	
3073	PLAZA DRIVE	18331	401-281-09	C4	1	1852	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	10	1"	Yes			Grind	
3072	PLAZA DRIVE	18331	401-281-09	C4	1	1852	Sidewalk	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
3064	PLAZA DRIVE		401-282-17	C4	1	1852	Sidewalk	PCC	Faulting	1" to 2"	4		Yes			Replace Slab	Prev grind
3059	PLAZA DRIVE		401-282-17	C4	1	1852	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
3063	PLAZA DRIVE		401-282-17	C4	1	1852	Sidewalk	PCC	Faulting	1/4" to 1/2"	7		No			Grind	
3069	PLAZA DRIVE		401-282-17	C4	1	1852	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
3070	PLAZA DRIVE		401-282-17	C4	1	1852	Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	4		No			Grind	
3058	PLAZA DRIVE		401-282-17	C4	1	1852	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	6		Yes			Replace Slab	
3060	PLAZA DRIVE		401-282-17	C4	1	1852	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	6		Yes			Replace Slab	
3068	PLAZA DRIVE		401-282-17	C4	1	1852	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	6		Yes			Replace Slab	
3056	PLAZA DRIVE		401-282-17	C4	1	1852	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	6		Yes			Grind	
3057	PLAZA DRIVE		401-282-17	C4	1	1852	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	6		Yes			Grind	
3061	PLAZA DRIVE		401-282-17	C4	1	1852	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	6		Yes			Grind	
3062	PLAZA DRIVE		401-282-17	C4	1	1852	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	6		Yes			Grind	
3067	PLAZA DRIVE		401-282-17	C4	1	1852	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	6		Yes			Grind	
3065	PLAZA DRIVE		401-282-17	C4	1	1852	Curb/Gutter	PCC	Spalling	1" to 2"	1		Yes			Patch	
3066	PLAZA DRIVE		401-282-17	C4	1	1852	Sidewalk	PCC	Spalling	1/2" to 1"	1		Yes			Replace C&G	
3115	PLAZA WAY	18271	401-271-45	C4	1	1853	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
3048	PLAZA WAY	18272	401-282-16	C4	1	1853	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
3049	PLAZA WAY	18272	401-282-16	C4	1	1853	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
3114	PLAZA WAY	18281	401-271-44	C4	1	1853	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
3113	PLAZA WAY	18281	401-271-44	C4	1	1853	Sidewalk	PCC	Spalling	Over 2"	1		Yes			Patch	
3051	PLAZA WAY	18282	401-282-15	C4	1	1853	Sidewalk	PCC	Corner Break	1/2" to 1"	2		No			Ramp	
3050	PLAZA WAY	18282	401-282-15	C4	1	1853	Sidewalk	PCC	Corner Break	No Displacement	2		Yes			Patch	
3111	PLAZA WAY	18291	401-271-43	C4	1	1853	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
3112	PLAZA WAY	18291	401-271-43	C4	1	1853	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
3109	PLAZA WAY	18321	401-271-28	C4	1	1853	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
3108	PLAZA WAY	18321	401-271-28	C4	1	1853	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	6		Yes			Replace Slab	
3052	PLAZA WAY		401-282-12	C4	1	1853	Driveway	PCC	Faulting	1/4" to 1/2"	3		No			Grind Driveway	
3110	PLAZA WAY		401-271-30	C4	1	1853	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
3053	PLAZA WAY		401-282-12	C4	1	1853	Driveway	PCC	Sidewalk Curb Separation	1/2" to 1"	10		No			Replace Driveway	
3055	PLAZA WAY		401-282-17	C4	1	1853	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	8		Yes			Grind	
3054	PLAZA WAY		401-282-17	C4	1	1853	Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	4		Yes			Replace Slab	
9814	PROSPECT AVENUE	13772	395-291-24	B3	1	1157	Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	4		No			Grind	Pole base
9815	PROSPECT AVENUE	13792	395-291-26	B3	1	1157	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
9820				B3	1	1157	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
9819	PROSPECT AVENUE	13802	395-291-27	B3	1	1157	Sidewalk	PCC	Linear Cracking	No Displacement	4		Yes			Joint Seal	
9817	PROSPECT AVENUE	13802	395-291-27	B3	1	1157	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	12		Yes			Grind	
9822	PROSPECT AVENUE	13812	395-291-28	B3	1	1157	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
9824	PROSPECT AVENUE	13812	395-291-28	B3	1	1157	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	12		Yes			Grind	
9826	PROSPECT AVENUE	13812	395-291-28	B3	1	1157	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	12		Yes			Grind	
9831	PROSPECT AVENUE	13822	395-291-29	B3	1	1157	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
9828	PROSPECT AVENUE	13822	395-291-29	B3	1	1157	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	10		Yes			Grind	
9830	PROSPECT AVENUE	13822	395-291-29	B3	1	1157	Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	12		Yes			Replace Slab(s)	
9833	PROSPECT AVENUE	13881	395-291-03	B3	1	1157	Driveway	PCC	Corner Break	1/4" to 1/2"	3		No			Grind	
9834	PROSPECT AVENUE	13881	395-291-03	B3	1	1157	Driveway	PCC	Corner Break	1/4" to 1/2"	3		No			Grind	
9836	PROSPECT AVENUE	13881	395-291-03	B3	1	1157	Driveway	PCC	Linear Cracking	1/2" to 1"	6		No			Grind	
11325	PROSPECT AVENUE	14162	401-412-01	B3	1	1156	Sidewalk	PCC	Faulting	1/2" to 1"	3		No			Ramp	
11326	PROSPECT AVENUE	14162	401-412-01	B3	1	1156	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
11324	PROSPECT AVENUE	14182	401-412-29	B3	1	1156	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
11323	PROSPECT AVENUE	14212	401-412-27	B3	1	1156	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
11245	PROSPECT AVENUE	14611	401-034-09	C3	1	1154	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
11256	PROSPECT AVENUE	14652	401-131-12	C3	1	1154	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No		Yes	Grind	
11258	PROSPECT AVENUE	14652	401-131-12	C3	1	1154	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No		Yes	Grind	
11259	PROSPECT AVENUE	14652	401-131-12	C3	1	1154	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No		Yes	Grind	
11257	PROSPECT AVENUE	14652	401-131-12	C3	1	1154	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	10		No		Yes	Grind	
11255	PROSPECT AVENUE	14702	401-131-10	C3	1	1154	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	7		No		Yes	Grind	
5569	PROSPECT AVENUE	17651	401-382-01	B3	1	1156	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
5571	PROSPECT AVENUE	17651	401-382-01	B3	1	1156	Sidewalk	PCC	Divided Slab	No Displacement	5		No			Replace Slab	Slight displacement
5570	PROSPECT AVENUE	17651	401-382-01	B3	1	1156	Sidewalk	PCC	Faulting	1/4" to 1/2"	7		No			Grind	
11239	PROSPECT AVENUE	17651	401-382-14	B3	1	1156	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
5568	PROSPECT AVENUE	17651	401-382-01	B3	1	1156	Curb/Gutter	PCC	Spalling	1/2" to 1"		1"	No			Replace C&G	
11242	PROSPECT AVENUE	17652	401-392-18	B3	1	1156	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
11238	PROSPECT AVENUE	17652	401-382-13	B3	1	1156	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
11237	PROSPECT AVENUE	17662	401-381-03	B3	1	1156	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	4		No			Grind	
11244	PROSPECT AVENUE	17731	401-031-14	C3	1	1154	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9934	PROSPECT AVENUE	17761	395-292-01	B3	1	1157	Sidewalk	PCC	Buckled Slab	Over 2"	6		Yes			Replace Slab	
9935	PROSPECT AVENUE	17761	395-292-01	B3	1	1157	Sidewalk	PCC	Buckled Slab	Over 2"	6		Yes			Replace Slab	
11320	PROSPECT AVENUE	17761	401-241-07	C3	1	1154	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
11321	PROSPECT AVENUE	17761	401-241-07	C3	1	1154	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9936	PROSPECT AVENUE	17761	395-292-01	B3	1	1157	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
11322	PROSPECT AVENUE	17762	401-413-29	B3	1	1156	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
9839	PROSPECT AVENUE	17821	395-291-52	B3	1	1157	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
9842	PROSPECT AVENUE	17821	395-291-52	B3	1	1157	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
9841	PROSPECT AVENUE	17821	395-291-52	B3	1	1157	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	8		Yes			Grind	
9854	PROSPECT AVENUE	17851	395-291-49	B3	1	1157	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
9855	PROSPECT AVENUE	17851	395-291-49	B3	1	1157	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
9846	PROSPECT AVENUE	17851	395-291-49	B3	1	1157	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
9849	PROSPECT AVENUE	17851	395-291-49	B3	1	1157	Sidewalk	PCC	Faulting	1/2" to 1"	5		Yes			Ramp	
9844	PROSPECT AVENUE	17851	395-291-49	B3	1	1157	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
9850	PROSPECT AVENUE	17851	395-291-49	B3	1	1157	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
9851	PROSPECT AVENUE	17851	395-291-49	B3	1	1157	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
9852	PROSPECT AVENUE	17851	395-291-49	B3	1	1157	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	8		Yes			Replace Slab	
9847	PROSPECT AVENUE	17851	395-291-49	B3	1	1157	Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	15		Yes			Replace Slab(s)	
11252	PROSPECT AVENUE	17952	401-131-13	C3	1	1154	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No		Yes	Grind	Prev grind
11253	PROSPECT AVENUE	17952	401-131-13	C3	1	1154	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No		Yes	Grind	Prev grind
11250	PROSPECT AVENUE	17952	401-131-13	C3	1	1154	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No		Yes	Grind	
11251	PROSPECT AVENUE	17952	401-131-13	C3	1	1154	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No		Yes	Grind	
11254	PROSPECT AVENUE	17952	401-131-13	C3	1	1154	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	1.5		No		Yes	Grind	
11248	PROSPECT AVENUE		401-044-21	C3	1	1154	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		No			Ramp	
11327	PROSPECT AVENUE		401-401-17	B3	1	1156	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
11246	PROSPECT AVENUE		401-044-21	C3	1	1154	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
11247	PROSPECT AVENUE		401-044-21	C3	1	1154	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
11249	PROSPECT AVENUE		401-044-21	C3	1	1154	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
11260	PROSPECT AVENUE		401-131-14	C3	1	1154	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No		Yes	Grind	
11318	PROSPECT AVENUE		401-242-03	C3	1	1154	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No		Yes	Grind	
11319	PROSPECT AVENUE		401-242-03	C3	1	1154	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No		Yes	Grind	
10063	RIDGECREST CIRCLE	13772	395-291-24	B3	1	1870	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
10062	RIDGECREST CIRCLE	13782	395-291-25	B3	1	1870	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
10061				B3	1	1870	Driveway	PCC	Linear Cracking	1/4" to 1/2"	6		No			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
10060	RIDGECREST CIRCLE	13832	395-291-30	B3	1	1870	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10235	RONDEL PLACE	14202	401-391-17	B3	1	1875	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
10211	RONDEL PLACE	14271	401-392-05	B3	1	1874	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
10212	RONDEL PLACE	14271	401-392-05	B3	1	1874	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
10234	RONDEL PLACE	17571	401-391-18	B3	1	1875	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
10215	RONDEL PLACE	17572	401-392-08	B3	1	1874	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
10213	RONDEL PLACE	17572	401-392-08	B3	1	1874	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
10216	RONDEL PLACE	17572	401-392-08	B3	1	1874	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
10214	RONDEL PLACE	17572	401-392-08	B3	1	1874	Sidewalk	PCC	Linear Cracking	1/2" to 1"	3		Yes			Grind	
5200	ROSALIND DRIVE	13642	395-263-12	A3	1	1877	Sidewalk	PCC	Linear Cracking	1/2" to 1"	4		Yes			Grind	Prev grind
5202	ROSALIND DRIVE	13642	395-263-12	A3	1	1877	Sidewalk	PCC	Linear Cracking	1/2" to 1"	4		Yes			Grind	Prev grind
5203	ROSALIND DRIVE	13642	395-263-12	A3	1	1877	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	2		Yes			Grind	
5273	ROSALIND DRIVE	13651	395-264-08	A3	1	1877	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No			Grind	
5199	ROSALIND DRIVE	13662	395-263-13	A3	1	1877	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
5197	ROSALIND DRIVE	13672	395-263-14	A3	1	1877	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
5277	ROSALIND DRIVE	13681	395-264-06	B3	1	1877	Sidewalk	PCC	Faulting	1/2" to 1"	2		No			Ramp	
5275	ROSALIND DRIVE	13681	395-264-06	A3	1	1877	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
5196	ROSALIND DRIVE	13682	395-263-15	B3	1	1877	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
5279	ROSALIND DRIVE	13691	395-264-05	B3	1	1877	Sidewalk	PCC	Divided Slab	1/4" to 1/2"	6		No			Replace Slab	Low
5281	ROSALIND DRIVE	17552	395-264-03	B3	1	1877	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
10462	ROSELEAF AVENUE	14701	401-502-06	C3	1	1879	Sidewalk	PCC	Linear Cracking	1/2" to 1"	4		No			Grind	
11572	ROSELEAF AVENUE	17281	401-101-41	C2	1	1878	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
10435	ROSELEAF AVENUE	17341	401-501-04	C2	1	1879	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
10464	ROSELEAF AVENUE	17352	401-502-03	C2	1	1879	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
10463	ROSELEAF AVENUE	17372	401-502-05	C3	1	1879	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
10445	ROSELEAF AVENUE	17381	401-501-10	C3	1	1879	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
10278	ROSEWOOD CIRCLE	14372	401-112-40	C2	1	1880	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	3		Yes			Grind	
10279	ROSEWOOD CIRCLE	14382	401-112-39	C2	1	1880	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
10280	ROSEWOOD CIRCLE	14392	401-112-38	C2	1	1880	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	
3488	SANTA CLARA (FRONTAGE) AVENUE	13521	395-022-01	A2	1	1892	Sidewalk	PCC	Faulting	1/4" to 1/2"	6		Yes			Grind	Prev grind
3487	SANTA CLARA (FRONTAGE) AVENUE	13521	395-022-01	A2	1	1892	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
3489	SANTA CLARA (FRONTAGE) AVENUE	17362	395-021-49	A3	1	1892	Driveway	PCC	Faulting	1/4" to 1/2"	4		No			Grind Driveway	
3490	SANTA CLARA (FRONTAGE) AVENUE	17372	395-021-01	A3	1	1892	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
9866	SEVENTEENTH STREET	13972	395-291-05	B3	1	1217	Sidewalk	PCC	Buckled Slab	Over 2"	6		No			Replace Slab	Manhole
9893	SEVENTEENTH STREET	13992	395-301-32	B3	1	1215	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	9		Yes			Grind	
9905	SEVENTEENTH STREET	17231	395-311-40	B2	1	1209	Sidewalk	PCC	Faulting	1" to 2"	5		No	Yes	Yes	Replace Slab	
9906	SEVENTEENTH STREET	17240	401-251-06	B2	1	1208	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	10		Yes			Replace Slab	
3610	SEVENTEENTH STREET	17241	395-311-01	B3	1	1209	Sidewalk	PCC	Patch / Utility Cut	1/2" to 1"	4		No		Yes	Grind	Metal util cover
9904	SEVENTEENTH STREET	17241	395-311-01	B2	1	1209	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No		Yes	Grind	
9903	SEVENTEENTH STREET	17241	395-311-01	B3	1	1209	Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	1		No		Yes	Grind	
9902	SEVENTEENTH STREET	17245	395-142-08	B3	1	1211	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
9901	SEVENTEENTH STREET	17395	395-142-09	B3	1	1211	Driveway	PCC	Spalling	1/4" to 1/2"	12		No			Grind	
9894	SEVENTEENTH STREET	17401	395-142-03	B3	1	1211	Driveway	PCC	Corner Break	1/4" to 1/2"	2		No			Grind	
9897	SEVENTEENTH STREET	17401	395-142-03	B3	1	1211	Driveway	PCC	Corner Break	1/4" to 1/2"	3		No			Grind	
9895	SEVENTEENTH STREET	17401	395-142-03	B3	1	1211	Driveway	PCC	Faulting	1/4" to 1/2"	6		No			Grind Driveway	
9898	SEVENTEENTH STREET	17401	395-142-03	B3	1	1211	Driveway	PCC	Linear Cracking	1/4" to 1/2"	5		No			Grind	
9896	SEVENTEENTH STREET	17401	395-142-03	B3	1	1211	Curb/Gutter	PCC	Spalling	1" to 2"	2		No			Patch	
9899	SEVENTEENTH STREET	17401	395-142-03	B3	1	1211	Sidewalk	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
9900	SEVENTEENTH STREET	17401	395-142-03	B3	1	1211	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
5552	SEVENTEENTH STREET	17501	395-301-36	B3	1	1213	Curb/Gutter	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
9913	SEVENTEENTH STREET	17502	401-253-02	B3	1	1212	Driveway	PCC	Linear Cracking	1/4" to 1/2"	8		No			Grind	
5551	SEVENTEENTH STREET	17541	395-301-35	B3	1	1213	Sidewalk	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
9916	SEVENTEENTH STREET	17542	401-351-02	B3	1	1212	Cross Gutter	PCC	Divided Slab	No Displacement	15		No			Replace Slab(s)	
9914	SEVENTEENTH STREET	17542	401-351-02	B3	1	1212	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
9915	SEVENTEENTH STREET	17542	401-351-02	B3	1	1212	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	4		Yes			Grind	
5550	SEVENTEENTH STREET	17561	395-301-33	B3	1	1213	Driveway	PCC	Linear Cracking	1/4" to 1/2"	7		No			Grind	
5545	SEVENTEENTH STREET	17561	395-301-33	B3	1	1213	Sidewalk	PCC	Patch / Utility Cut	1/2" to 1"	6		No			Grind	
5547	SEVENTEENTH STREET	17561	395-301-33	B3	1	1213	Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	4		No			Grind	
5546	SEVENTEENTH STREET	17561	395-301-33	B3	1	1213	Sidewalk	PCC	Spalling	1/2" to 1"	2		No			Replace C&G	
5548	SEVENTEENTH STREET	17561	395-301-33	B3	1	1213	Sidewalk	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
5549	SEVENTEENTH STREET	17561	395-301-33	B3	1	1213	Curb/Gutter	PCC	Spalling	1/4" to 1/2"	4		No			Grind	
9918	SEVENTEENTH STREET	17582	401-351-05	B3	1	1214	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	12		Yes			Replace Slab	
9917	SEVENTEENTH STREET	17582	401-351-05	B3	1	1212	Curb/Gutter	PCC	Spalling	1" to 2"	1		No			Patch	
5544				B3	1	1213	Sidewalk	PCC	Divided Slab	No Displacement	12		No			Replace Slab(s)	Low

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
5541	SEVENTEENTH STREET	17601	395-301-05	B3	1	1213	Curb/Gutter	PCC	Spalling	1/2" to 1"	2		No			Replace C&G	
5542	SEVENTEENTH STREET	17601	395-301-05	B3	1	1213	Sidewalk	PCC	Spalling	1/4" to 1/2"	0.5		No			Grind	
5543	SEVENTEENTH STREET	17601	395-301-05	B3	1	1213	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
9919	SEVENTEENTH STREET	17632	401-381-05	B3	1	1214	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	10		Yes			Grind	
9923	SEVENTEENTH STREET	17642	401-381-04	B3	1	1214	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
9922	SEVENTEENTH STREET	17642	401-381-04	B3	1	1214	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		Yes			Grind	
9921	SEVENTEENTH STREET	17642	401-381-04	B3	1	1214	Driveway	PCC	Linear Cracking	1/4" to 1/2"	8		No			Grind	
9920	SEVENTEENTH STREET	17642	401-381-04	B3	1	1214	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	12		Yes			Replace Slab	
9924	SEVENTEENTH STREET	17642	401-381-04	B3	1	1214	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	12		Yes			Grind	
5521	SEVENTEENTH STREET	17652	395-301-13	B3	1	1215	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	5		No			Grind	
9926	SEVENTEENTH STREET	17662	401-381-03	B3	1	1214	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
5520	SEVENTEENTH STREET	17662	395-301-12	B3	1	1215	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	13		Yes			Replace Slab	
9925	SEVENTEENTH STREET	17662	401-381-03	B3	1	1214	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	12		Yes			Replace Slab	
5519	SEVENTEENTH STREET	17672	395-301-11	B3	1	1215	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	30		No			Grind	
9927	SEVENTEENTH STREET	17752	401-381-01	B3	1	1214	Driveway	PCC	Linear Cracking	1/4" to 1/2"	8		No			Grind	
9928	SEVENTEENTH STREET	17752	401-381-01	B3	1	1214	Driveway	PCC	Linear Cracking	1/4" to 1/2"	8		No			Grind	
9929	SEVENTEENTH STREET	17752	401-381-01	B3	1	1214	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	8		Yes			Grind	
9892	SEVENTEENTH STREET	17771	395-291-47	B3	1	1215	Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	2		No			Grind	
9863	SEVENTEENTH STREET	17821	395-291-52	B3	1	1217	Sidewalk	PCC	Patch / Utility Cut	1/2" to 1"	2		No			Grind	
9860	SEVENTEENTH STREET	17821	395-291-52	B3	1	1217	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
9857	SEVENTEENTH STREET	17851	395-291-49	B3	1	1217	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	6		No			Grind	
9859	SEVENTEENTH STREET	17851	395-291-49	B3	1	1217	Sidewalk	PCC	Spalling	1/4" to 1/2"	2		No			Grind	
9930	SEVENTEENTH STREET		401-401-17	B3	1	1216	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
9931	SEVENTEENTH STREET		401-401-17	B3	1	1216	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
9932	SEVENTEENTH STREET		401-401-17	B3	1	1216	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
9933	SEVENTEENTH STREET		401-401-17	B3	1	1216	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
5513	SHADEL DRIVE	17651	395-301-14	B3	1	1906	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
5517	SHADEL DRIVE	17672	395-301-11	B3	1	1906	Sidewalk	PCC	Faulting	1/2" to 1"	4		No			Ramp	Prev grind
5514	SHADEL DRIVE	17672	395-301-11	B3	1	1906	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
5515	SHADEL DRIVE	17672	395-301-11	B3	1	1906	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
5516	SHADEL DRIVE	17672	395-301-11	B3	1	1906	Driveway	PCC	Sidewalk Curb Separation	1/2" to 1"	7		No			Replace Driveway	
11312	SHASTA WAY	17872	401-241-01	C3	1	1908	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
11311	SHASTA WAY	17872	401-241-01	C3	1	1908	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
11288	SHASTA WAY	17902	401-241-29	C3	1	1908	Sidewalk	PCC	Faulting	1" to 2"	4		No			Replace Slab	Prev grind
11286	SHASTA WAY	17902	401-241-29	C3	1	1908	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
11287	SHASTA WAY	17902	401-241-29	C3	1	1908	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	Prev grind
11284	SHASTA WAY		401-242-04	C3	1	1908	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		Yes		Yes	Grind	
11285	SHASTA WAY		401-242-04	C3	1	1908	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes		Yes	Grind	
11313	SHASTA WAY		401-242-03	C3	1	1908	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No		Yes	Grind	
10243	SHERBROOK DRIVE	17492	401-024-08	C3	1	1909	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	2		No			Grind	
10244	SHERBROOK DRIVE	17512	401-024-10	C3	1	1909	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
10252	SHERBROOK DRIVE	17535	401-023-17	C3	1	1909	Sidewalk	PCC	Faulting	1/2" to 1"	5		Yes			Ramp	
10253	SHERBROOK DRIVE	17535	401-023-17	C3	1	1909	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
10245	SHERBROOK DRIVE	17536	401-024-12	C3	1	1909	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	
10246	SHERBROOK DRIVE	17536	401-024-12	C3	1	1909	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
5540	TREEHAVEN DRIVE	17601	395-301-05	B3	1	1936	Sidewalk	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	Around pole
5536	TREEHAVEN DRIVE	17601	395-301-05	B3	1	1936	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
5537	TREEHAVEN DRIVE	17601	395-301-05	B3	1	1936	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
5539	TREEHAVEN DRIVE	17601	395-301-05	B3	1	1936	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	25		No			Grind	
5538	TREEHAVEN DRIVE	17601	395-301-05	B3	1	1936	Driveway	PCC	Spalling	1/4" to 1/2"	0.5		No			Grind	
5527	TREEHAVEN DRIVE	17631	395-301-07	B3	1	1936	Curb/Gutter	PCC	Other - Leave Comment	Over 2"			No			Replace C&G	Broken
5525	TREEHAVEN DRIVE	17631	395-301-07	B3	1	1936	Sidewalk	PCC	Linear Cracking	No Displacement	6		No			Joint Seal	Slight displacement
5528	TREEHAVEN DRIVE	17631	395-301-07	B3	1	1936	Sidewalk	PCC	Linear Cracking	No Displacement	6		No			Joint Seal	Slight displacement
5524	TREEHAVEN DRIVE	17631	395-301-07	B3	1	1936	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
5526	TREEHAVEN DRIVE	17631	395-301-07	B3	1	1936	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
5529	TREEHAVEN DRIVE	17631	395-301-07	B3	1	1936	Driveway	PCC	Linear Cracking	1/4" to 1/2"	12		No			Grind	
5522	TREEHAVEN DRIVE	17631	395-301-07	B3	1	1936	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	5		No			Grind	
5523	TREEHAVEN DRIVE	17631	395-301-07	B3	1	1936	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	5		No			Grind	
5530	TREEHAVEN DRIVE		395-301-09	B3	1	1936	Driveway	PCC	Linear Cracking	1/4" to 1/2"	10		No			Grind	Driveway scaling
5533	TREEHAVEN DRIVE		395-301-09	B3	1	1936	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	5		No			Grind	Prev grind
5534	TREEHAVEN DRIVE		395-301-09	B3	1	1936	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	5		No			Grind	Prev grind
5535	TREEHAVEN DRIVE		395-301-09	B3	1	1936	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	5		No			Grind	Prev grind
5531	TREEHAVEN DRIVE		395-301-09	B3	1	1936	Sidewalk	PCC	Divided Slab	No Displacement	12		No			Replace Slab(s)	
5532				B3	1	1936	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	8		No			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
10064	VANDENBERG LANE	17300	401-252-06	B3	1	1946	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
10065	VANDENBERG LANE	17300	401-252-06	B2	1	1946	Sidewalk	PCC	Other - Leave Comment	1" to 2"	1		No			Ramp	
10206	VANDENBERG LANE	17440	401-252-10	B3	1	1946	Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	3		Yes			Grind	Pole bass
5593	VANDENBERG LANE	17542	401-351-02	B3	1	1947	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	9		Yes			Replace Slab	Raised, fault previous grind
5590	VANDENBERG LANE	17542	401-351-02	B3	1	1947	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
5591	VANDENBERG LANE	17542	401-351-02	B3	1	1947	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
5592	VANDENBERG LANE	17542	401-351-02	B3	1	1947	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	15		No			Grind	
5594	VANDENBERG LANE	17542	401-351-02	B3	1	1947	Sidewalk	PCC	Spalling	1/4" to 1/2"	2		No			Grind	
5586	VANDENBERG LANE	17592	401-351-04	B3	1	1947	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Manhole
5589	VANDENBERG LANE	17592	401-351-04	B3	1	1947	Driveway	PCC	Faulting	1/4" to 1/2"	5		No			Grind Driveway	
5588	VANDENBERG LANE	17592	401-351-04	B3	1	1947	Curb/Gutter	PCC	Linear Cracking	1/2" to 1"	3		No			Grind	
5587	VANDENBERG LANE	17592	401-351-04	B3	1	1947	Sidewalk	PCC	Spalling	1/2" to 1"	0.5		No			Replace C&G	
5567	VANDENBERG LANE	17651	401-382-01	B3	1	1947	Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	5		No			Grind	
5585	VANDENBERG LANE	17662	401-381-03	B3	1	1947	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
10204	VANDENBERG LANE		401-261-01	B3	1	1946	Sidewalk	PCC	Other - Leave Comment	1/2" to 1"	1		No			Grind	Hole
5595	VANDENBERG LANE		401-261-01	B3	1	1947	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	Prev grind
5559	VANDENBERG LANE		401-352-02	B3	1	1947	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
5566	VANDENBERG LANE		401-352-02	B3	1	1947	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
5562	VANDENBERG LANE		401-352-02	B3	1	1947	Driveway	PCC	Spalling	Over 2"	2		No			Patch	Severe
5563	VANDENBERG LANE		401-352-02	B3	1	1947	Driveway	PCC	Spalling	Over 2"	2		No			Patch	Severe
10205	VANDENBERG LANE		401-252-08	B3	1	1946	Sidewalk	PCC	Faulting	1/2" to 1"	3		No			Ramp	
5561	VANDENBERG LANE		401-352-02	B3	1	1947	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
10201	VANDENBERG LANE		401-261-01	B3	1	1946	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
10202	VANDENBERG LANE		401-261-01	B3	1	1946	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
10203	VANDENBERG LANE		401-261-01	B3	1	1946	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
5557	VANDENBERG LANE		401-352-02	B3	1	1947	Driveway	PCC	Linear Cracking	1/4" to 1/2"	5		No			Grind	
5558	VANDENBERG LANE		401-352-02	B3	1	1947	Driveway	PCC	Linear Cracking	1/4" to 1/2"	5		No			Grind	
5564	VANDENBERG LANE		401-352-02	B3	1	1947	Driveway	PCC	Linear Cracking	1/4" to 1/2"	5		No			Grind	
5565	VANDENBERG LANE		401-352-02	B3	1	1947	Driveway	PCC	Linear Cracking	1/4" to 1/2"	5		No			Grind	
5560	VANDENBERG LANE		401-352-02	B3	1	1947	Sidewalk	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
10136	VILLAGE DRIVE	17331	401-491-01	C2	1	1951	Cross Gutter	PCC	Linear Cracking	1/4" to 1/2"	10		No			Grind	
10308	VILLAGE DRIVE	17332	401-492-01	C2	1	1951	Sidewalk	PCC	Faulting	1/2" to 1"	5		Yes			Ramp	
12046	VILLAGE DRIVE	17332	401-492-01	C2	1	1951	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
10309	VILLAGE DRIVE	17332	401-492-01	C2	1	1951	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	5		Yes			Grind	
12060	VILLAGE DRIVE	17351	401-491-02	C2	1	1951	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
12058	VILLAGE DRIVE	17361	401-491-03	C2	1	1951	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
12059	VILLAGE DRIVE	17361	401-491-03	C2	1	1951	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
10310	VILLAGE DRIVE	17371	401-491-04	C2	1	1951	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
10311	VILLAGE DRIVE	17371	401-491-04	C3	1	1951	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
10312	VILLAGE DRIVE	17381	401-491-05	C3	1	1951	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
10313	VILLAGE DRIVE	17381	401-491-05	C3	1	1951	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
12057	VILLAGE DRIVE	17401	401-491-07	C3	1	1951	Driveway	PCC	Spalling	1/4" to 1/2"	2		No			Grind	
10315	VILLAGE DRIVE	17431	401-491-09	C3	1	1951	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	Prev grind
10314	VILLAGE DRIVE	17431	401-491-09	C3	1	1951	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10316	VILLAGE DRIVE	17431	401-491-09	C3	1	1951	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10305	VILLAGE DRIVE	17432	401-492-11	C3	1	1951	Sidewalk	PCC	Faulting	1" to 2"	5		Yes			Replace Slab	
10306	VILLAGE DRIVE	17432	401-492-11	C3	1	1951	Sidewalk	PCC	Faulting	1/2" to 1"	5		Yes			Ramp	
10304	VILLAGE DRIVE	17432	401-492-11	C3	1	1951	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
10307	VILLAGE DRIVE	17432	401-492-11	C3	1	1951	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10317	VILLAGE DRIVE	17441	401-491-10	C3	1	1951	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
12056	VILLAGE DRIVE	17441	401-491-10	C3	1	1951	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
10318	VILLAGE DRIVE	17441	401-491-10	C3	1	5012	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10319	VILLAGE DRIVE	17441	401-491-10	C3	1	5012	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		Yes			Grind	
10320	VILLAGE DRIVE	17441	401-491-10	C3	1	5012	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
12051	VILLAGE DRIVE	17442	401-492-12	C3	1	1951	Driveway	PCC	Faulting	1/4" to 1/2"	8		No			Grind Driveway	
10302	VILLAGE DRIVE	17442	401-492-12	C3	1	1951	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	
10303	VILLAGE DRIVE	17442	401-492-12	C3	1	1951	Sidewalk	PCC	Faulting	1/2" to 1"			Yes			Ramp	
10301	VILLAGE DRIVE	17462	401-492-13	C3	1	1951	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	
10323	VILLAGE DRIVE	17491	401-491-15	C3	1	1951	Sidewalk	PCC	Faulting	1/2" to 1"	5		Yes			Ramp	
10324	VILLAGE DRIVE	17491	401-491-15	C3	1	1951	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
10321	VILLAGE DRIVE	17491	401-491-15	C3	1	5012	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		Yes			Grind	
10322	VILLAGE DRIVE	17491	401-491-15	C3	1	5012	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
12055	VILLAGE DRIVE	17491	401-491-15	C3	1	5012	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
12054				i	C3	1	1951	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	5		No		Replace Slab	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
12052	VILLAGE DRIVE	17502	401-492-16	C3	1	1951	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	Prev grind
12053	VILLAGE DRIVE	17502	401-492-16	C3	1	1951	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	14		No			Grind	
10459	VINEWOOD AVENUE	14721	401-502-08	C3	1	1952	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	
10458	VINEWOOD AVENUE	14721	401-502-08	C3	1	1952	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10455	VINEWOOD AVENUE	17341	401-502-12	C2	1	1952	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10454	VINEWOOD AVENUE	17342	401-501-31	C2	1	1952	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
10456	VINEWOOD AVENUE	17361	401-502-10	C3	1	1952	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	
10457	VINEWOOD AVENUE	17381	401-502-09	C3	1	1952	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
10452	VINEWOOD AVENUE	17382	401-501-28	C3	1	1952	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
10453	VINEWOOD AVENUE	17382	401-501-28	C3	1	1952	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
9222	WARREN AVENUE	12651	401-181-52	C4	1	1958	Driveway	PCC	Faulting	1/4" to 1/2"	12		No			Grind Driveway	
9223	WARREN AVENUE	12651	401-181-52	C4	1	1958	Driveway	PCC	Sidewalk Curb Separation	1/2" to 1"	10		No			Replace Driveway	
9224	WARREN AVENUE	12681	401-211-69	C4	1	1958	Driveway	PCC	Spalling	1/2" to 1"	3		No			Replace C&G	
3148	WARREN AVENUE	18281	401-122-17	C4	1	1957	Driveway	PCC	Linear Cracking	No Displacement	6		No			Joint Seal	Slight displacement
3147	WARREN AVENUE	18281	401-122-17	C4	1	1957	Driveway	PCC	Faulting	1/4" to 1/2"	1		No			Grind Driveway	
3146	WARREN AVENUE	18281	401-122-17	C4	1	1957	Driveway	PCC	Sidewalk Curb Separation	1/4" to 1/2"	7		No			Grind	
3144	WARREN AVENUE		401-278-04	C4	1	1957	Curb/Gutter	PCC	Faulting	1" to 2"	1		Yes			Replace C&G	
3145	WARREN AVENUE		999-000-56	C4	1	1958	Sidewalk	AC	Faulting	1/2" to 1"	4		No			Ramp	
3140	WARREN AVENUE		401-278-04	C4	1	1957	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
3141	WARREN AVENUE		401-278-04	C4	1	1957	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
3142	WARREN AVENUE		401-278-04	C4	1	1957	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
3143	WARREN AVENUE		401-278-04	C4	1	1957	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
10238	WELLINGTON AVENUE	14252	401-391-11	B3	1	1960	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	7		Yes			Grind	
10209	WELLINGTON AVENUE	17522	401-392-02	B3	1	1960	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
10208	WELLINGTON AVENUE	17522	401-392-02	B3	1	1960	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
10210	WELLINGTON AVENUE	17532	401-392-03	B3	1	1960	Sidewalk	PCC	Linear Cracking	1/2" to 1"	4		Yes			Grind	
10237	WELLINGTON AVENUE	17551	401-391-13	B3	1	1960	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
10236	WELLINGTON AVENUE	17551	401-391-13	B3	1	1960	Sidewalk	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
10217	WELLINGTON AVENUE	17572	401-392-08	B3	1	1960	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10233	WELLINGTON AVENUE	17591	401-391-19	B3	1	1960	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
10232	WELLINGTON AVENUE	17611	401-391-21	B3	1	1960	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
10223	WELLINGTON AVENUE	17632	401-392-16	B3	1	1960	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
10224	WELLINGTON AVENUE	17652	401-392-18	B3	1	1960	Sidewalk	PCC	Faulting	1" to 2"	5		No			Replace Slab	
11241	WELLINGTON AVENUE	17652	401-392-18	B3	1	1960	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
10381	WESTBURY LANE	14721	401-032-06	C3	1	1961	Sidewalk	PCC	Faulting	1" to 2"	4		Yes			Replace Slab	
10374	WESTBURY LANE	14721	401-033-14	C3	1	1961	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10380	WESTBURY LANE	14721	401-032-06	C3	1	1961	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
10382	WESTBURY LANE	14721	401-032-06	C3	1	1961	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes		Yes	Grind	
10367	WESTBURY LANE	14722	401-033-09	C3	1	1961	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
10368	WESTBURY LANE	14722	401-033-09	C3	1	1961	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10369	WESTBURY LANE	14722	401-033-09	C3	1	1961	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
10395	WESTBURY LANE	17572	401-035-01	C3	1	1961	Sidewalk	PCC	Faulting	1" to 2"	3		Yes			Replace Slab	
10394	WESTBURY LANE	17572	401-035-01	C3	1	1961	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10393	WESTBURY LANE	17572	401-035-01	C3	1	1961	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	3		Yes			Grind	
10396	WESTBURY LANE	17592	401-035-02	C3	1	1961	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
10397	WESTBURY LANE	17612	401-035-03	C3	1	1961	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	5		Yes			Grind	
10398	WESTBURY LANE	17692	401-035-08	C3	1	1961	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
10402	WESTBURY LANE	17711	401-034-07	C3	1	1961	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
10401	WESTBURY LANE	17711	401-034-07	C3	1	1961	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
10399	WESTBURY LANE	17712	401-035-09	C3	1	1961	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	3		Yes			Grind	
10400	WESTBURY LANE	17731	401-034-06	C3	1	1961	Sidewalk	PCC	Linear Cracking	1/2" to 1"	4		Yes			Grind	
10009	WHEELER PLACE	13501	395-273-02	A3	1	1963	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
10010	WHEELER PLACE	13501	395-273-02	A3	1	1963	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
10011	WHEELER PLACE	13501	395-273-02	A3	1	1963	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
10012	WHEELER PLACE	13501	395-273-02	A3	1	1963	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
10013	WHEELER PLACE	13521	395-273-03	A3	1	1963	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
10014	WHEELER PLACE	13521	395-273-03	A3	1	1963	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
10015	WHEELER PLACE	13551	395-273-05	A3	1	1963	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No			Grind	
10016	WHEELER PLACE	13551	395-273-05	A3	1	1963	Sidewalk	PCC	Spalling	1/4" to 1/2"	2		No			Grind	
10017	WHEELER PLACE	13571	395-273-06	A3	1	1963	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
10018	WHEELER PLACE	13571	395-273-06	A3	1	1963	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
10019	WHEELER PLACE	13571	395-273-06	A3	1	1963	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
10020	WHEELER PLACE	13581	395-273-07	A3	1	1963	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
10005				A3	1	1963	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
10007	WHEELER PLACE	13592	395-272-22	A3	1	1963	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
10008	WHEELER PLACE	13592	395-272-22	A3	1	1963	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
10006	WHEELER PLACE	13592	395-272-22	A3	1	1963	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10004	WHEELER PLACE	13602	395-272-21	A3	1	1963	Sidewalk	PCC	Divided Slab	No Displacement	8		No			Replace Slab(s)	
10003	WHEELER PLACE	13612	395-272-20	A3	1	1963	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10021	WHEELER PLACE	13621	395-273-10	A3	1	1963	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
10001	WHEELER PLACE	13632	395-272-19	A3	1	1963	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	
10000	WHEELER PLACE	13632	395-272-19	A3	1	1963	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
10002	WHEELER PLACE	13632	395-272-19	A3	1	1963	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
10022	WHEELER PLACE	13641	395-273-11	A3	1	1963	Sidewalk	PCC	Faulting	1/2" to 1"	4		No			Ramp	Prev grind
10023	WHEELER PLACE	13641	395-273-11	A3	1	1963	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	Prev grind
10024	WHEELER PLACE	13641	395-273-11	A3	1	1963	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
9998	WHEELER PLACE	13642	395-272-18	A3	1	1963	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	
9999	WHEELER PLACE	13642	395-272-18	A3	1	1963	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
10026	WHEELER PLACE	13661	395-273-12	A3	1	1963	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
10025	WHEELER PLACE	13661	395-273-12	A3	1	1963	Sidewalk	PCC	Corner Break	1/4" to 1/2"	3		Yes			Grind	
10027	WHEELER PLACE	13671	395-273-13	A3	1	1963	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
9997	WHEELER PLACE	13682	395-272-16	B3	1	1963	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
10029	WHEELER PLACE	13711	395-273-16	B3	1	1963	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
10028	WHEELER PLACE	13711	395-273-16	B3	1	1963	Driveway	PCC	Linear Cracking	1/2" to 1"	7		No			Grind	
9996	WHEELER PLACE	17661	395-272-15	B3	1	1963	Sidewalk	PCC	Divided Slab	No Displacement	12		No			Replace Slab(s)	
9995	WHEELER PLACE	17661	395-272-15	B3	1	1963	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
10352	WILLOW LANE	14391	401-112-11	C3	1	1968	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		Yes			Grind	
12047	WISTERIA CIRCLE	17332	401-492-01	C2	1	5013	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
12048	WISTERIA CIRCLE	17342	401-492-02	C2	1	5013	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
12049	WISTERIA CIRCLE	17362	401-492-04	C2	1	5013	Driveway	PCC	Linear Cracking	1/4" to 1/2"	6		No			Grind	
12050	WISTERIA CIRCLE	17382	401-492-06	C2	1	5013	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	6		No			Grind	
3663	YORBA STREET	13692	395-264-12	B3	1	1277	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
3662	YORBA STREET	13692	395-264-12	B3	1	1277	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
3660	YORBA STREET	13702	395-264-13	B3	1	1277	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
3661	YORBA STREET	13702	395-264-13	B3	1	1277	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
3536	YORBA STREET	13711	395-012-09	B3	1	1277	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	8		No			Grind	
3659	YORBA STREET	13712	395-264-14	B3	1	1277	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
3658	YORBA STREET	13712	395-264-14	B3	1	1277	Sidewalk	PCC	Spalling	1/4" to 1/2"	2		Yes			Grind	
3565	YORBA STREET	13762	395-141-17	B3	1	1276	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
3566	YORBA STREET	13762	395-141-17	B3	1	1276	Sidewalk	PCC	Spalling	1/4" to 1/2"	3		Yes			Grind	
3570	YORBA STREET	13772	395-141-16	B3	1	1276	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	Prev grind
3568	YORBA STREET	13772	395-141-16	B3	1	1276	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	5		Yes			Replace Slab	
3569	YORBA STREET	13772	395-141-16	B3	1	1276	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	10		Yes			Grind	
3567	YORBA STREET	13772	395-141-16	B3	1	1276	Sidewalk	PCC	Spalling	1/4" to 1/2"	2		Yes			Grind	
3571	YORBA STREET	13782	395-141-15	B3	1	1276	Curb/Gutter	PCC	Sidewalk Curb Separation	1" to 2"	6		Yes			Replace Curb	
3572	YORBA STREET	13782	395-141-15	B3	1	1276	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
3655	YORBA STREET	13821	395-162-71	B3	1	1276	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	
3657	YORBA STREET	13821	395-162-71	B3	1	1276	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	5	1"	Yes			Grind	
3628	YORBA STREET	13901	395-142-04	B3	1	1276	Sidewalk	PCC	Temporary Ramp	1/4" to 1/2"	1		No			Replace Slab	Filled spall
3631	YORBA STREET	13901	395-142-04	B3	1	1276	Sidewalk	PCC	Divided Slab	No Displacement	6		Yes			Replace Slab(s)	Low
3627	YORBA STREET	13901	395-142-04	B3	1	1276	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		Yes			Grind	
3636	YORBA STREET	13901	395-142-04	B3	1	1276	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
3634	YORBA STREET	13901	395-142-04	B3	1	1276	Curb/Gutter	PCC	Linear Cracking	1" to 2"	12		No			Grind	
3635	YORBA STREET	13901	395-142-04	B3	1	1276	Driveway	PCC	Linear Cracking	1/2" to 1"	3		No			Grind	
3629	YORBA STREET	13901	395-142-04	B3	1	1276	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	3		Yes			Grind	
3630	YORBA STREET	13901	395-142-04	B3	1	1276	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	8		Yes			Grind	
3626	YORBA STREET	13901	395-142-04	B3	1	1276	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	10		Yes			Grind	
3633	YORBA STREET	13901	395-142-04	B3	1	1276	Sidewalk	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
3632	YORBA STREET	13901	395-142-04	B3	1	1276	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
10073	YORBA STREET	14081	401-251-04	B2	1	1275	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
10075	YORBA STREET	14081	401-251-04	B2	1	1275	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10074	YORBA STREET	14081	401-251-04	B2	1	1275	Driveway	PCC	Linear Cracking	1/4" to 1/2"	7		No			Grind	
10076	YORBA STREET	14081	401-251-04	B2	1	1275	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	8		Yes			Grind	
10080	YORBA STREET	14101	401-321-30	B2	1	1275	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
10081	YORBA STREET	14101	401-321-30	B2	1	1275	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	7		Yes			Grind	
10082	YORBA STREET	14131	401-321-31	B2	1	1275	Driveway	PCC	Corner Break	1/4" to 1/2"	2		No			Grind	
10084	YORBA STREET	14181	401-321-28	B2	1	1275	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	Prev grind
10085				B2	1	1275	Sidewalk	PCC	Patch / Utility Cut	1/2" to 1"	4		No			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
10083	YORBA STREET	14181	401-321-28	B2	1	1275	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	8		Yes			Replace Slab	
10086	YORBA STREET	14211	401-321-29	B2	1	1274	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
10089	YORBA STREET	14271	401-321-06	B2	1	2029	Cross Gutter	PCC	Linear Cracking	1/4" to 1/2"	9		No			Grind	
10087	YORBA STREET	14271	401-321-06	B2	1	1274	Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	5		No			Grind	
10088	YORBA STREET	14271	401-321-06	B2	1	1274	Sidewalk	PCC	Spalling	1/4" to 1/2"	2		No			Grind	
10147	YORBA STREET	14302	401-232-03	B2	1	1274	Driveway	PCC	Faulting	1/2" to 1"	4		No			Grind Driveway	
10146	YORBA STREET	14302	401-232-03	C2	1	1274	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	10		Yes			Replace Slab	
10092	YORBA STREET	14311	401-321-11	C2	1	2028	Curb/Gutter	PCC	Linear Cracking	1/2" to 1"	1		No			Grind	
10090	YORBA STREET	14311	401-321-11	C2	1	1274	Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	14		Yes			Replace Slab(s)	
10091	YORBA STREET	14311	401-321-11	C2	1	1274	Sidewalk	PCC	Temporary Ramp	1/2" to 1"	5		Yes			Replace Slab	
10093	YORBA STREET	14331	401-321-13	C2	1	2028	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	4		No			Grind	
10144	YORBA STREET	14332	401-232-01	C2	1	1274	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
10145	YORBA STREET	14332	401-232-01	C2	1	1274	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	5		Yes			Grind	
10094	YORBA STREET	14351	401-321-15	C2	1	2028	Cross Gutter	PCC	Linear Cracking	1/4" to 1/2"	15		No			Grind	
10095	YORBA STREET	14351	401-321-15	C2	1	1274	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	16		No			Replace Slab	
10142	YORBA STREET	14381	401-112-36	C2	1	1274	Sidewalk	PCC	Buckled Slab	Over 2"	10		Yes			Replace Slab(s)	
10103	YORBA STREET	14432	401-101-07	C2	1	1274	Sidewalk	PCC	Buckled Slab	Over 2"	12		Yes			Replace Slab(s)	
10104	YORBA STREET	14452	401-101-06	C2	1	1274	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	8		Yes			Replace Slab	
10106	YORBA STREET	14462	401-101-05	C2	1	1274	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		Yes			Grind	
10105	YORBA STREET	14462	401-101-05	C2	1	1274	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	8		Yes			Grind	
10108	YORBA STREET	14492	401-101-03	C2	1	1273	Sidewalk	PCC	Faulting	1/4" to 1/2"		4	No			Grind	
10107	YORBA STREET	14492	401-101-03	C2	1	1273	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	5		No			Grind	
10109	YORBA STREET	14502	401-101-02	C2	1	1273	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
10122	YORBA STREET	14601	401-101-23	C2	1	1273	Sidewalk	PCC	Faulting	1/4" to 1/2"	6		Yes			Grind	
10121	YORBA STREET	14601	401-101-23	C2	1	1273	Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	12		Yes			Replace Slab(s)	
10127	YORBA STREET	14621	401-101-30	C2	1	1273	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	8		Yes			Grind	
11554	YORBA STREET	14631	401-101-31	C2	1	1273	Sidewalk	PCC	Faulting	1/2" to 1"	2.5		Yes			Ramp	
11553	YORBA STREET	14631	401-101-31	C2	1	1273	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
11555	YORBA STREET	14631	401-101-31	C2	1	1273	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	2.5		Yes			Grind	
10430	YORBA STREET	14632	401-501-01	C2	1	1273	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10429	YORBA STREET	14632	401-501-01	C2	1	1273	Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	20		Yes			Replace Slab(s)	
10432	YORBA STREET	14651	401-501-02	C2	1	1273	Sidewalk	PCC	Faulting	1/2" to 1"	2		Yes			Ramp	
10431	YORBA STREET	14651	401-501-02	C2	1	1273	Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	20		Yes			Replace Slab(s)	
11564	YORBA STREET	14661	401-101-38	C2	1	1273	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
11566	YORBA STREET	14661	401-101-38	C2	1	1273	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
11567	YORBA STREET	14661	401-101-38	C2	1	1273	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
11568	YORBA STREET	14661	401-101-38	C2	1	1273	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
11565	YORBA STREET	14661	401-101-38	C2	1	1273	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	6		Yes			Replace Slab	
11569	YORBA STREET	14661	401-101-38	C2	1	1273	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	3		Yes			Grind	
11570	YORBA STREET	14681	401-101-39	C2	1	1273	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	5		Yes			Grind	
11571	YORBA STREET	14681	401-101-39	C2	1	1273	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	2		Yes			Grind	
11574	YORBA STREET	14711	401-101-46	C2	1	1273	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
11573	YORBA STREET	14711	401-101-46	C2	1	1273	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	5		Yes			Grind	
10072	YORBA STREET	17240	401-251-06	B3	1	1275	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
10071	YORBA STREET	17240	401-251-06	B3	1	1275	Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	12		Yes			Replace Slab(s)	
11578	YORBA STREET	17291	401-301-01	C2	1	1273	Sidewalk	PCC	Faulting	1/2" to 1"	2.5		Yes			Ramp	
11575	YORBA STREET	17291	401-301-01	C2	1	1273	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
11577	YORBA STREET	17291	401-301-01	C2	1	1273	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No			Grind	
11580	YORBA STREET	17291	401-301-01	C2	1	1273	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
11581	YORBA STREET	17291	401-301-01	C2	1	1273	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
11579	YORBA STREET	17291	401-301-01	C2	1	1273	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	8		No			Replace Slab	
11576	YORBA STREET	17291	401-301-01	C2	1	1273	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	10		No			Grind	
11582	YORBA STREET	17291	401-301-01	C2	1	1273	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	10		No			Grind	
10067	YORBA STREET	17300	401-252-06	B3	1	1275	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No	Yes		Grind	
10068	YORBA STREET	17300	401-252-06	B3	1	1275	Sidewalk	PCC	Faulting	1/4" to 1/2"	7		No			Grind	
10066	YORBA STREET	17300	401-252-06	B3	1	1275	Sidewalk	PCC	Linear Cracking	1/2" to 1"	3		No			Grind	
10069	YORBA STREET	17300	401-252-06	B3	1	1275	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	10		No			Grind	
10070	YORBA STREET	17300	401-252-06	B3	1	1275	Curb/Gutter	PCC	Spalling	1" to 2"	3		No			Patch	
10096	YORBA STREET	17301	401-321-16	C2	1	1274	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No	Yes		Grind	
10131	YORBA STREET	17331	401-492-37	C2	1	1273	Sidewalk	PCC	Buckled Slab	Over 2"	12		Yes			Replace Slab(s)	
10434	YORBA STREET	17331	401-501-03	C2	1	1273	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
10192	YORBA STREET	17331	401-231-02	B2	1	1275	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10433	YORBA STREET	17331	401-501-03	C2	1	1273	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
10190				B2	1	1275	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
10191	YORBA STREET	17331	401-231-02	B2	1	1275	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
10141	YORBA STREET	17331	401-112-33	C2	1	1274	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	8		No			Grind	
10139	YORBA STREET	17332	401-113-01	C2	1	1274	Sidewalk	PCC	Faulting	1/4" to 1/2"	8		No			Grind	Prev grind
10137	YORBA STREET	17332	401-113-01	C2	1	1274	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	
10148	YORBA STREET	17332	401-232-04	B2	1	1274	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
10150	YORBA STREET	17332	401-232-04	B2	1	1274	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
10149	YORBA STREET	17332	401-232-04	B2	1	1274	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
10151	YORBA STREET	17332	401-232-04	B2	1	1274	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	14		No			Grind	
10138	YORBA STREET	17332	401-113-01	C2	1	1274	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	5		Yes			Grind	
10135	YORBA STREET	17332	401-492-01	C2	1	1273	Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	14		Yes			Replace Slab(s)	
10132	YORBA STREET	17341	401-492-36	C2	1	1273	Sidewalk	PCC	Buckled Slab	1/2" to 1"	10		Yes			Replace Slab(s)	
10134	YORBA STREET	17341	401-492-36	C2	1	1273	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	8		Yes			Grind	
10133	YORBA STREET	17341	401-492-36	C2	1	1273	Sidewalk	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
3637	YORBA STREET	17401	395-142-03	B3	1	1276	Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	3		No			Grind	
3638	YORBA STREET	17401	395-142-03	B3	1	1276	Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	3		No			Grind	
3665	YORBA STREET	17471	395-011-19	A3	1	1278	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
3664	YORBA STREET	17471	395-011-19	A3	1	1278	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
3538	YORBA STREET	17471	395-141-01	B3	1	1277	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	8		No			Grind	
3537	YORBA STREET	17471	395-141-01	B3	1	1277	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
3640	YORBA STREET	17501	395-301-36	B3	1	1276	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
3641	YORBA STREET	17501	395-301-36	B3	1	1276	Curb/Gutter	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind C&G	
3642	YORBA STREET	17501	395-301-36	B3	1	1276	Driveway	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
5241	YORBA STREET	17501	395-263-08	A3	1	1278	Sidewalk	PCC	Linear Cracking	1/2" to 1"	9		No			Grind	
3639	YORBA STREET	17501	395-301-36	B3	1	1276	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	12		Yes			Replace Slab	
3656	YORBA STREET	17521	395-162-68	B3	1	1276	Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	1		Yes			Patch	
3654	YORBA STREET	17521	395-162-68	B3	1	1276	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
3651	YORBA STREET	17522	395-162-67	B3	1	1276	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
3653	YORBA STREET	17522	395-162-67	B3	1	1276	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
3650	YORBA STREET	17522	395-162-67	B3	1	1276	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
3652	YORBA STREET	17522	395-162-67	B3	1	1276	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	6		Yes			Grind	
3649	YORBA STREET		395-301-09	B3	1	1276	Driveway	PCC	Linear Cracking	1/4" to 1/2"	6		No			Grind	Cut
3648	YORBA STREET		395-301-09	B3	1	1276	Driveway	PCC	Other - Leave Comment	1" to 2"	2	1.5"	No			Grind	Cut
10078	YORBA STREET		401-321-03	B2	1	1275	Sidewalk	PCC	Buckled Slab	Over 2"	10		Yes			Replace Slab(s)	
3647	YORBA STREET		395-301-09	B3	1	1276	Sidewalk	PCC	Corner Break	1/4" to 1/2"	2		No			Grind	
10198	YORBA STREET		401-261-01	B2	1	1275	Sidewalk	PCC	Faulting	1" to 2"	5		Yes			Replace Slab	
10195	YORBA STREET		401-261-01	B2	1	1275	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
10196	YORBA STREET		401-261-01	B2	1	1275	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
3644	YORBA STREET		395-301-09	B3	1	1276	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
10077	YORBA STREET		401-321-03	B2	1	1275	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No	Yes		Grind	
10079	YORBA STREET		401-321-03	B2	1	1275	Sidewalk	PCC	Faulting	1/4" to 1/2"		4	Yes			Grind	
3643	YORBA STREET		395-301-09	B3	1	1276	Driveway	PCC	Linear Cracking	1/4" to 1/2"	7		No			Grind	
10199	YORBA STREET		401-261-01	B2	1	1275	Curb/Gutter	PCC	Sidewalk Curb Separation	1" to 2"	4		No			Replace Curb	
3645	YORBA STREET		395-301-09	B3	1	1276	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	12		No			Grind	
3646	YORBA STREET		395-301-09	B3	1	1276	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	5		No			Grind	
10193	YORBA STREET		401-261-01	B2	1	1275	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	10		Yes			Grind	
10194	YORBA STREET		401-261-01	B2	1	1275	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	10		Yes			Grind	
10197	YORBA STREET		401-261-01	B2	1	1275	Curb/Gutter	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
10200	YORBA STREET		401-261-01	B2	1	1275	Curb/Gutter	PCC	Spalling	1/2" to 1"	2		No			Replace C&G	
3367		13351	395-582-16	A2	1	?	Sidewalk	PCC	Faulting	1" to 2"	4		Yes			Replace Slab	
3366		13351	395-582-16	A2	1	?	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
3492			395-252-47	A3	1	?	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	

Zone 2

7575	A STREET, NORTH	112	401-522-12	D3	2	1500	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No		Yes	Grind	
7574	A STREET, NORTH	112	401-522-12	D3	2	1500	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	10		Yes		Yes	Grind	
7573	A STREET, NORTH	112	401-522-12	D3	2	1500	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	15		Yes		Yes	Replace Slab	
7547	A STREET, NORTH	125	401-523-31	D3	2	1500	Curb/Gutter	PCC	Spalling	1/2" to 1"	5		No		Yes	Replace C&G	
7548	A STREET, NORTH	125	401-523-31	D3	2	1500	Curb/Gutter	PCC	Spalling	1/4" to 1/2"	5		No		Yes	Grind	
7549	A STREET, NORTH	145	401-523-07	C3	2	1500	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
7572	A STREET, NORTH	150	401-522-17	C3	2	1500	Curb/Gutter	PCC	Sidewalk Curb Separation	1" to 2"	4		Yes			Replace Curb	
7550	A STREET, NORTH	153	401-523-06	C3	2	1500	Sidewalk	PCC	Linear Cracking	No Displacement	4		Yes			Joint Seal	
7551	A STREET, NORTH	155	401-523-05	C3	2	1500	Sidewalk	PCC	Spalling	1/2" to 1"	1		Yes			Replace C&G	
7553	A STREET, NORTH	165	401-523-03	C3	2	1500	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
7552				C3	2	1500	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
7554	A STREET, NORTH	165	401-523-03	C3	2	1500	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
7555	A STREET, NORTH	173	401-523-02	C3	2	1500	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
7568	A STREET, NORTH	17400	401-513-01	C3	2	1500	Driveway	PCC	Corner Break	1/4" to 1/2"	2.5		No			Grind	
7565	A STREET, NORTH	17400	401-513-01	C3	2	1500	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No			Grind	
7569	A STREET, NORTH	17400	401-513-01	C3	2	1500	Driveway	PCC	Linear Cracking	1/4" to 1/2"	5		No			Grind	
7567	A STREET, NORTH	17400	401-513-01	C3	2	1500	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
7566	A STREET, NORTH	17400	401-513-01	C3	2	1500	Curb/Gutter	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
7561	A STREET, NORTH	17452	401-514-01	C3	2	1500	Sidewalk	PCC	Divided Slab	1/4" to 1/2"	6		No			Replace Slab(s)	
7557	A STREET, NORTH	17452	401-514-01	C3	2	1500	Driveway	PCC	Linear Cracking	1/4" to 1/2"	5		No			Grind	
7558	A STREET, NORTH	17452	401-514-01	C3	2	1500	Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	2		No			Grind	
7562	A STREET, NORTH	17452	401-514-01	C3	2	1500	Curb/Gutter	PCC	Spalling	1/2" to 1"	4		No			Replace C&G	
7559	A STREET, NORTH	17452	401-514-01	C3	2	1500	Sidewalk	PCC	Spalling	1/2" to 1"	0.5		No			Replace C&G	
7560	A STREET, NORTH	17452	401-514-01	C3	2	1500	Sidewalk	PCC	Spalling	1/2" to 1"	2		No			Replace C&G	
7556	A STREET, NORTH	175	401-523-01	C3	2	1500	Sidewalk	PCC	Buckled Slab	Over 2"	5		Yes			Replace Slab	
7571	A STREET, NORTH	178	401-522-22	C3	2	1500	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	3		No			Grind	
7570	A STREET, NORTH	178	401-522-22	C3	2	1500	Driveway	PCC	Sidewalk Curb Separation	1/4" to 1/2"	14		No			Grind	
10968	A STREET, SOUTH	170	401-361-06	D3	2	30	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
11593	A STREET, SOUTH	330	401-561-18	D3	2	30	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No		Yes	Grind	
10928	A STREET, SOUTH	344	401-563-06	D3	2	1501	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
10929	A STREET, SOUTH	344	401-563-06	D3	2	1501	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
10931	A STREET, SOUTH	350	401-562-12	D3	2	20	Sidewalk	PCC	Spalling	1/2" to 1"	0.5		No			Replace C&G	
10927	A STREET, SOUTH	405	401-363-03	D3	2	1501	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
10488	ALLIANCE AVENUE	15601	402-291-08	E2	2	1509	Sidewalk	PCC	Buckled Slab	1/4" to 1/2"	4		Yes			Replace Slab	
10489	ALLIANCE AVENUE	15601	402-291-08	E2	2	1509	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10490	ALLIANCE AVENUE	15601	402-291-08	E2	2	1509	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
10530	ALLIANCE AVENUE	16502	402-292-01	E2	2	1509	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
10494	ALLIANCE AVENUE	16531	402-291-03	E2	2	1509	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	
10493	ALLIANCE AVENUE	16531	402-291-03	E2	2	1509	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	3		Yes			Grind	
10492	ALLIANCE AVENUE	16561	402-291-04	E2	2	1509	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
10531	ALLIANCE AVENUE	16562	402-292-06	E2	2	1509	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10491	ALLIANCE AVENUE	16571	402-291-05	E2	2	1509	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
10532	ALLIANCE AVENUE	16592	402-292-08	E2	2	1509	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	2		Yes			Grind	
10533	ALLIANCE AVENUE	16602	402-292-09	E2	2	1509	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
10481	ALLIANCE AVENUE	16622	402-292-10	E2	2	1509	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
8771	ALTADENA DRIVE	15981	402-133-06	E2	2	1512	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
8773	ALTADENA DRIVE	15981	402-133-06	E2	2	1512	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
8772	ALTADENA DRIVE	15981	402-133-06	E2	2	1512	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
8795	ALTADENA DRIVE	15981	402-133-06	E2	2	1512	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	6		No			Grind	
8763	ALTADENA DRIVE	15991	402-133-03	E2	2	1512	Sidewalk	PCC	Divided Slab	1/2" to 1"	10		No			Replace Slab(s)	
8762	ALTADENA DRIVE	15991	402-133-03	E2	2	1512	Driveway	PCC	Linear Cracking	1/4" to 1/2"	6		No			Grind	
8758	ALTADENA DRIVE	15992	402-133-02	E2	2	1512	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
8759	ALTADENA DRIVE	15992	402-133-02	E2	2	1512	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
8761	ALTADENA DRIVE	15992	402-133-02	E2	2	1512	Driveway	PCC	Linear Cracking	1/4" to 1/2"	6		No			Grind	
8760	ALTADENA DRIVE	15992	402-133-02	E2	2	1512	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
8757	ALTADENA DRIVE	15992	402-133-02	E2	2	1512	Cross Gutter	PCC	Spalling	1/2" to 1"	2		No			Patch	
8705	ALTADENA DRIVE	16001	402-131-04	E2	2	1511	Curb/Gutter	PCC	Linear Cracking	1/2" to 1"	5		No			Grind	
8703	ALTADENA DRIVE	16001	402-131-04	E2	2	1511	Driveway	PCC	Linear Cracking	1/2" to 1"	8		No			Grind	
8704	ALTADENA DRIVE	16001	402-131-04	E2	2	1511	Driveway	PCC	Linear Cracking	1/2" to 1"	8		No			Grind	
8700	ALTADENA DRIVE	17021	402-131-02	E2	2	1511	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight displacement
8699	ALTADENA DRIVE	17021	402-131-02	E2	2	1511	Driveway	PCC	Divided Slab	1/2" to 1"	12		No			Replace Slab(s)	
8701	ALTADENA DRIVE	17021	402-131-02	E2	2	1511	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
8696	ALTADENA DRIVE	17061	402-131-01	E2	2	1511	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
8694	ALTADENA DRIVE	17061	402-131-01	E2	2	1511	Sidewalk	PCC	Divided Slab	No Displacement	10		No			Replace Slab(s)	
8697	ALTADENA DRIVE	17061	402-131-01	E2	2	1511	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
8695	ALTADENA DRIVE	17061	402-131-01	E2	2	1511	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
8698	ALTADENA DRIVE	17061	402-131-01	E2	2	1511	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
8702	ALTADENA DRIVE	17062	402-131-03	E2	2	1511	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
8794	ALTADENA DRIVE	17111	402-132-01	E2	2	1512	Cross Gutter	PCC	Divided Slab	1/2" to 1"	15		No			Replace Slab(s)	
8710	ALTADENA DRIVE	17111	402-132-01	E2	2	1512	Sidewalk	PCC	Divided Slab	No Displacement			No			Replace Slab	
8709	ALTADENA DRIVE	17111	402-132-01	E2	2	1512	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
8707	ALTADENA DRIVE	17111	402-132-01	E2	2	1512	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
8708	ALTADENA DRIVE	17111	402-132-01	E2	2	1512	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
10960	B STREET	120	401-561-03	D3	2	1540	Sidewalk	PCC	Faulting	1/2" to 1"	2		Yes		Yes	Ramp	
10962				D3	2	1540	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes		Yes	Grind	Prev grind

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
11140	B STREET	130	401-523-19	D3	2	1541	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
11141	B STREET	130	401-523-19	D3	2	1541	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
10961	B STREET	130	401-561-04	D3	2	1540	Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	7		Yes		Yes	Replace Slab(s)	
8644	B STREET	14061	402-371-37	E3	2	1536	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No			Grind	Prev grind
11139	B STREET	150	401-523-23	C3	2	1541	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
11142	B STREET	153	401-531-07	C3	2	1541	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
11143	B STREET	155	401-531-06	C3	2	1541	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
8614	B STREET	15561	402-333-06	E3	2	1535	Sidewalk	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
8641	B STREET	15662	402-331-22	E3	2	1535	Sidewalk	PCC	Corner Break	1/4" to 1/2"	3		No			Grind	
8639	B STREET	15662	402-331-22	E3	2	1535	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
8640	B STREET	15662	402-331-22	E3	2	1535	Curb/Gutter	PCC	Linear Cracking	1/4" to 1/2"	10		No			Grind	
8638	B STREET	15682	402-331-21	E3	2	1535	Driveway	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
8637	B STREET	15712	402-331-19	E3	2	1535	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
8616	B STREET	15715	402-333-03	E3	2	1535	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
8615	B STREET	15715	402-333-03	E3	2	1535	Curb/Gutter	PCC	Linear Cracking	1/2" to 1"	1		No			Grind	
8617	B STREET	15721	402-333-02	E3	2	1535	Sidewalk	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
8635	B STREET	15722	402-331-18	E3	2	1535	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
8636	B STREET	15722	402-331-18	E3	2	1535	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
11138	B STREET	158	401-523-24	C3	2	1541	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
11136	B STREET	168	401-523-26	C3	2	1541	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
11137	B STREET	168	401-523-26	C3	2	1541	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
10963	B STREET	170	401-561-07	D3	2	1540	Driveway	PCC	Spalling	1/2" to 1"	0.5		No			Replace C&G	
8619	B STREET	17271	402-333-01	E3	2	1535	Sidewalk	PCC	Other - Leave Comment	1/4" to 1/2"	5		No			Patch	Scaling
8620	B STREET	17271	402-333-01	E3	2	1535	Driveway	PCC	Linear Cracking	1/4" to 1/2"	10		No			Grind	
8618	B STREET	17271	402-333-01	E3	2	1535	Curb/Gutter	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
8621	B STREET	17282	402-381-12	E3	2	1535	Cross Gutter	PCC	Linear Cracking	1/4" to 1/2"	7		No			Grind	
8627	B STREET	17311	402-331-17	E3	2	1535	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
8626	B STREET	17311	402-331-17	E3	2	1535	Sidewalk	PCC	Divided Slab	No Displacement	13		No			Replace Slab(s)	
8628	B STREET	17311	402-331-17	E3	2	1535	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		Yes			Grind	
8625	B STREET	17311	402-331-17	E3	2	1535	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	12		No			Grind	
8629	B STREET	17311	402-331-17	E3	2	1535	Sidewalk	PCC	Spalling	1/2" to 1"	1		Yes			Replace C&G	
8630	B STREET	17311	402-331-17	E3	2	1535	Sidewalk	PCC	Spalling	1/2" to 1"	1		Yes			Replace C&G	
8631	B STREET	17311	402-331-17	E3	2	1535	Sidewalk	PCC	Spalling	1/2" to 1"	1		Yes			Replace C&G	
11144	B STREET	17592	401-042-05	C3	2	1541	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
11135	B STREET	178	401-523-28	C3	2	1541	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
10950	B STREET	200	401-574-04	D3	2	1540	Driveway	PCC	Divided Slab	1/2" to 1"	15		No		Yes	Replace Slab(s)	
10951	B STREET	200	401-574-04	D3	2	1540	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes		Yes	Grind	
10932	B STREET	220	401-562-03	D3	2	1540	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
10933	B STREET	220	401-562-03	D3	2	1540	Curb/Gutter	PCC	Spalling	1" to 2"	0.5		No			Patch	
10945	B STREET	225	401-574-03	D3	2	1539	Driveway	PCC	Divided Slab	No Displacement	15		No		Yes	Replace Slab(s)	
10943	B STREET	225	401-574-03	D3	2	1539	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes		Yes	Grind	
10944	B STREET	225	401-574-03	D3	2	1539	Sidewalk	PCC	Faulting	1/4" to 1/2"	6		No		Yes	Grind	
10941	B STREET	225	401-574-03	D3	2	1539	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	3		Yes		Yes	Grind	
10942	B STREET	225	401-574-03	D3	2	1539	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	3		Yes		Yes	Grind	
10954	B STREET	230	401-574-01	D3	2	1540	Sidewalk	AC	Patch / Utility Cut	Over 2"	8		No		Yes	Remove & Replace	Ac patch
10953	B STREET	230	401-574-01	D3	2	1540	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes		Yes	Grind	
10934	B STREET	230	401-562-05	D3	2	1540	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	6		Yes			Grind	
10952	B STREET	230	401-574-01	D3	2	1540	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	25		No		Yes	Grind	
6449	B STREET	242	401-622-24	D3	2	1538	Sidewalk	Brick	Buckled Slab	Over 2"	8		Yes			Remove & Replace	Bricks lifted a lot
6448	B STREET	242	401-622-24	D3	2	1538	Sidewalk	PCC	Linear Cracking	No Displacement	4		Yes			Joint Seal	Slight displacement
6447	B STREET	242	401-622-24	D3	2	1538	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
6450	B STREET	250	401-622-22	D3	2	1538	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes	Yes		Grind	
10936	B STREET	300	401-563-01	D3	2	1539	Sidewalk	PCC	Divided Slab	1/4" to 1/2"	10		No			Replace Slab	
10937	B STREET	300	401-563-01	D3	2	1539	Sidewalk	PCC	Divided Slab	1/4" to 1/2"	10		No			Replace Slab	
10948	B STREET	300	401-574-05	D3	2	1539	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No		Yes	Grind	
10947	B STREET	300	401-574-05	D3	2	1540	Curb/Gutter	PCC	Linear Cracking	1/4" to 1/2"	2		No		Yes	Grind	
10946	B STREET	300	401-574-05	D3	2	1539	Driveway	PCC	Linear Cracking	1/4" to 1/2"	9		No		Yes	Grind	
10949	B STREET	300	401-574-05	D3	2	1540	Sidewalk	PCC	Punchout	1/4" to 1/2"	2		No		Yes	Replace Slab	
10935	B STREET	300	401-563-01	D3	2	1539	Sidewalk	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
10959	B STREET	310	401-561-20	D3	2	1540	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes		Yes	Ramp	Prev grind
10956	B STREET	310	401-561-21	D3	2	1540	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes		Yes	Grind	Prev grind
10958	B STREET	310	401-561-20	D3	2	1540	Driveway	PCC	Faulting	1/2" to 1"	4		No		Yes	Grind Driveway	
10957	B STREET	310	401-561-20	D3	2	1540	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	8		Yes		Yes	Replace Slab	
10939				D3	2	1539	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
10940	B STREET	350	401-563-04	D3	2	1539	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
10938	B STREET	350	401-563-04	D3	2	1539	Sidewalk	PCC	Divided Slab	1/4" to 1/2"	10		Yes			Replace Slab	
6446	B STREET	515	401-622-28	D3	2	1538	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
6444	B STREET	525	401-622-29	D3	2	1538	Sidewalk	PCC	Faulting	1" to 2"	6		Yes			Replace Slab	
6445	B STREET	525	401-622-29	D3	2	1538	Driveway	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
6441	B STREET	535	401-622-30	D3	2	1538	Sidewalk	PCC	Divided Slab	1/4" to 1/2"	7		Yes			Replace Slab	Low
6442	B STREET	535	401-622-30	D3	2	1538	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
6443	B STREET	535	401-622-30	D3	2	1538	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
6417	B STREET	621	401-631-08	D3	2	1537	Driveway	PCC	Divided Slab	1/2" to 1"	15		No		Yes	Replace Slab(s)	Med
6420	B STREET	621	401-631-08	D3	2	1537	Sidewalk	PCC	Corner Break	1/2" to 1"	2		No			Ramp	
6418	B STREET	621	401-631-08	D3	2	1537	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
6419	B STREET	621	401-631-08	D3	2	1537	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
6416	B STREET	653	401-631-06	D3	2	1537	Driveway	PCC	Corner Break	1/2" to 1"	2		No		Yes	Ramp	
6415	B STREET	653	401-631-06	D3	2	1537	Curb/Gutter	PCC	Linear Cracking	1" to 2"	5		No		Yes	Grind	
6414	B STREET	655	401-631-05	D3	2	1537	Driveway	PCC	Divided Slab	1" to 2"	15		Yes		Yes	Replace Slab(s)	High
6413	B STREET	655	401-631-05	D3	2	1537	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes		Yes	Grind	
6412	B STREET	655	401-631-05	D3	2	1537	Driveway	PCC	Spalling	1/2" to 1"	2		No		Yes	Replace C&G	
8633	B STREET		402-332-13	E3	2	1535	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
8643	B STREET		402-371-27	E3	2	1536	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
8632	B STREET		402-332-13	E3	2	1535	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
8622	B STREET		402-381-12	E3	2	1535	Cross Gutter	PCC	Linear Cracking	1/4" to 1/2"	7		No			Grind	
8642	B STREET		402-371-27	E3	2	1536	Driveway	PCC	Linear Cracking	1/2" to 1"	3		No			Grind	
8634	B STREET		402-332-13	E3	2	1535	Driveway	PCC	Linear Cracking	1/4" to 1/2"	10		No			Grind	
8646	B STREET		402-341-07	E3	2	1536	Driveway	PCC	Linear Cracking	1/4" to 1/2"	10		No			Grind	
8647	B STREET		402-341-07	E3	2	1536	Driveway	PCC	Linear Cracking	1/4" to 1/2"	10		No			Grind	
8645	B STREET		402-341-07	E3	2	1536	Sidewalk	PCC	Spalling	1/4" to 1/2"	2		No			Grind	
8770	BLISS LANE	15981	402-133-06	E2	2	1554	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
8768	BLISS LANE	15981	402-133-06	E2	2	1554	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
8769	BLISS LANE	15981	402-133-06	E2	2	1554	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
8766	BLISS LANE	15981	402-133-06	E2	2	1554	Driveway	PCC	Linear Cracking	1/2" to 1"	8		No			Grind	
8767	BLISS LANE	15981	402-133-06	E2	2	1554	Driveway	PCC	Linear Cracking	1/4" to 1/2"	8		No			Grind	
8764	BLISS LANE	16001	402-133-04	E2	2	1554	Driveway	PCC	Faulting	1/4" to 1/2"	3		No			Grind Driveway	
8765	BLISS LANE	16021	402-133-05	E2	2	1554	Driveway	PCC	Spalling	1/4" to 1/2"	3		No			Grind	
8829	BOLEYN CIRCLE	15551	402-362-10	D2	2	1555	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
8830	BOLEYN CIRCLE	15561	402-362-11	D2	2	1555	Sidewalk	PCC	Other - Leave Comment	1/2" to 1"			No			Grind	Ground section
8828	BOLEYN CIRCLE	15562	402-362-08	D2	2	1555	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	Prev grind
8831	BOLEYN CIRCLE	15581	402-362-12	E2	2	1555	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
8827	BOLEYN CIRCLE	15582	402-362-07	E2	2	1555	Sidewalk	PCC	Divided Slab	1/4" to 1/2"	15		No			Replace Slab	
7606	C STREET, NORTH	135	401-532-10	C3	2	1576	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
7607	C STREET, NORTH	153	401-532-07	C3	2	1576	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
7616	C STREET, NORTH	158	401-531-21	C3	2	1576	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
7608	C STREET, NORTH	163	401-532-05	C3	2	1576	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
7609	C STREET, NORTH	163	401-532-05	C3	2	1576	Sidewalk	PCC	Punchout	1" to 2"	3		Yes			Replace Slab	
7610	C STREET, NORTH	173	401-532-03	C3	2	1576	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	3		No			Grind	
7614	C STREET, NORTH	178	401-531-25	C3	2	1576	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
7615	C STREET, NORTH	178	401-531-25	C3	2	1576	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
7611	C STREET, NORTH	180	401-531-26	C3	2	1576	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
7612	C STREET, NORTH	180	401-531-26	C3	2	1576	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
7613	C STREET, NORTH	180	401-531-26	C3	2	1576	Driveway	PCC	Corner Break	1/2" to 1"	3		No			Ramp	
7528	C STREET, NORTH	205	401-531-14	D3	2	1576	Curb/Gutter	PCC	Faulting	1/4" to 1/2"	1		Yes		Yes	Grind C&G	
7529	C STREET, NORTH	205	401-531-14	D3	2	1576	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes		Yes	Grind	
7530	C STREET, NORTH	205	401-531-14	D3	2	1576	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	6		Yes		Yes	Grind	
7531	C STREET, NORTH	205	401-531-14	D3	2	1576	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	6		No		Yes	Grind	
7330	C STREET, SOUTH	125	401-571-14	D3	2	1581	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No		Yes	Grind	
7328	C STREET, SOUTH	125	401-571-14	D3	2	1581	Driveway	PCC	Linear Cracking	1/4" to 1/2"	9		No		Yes	Grind	
8608	C STREET, SOUTH	14086	402-371-10	E3	2	1577	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
8609	C STREET, SOUTH	14086	402-371-10	E3	2	1577	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
7364	C STREET, SOUTH	145	401-573-07	D3	2	1580	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No		Yes	Grind	
7326	C STREET, SOUTH	150	401-571-15	D3	2	1581	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No		Yes	Grind	Prev grind
6343	C STREET, SOUTH	150	401-622-01	D3	2	1579	Curb/Gutter	PCC	Linear Cracking	1" to 2"	5		No		Yes	Grind	
6346	C STREET, SOUTH	150	401-622-01	D3	2	1579	Curb/Gutter	PCC	Sidewalk Curb Separation	1" to 2"	6		No		Yes	Replace Curb	
7323	C STREET, SOUTH	150	401-571-15	D3	2	1581	Curb/Gutter	PCC	Spalling	1" to 2"	1		No		Yes	Patch	
6345	C STREET, SOUTH	150	401-622-01	D3	2	1579	Curb/Gutter	PCC	Spalling	1/2" to 1"	1		No		Yes	Replace C&G	
6344				D3	2	1579	Driveway	PCC	Spalling	1/2" to 1"	4		No		Yes	Replace C&G	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
7309	C STREET, SOUTH	155	401-572-05	D3	2	1580	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No		Yes	Grind	Prev grind
7310	C STREET, SOUTH	155	401-572-05	D3	2	1580	Sidewalk	PCC	Spalling	1/4" to 1/2"	2		No		Yes	Grind	
7320	C STREET, SOUTH	175	401-571-11	D3	2	1581	Driveway	PCC	Divided Slab	1/4" to 1/2"	12		No		Yes	Replace Slab	
7318	C STREET, SOUTH	175	401-571-11	D3	2	1581	Driveway	PCC	Sidewalk Curb Separation	1/2" to 1"	3		Yes		Yes	Patch	
7322	C STREET, SOUTH	175	401-571-11	D3	2	1581	Curb/Gutter	PCC	Spalling	1" to 2"	2		No		Yes	Patch	
7317	C STREET, SOUTH	195	401-571-16	D3	2	1581	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes		Yes	Grind	
6338	C STREET, SOUTH	210	401-622-20	D3	2	1579	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
6339	C STREET, SOUTH	210	401-622-20	D3	2	1579	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
6340	C STREET, SOUTH	210	401-622-20	D3	2	1579	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
6341	C STREET, SOUTH	210	401-622-20	D3	2	1579	Sidewalk	PCC	Spalling	1/4" to 1/2"	3		No			Grind	
7356	C STREET, SOUTH	225	401-574-03	D3	2	1580	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes		Yes	Grind	
7358	C STREET, SOUTH	225	401-574-03	D3	2	1580	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes		Yes	Grind	
7361	C STREET, SOUTH	225	401-574-03	D3	2	1580	Sidewalk	PCC	Spalling	1/4" to 1/2"	2		No		Yes	Grind	
7339	C STREET, SOUTH	230	401-574-01	D3	2	1581	Curb/Gutter	PCC	Spalling	Over 2"	9		No		Yes	Replace C&G	Curb removed
7341	C STREET, SOUTH	230	401-574-01	D3	2	1581	Curb/Gutter	PCC	Spalling	Over 2"	2		No		Yes	Replace C&G	Curb removed
7334	C STREET, SOUTH	230	401-574-01	D3	2	1581	Curb/Gutter	PCC	Spalling	1/2" to 1"	30		No		Yes	Replace C&G	
7336	C STREET, SOUTH	230	401-574-01	D3	2	1581	Curb/Gutter	PCC	Spalling	1/2" to 1"	30		No		Yes	Replace C&G	
7344	C STREET, SOUTH	230	401-574-01	D3	2	1581	Driveway	PCC	Spalling	1/4" to 1/2"	2		No		Yes	Grind	
7311	C STREET, SOUTH	245	401-572-04	D3	2	1580	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No		Yes	Grind	
7314	C STREET, SOUTH	245	401-572-04	D3	2	1580	Driveway	PCC	Linear Cracking	1/4" to 1/2"	10		No		Yes	Grind	
7354	C STREET, SOUTH	300	401-574-05	D3	2	1580	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No		Yes	Grind	Prev grind
7349	C STREET, SOUTH	300	401-574-05	D3	2	1580	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	10		No		Yes	Grind	
7350	C STREET, SOUTH	300	401-574-05	D3	2	1580	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	10		No		Yes	Grind	
7351	C STREET, SOUTH	300	401-574-05	D3	2	1580	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	10		No		Yes	Grind	
7352	C STREET, SOUTH	300	401-574-05	D3	2	1580	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	5		No		Yes	Grind	
7347	C STREET, SOUTH	300	401-574-05	D3	2	1580	Sidewalk	PCC	Spalling	1/4" to 1/2"	2		No		Yes	Grind	
7366	C STREET, SOUTH	315	401-573-10	D3	2	1580	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes		Yes	Grind	Prev grind
7368	C STREET, SOUTH	315	401-573-10	D3	2	1580	Curb/Gutter	PCC	Spalling	1/2" to 1"	6		No		Yes	Replace C&G	
6436	C STREET, SOUTH	500	401-622-36	D3	2	1578	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
6432	C STREET, SOUTH	520	401-622-14	D3	2	1578	Driveway	PCC	Divided Slab	1/2" to 1"	20		No		Yes	Replace Slab(s)	
6425	C STREET, SOUTH	520	401-622-14	D3	2	1578	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No		Yes	Grind	
6428	C STREET, SOUTH	520	401-622-14	D3	2	1578	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes		Yes	Grind	
6430	C STREET, SOUTH	520	401-622-14	D3	2	1578	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		Yes		Yes	Grind	
6427	C STREET, SOUTH	520	401-622-14	D3	2	1578	Driveway	PCC	Linear Cracking	1/4" to 1/2"	10		No		Yes	Grind	
6434	C STREET, SOUTH	520	401-622-14	D3	2	1578	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No		Yes	Grind	
6433	C STREET, SOUTH	520	401-622-14	D3	2	1578	Sidewalk	PCC	Patch / Utility Cut	1/2" to 1"	5		No		Yes	Grind	
6429	C STREET, SOUTH	520	401-622-14	D3	2	1578	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	7		Yes		Yes	Replace Slab	
6431	C STREET, SOUTH	520	401-622-14	D3	2	1578	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	12		Yes		Yes	Grind	
6426	C STREET, SOUTH	520	401-622-14	D3	2	1578	Sidewalk	PCC	Spalling	1/2" to 1"	2		No		Yes	Replace C&G	
6439	C STREET, SOUTH	570	401-622-33	D3	2	1578	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
6437	C STREET, SOUTH	570	401-622-33	D3	2	1578	Sidewalk	PCC	Buckled Slab	1/2" to 1"	10		Yes			Replace Slab(s)	Slab lifted, prev grind
6438	C STREET, SOUTH	570	401-622-33	D3	2	1578	Sidewalk	PCC	Buckled Slab	1/4" to 1/2"	10		Yes			Replace Slab(s)	Slab lifted, prev grind
6435	C STREET, SOUTH		401-622-19	D3	2	1578	Driveway	PCC	Divided Slab	1" to 2"	15		No		Yes	Replace Slab(s)	High
6342	C STREET, SOUTH		401-622-19	D3	2	1579	Driveway	PCC	Linear Cracking	1/4" to 1/2"	4		No		Yes	Grind	
8570	CALIFORNIA STREET	15621	402-382-01	E3	2	1583	Ramp	PCC	Divided Slab	No Displacement			No			Replace Slab	
8510	CALIFORNIA STREET	15632	402-381-02	E3	2	1583	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
8505	CALIFORNIA STREET	15642	402-381-03	E3	2	1583	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
8506	CALIFORNIA STREET	15642	402-381-03	E3	2	1583	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
8507	CALIFORNIA STREET	15642	402-381-03	E3	2	1583	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
8508	CALIFORNIA STREET	15642	402-381-03	E3	2	1583	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
8569	CALIFORNIA STREET	15661	402-382-04	E3	2	1583	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
8568	CALIFORNIA STREET	15681	402-382-06	E3	2	1583	Sidewalk	PCC	Buckled Slab	1/4" to 1/2"	10		Yes			Replace Slab(s)	Slight tent
8567	CALIFORNIA STREET	15681	402-382-06	E3	2	1583	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
8500	CALIFORNIA STREET	15702	402-381-07	E3	2	1583	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
8502	CALIFORNIA STREET	15702	402-381-07	E3	2	1583	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
8566	CALIFORNIA STREET	15721	402-382-08	E3	2	1583	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
8498	CALIFORNIA STREET	15742	402-381-09	E3	2	1583	Curb/Gutter	PCC	Sidewalk Curb Separation	Over 2"	5		No			Replace C&G	
8496	CALIFORNIA STREET	15752	402-381-10	E3	2	1583	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	Prev grind
8495	CALIFORNIA STREET	15752	402-381-10	E3	2	1583	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
8493	CALIFORNIA STREET	15762	402-381-11	E3	2	1583	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
8491	CALIFORNIA STREET	17282	402-381-12	E3	2	1583	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
8492	CALIFORNIA STREET	17282	402-381-12	E3	2	1583	Driveway	PCC	Linear Cracking	1/4" to 1/2"	8		No			Grind	
6376	CALIFORNIA STREET	330	401-364-01	D3	2	1584	Curb/Gutter	PCC	Spalling	1" to 2"	2		No			Patch	
10926				}	D3	2	1584	Sidewalk	PCC	Other - Leave Comment	No Displacement			No		N/A	No distress

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
8826	CARLANN CIRCLE	15582	402-362-07	E2	2	1592	Sidewalk	PCC	Spalling	1/2" to 1"	0.5		No			Replace C&G	
8832	CARLANN CIRCLE	15591	402-362-13	E2	2	1592	Driveway	PCC	Divided Slab	1/2" to 1"	12		No			Replace Slab(s)	
8833	CARLANN CIRCLE	17042	402-362-14	E2	2	1592	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
8834	CARLANN CIRCLE	17042	402-362-14	E2	2	1592	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
8835	CARLANN CIRCLE	17052	402-362-15	E2	2	1592	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
8836	CARLANN CIRCLE	17062	402-362-16	E2	2	1592	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
8837	CARLANN CIRCLE	17072	402-362-17	E2	2	1592	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
8838	CARLANN CIRCLE	17082	402-362-18	E2	2	1592	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
6287	CENTENNIAL WAY	140	401-591-08	D3	2	1601	Cross Gutter	PCC	Divided Slab	1/4" to 1/2"			No		Yes	Replace Slab(s)	Med/high
6288	CENTENNIAL WAY	140	401-591-08	D3	2	1601	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No		Yes	Grind	
6289	CENTENNIAL WAY	160	401-591-09	D3	2	1601	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	7		No		Yes	Grind	
6258	CENTENNIAL WAY	275	401-601-09	D3	2	1601	Sidewalk	PCC	Faulting	1/2" to 1"	6		Yes		Yes	Ramp	Prev grind
6255	CENTENNIAL WAY	275	401-601-09	D3	2	1601	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	6		Yes		Yes	Replace Slab	
6257	CENTENNIAL WAY	275	401-601-09	D3	2	1601	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	6		Yes		Yes	Replace Slab	
6256	CENTENNIAL WAY	275	401-601-09	D3	2	1601	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	8		Yes		Yes	Grind	
6259	CENTENNIAL WAY	275	401-601-09	D3	2	1601	Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	12		Yes		Yes	Replace Slab(s)	
6290	CENTENNIAL WAY	300	401-592-16	D3	2	1601	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes		Yes	Grind	
6291	CENTENNIAL WAY	300	401-592-16	D3	2	1601	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes		Yes	Grind	
6254	CENTENNIAL WAY	315	401-612-01	D3	2	1601	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	6		Yes		Yes	Replace Slab	
6253	CENTENNIAL WAY	315	401-612-01	D3	2	1601	Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	6		Yes		Yes	Replace Slab(s)	
6283	CENTENNIAL WAY	450	401-591-01	D3	2	1601	Sidewalk	PCC	Faulting	1/2" to 1"	5		Yes		Yes	Ramp	
6286	CENTENNIAL WAY	450	401-591-01	D3	2	1601	Sidewalk	PCC	Faulting	1/4" to 1/2"	6		Yes		Yes	Grind	
6285	CENTENNIAL WAY	450	401-591-01	D3	2	1601	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	10		Yes		Yes	Grind	
6284	CENTENNIAL WAY	450	401-591-01	D3	2	1601	Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	20		Yes		Yes	Replace Slab(s)	
6252	CENTENNIAL WAY	535	401-612-04	D3	2	1601	Driveway	PCC	Faulting	1/4" to 1/2"	5		No		Yes	Grind Driveway	
6264	CENTENNIAL WAY	540	401-601-01	D3	2	1601	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes		Yes	Ramp	Prev grind
6279	CENTENNIAL WAY	540	401-601-01	D3	2	1601	Sidewalk	PCC	Faulting	1/2" to 1"	5		Yes		Yes	Ramp	Prev grind
6260	CENTENNIAL WAY	540	401-601-01	D3	2	1601	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	5		Yes		Yes	Grind	Prev grind
6265	CENTENNIAL WAY	540	401-601-01	D3	2	1601	Sidewalk	PCC	Faulting	1/2" to 1"	7		Yes		Yes	Ramp	
6266	CENTENNIAL WAY	540	401-601-01	D3	2	1601	Sidewalk	PCC	Faulting	1/2" to 1"	5		Yes		Yes	Ramp	
6268	CENTENNIAL WAY	540	401-601-01	D3	2	1601	Sidewalk	PCC	Faulting	1/2" to 1"	5		Yes		Yes	Ramp	
6281	CENTENNIAL WAY	540	401-601-01	D3	2	1601	Sidewalk	PCC	Faulting	1/2" to 1"	4		No	Yes	Yes	Ramp	
6261	CENTENNIAL WAY	540	401-601-01	D3	2	1601	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		Yes		Yes	Grind	
6263	CENTENNIAL WAY	540	401-601-01	D3	2	1601	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes		Yes	Grind	
6269	CENTENNIAL WAY	540	401-601-01	D3	2	1601	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes		Yes	Grind	
6271	CENTENNIAL WAY	540	401-601-01	D3	2	1601	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No		Yes	Grind	
6274	CENTENNIAL WAY	540	401-601-01	D3	2	1601	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No		Yes	Grind	
6275	CENTENNIAL WAY	540	401-601-01	D3	2	1601	Sidewalk	PCC	Faulting	1/4" to 1/2"	10		Yes		Yes	Grind	
6276	CENTENNIAL WAY	540	401-601-01	D3	2	1601	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		Yes		Yes	Grind	
6282	CENTENNIAL WAY	540	401-601-01	D3	2	1601	Curb/Gutter	PCC	Linear Cracking	1/2" to 1"	4		No		Yes	Grind	
6272	CENTENNIAL WAY	540	401-601-01	D3	2	1601	Driveway	PCC	Linear Cracking	1/4" to 1/2"	4		No		Yes	Grind	
6273	CENTENNIAL WAY	540	401-601-01	D3	2	1601	Driveway	PCC	Linear Cracking	1/4" to 1/2"	4		No		Yes	Grind	
6278	CENTENNIAL WAY	540	401-601-01	D3	2	1601	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	5		Yes		Yes	Grind	
6262	CENTENNIAL WAY	540	401-601-01	D3	2	1601	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	7		Yes		Yes	Grind	
6267	CENTENNIAL WAY	540	401-601-01	D3	2	1601	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	5		Yes		Yes	Grind	
6270	CENTENNIAL WAY	540	401-601-01	D3	2	1601	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	5		Yes		Yes	Grind	
6277	CENTENNIAL WAY	540	401-601-01	D3	2	1601	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	6		Yes		Yes	Grind	
6280	CENTENNIAL WAY	540	401-601-01	D3	2	1601	Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	5		Yes		Yes	Replace Slab(s)	
8587	CORLA AVENUE	15621	402-383-01	E2	2	1625	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight displacement
8588	CORLA AVENUE	15621	402-383-01	E2	2	1625	Sidewalk	PCC	Faulting	1/2" to 1"	3		No			Ramp	
8571	CORLA AVENUE	15621	402-382-01	E2	2	1625	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
8513	CORLA AVENUE	15622	402-381-01	E3	2	1625	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
8527	CORLA AVENUE	17191	402-385-09	E2	2	1625	Ramp	PCC	Divided Slab	No Displacement	16		No			Replace Slab(s)	
8531	CORLA AVENUE	17191	402-385-09	E2	2	1625	Cross Gutter	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
8525	CORLA AVENUE	17231	402-385-06	E2	2	1625	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
8523	CORLA AVENUE	17251	402-385-04	E2	2	1625	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
8519	CORLA AVENUE	17271	402-385-03	E3	2	1625	Sidewalk	PCC	Divided Slab	No Displacement	6		No			Replace Slab(s)	
8521	CORLA AVENUE	17271	402-385-03	E3	2	1625	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
8515	CORLA AVENUE	17291	402-385-01	E3	2	1625	Curb/Gutter	PCC	Spalling	1" to 2"	1		No			Patch	
11172	D STREET	110	401-532-26	C3	2	1630	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		Yes			Grind	Prev grind
11171	D STREET	110	401-532-26	C3	2	1630	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
11190	D STREET	130	401-533-14	C3	2	1630	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	Prev grind
11189	D STREET	130	401-533-14	C3	2	1630	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
11191					C3	2	1630	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No		Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
11170	D STREET	160	401-532-25	C3	2	1630	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
11169	D STREET	170	401-532-24	C3	2	1630	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
7454	EL CAMINO REAL	100	401-571-01	D3	2	1055	Sidewalk	PCC	Faulting	1/2" to 1"	15		Yes		Yes	Ramp	
7455	EL CAMINO REAL	100	401-571-01	D3	2	1055	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		Yes		Yes	Grind	
7456	EL CAMINO REAL	100	401-571-01	D3	2	1055	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		Yes		Yes	Grind	
7457	EL CAMINO REAL	100	401-571-01	D3	2	1055	Driveway	PCC	Sidewalk Curb Separation	1" to 2"	10		Yes		Yes	Replace Driveway	
7452	EL CAMINO REAL	100	401-571-01	D3	2	1055	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	6		Yes		Yes	Grind	
7453	EL CAMINO REAL	100	401-571-01	D3	2	1055	Driveway	PCC	Sidewalk Curb Separation	Over 2"	5		Yes		Yes	Replace Driveway	
7451	EL CAMINO REAL	105	401-583-15	D3	2	1055	Sidewalk	PCC	Faulting	1/2" to 1"	1		Yes		Yes	Ramp	
7487	EL CAMINO REAL	115	401-573-12	D3	2	1055	Driveway	PCC	Sidewalk Curb Separation	1" to 2"	8		Yes		Yes	Replace Driveway	
7458	EL CAMINO REAL	130	401-571-02	D3	2	1055	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		Yes		Yes	Grind	Prev grind
7459	EL CAMINO REAL	130	401-571-02	D3	2	1055	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes		Yes	Grind	
7460	EL CAMINO REAL	130	401-571-02	D3	2	1055	Sidewalk	PCC	Faulting	1/4" to 1/2"	7		Yes		Yes	Grind	
7461	EL CAMINO REAL	130	401-571-02	D3	2	1055	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes		Yes	Grind	
7462	EL CAMINO REAL	130	401-571-02	D3	2	1055	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	13		Yes		Yes	Replace Slab	
7450	EL CAMINO REAL	135	401-583-14	D3	2	1055	Sidewalk	PCC	Faulting	1/4" to 1/2"	6		Yes		Yes	Grind	
7449	EL CAMINO REAL	135	401-583-14	D3	2	1055	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	6		Yes		Yes	Replace Slab	
8158	EL CAMINO REAL	13891	401-642-10	D3	2	1057	Sidewalk	PCC	Buckled Slab	1/2" to 1"	10		Yes			Replace Slab(s)	Prev grind
8159	EL CAMINO REAL	13891	401-642-10	D3	2	1057	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		Yes			Grind	
8161	EL CAMINO REAL	13891	401-642-10	D3	2	1057	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
8160	EL CAMINO REAL	13891	401-642-10	D3	2	1057	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	5		Yes			Grind	
8157	EL CAMINO REAL	13891	401-642-10	D3	2	1057	Driveway	PCC	Spalling	1/2" to 1"	2		No			Replace C&G	
8163	EL CAMINO REAL	14001	401-641-11	D3	2	1057	Sidewalk	PCC	Faulting	1/2" to 1"	3		No		Yes	Ramp	Util cover
8164	EL CAMINO REAL	14001	401-641-11	D3	2	1057	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	4		Yes		Yes	Grind	
8162	EL CAMINO REAL	14001	401-641-11	D3	2	1057	Cross Gutter	PCC	Spalling	1" to 2"	2		No		Yes	Patch	
7463	EL CAMINO REAL	150	401-571-15	D3	2	1055	Sidewalk	PCC	Faulting	1" to 2"	1		Yes		Yes	Replace Slab	
7464	EL CAMINO REAL	150	401-571-15	D3	2	1055	Sidewalk	PCC	Faulting	1/4" to 1/2"	6		Yes		Yes	Grind	
7465	EL CAMINO REAL	150	401-571-15	D3	2	1055	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	5		Yes		Yes	Grind	
7446	EL CAMINO REAL	155	401-583-17	D3	2	1055	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	5		Yes		Yes	Grind	
7447	EL CAMINO REAL	155	401-583-17	D3	2	1055	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	10		Yes		Yes	Replace Slab	
7448	EL CAMINO REAL	155	401-583-17	D3	2	1055	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	6		Yes		Yes	Replace Slab	
7467	EL CAMINO REAL	170	401-571-05	D3	2	1055	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	6		Yes		Yes	Grind	
7466	EL CAMINO REAL	170	401-571-05	D3	2	1055	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	4		Yes		Yes	Grind	
7468	EL CAMINO REAL	180	401-571-06	D3	2	1055	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	6		Yes		Yes	Grind	
7445	EL CAMINO REAL	181	401-583-10	D3	2	1055	Sidewalk	PCC	Linear Cracking	1/2" to 1"	8		Yes		Yes	Grind	
7444	EL CAMINO REAL	181	401-583-10	D3	2	1055	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	18		Yes		Yes	Replace Slab	
7469	EL CAMINO REAL	190	401-571-07	D3	2	1055	Sidewalk	PCC	Faulting	1/2" to 1"	1		Yes		Yes	Ramp	
7443	EL CAMINO REAL	195	401-583-09	D3	2	1055	Sidewalk	PCC	Faulting	1/2" to 1"	5		Yes		Yes	Ramp	
7497	EL CAMINO REAL	205	401-584-11	D3	2	1055	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes		Yes	Grind	
7478	EL CAMINO REAL	220	401-572-06	D3	2	1055	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	5		Yes		Yes	Grind	Prev grind
7477	EL CAMINO REAL	220	401-572-06	D3	2	1055	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	8		Yes		Yes	Grind	
7496	EL CAMINO REAL	235	401-584-08	D3	2	1055	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes	Yes	Yes	Grind	
7495	EL CAMINO REAL	245	401-584-07	D3	2	1055	Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	2		Yes		Yes	Patch	
7479	EL CAMINO REAL	250	401-572-03	D3	2	1055	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes		Yes	Grind	
7480	EL CAMINO REAL	250	401-572-03	D3	2	1055	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		Yes		Yes	Grind	
7303	EL CAMINO REAL	255	401-584-06	D3	2	1055	Sidewalk	Brick	Faulting	1" to 2"	7		Yes		Yes	AC Patch	
7304	EL CAMINO REAL	255	401-584-06	D3	2	1055	Sidewalk	Brick	Faulting	1" to 2"	7		Yes		Yes	AC Patch	
7482	EL CAMINO REAL	300	401-573-01	D3	2	1055	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes		Yes	Grind	Prev grind
7483	EL CAMINO REAL	300	401-573-01	D3	2	1055	Sidewalk	PCC	Faulting	1/4" to 1/2"	6		Yes		Yes	Grind	Prev grind
7484	EL CAMINO REAL	300	401-573-01	D3	2	1055	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes		Yes	Grind	Prev grind
7481	EL CAMINO REAL	300	401-573-01	D3	2	1055	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes		Yes	Grind	
7485	EL CAMINO REAL	300	401-573-01	D3	2	1055	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No		Yes	Grind	
7492	EL CAMINO REAL	305	401-585-02	D3	2	1055	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No		Yes	Grind	Util cover
7491	EL CAMINO REAL	305	401-585-02	D3	2	1055	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	5		Yes		Yes	Replace Slab	
7493	EL CAMINO REAL	305	401-585-02	D3	2	1055	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	8		Yes		Yes	Replace Slab	
7494	EL CAMINO REAL	305	401-585-02	D3	2	1055	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	6		Yes		Yes	Grind	
7486	EL CAMINO REAL	330	401-573-02	D3	2	1055	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes		Yes	Grind	
7490	EL CAMINO REAL	365	401-585-05	D3	2	1055	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	5		Yes		Yes	Replace Slab	
7489	EL CAMINO REAL	397	401-585-06	D3	2	1055	Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	7		Yes		Yes	Replace Slab(s)	
7488	EL CAMINO REAL	397	401-585-06	D3	2	1055	Cross Gutter	Brick	Spalling	1/4" to 1/2"	1		No		Yes	AC Patch	
8143	EL CAMINO REAL	405	401-623-01	D3	2	1056	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes		Yes	Grind	Prev grind
8145	EL CAMINO REAL	405	401-623-01	D3	2	1056	Driveway	PCC	Divided Slab	No Displacement			No		Yes	Replace Slab	
8144	EL CAMINO REAL	405	401-623-01	D3	2	1056	Curb/Gutter	PCC	Spalling	1/2" to 1"	0.5		No		Yes	Replace C&G	
8146				D3	2	1056	Driveway	PCC	Divided Slab	1/4" to 1/2"	12		No		Yes	Replace Slab	

Sorted by Zone (1-7)



3548 Seagate Way, Suite 230
Oceanside, CA 92056
T: (760) 216-6529
www.bucknam-inc.com

Page 32 of 190

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
8087	FIRST STREET	111	401-162-09	D3	2	1028	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	16		Yes		Yes	Replace Slab	
8084	FIRST STREET	111	401-162-09	D3	2	1028	Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	18		Yes		Yes	Replace Slab(s)	
7578	FIRST STREET	112	401-522-12	D3	2	1022	Sidewalk	PCC	Other - Leave Comment	1/2" to 1"		2"	No		Yes	Grind	Hole
7577	FIRST STREET	112	401-522-12	D3	2	1022	Curb/Gutter	PCC	Faulting	1/2" to 1"	1		No		Yes	Replace C&G	
7576	FIRST STREET	112	401-522-12	D3	2	1022	Sidewalk	PCC	Faulting	1/2" to 1"	4		No		Yes	Ramp	
7546	FIRST STREET	125	401-523-31	D3	2	1024	Sidewalk	PCC	Other - Leave Comment	1/2" to 1"		2"	No		Yes	Grind	Hole
7545	FIRST STREET	125	401-523-31	D3	2	1024	Driveway	PCC	Linear Cracking	1/4" to 1/2"	6		No		Yes	Grind	
7544	FIRST STREET	125	401-523-31	D3	2	1024	Driveway	PCC	Spalling	1/2" to 1"	2		No		Yes	Replace C&G	
11608	FIRST STREET	131	401-532-37	D3	2	1026	Sidewalk	PCC	Faulting	1/2" to 1"	1		No		Yes	Ramp	
11607	FIRST STREET	131	401-532-37	D3	2	1026	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	4		Yes		Yes	Grind	
7967	FIRST STREET	13341	401-601-04	D3	2	1027	Sidewalk	PCC	Patch / Utility Cut	1/2" to 1"	4		No		Yes	Replace Patch	AC patch
7970	FIRST STREET	13341	401-601-04	D3	2	1027	Sidewalk	PCC	Patch / Utility Cut	1/2" to 1"	2		No	Yes	Yes	Replace Patch	AC patch
7971	FIRST STREET	13341	401-601-04	D3	2	1027	Sidewalk	PCC	Patch / Utility Cut	1/2" to 1"	2		No	Yes	Yes	Replace Patch	AC patch
7968	FIRST STREET	13341	401-601-04	D3	2	1027	Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	16		Yes		Yes	Replace Slab(s)	Severe
7969	FIRST STREET	13341	401-601-04	D3	2	1027	Sidewalk	PCC	Linear Cracking	No Displacement	6		Yes		Yes	Joint Seal	Slight displacement
7966	FIRST STREET	13341	401-601-04	D3	2	1027	Sidewalk	PCC	Spalling	1/2" to 1"	0.5		No		Yes	Replace C&G	
8098	FIRST STREET	14945	401-292-15	D3	2	1028	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes		Yes	Grind	Prev grind
8104	FIRST STREET	14945	401-292-15	D3	2	1028	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No		Yes	Grind	Prev grind
8102	FIRST STREET	14945	401-292-15	D3	2	1028	Sidewalk	PCC	Other - Leave Comment	1/4" to 1/2"	7		No		Yes	Patch	Scaling
8105	FIRST STREET	14945	401-292-15	D3	2	1028	Driveway	PCC	Temporary Ramp	1/4" to 1/2"			No		Yes	Replace Slab	Scaling
8100	FIRST STREET	14945	401-292-15	D3	2	1028	Cross Gutter	PCC	Linear Cracking	1/2" to 1"	5		No		Yes	Replace Slab	
8101	FIRST STREET	14945	401-292-15	D3	2	1028	Cross Gutter	PCC	Linear Cracking	1/4" to 1/2"	8		No		Yes	Grind	
8099	FIRST STREET	14945	401-292-15	D3	2	1028	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	6		No		Yes	Grind	
8097	FIRST STREET	14945	401-292-15	D3	2	1028	Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	18		Yes		Yes	Replace Slab(s)	
8103	FIRST STREET	14945	401-292-15	D3	2	1028	Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	28		Yes		Yes	Replace Slab(s)	
8106	FIRST STREET	14945	401-292-15	D3	2	1028	Driveway	PCC	Spalling	1/2" to 1"	2		No		Yes	Replace C&G	
8034	FIRST STREET	14982	401-141-06	D3	2	1026	Sidewalk	PCC	Corner Break	1/4" to 1/2"	2		No		Yes	Grind	
8036	FIRST STREET	14982	401-141-06	D3	2	1026	Driveway	PCC	Linear Cracking	1/4" to 1/2"	7		No		Yes	Grind	
8037	FIRST STREET	14982	401-141-06	D3	2	1026	Driveway	PCC	Linear Cracking	1/4" to 1/2"	7		No		Yes	Grind	
8038	FIRST STREET	14982	401-141-06	D3	2	1026	Driveway	PCC	Linear Cracking	1/4" to 1/2"	7		No		Yes	Grind	
8039	FIRST STREET	14982	401-141-06	D3	2	1026	Driveway	PCC	Linear Cracking	1/4" to 1/2"	7		No		Yes	Grind	
8035	FIRST STREET	14982	401-141-06	D3	2	1026	Sidewalk	PCC	Spalling	1/4" to 1/2"	2		No		Yes	Grind	
11606	FIRST STREET	150	401-583-01	D3	2	1025	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No		Yes	Grind	
11605	FIRST STREET	150	401-583-01	D3	2	1025	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	8		Yes		Yes	Replace Slab	
11604	FIRST STREET	150	401-583-01	D3	2	1025	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	7		Yes		Yes	Grind	
8069	FIRST STREET	17912	401-151-09	D3	2	1026	Sidewalk	PCC	Buckled Slab	1/2" to 1"	16		Yes			Replace Slab(s)	Raised
8070	FIRST STREET	17912	401-151-09	D3	2	1026	Sidewalk	PCC	Buckled Slab	1/2" to 1"	16		Yes			Replace Slab(s)	Raised
8068	FIRST STREET	17912	401-151-09	D3	2	1026	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
8067	FIRST STREET	17912	401-151-09	D3	2	1026	Driveway	PCC	Spalling	1/2" to 1"	2		No		Yes	Replace C&G	
7532	FIRST STREET	205	401-531-14	D3	2	1024	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No		Yes	Grind	
7533	FIRST STREET	215	401-531-13	D3	2	1024	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes		Yes	Grind	Prev grind
7535	FIRST STREET	215	401-531-13	D3	2	1024	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No		Yes	Grind	
7534	FIRST STREET	215	401-531-13	D3	2	1024	Sidewalk	PCC	Spalling	1/4" to 1/2"	2		No		Yes	Grind	
8028	FIRST STREET	240	401-581-01	D3	2	1025	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No		Yes	Grind	
8029	FIRST STREET	240	401-581-01	D3	2	1025	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No		Yes	Grind	
8030	FIRST STREET	240	401-581-01	D3	2	1025	Curb/Gutter	PCC	Spalling	1/2" to 1"	1		No		Yes	Replace C&G	
8031	FIRST STREET	240	401-581-01	D3	2	1025	Curb/Gutter	PCC	Spalling	1/2" to 1"	1		No		Yes	Replace C&G	
8043	FIRST STREET	245	401-141-07	D3	2	1026	Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	2		No		Yes	Replace Patch	AC patch
8040	FIRST STREET	245	401-141-07	D3	2	1026	Driveway	PCC	Linear Cracking	1/2" to 1"	7		No		Yes	Grind	
8044	FIRST STREET	245	401-141-07	D3	2	1026	Driveway	PCC	Linear Cracking	1/2" to 1"	7		No		Yes	Grind	
8045	FIRST STREET	245	401-141-07	D3	2	1026	Driveway	PCC	Linear Cracking	1/2" to 1"	7		No		Yes	Grind	
8041	FIRST STREET	245	401-141-07	D3	2	1026	Driveway	PCC	Linear Cracking	1/4" to 1/2"	7		No		Yes	Grind	
8042	FIRST STREET	245	401-141-07	D3	2	1026	Sidewalk	PCC	Spalling	1" to 2"	2		Yes		Yes	Patch	
8046	FIRST STREET	245	401-141-07	D3	2	1026	Driveway	PCC	Spalling	1/2" to 1"	4		No		Yes	Replace C&G	
8047	FIRST STREET	245	401-141-07	D3	2	1026	Curb/Gutter	PCC	Spalling	Over 2"	1		No		Yes	Replace C&G	
7536	FIRST STREET	305	401-523-16	D3	2	1024	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No		Yes	Grind	
7537	FIRST STREET	305	401-523-16	D3	2	1024	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	7		No		Yes	Grind	
7538	FIRST STREET	305	401-523-16	D3	2	1024	Driveway	PCC	Punchout	1/4" to 1/2"	5		No		Yes	Replace Slab	
7539	FIRST STREET	305	401-523-16	D3	2	1024	Curb/Gutter	PCC	Spalling	1/2" to 1"	2		No		Yes	Replace C&G	
10955	FIRST STREET	310	401-561-21	D3	2	1023	Ramp	PCC	Faulting	1/4" to 1/2"	3		No		Yes	Grind Ramp	
11599	FIRST STREET	320	401-561-19	D3	2	1023	Sidewalk	PCC	Faulting	1/4" to 1/2"	7		No		Yes	Grind	
11594	FIRST STREET	330	401-561-18	D3	2	1023	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No		Yes	Grind	
11597	FIRST STREET	330	401-561-18	D3	2	1023	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes		Yes	Grind	
11595				D3	2	1023	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	10		No		Yes	Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP	Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
11598	FIRST STREET	330	401-561-18	D3	2	1023		Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	6		No		Yes	Grind	
11596	FIRST STREET	330	401-561-18	D3	2	1023		Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	7		Yes		Yes	Replace Slab(s)	
8053	FIRST STREET	341	401-141-11	D3	2	1026		Driveway	PCC	Linear Cracking	1/4" to 1/2"	8		No		Yes	Grind	
8054	FIRST STREET	341	401-141-11	D3	2	1026		Driveway	PCC	Linear Cracking	1/4" to 1/2"	8		No		Yes	Grind	
8057	FIRST STREET	341	401-141-11	D3	2	1026		Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	2		No		Yes	Grind	
8056	FIRST STREET	341	401-141-11	D3	2	1026		Sidewalk	PCC	Patch / Utility Cut	Over 2"	2		Yes		Yes	Replace Slab	
8055	FIRST STREET	341	401-141-11	D3	2	1026		Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	12		Yes		Yes	Replace Slab(s)	
8052	FIRST STREET	341	401-141-11	D3	2	1026		Curb/Gutter	PCC	Spalling	1" to 2"	1		No		Yes	Patch	
7541	FIRST STREET	345	401-523-15	D3	2	1024		Cross Gutter	PCC	Linear Cracking	1/4" to 1/2"	4		No		Yes	Grind	
7542	FIRST STREET	345	401-523-15	D3	2	1024		Cross Gutter	PCC	Linear Cracking	1/4" to 1/2"	6		No		Yes	Grind	
7540	FIRST STREET	345	401-523-15	D3	2	1024		Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	16		Yes		Yes	Replace Slab(s)	
7543	FIRST STREET	345	401-523-15	D3	2	1024		Cross Gutter	PCC	Spalling	1/2" to 1"	1		No		Yes	Patch	
8023	FIRST STREET	360	401-591-06	D3	2	1025		Sidewalk	PCC	Divided Slab	1/4" to 1/2"	10		No		Yes	Replace Slab	
8021	FIRST STREET	360	401-591-06	D3	2	1025		Driveway	PCC	Faulting	1/4" to 1/2"	4		No		Yes	Grind Driveway	
8024	FIRST STREET	360	401-591-06	D3	2	1025		Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No		Yes	Grind	
8022	FIRST STREET	360	401-591-06	D3	2	1025		Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	8		No		Yes	Grind	
8020	FIRST STREET	380	401-591-05	D3	2	1025		Sidewalk	PCC	Other - Leave Comment	1/2" to 1"		2"	No		Yes	Grind	Hole
8017	FIRST STREET	380	401-591-05	D3	2	1025		Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No		Yes	Grind	
8018	FIRST STREET	380	401-591-05	D3	2	1025		Driveway	PCC	Linear Cracking	1/4" to 1/2"	8		No		Yes	Grind	
8019	FIRST STREET	380	401-591-05	D3	2	1025		Driveway	PCC	Sidewalk Curb Separation	1/4" to 1/2"	10		No		Yes	Grind	
8066	FIRST STREET	381	401-141-10	D3	2	1026		Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No		Yes	Grind	
11592	FIRST STREET	400	401-361-01	D3	2	1023		Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No		Yes	Grind	
8010	FIRST STREET	414	401-591-04	D3	2	1025		Sidewalk	PCC	Other - Leave Comment	1" to 2"		3"	No		Yes	Ramp	Hole
8012	FIRST STREET	414	401-591-04	D3	2	1025		Sidewalk	PCC	Corner Break	1/2" to 1"	5		Yes		Yes	Ramp	
8014	FIRST STREET	414	401-591-04	D3	2	1025		Sidewalk	PCC	Faulting	1" to 2"	6		Yes		Yes	Replace Slab	
8013	FIRST STREET	414	401-591-04	D3	2	1025		Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes		Yes	Grind	
8011	FIRST STREET	414	401-591-04	D3	2	1025		Driveway	PCC	Linear Cracking	1/4" to 1/2"	7		No		Yes	Grind	
8016	FIRST STREET	414	401-591-04	D3	2	1025		Driveway	PCC	Linear Cracking	1/4" to 1/2"	8		No		Yes	Grind	
8015	FIRST STREET	414	401-591-04	D3	2	1025		Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No		Yes	Grind	
7581	FIRST STREET	425	401-522-11	D3	2	1022		Sidewalk	PCC	Buckled Slab	Over 2"	12		Yes		Yes	Replace Slab(s)	Slab raised
7579	FIRST STREET	425	401-522-11	D3	2	1022		Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	15		Yes		Yes	Replace Slab	
7580	FIRST STREET	425	401-522-11	D3	2	1022		Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	10		Yes		Yes	Replace Slab	
7582	FIRST STREET	435	401-522-27	D3	2	1022		Driveway	PCC	Sidewalk Curb Separation	1/4" to 1/2"	7		No		Yes	Grind	
7583	FIRST STREET	435	401-522-27	D3	2	1022		Driveway	PCC	Spalling	1/4" to 1/2"	1		No		Yes	Grind	
8009	FIRST STREET	440	401-591-03	D3	2	1025		Sidewalk	PCC	Buckled Slab	1" to 2"	6		Yes		Yes	Replace Slab	
8004	FIRST STREET	440	401-591-03	D3	2	1025		Sidewalk	PCC	Corner Break	1/4" to 1/2"	1		No		Yes	Grind	
11589	FIRST STREET	440	401-361-31	D3	2	1021		Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No		Yes	Grind	
11590	FIRST STREET	440	401-361-31	D3	2	1021		Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes		Yes	Grind	
11591	FIRST STREET	440	401-361-31	D3	2	1021		Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No		Yes	Grind	
8006	FIRST STREET	440	401-591-03	D3	2	1025		Driveway	PCC	Linear Cracking	1/4" to 1/2"	7		No		Yes	Grind	
8007	FIRST STREET	440	401-591-03	D3	2	1025		Driveway	PCC	Linear Cracking	1/4" to 1/2"	7		No		Yes	Grind	
8008	FIRST STREET	440	401-591-03	D3	2	1025		Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	8		Yes		Yes	Replace Slab(s)	
8005	FIRST STREET	440	401-591-03	D3	2	1025		Curb/Gutter	PCC	Spalling	1" to 2"	1		No		Yes	Patch	
8002	FIRST STREET	450	401-591-01	D3	2	1025		Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes		Yes	Ramp	Prev grind
8001	FIRST STREET	450	401-591-01	D3	2	1025		Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes		Yes	Ramp	
7998	FIRST STREET	450	401-591-01	D3	2	1025		Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No		Yes	Grind	
8003	FIRST STREET	450	401-591-01	D3	2	1025		Sidewalk	PCC	Faulting	1/4" to 1/2"	8		No		Yes	Grind	
11585	FIRST STREET	450	401-361-24	D3	2	1021		Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No		Yes	Grind	
11587	FIRST STREET	450	401-361-24	D3	2	1021		Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No		Yes	Grind	
11588	FIRST STREET	450	401-361-24	D3	2	1021		Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No		Yes	Grind	
11586	FIRST STREET	450	401-361-24	D3	2	1021		Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	8		Yes		Yes	Replace Slab	
8000	FIRST STREET	450	401-591-01	D3	2	1025		Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	20	1"	Yes		Yes	Replace Slab(s)	
7999	FIRST STREET	450	401-591-01	D3	2	1025		Sidewalk	PCC	Spalling	1" to 2"	2		No		Yes	Patch	
7585	FIRST STREET	465	401-522-10	D3	2	1022		Curb/Gutter	PCC	Faulting	1/4" to 1/2"	1		No		Yes	Grind C&G	
7584	FIRST STREET	465	401-522-10	D3	2	1022		Sidewalk	PCC	Faulting	1/4" to 1/2"	6		No		Yes	Grind	
7586	FIRST STREET	465	401-522-10	D3	2	1022		Sidewalk	PCC	Faulting	1/4" to 1/2"	6		No		Yes	Grind	
7587	FIRST STREET	465	401-522-10	D3	2	1022		Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No		Yes	Grind	
11610	FIRST STREET	505	401-521-13	D2	2	1022		Curb/Gutter	PCC	Faulting	1" to 2"			No		Yes	Replace C&G	
11611	FIRST STREET	505	401-521-13	D2	2	1022		Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No		Yes	Grind	
11583	FIRST STREET	520	401-361-23	D3	2	1021		Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes		Yes	Grind	Prev work
11584	FIRST STREET	520	401-361-23	D3	2	1021		Curb/Gutter	PCC	Sidewalk Curb Separation	1" to 2"	4		No		Yes	Replace Curb	
7978	FIRST STREET	540	401-601-01	D3	2	1027		Sidewalk	PCC	Patch / Utility Cut	1/2" to 1"	2		No	Yes	Yes	Replace Patch	AC patch
7979	FIRST STREET	540	401-601-01	D3	2	1027		Sidewalk	PCC	Patch / Utility Cut	1/2" to 1"	2		No	Yes	Yes	Replace Patch	AC patch
7980				D3	2	1027		Sidewalk	PCC	Patch / Utility Cut	1/2" to 1"	2		No	Yes	Yes	Replace Patch	AC patch

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
7985	FIRST STREET	540	401-601-01	D3	2	1027	Sidewalk	PCC	Patch / Utility Cut	1/2" to 1"	2		No		Yes	Replace Patch	AC patch
7986	FIRST STREET	540	401-601-01	D3	2	1027	Sidewalk	PCC	Patch / Utility Cut	1/2" to 1"	2		No		Yes	Replace Patch	AC patch
7987	FIRST STREET	540	401-601-01	D3	2	1027	Sidewalk	PCC	Patch / Utility Cut	1/2" to 1"	2		Yes		Yes	Replace Patch	AC patch
7988	FIRST STREET	540	401-601-01	D3	2	1027	Sidewalk	PCC	Patch / Utility Cut	1/2" to 1"	2		Yes		Yes	Replace Patch	AC patch
7990	FIRST STREET	540	401-601-01	D3	2	1027	Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	2		No		Yes	Replace Patch	AC patch
7991	FIRST STREET	540	401-601-01	D3	2	1027	Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	2		No		Yes	Replace Patch	AC patch
7992	FIRST STREET	540	401-601-01	D3	2	1027	Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	2		No		Yes	Replace Patch	AC patch
7993	FIRST STREET	540	401-601-01	D3	2	1027	Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	2		No		Yes	Replace Patch	AC patch
7994	FIRST STREET	540	401-601-01	D3	2	1027	Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	2		No		Yes	Replace Patch	AC patch
7995	FIRST STREET	540	401-601-01	D3	2	1027	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes		Yes	Ramp	
7989	FIRST STREET	540	401-601-01	D3	2	1027	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes		Yes	Grind	
7977	FIRST STREET	540	401-601-01	D3	2	1027	Driveway	PCC	Linear Cracking	1/2" to 1"	7		No		Yes	Grind	
7975	FIRST STREET	540	401-601-01	D3	2	1027	Driveway	PCC	Linear Cracking	1/4" to 1/2"	7		No		Yes	Grind	
7976	FIRST STREET	540	401-601-01	D3	2	1027	Driveway	PCC	Linear Cracking	1/4" to 1/2"	7		No		Yes	Grind	
7981	FIRST STREET	540	401-601-01	D3	2	1027	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	15		Yes		Yes	Replace Slab	
7982	FIRST STREET	540	401-601-01	D3	2	1027	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	15		Yes		Yes	Replace Slab	
7983	FIRST STREET	540	401-601-01	D3	2	1027	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	10		Yes		Yes	Grind	
7996	FIRST STREET	540	401-601-01	D3	2	1027	Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	9		Yes		Yes	Replace Slab(s)	
7984	FIRST STREET	540	401-601-01	D3	2	1027	Sidewalk	PCC	Temporary Ramp	1/2" to 1"	4		Yes		Yes	Replace Slab	
7997	FIRST STREET	540	401-601-01	D3	2	1027	Sidewalk	PCC	Temporary Ramp	1/2" to 1"	4		Yes		Yes	Replace Slab	
10975	FIRST STREET	560	401-361-21	D2	2	1021	Sidewalk	PCC	Corner Break	1/4" to 1/2"	3		No		Yes	Grind	
11126	FIRST STREET	610	401-551-01	D2	2	1021	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No		Yes	Grind	
8094	FIRST STREET	615	401-162-03	D3	2	1028	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes		Yes	Grind	Prev grind
8095	FIRST STREET	615	401-162-03	D3	2	1028	Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	22		Yes		Yes	Replace Slab(s)	Severe
8090	FIRST STREET	615	401-162-03	D3	2	1028	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No		Yes	Grind	
8093	FIRST STREET	615	401-162-03	D3	2	1028	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No		Yes	Grind	
8088	FIRST STREET	615	401-162-03	D3	2	1028	Driveway	PCC	Linear Cracking	1/4" to 1/2"	7		No		Yes	Grind	
8089	FIRST STREET	615	401-162-03	D3	2	1028	Driveway	PCC	Linear Cracking	1/4" to 1/2"	7		No		Yes	Grind	
8096	FIRST STREET	615	401-162-03	D3	2	1028	Driveway	PCC	Linear Cracking	1/4" to 1/2"	7		No		Yes	Grind	
8091	FIRST STREET	615	401-162-03	D3	2	1028	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	12		Yes		Yes	Replace Slab	
8092	FIRST STREET	615	401-162-03	D3	2	1028	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	8		Yes		Yes	Replace Slab	
11100	FIRST STREET	621	401-302-06	D2	2	1022	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No		Yes	Grind	
11101	FIRST STREET	621	401-302-06	D2	2	1022	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No		Yes	Grind	
11102	FIRST STREET	621	401-302-06	D2	2	1022	Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	10		No		Yes	Replace Slab(s)	
11125	FIRST STREET	640	401-551-40	D2	2	1021	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes		Yes	Grind	At traffic signal patch
11123	FIRST STREET	660	401-551-39	D2	2	1021	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes		Yes	Grind	
11124	FIRST STREET	660	401-551-39	D2	2	1021	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	10		Yes		Yes	Replace Slab(s)	
11103	FIRST STREET	661	401-302-07	D2	2	1022	Sidewalk	PCC	Faulting	1/2" to 1"	1		No		Yes	Ramp	
7973	FIRST STREET	662	401-601-10	D3	2	1027	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes		Yes	Grind	
7974	FIRST STREET	662	401-601-10	D3	2	1027	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes		Yes	Grind	
7972	FIRST STREET	662	401-601-10	D3	2	1027	Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	30		Yes		Yes	Replace Slab(s)	
12037	FIRST STREET	700	401-541-01	D2	2	1021	Sidewalk	PCC	Spalling	1/4" to 1/2"			No		Yes	Grind	Multiple small spalls
8107	FIRST STREET	701	401-292-13	D3	2	1028	Sidewalk	PCC	Faulting	1/4" to 1/2"	8		No		Yes	Grind	
12043	FIRST STREET	721	401-302-08	D2	2	1022	Sidewalk	PCC	Patch / Utility Cut	1/2" to 1"	1		No		Yes	Grind	Broken util cover
12042	FIRST STREET	721	401-302-08	D2	2	1022	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	6		No		Yes	Grind	
12041	FIRST STREET	721	401-302-08	D2	2	1022	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No		Yes	Grind	
12039	FIRST STREET	741	401-302-13	D2	2	1022	Sidewalk	PCC	Faulting	1/2" to 1"	1		No		Yes	Ramp	Corner
12040	FIRST STREET	741	401-302-13	D2	2	1022	Curb/Gutter	PCC	Spalling	1/4" to 1/2"	4		No		Yes	Grind	
12038	FIRST STREET	750	401-541-17	D2	2	1021	Sidewalk	PCC	Temporary Ramp	1/2" to 1"	5		No		Yes	Replace Slab	
11333	FIRST STREET	900	402-181-15	D2	2	1020	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No		Yes	Grind	
11334	FIRST STREET	900	402-181-15	D2	2	1020	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	5		No		Yes	Grind	
8048	FIRST STREET		401-141-12	D3	2	1026	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No		Yes	Grind	
11335	FIRST STREET		402-181-13	D2	2	1020	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No		Yes	Grind	
11336	FIRST STREET		402-181-13	D2	2	1020	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No		Yes	Grind	
8025	FIRST STREET		401-581-02	D3	2	1025	Driveway	PCC	Linear Cracking	1/4" to 1/2"	7		No		Yes	Grind	
8026	FIRST STREET		401-581-02	D3	2	1025	Driveway	PCC	Linear Cracking	1/4" to 1/2"	7		No		Yes	Grind	
8050	FIRST STREET		401-141-12	D3	2	1026	Driveway	PCC	Linear Cracking	1/4" to 1/2"	5		No		Yes	Grind	
8051	FIRST STREET		401-141-12	D3	2	1026	Driveway	PCC	Linear Cracking	1/4" to 1/2"	8		No		Yes	Grind	
8049	FIRST STREET		401-141-12	D3	2	1026	Driveway	PCC	Patch / Utility Cut	1/4" to 1/2"	4		No		Yes	Grind	
8027	FIRST STREET		401-581-02	D3	2	1025	Curb/Gutter	PCC	Spalling	1" to 2"	2		No		Yes	Patch	
8071	FIRST STREET		401-151-11	D3	2	1026	Curb/Gutter	PCC	Spalling	1/2" to 1"	2.5		No		Yes	Replace C&G	
8072	FIRST STREET		401-151-11	D3	2	1026	Driveway	PCC	Spalling	1/4" to 1/2"	10		No		Yes	Grind	
8063	HALL CIRCLE	131	401-141-09	D3	2	1704	Driveway	PCC	Linear Cracking	1/4" to 1/2"	5		No		Yes	Grind	
8064				D3	2	1704	Driveway	PCC	Linear Cracking	1/4" to 1/2"	5		No		Yes	Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
8061	HALL CIRCLE	131	401-141-09	D3	2	1704	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	25		No			Grind	
8062	HALL CIRCLE	131	401-141-09	D3	2	1704	Curb/Gutter	PCC	Spalling	1/4" to 1/2"	12		No		Yes	Grind	
8060	HALL CIRCLE	341	401-141-11	D3	2	1704	Driveway	PCC	Spalling	1/2" to 1"	8		No		Yes	Replace C&G	Cracks also
8059	HALL CIRCLE	341	401-141-11	D3	2	1704	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No		Yes	Grind	
8058	HALL CIRCLE	341	401-141-11	D3	2	1704	Sidewalk	PCC	Spalling	1/4" to 1/2"	2		No		Yes	Grind	
8065	HALL CIRCLE	381	401-141-10	D3	2	1704	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	6		No		Yes	Grind	
8109	HOLT AVENUE	14971	401-292-12	D4	2	1090	Sidewalk	PCC	Spalling	1/2" to 1"	0.5		No		Yes	Replace C&G	
8120	HOLT AVENUE	18182	401-292-08	C4	2	1090	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes		Yes	Grind	Prev grind
8121	HOLT AVENUE	18182	401-292-08	C4	2	1090	Sidewalk	PCC	Buckled Slab	Over 2"	12		Yes		Yes	Replace Slab(s)	
8115	HOLT AVENUE	18182	401-292-08	C4	2	1090	Sidewalk	PCC	Corner Break	1/4" to 1/2"	6		No		Yes	Grind	
8117	HOLT AVENUE	18182	401-292-08	C4	2	1090	Cross Gutter	PCC	Divided Slab	1/4" to 1/2"	15		No		Yes	Replace Slab	
8110	HOLT AVENUE	18182	401-292-08	C4	2	1090	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes		Yes	Grind	
8116	HOLT AVENUE	18182	401-292-08	C4	2	1090	Cross Gutter	PCC	Linear Cracking	1/4" to 1/2"	14		No		Yes	Grind	
8114	HOLT AVENUE	18182	401-292-08	C4	2	1090	Sidewalk	PCC	Linear Cracking	1" to 2"	8		Yes		Yes	Replace Slab(s)	
8111	HOLT AVENUE	18182	401-292-08	C4	2	1090	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	16	1"	Yes		Yes	Replace Slab	
8118	HOLT AVENUE	18182	401-292-08	C4	2	1090	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	14	2"	Yes		Yes	Replace Slab	
8119	HOLT AVENUE	18182	401-292-08	C4	2	1090	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	7		Yes		Yes	Grind	
8112	HOLT AVENUE	18182	401-292-08	C4	2	1090	Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	16	2"	Yes		Yes	Replace Slab(s)	
8113	HOLT AVENUE	18182	401-292-08	C4	2	1090	Sidewalk	PCC	Temporary Ramp	1/2" to 1"	4		Yes		Yes	Replace Slab	
8122	HOLT AVENUE	18232	401-292-03	C4	2	1090	Sidewalk	PCC	Buckled Slab	1/2" to 1"	6		Yes		Yes	Replace Slab	
8124	HOLT AVENUE	18232	401-292-03	C4	2	1090	Sidewalk	PCC	Buckled Slab	1" to 2"	10		Yes		Yes	Replace Slab(s)	
8123	HOLT AVENUE	18232	401-292-03	C4	2	1090	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	12		Yes		Yes	Grind	
8125	HOLT AVENUE		401-283-07	D4	2	1090	Sidewalk	PCC	Faulting	1/4" to 1/2"	6		No		Yes	Grind	
11095	IRVINE BLVD	14841	401-302-01	C2	2	1091	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
11094	IRVINE BLVD	14841	401-302-01	C2	2	1091	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	50		No			Grind	
11129	IRVINE BLVD	17332	401-512-01	C2	2	1093	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7597	IRVINE BLVD	17332	401-512-01	C2	2	1093	Cross Gutter	PCC	Linear Cracking	1/2" to 1"	16		No			Replace Slab(s)	
7598	IRVINE BLVD	17332	401-512-01	C3	2	1093	Cross Gutter	PCC	Linear Cracking	1/4" to 1/2"	5		No			Grind	
11130	IRVINE BLVD	17332	401-512-01	C2	2	1093	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	10		No			Grind	
7564	IRVINE BLVD	17400	401-513-01	C3	2	1093	Sidewalk	PCC	Divided Slab	1/2" to 1"	17		No			Replace Slab(s)	
11131	IRVINE BLVD	17400	401-513-01	C3	2	1093	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
7596	IRVINE BLVD	17400	401-513-01	C3	2	1093	Cross Gutter	PCC	Linear Cracking	1/2" to 1"	16		No			Replace Slab(s)	
7563	IRVINE BLVD	17452	401-514-01	C3	2	1093	Sidewalk	PCC	Divided Slab	1/2" to 1"	17		No			Replace Slab(s)	
11132	IRVINE BLVD	17482	401-514-02	C3	2	1093	Driveway	PCC	Linear Cracking	1/4" to 1/2"	10		No			Grind	
11133	IRVINE BLVD	17502	401-514-03	C3	2	1093	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
11134	IRVINE BLVD	17502	401-514-03	C3	2	1093	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	5		No			Grind	
11146	IRVINE BLVD	17592	401-042-05	C3	2	1095	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
11145	IRVINE BLVD	17592	401-042-05	C3	2	1095	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
11147	IRVINE BLVD	17632	401-042-03	C3	2	1095	Sidewalk	PCC	Faulting	1/2" to 1"	3.5		Yes			Ramp	
11148	IRVINE BLVD	17632	401-042-03	C3	2	1095	Sidewalk	PCC	Faulting	1/2" to 1"	2		Yes			Ramp	
11149	IRVINE BLVD	17632	401-042-03	C3	2	1095	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
11153	IRVINE BLVD	17702	401-042-07	C3	2	1095	Sidewalk	PCC	Faulting	1/2" to 1"	4		No			Ramp	
11154	IRVINE BLVD	17722	401-042-08	C3	2	1095	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	6		Yes			Grind	
11157	IRVINE BLVD	17742	401-042-09	C3	2	1095	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	At patch
11155	IRVINE BLVD	17742	401-042-09	C3	2	1095	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
11156	IRVINE BLVD	17742	401-042-09	C3	2	1095	Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	5		Yes			Replace Slab(s)	
11214	IRVINE BLVD	17772	401-141-14	C3	2	1098	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes		Yes	Grind	
11215	IRVINE BLVD	17772	401-141-14	C3	2	1098	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No		Yes	Grind	
11213	IRVINE BLVD	17772	401-141-14	C3	2	1098	Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	7		Yes		Yes	Replace Slab(s)	
11216	IRVINE BLVD	17802	401-141-13	C3	2	1098	Sidewalk	PCC	Other - Leave Comment	1/2" to 1"	5		No		Yes	Grind	Giant patch vert
11217	IRVINE BLVD	17802	401-141-13	C3	2	1098	Driveway	PCC	Faulting	1/2" to 1"	3		No		Yes	Grind Driveway	
11220	IRVINE BLVD	17842	401-141-57	C3	2	1098	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		No		Yes	Ramp	
11218	IRVINE BLVD	17842	401-141-57	C3	2	1098	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No		Yes	Grind	
11221	IRVINE BLVD	17842	401-141-57	C3	2	1098	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No		Yes	Grind	
11219	IRVINE BLVD	17842	401-141-57	C3	2	1098	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	10		Yes		Yes	Grind	
11222	IRVINE BLVD	17912	401-151-09	C3	2	1098	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
11223	IRVINE BLVD	18062	401-163-13	C3	2	1098	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No		Yes	Grind	
11226	IRVINE BLVD	18102	401-162-08	C3	2	1099	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No		Yes	Grind	At patch
11225	IRVINE BLVD	18102	401-162-08	C3	2	1099	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No		Yes	Grind	
11224	IRVINE BLVD	18102	401-162-08	C3	2	1099	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	6		No		Yes	Grind	
11231	IRVINE BLVD	18182	401-292-08	C3	2	1099	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes		Yes	Grind	Prev grind
11227	IRVINE BLVD	18182	401-292-08	C3	2	1099	Sidewalk	PCC	Corner Break	1/4" to 1/2"	5		No		Yes	Grind	
11228	IRVINE BLVD	18182	401-292-08	C3	2	1099	Sidewalk	PCC	Corner Break	1/4" to 1/2"	5		No		Yes	Grind	
11229				C3	2	1099	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes		Yes	Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
11230	IRVINE BLVD	18182	401-292-08	C3	2	1099	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	5		Yes		Yes	Grind	
11232	IRVINE BLVD	18182	401-292-08	C3	2	1099	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	15		No		Yes	Grind	
11233	IRVINE BLVD	18302	401-283-13	C4	2	1102	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
11234	IRVINE BLVD	18302	401-283-13	C4	2	1102	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
11152	IRVINE BLVD		401-042-10	C3	2	1095	Driveway	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind Driveway	
11150	IRVINE BLVD		401-042-10	C3	2	1095	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
11151	IRVINE BLVD		401-042-10	C3	2	1095	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
2408	KENYON DRIVE	17001	402-142-10	E2	2	1727	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
2410	KENYON DRIVE	17021	402-142-11	E2	2	1727	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		Yes			Ramp	Prev grind
2411	KENYON DRIVE	17021	402-142-11	E2	2	1727	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
2409	KENYON DRIVE	17021	402-142-11	E2	2	1727	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	5		No			Grind	
2404	KENYON DRIVE	17022	402-142-09	E2	2	1727	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	Prev grind
2405	KENYON DRIVE	17022	402-142-09	E2	2	1727	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
2406	KENYON DRIVE	17022	402-142-09	E2	2	1727	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
2407	KENYON DRIVE	17022	402-142-09	E2	2	1727	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
2402	KENYON DRIVE	17042	402-142-08	E2	2	1727	Sidewalk	PCC	Faulting	1/2" to 1"	2		Yes			Ramp	
2403	KENYON DRIVE	17042	402-142-08	E2	2	1727	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
2401	KENYON DRIVE	17042	402-142-08	E2	2	1727	Sidewalk	PCC	Linear Cracking	No Displacement	9		No			Joint Seal	
2412	KENYON DRIVE	17051	402-142-12	E2	2	1727	Driveway	PCC	Spalling	1/2" to 1"	1.5		No			Replace C&G	
2414	KENYON DRIVE	17071	402-142-13	E2	2	1727	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	Prev grind
2413	KENYON DRIVE	17071	402-142-13	E2	2	1727	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
2416	KENYON DRIVE	17071	402-142-13	E2	2	1727	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
2415	KENYON DRIVE	17071	402-142-13	E2	2	1727	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
2399	KENYON DRIVE	17082	402-142-25	E2	2	1727	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		Yes			Grind	
2400	KENYON DRIVE	17082	402-142-25	E2	2	1727	Driveway	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
2418	KENYON DRIVE	17091	402-142-14	E2	2	1727	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
2417	KENYON DRIVE	17091	402-142-14	E2	2	1727	Driveway	PCC	Linear Cracking	1/4" to 1/2"	9		No			Grind	
2420	KENYON DRIVE	17111	402-142-15	E2	2	1727	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		Yes			Ramp	
2419	KENYON DRIVE	17111	402-142-15	E2	2	1727	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
2398	KENYON DRIVE	17112	402-142-20	E2	2	1727	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
2421	KENYON DRIVE	17131	402-142-21	E2	2	1727	Driveway	PCC	Corner Break	1/4" to 1/2"	3		No			Grind	
2423	KENYON DRIVE	17131	402-142-21	E2	2	1727	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
2422	KENYON DRIVE	17131	402-142-21	E2	2	1727	Sidewalk	PCC	Linear Cracking	No Displacement	8	1"	No			Joint Seal	
11175	LOCKWOOD PARK PLACE	135	401-532-29	C3	2	1754	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes		Yes	Grind	Prev grind
11173	LOCKWOOD PARK PLACE	135	401-532-29	C3	2	1754	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No		Yes	Grind	
11174	LOCKWOOD PARK PLACE	135	401-532-29	C3	2	1754	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	2.5		Yes		Yes	Grind	
11187	LOCKWOOD PARK PLACE	140	401-533-13	C3	2	1754	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
11188	LOCKWOOD PARK PLACE	140	401-533-13	C3	2	1754	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
11185	LOCKWOOD PARK PLACE	150	401-533-12	C3	2	1754	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	Prev grind
11186	LOCKWOOD PARK PLACE	150	401-533-12	C3	2	1754	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	Prev grind
11183	LOCKWOOD PARK PLACE	160	401-533-11	C3	2	1754	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
11184	LOCKWOOD PARK PLACE	160	401-533-11	C3	2	1754	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
11176	LOCKWOOD PARK PLACE	165	401-532-32	C3	2	1754	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
11177	LOCKWOOD PARK PLACE	165	401-532-32	C3	2	1754	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
11178	LOCKWOOD PARK PLACE	175	401-532-33	C3	2	1754	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	Prev grind
11179	LOCKWOOD PARK PLACE	175	401-532-33	C3	2	1754	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
11180	LOCKWOOD PARK PLACE	185	401-532-34	C3	2	1754	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
11181	LOCKWOOD PARK PLACE	195	401-532-35	C3	2	1754	Sidewalk	PCC	Faulting	1/2" to 1"	1		Yes			Ramp	
11182	LOCKWOOD PARK PLACE	195	401-532-35	C3	2	1754	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
10506	LORELEI LANE	16501	402-271-05	D2	2	1755	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
10502	LORELEI LANE	16512	402-271-07	D2	2	1755	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10505	LORELEI LANE	16521	402-271-03	D2	2	1755	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
10503	LORELEI LANE	16562	402-271-12	D2	2	1755	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
10504	LORELEI LANE	16562	402-271-12	D2	2	1755	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
6318	MAIN ST	100	401-622-04	D3	2	1038	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes		Yes	Grind	
6246	MAIN ST	13771	401-611-06	D3	2	1041	Cross Gutter	PCC	Divided Slab	1/4" to 1/2"	12		No			Replace Slab	Ned
6247	MAIN ST	13771	401-611-06	D3	2	1041	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
6245	MAIN ST	13771	401-611-06	D3	2	1041	Cross Gutter	PCC	Linear Cracking	1/4" to 1/2"	12		No			Grind	
6244	MAIN ST	13771	401-611-06	D3	2	1041	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	6		No			Grind	
6316	MAIN ST	138	401-622-02	D3	2	1038	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	6		Yes		Yes	Grind	
6311	MAIN ST	145	401-573-07	D3	2	1038	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		Yes		Yes	Grind	Prev grind
6309	MAIN ST	145	401-573-07	D3	2	1038	Sidewalk	PCC	Corner Break	No Displacement	2		Yes		Yes	Patch	
6308	MAIN ST	145	401-573-07	D3	2	1038	Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	20		Yes		Yes	Replace Slab(s)	
6310				D3	2	1038	Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	12		Yes		Yes	Replace Slab(s)	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
6312	MAIN ST	145	401-573-07	D3	2	1038	Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	7		Yes		Yes	Replace Slab(s)	
6314	MAIN ST	150	401-622-01	D3	2	1038	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	6		Yes		Yes	Grind	
6315	MAIN ST	150	401-622-01	D3	2	1038	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	6		Yes		Yes	Grind	
11366	MAIN ST	15202	402-271-16	D2	2	1032	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	4		No			Grind	
11337	MAIN ST	15401	402-011-01	D2	2	1031	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
11338	MAIN ST	15401	402-011-01	D2	2	1031	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
11341	MAIN ST	15401	402-011-01	D2	2	1031	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
11342	MAIN ST	15401	402-011-01	D2	2	1031	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
11344	MAIN ST	15401	402-011-01	D2	2	1031	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
11340	MAIN ST	15401	402-011-01	D2	2	1031	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	12		Yes			Replace Slab	
11367	MAIN ST	15401	402-011-01	D2	2	1031	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	15		Yes			Replace Slab	
11343	MAIN ST	15401	402-011-01	D2	2	1031	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	10		Yes			Grind	
11345	MAIN ST	15401	402-011-01	D2	2	1031	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	10		Yes			Grind	
11339	MAIN ST	15401	402-011-01	D2	2	1031	Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	12		Yes			Replace Slab(s)	
6225	MAIN ST	160	401-623-02	D3	2	1039	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	7		Yes		Yes	Replace Slab	
6224	MAIN ST	160	401-623-02	D3	2	1039	Sidewalk	PCC	Spalling	1" to 2"	1		Yes		Yes	Patch	
11347	MAIN ST	16282	402-061-01	D2	2	1031	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	10		No			Grind	
11346	MAIN ST	16282	402-061-01	D2	2	1031	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	6		Yes			Grind	
11360	MAIN ST	16481	402-202-03	D2	2	1031	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No		Yes	Grind	
11361	MAIN ST	16481	402-202-03	D2	2	1031	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No		Yes	Grind	
11364	MAIN ST	16481	402-202-03	D2	2	1033	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No		Yes	Grind	
11363	MAIN ST	16481	402-202-03	D2	2	1033	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	8		Yes		Yes	Replace Slab	
11362	MAIN ST	16481	402-202-03	D2	2	1031	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	15		No		Yes	Grind	
11365	MAIN ST	16791	402-191-10	D2	2	1033	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No		Yes	Grind	
6226	MAIN ST	174	401-623-17	D3	2	1039	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	4		Yes		Yes	Grind	
6227	MAIN ST	180	401-623-18	D3	2	1039	Driveway	PCC	Corner Break	1/4" to 1/2"	3		No		Yes	Grind	
6228	MAIN ST	180	401-623-18	D3	2	1039	Driveway	PCC	Corner Break	1/4" to 1/2"	3		No		Yes	Grind	
6229	MAIN ST	180	401-623-18	D3	2	1039	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	3		No		Yes	Grind	
6303	MAIN ST	191	401-585-14	D3	2	1039	Sidewalk	Brick	Sidewalk Curb Separation	Over 2"	6		Yes		Yes	AC Patch	
6237	MAIN ST	220	401-623-04	D3	2	1040	Sidewalk	PCC	Faulting	1" to 2"	10		No		Yes	Replace Slab	Util cover
6231	MAIN ST	220	401-623-04	D3	2	1040	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No		Yes	Grind	
6233	MAIN ST	220	401-623-04	D3	2	1040	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes		Yes	Grind	
6234	MAIN ST	220	401-623-04	D3	2	1040	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No		Yes	Grind	
6235	MAIN ST	220	401-623-04	D3	2	1040	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No		Yes	Grind	
6236	MAIN ST	220	401-623-04	D3	2	1040	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes		Yes	Grind	
6230	MAIN ST	220	401-623-04	D3	2	1040	Driveway	PCC	Linear Cracking	1/4" to 1/2"	7		No		Yes	Grind	
6238	MAIN ST	220	401-623-04	D3	2	1040	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	7		Yes		Yes	Grind	
6232	MAIN ST	220	401-623-04	D3	2	1040	Sidewalk	PCC	Spalling	1/2" to 1"	1		Yes		Yes	Replace C&G	
6356	MAIN ST	225	401-574-03	D3	2	1037	Sidewalk	PCC	Faulting	1/2" to 1"	8		Yes		Yes	Ramp	Prev grind
6352	MAIN ST	225	401-574-03	D3	2	1037	Sidewalk	PCC	Buckled Slab	Over 2"	6		Yes		Yes	Replace Slab	
6313	MAIN ST	225	401-574-03	D3	2	1037	Sidewalk	PCC	Divided Slab	1/4" to 1/2"	8		No		Yes	Replace Slab	
6348	MAIN ST	225	401-574-03	D3	2	1037	Sidewalk	PCC	Divided Slab	1/4" to 1/2"	8		Yes		Yes	Replace Slab	
6351	MAIN ST	225	401-574-03	D3	2	1037	Sidewalk	PCC	Faulting	1" to 2"	3		Yes		Yes	Replace Slab	
6353	MAIN ST	225	401-574-03	D3	2	1037	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No		Yes	Grind	
6350	MAIN ST	225	401-574-03	D3	2	1037	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	5		Yes		Yes	Grind	
6357	MAIN ST	225	401-574-03	D3	2	1037	Sidewalk	PCC	Patch / Utility Cut	1/2" to 1"	3		Yes		Yes	Grind	
6349	MAIN ST	225	401-574-03	D3	2	1037	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	5		Yes		Yes	Grind	
6354	MAIN ST	225	401-574-03	D3	2	1037	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	4		Yes		Yes	Grind	
6355	MAIN ST	225	401-574-03	D3	2	1037	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	6		Yes		Yes	Grind	
6358	MAIN ST	225	401-574-03	D3	2	1037	Sidewalk	PCC	Spalling	1" to 2"	1		Yes		Yes	Patch	
6347	MAIN ST	225	401-574-03	D3	2	1037	Curb/Gutter	PCC	Spalling	1/2" to 1"	2		No		Yes	Replace C&G	
7362	MAIN ST	225	401-574-03	D3	2	1037	Curb/Gutter	PCC	Spalling	1/4" to 1/2"	2		No		Yes	Grind	
6296	MAIN ST	235	401-582-03	D3	2	1040	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	6		Yes		Yes	Grind	Prev grind
6295	MAIN ST	235	401-582-03	D3	2	1040	Sidewalk	PCC	Linear Cracking	No Displacement	30		Yes		Yes	Joint Seal	Slight displacement
6299	MAIN ST	235	401-582-03	D3	2	1040	Sidewalk	PCC	Other - Leave Comment	1/2" to 1"	5		No		Yes	Grind	Util cover
6297	MAIN ST	235	401-582-03	D3	2	1040	Sidewalk	PCC	Buckled Slab	Over 2"			Yes		Yes	Replace Slab	
6298	MAIN ST	235	401-582-03	D3	2	1040	Sidewalk	PCC	Buckled Slab	Over 2"			Yes		Yes	Replace Slab	
6300	MAIN ST	235	401-582-03	D3	2	1040	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes		Yes	Grind	
6301	MAIN ST	235	401-582-03	D3	2	1040	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	10		Yes		Yes	Replace Slab	
6302	MAIN ST	235	401-582-03	D3	2	1040	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	15		Yes		Yes	Replace Slab	
6292	MAIN ST	300	401-592-16	D3	2	1041	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No		Yes	Grind	
6294	MAIN ST	300	401-592-16	D3	2	1041	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No		Yes	Grind	
6293	MAIN ST	300	401-592-16	D3	2	1041	Sidewalk	PCC	Spalling	1/2" to 1"	0.5		No		Yes	Replace C&G	
6337			)	D3	2	1037	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
6335	MAIN ST	320	401-372-10	D3	2	1037	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
6336	MAIN ST	320	401-372-10	D3	2	1037	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
6333	MAIN ST	340	401-372-08	D3	2	1037	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		Yes			Grind	Prev grind
6334	MAIN ST	340	401-372-08	D3	2	1037	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		Yes			Grind	Prev grind
6370	MAIN ST	345	401-563-05	D3	2	1037	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
6371	MAIN ST	345	401-563-05	D3	2	1037	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
6491	MAIN ST	345	401-542-14	D2	2	1035	Curb/Gutter	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind C&G	
6492	MAIN ST	345	401-542-14	D2	2	1035	Sidewalk	PCC	Faulting	1/2" to 1"	2		Yes			Ramp	
6367	MAIN ST	345	401-563-05	D3	2	1037	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
6369	MAIN ST	345	401-563-05	D3	2	1037	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
6368	MAIN ST	345	401-563-05	D3	2	1037	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	5		Yes			Grind	
6493	MAIN ST	350	401-543-16	D2	2	1035	Sidewalk	PCC	Faulting	1/2" to 1"	2		Yes			Ramp	
6360	MAIN ST	350	401-563-04	D3	2	1037	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
6361	MAIN ST	350	401-563-04	D3	2	1037	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
6362	MAIN ST	350	401-563-04	D3	2	1037	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
6363	MAIN ST	350	401-563-04	D3	2	1037	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		Yes			Grind	
6364	MAIN ST	350	401-563-04	D3	2	1037	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		Yes			Grind	
6359	MAIN ST	350	401-563-04	D3	2	1037	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	5		Yes			Replace Slab	
6365	MAIN ST	350	401-563-04	D3	2	1037	Sidewalk	PCC	Spalling	1/2" to 1"	2		Yes			Replace C&G	
6366	MAIN ST	350	401-563-04	D3	2	1037	Sidewalk	PCC	Spalling	1/2" to 1"	5		No			Replace C&G	
6494	MAIN ST	350	401-543-16	D2	2	1035	Sidewalk	PCC	Spalling	1/2" to 1"	2		No			Replace C&G	
6304	MAIN ST	397	401-585-06	D3	2	1039	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes		Yes	Grind	
6305	MAIN ST	397	401-585-06	D3	2	1039	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	6		Yes		Yes	Grind	
6332	MAIN ST	400	401-372-06	D3	2	1036	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
6222	MAIN ST	405	401-623-01	D3	2	1039	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	10		Yes		Yes	Grind	
6223	MAIN ST	405	401-623-01	D3	2	1039	Driveway	PCC	Spalling	1/2" to 1"	1		No		Yes	Replace C&G	
6373	MAIN ST	415	401-363-04	D3	2	1036	Sidewalk	PCC	Faulting	1/2" to 1"	2		No			Ramp	
6372	MAIN ST	415	401-363-04	D3	2	1036	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
6331	MAIN ST	420	401-372-05	D3	2	1036	Sidewalk	PCC	Faulting	1/2" to 1"	6		Yes			Ramp	Prev grind
6330	MAIN ST	420	401-372-05	D3	2	1036	Sidewalk	PCC	Faulting	1/2" to 1"	6		No			Ramp	
6317	MAIN ST	420	401-622-18	D3	2	1038	Driveway	PCC	Spalling	1/2" to 1"	1		No		Yes	Replace C&G	
6328	MAIN ST	430	401-372-04	D3	2	1036	Driveway	PCC	Corner Break	No Displacement	5		No			Patch	
6329	MAIN ST	430	401-372-04	D3	2	1036	Driveway	PCC	Linear Cracking	1/4" to 1/2"	5		No			Grind	
6327	MAIN ST	430	401-372-04	D3	2	1036	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
6325	MAIN ST	440	401-372-03	D3	2	1036	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
6326	MAIN ST	440	401-372-03	D3	2	1036	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
6374	MAIN ST	445	401-363-06	D3	2	1036	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
6375	MAIN ST	455	401-363-07	D3	2	1036	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
6248	MAIN ST	535	401-612-04	D3	2	1041	Sidewalk	PCC	Corner Break	1/2" to 1"	6		No		Yes	Ramp	
6377	MAIN ST	535	401-364-03	D3	2	1036	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No		Yes	Grind	
6251	MAIN ST	535	401-612-04	D3	2	1041	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No		Yes	Grind	
6249	MAIN ST	535	401-612-04	D3	2	1041	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	8		No		Yes	Grind	
6250	MAIN ST	535	401-612-04	D3	2	1041	Sidewalk	PCC	Spalling	1" to 2"	1		No		Yes	Patch	
6505	MAIN ST	615	401-552-06	D2	2	1035	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	Prev grind
6506	MAIN ST	615	401-552-06	D2	2	1035	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
6379	MAIN ST	620	401-371-02	D2	2	1036	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
6473	MAIN ST	630	401-371-01	D2	2	1035	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
6504	MAIN ST	635	401-552-07	D2	2	1035	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
6474	MAIN ST	644	401-331-02	D2	2	1035	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	Prev grind
6476	MAIN ST	644	401-331-02	D2	2	1035	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
6481	MAIN ST	644	401-331-02	D2	2	1035	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
6482	MAIN ST	644	401-331-02	D2	2	1035	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
6483	MAIN ST	644	401-331-02	D2	2	1035	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
6484	MAIN ST	644	401-331-02	D2	2	1035	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
6475	MAIN ST	644	401-331-02	D2	2	1035	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	Prev grind
6488	MAIN ST	644	401-331-02	D2	2	1035	Driveway	PCC	Divided Slab	1" to 2"	10		No			Replace Slab(s)	
6490	MAIN ST	644	401-331-02	D2	2	1035	Driveway	PCC	Divided Slab	1" to 2"	15		No			Replace Slab(s)	
6480	MAIN ST	644	401-331-02	D2	2	1035	Sidewalk	PCC	Divided Slab	1/2" to 1"	5		Yes			Replace Slab	
6477	MAIN ST	644	401-331-02	D2	2	1035	Sidewalk	PCC	Faulting	1/2" to 1"	3		No			Ramp	
6478	MAIN ST	644	401-331-02	D2	2	1035	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No			Grind	
6485	MAIN ST	644	401-331-02	D2	2	1035	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
6486	MAIN ST	644	401-331-02	D2	2	1035	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
6479	MAIN ST	644	401-331-02	D2	2	1035	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
6487				D2	2	1035	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
6489	MAIN ST	644	401-331-02	D2	2	1035	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	2		Yes			Grind	
6503	MAIN ST	645	401-552-08	D2	2	1035	Driveway	PCC	Linear Cracking	1/4" to 1/2"	7		No			Grind	
6502	MAIN ST	665	401-552-09	D2	2	1035	Sidewalk	PCC	Buckled Slab	1" to 2"	5		Yes			Replace Slab	
6501	MAIN ST	665	401-552-09	D2	2	1035	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
6500	MAIN ST	675	401-552-10	D2	2	1035	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
6496	MAIN ST	725	401-542-12	D2	2	1035	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
11357	MAIN ST		402-011-01	D2	2	1031	Sidewalk	PCC	Faulting	1/4" to 1/2"	10		No			Grind	At grate/patch Prev grind
11352	MAIN ST		402-061-01	D2	2	1031	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	
6240	MAIN ST		401-623-05	D3	2	1040	Sidewalk	PCC	Faulting	1/2" to 1"	5		No		Yes	Ramp	
6241	MAIN ST		401-623-05	D3	2	1040	Sidewalk	PCC	Faulting	1/2" to 1"	5		No		Yes	Ramp	
11348	MAIN ST		402-061-01	D2	2	1031	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
6243	MAIN ST		401-623-05	D3	2	1040	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No		Yes	Grind	
11358	MAIN ST		402-011-01	D2	2	1031	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
11359	MAIN ST		402-011-01	D2	2	1031	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
11349	MAIN ST		402-061-01	D2	2	1031	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
11350	MAIN ST		402-061-01	D2	2	1031	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
11351	MAIN ST		402-061-01	D2	2	1031	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
11354	MAIN ST		402-061-07	D2	2	1031	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
11355	MAIN ST		402-061-07	D2	2	1031	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
6242	MAIN ST		401-623-05	D3	2	1040	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	7		Yes		Yes	Grind	
6307	MAIN ST		401-573-13	D3	2	1038	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	10		Yes		Yes	Replace Slab	
6306	MAIN ST		401-573-13	D3	2	1038	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	10		Yes		Yes	Grind	
6239	MAIN ST		401-623-05	D3	2	1040	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	7		Yes		Yes	Grind	
11356	MAIN ST		402-011-01	D2	2	1031	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	10		No			Grind	
11353	MAIN ST		402-061-01	D2	2	1031	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	10		Yes			Grind	
6495	MAIN ST		401-543-16	D2	2	1035	Sidewalk	PCC	Temporary Ramp	Over 2"	4		No			Replace Slab	
11420	McFADDEN AVENUE	14311	402-331-25	E3	2	1149	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No		Yes	Grind	
11421	McFADDEN AVENUE	14311	402-331-25	E3	2	1149	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes		Yes	Grind	
11453	McFADDEN AVENUE	14391	402-152-04	E3	2	1149	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No		Yes	Grind	
11368	McFADDEN AVENUE	15701	402-031-07	E2	2	1145	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No		Yes	Grind	
11369	McFADDEN AVENUE	15701	402-031-07	E2	2	1145	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
11380	McFADDEN AVENUE	15742	402-301-01	E2	2	1146	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev work
11373	McFADDEN AVENUE	15742	402-301-01	E2	2	1146	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
11374	McFADDEN AVENUE	15742	402-301-01	E2	2	1146	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
11375	McFADDEN AVENUE	15742	402-301-01	E2	2	1146	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
11376	McFADDEN AVENUE	15742	402-301-01	E2	2	1146	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
11377	McFADDEN AVENUE	15742	402-301-01	E2	2	1146	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
11378	McFADDEN AVENUE	15742	402-301-01	E2	2	1146	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		Yes			Grind	
11379	McFADDEN AVENUE	15742	402-301-01	E2	2	1146	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
11381	McFADDEN AVENUE	15742	402-301-01	E2	2	1146	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
11382	McFADDEN AVENUE	15742	402-301-01	E2	2	1146	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
11383	McFADDEN AVENUE	15742	402-301-01	E2	2	1146	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
11969	McFADDEN AVENUE	15742	402-301-01	E2	2	1146	Curb/Gutter	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
11392	McFADDEN AVENUE	15762	402-252-07	E2	2	1147	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	30		No		Yes	Grind	
11415	McFADDEN AVENUE	15771	402-384-15	E2	2	1148	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
11412	McFADDEN AVENUE	15802	402-123-01	E2	2	1149	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
8809	McFADDEN AVENUE	15811	402-121-04	E2	2	1000	Sidewalk	PCC	Spalling	1/2" to 1"	3		No			Replace C&G	
8808	McFADDEN AVENUE	15811	402-121-04	E2	2	1000	Sidewalk	PCC	Spalling	1/4" to 1/2"	2		No			Grind	
8810	McFADDEN AVENUE	15811	402-121-04	E2	2	1000	Sidewalk	PCC	Spalling	1/4" to 1/2"	3		No			Grind	
8811	McFADDEN AVENUE	15811	402-121-04	E2	2	1000	Sidewalk	PCC	Spalling	1/4" to 1/2"	3		No			Grind	
11372	McFADDEN AVENUE	16471	402-031-04	E2	2	1145	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No		Yes	Grind	
11384	McFADDEN AVENUE	16661	402-301-02	E2	2	1146	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
11385	McFADDEN AVENUE	16661	402-301-02	E2	2	1146	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
11388	McFADDEN AVENUE	16661	402-301-02	E2	2	1146	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No		Yes	Grind	
11386	McFADDEN AVENUE	16661	402-301-02	E2	2	1146	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	3		No			Grind	
11387	McFADDEN AVENUE	16661	402-301-02	E2	2	1146	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	3		No			Grind	
11389	McFADDEN AVENUE	16791	402-301-08	E2	2	1146	Driveway	PCC	Faulting	1/4" to 1/2"	3		No		Yes	Grind Driveway	
11390	McFADDEN AVENUE	16791	402-301-08	E2	2	1146	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No		Yes	Grind	
11391	McFADDEN AVENUE	16801	402-301-05	E2	2	1146	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No		Yes	Grind	
8683	McFADDEN AVENUE	17045	402-172-16	E2	2	1000	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
11413	McFADDEN AVENUE	17102	402-122-03	E2	2	1148	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No		Yes	Grind	
11416	McFADDEN AVENUE	17192	402-381-19	E2	2	1149	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
11411	McFADDEN AVENUE	17200	402-151-01	E2	2	1149	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
11408				E2	2	1149	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	



3548 Seagate Way, Suite 230
Oceanside, CA 92056
T: (760) 216-6529
www.bucknam-inc.com

Bucknam understands that the City will make all final decisions on sidewalk improvement types and repair locations

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
11410	McFADDEN AVENUE	17200	402-151-01	E2	2	1149	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
11409	McFADDEN AVENUE	17200	402-151-01	E2	2	1149	Driveway	PCC	Linear Cracking	1/4" to 1/2"	3	1	No			Grind	
11417	McFADDEN AVENUE	17242	402-381-15	E2	2	1149	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
11407	McFADDEN AVENUE	17272	402-151-02	E2	2	1149	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
11418	McFADDEN AVENUE	17282	402-381-12	E3	2	1149	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	10		No			Grind	
11452	McFADDEN AVENUE	17292	402-152-05	E3	2	1149	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	6		No		Yes	Grind	
8624	McFADDEN AVENUE	17311	402-331-17	E3	2	1149	Cross Gutter	PCC	Other - Leave Comment	1/4" to 1/2"			No			Grind	Half of cross gutter scaling
8623	McFADDEN AVENUE	17311	402-331-17	E3	2	1149	Cross Gutter	PCC	Linear Cracking	1/2" to 1"	10		No			Replace Slab(s)	
11419	McFADDEN AVENUE	17341	402-331-16	E3	2	1149	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No		Yes	Grind	
11370	McFADDEN AVENUE		402-061-07	E2	2	1145	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
11371	McFADDEN AVENUE		402-061-07	E2	2	1145	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
11414	McFADDEN AVENUE		402-171-04	E2	2	1148	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
8684	McFADDEN AVENUE		402-172-16	E2	2	1000	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
8869	MEDALLION AVENUE	15731	402-172-15	E2	2	1769	Cross Gutter	PCC	Linear Cracking	1/4" to 1/2"	5		No			Grind	
8560	MEDALLION AVENUE	15751	402-383-11	E2	2	1770	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
8564	MEDALLION AVENUE	15751	402-383-11	E2	2	1770	Cross Gutter	PCC	Other - Leave Comment	1/4" to 1/2"	20		No			Patch	Scaling
8565	MEDALLION AVENUE	15751	402-382-10	E3	2	1770	Sidewalk	PCC	Linear Cracking	No Displacement	6		Yes			Joint Seal	Slight displacement
8562	MEDALLION AVENUE	15751	402-383-11	E2	2	1770	Sidewalk	PCC	Buckled Slab	1/4" to 1/2"	10		Yes			Replace Slab(s)	Slight tent
8563	MEDALLION AVENUE	15751	402-383-11	E2	2	1770	Cross Gutter	PCC	Corner Break	1/2" to 1"	1		No			Ramp	
8561	MEDALLION AVENUE	15751	402-383-11	E2	2	1770	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	
8559	MEDALLION AVENUE	15751	402-383-11	E2	2	1770	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
8558	MEDALLION AVENUE	15752	402-383-12	E2	2	1770	Driveway	PCC	Divided Slab	No Displacement	18		No			Replace Slab(s)	
8870	MEDALLION AVENUE	17045	402-172-16	E2	2	1769	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
8463	MEDALLION AVENUE	17192	402-381-19	E2	2	1770	Cross Gutter	PCC	Linear Cracking	1/2" to 1"	6		Yes			Replace Slab	
8468	MEDALLION AVENUE	17192	402-381-19	E2	2	1770	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	2		No			Grind	
8471	MEDALLION AVENUE	17202	402-381-18	E2	2	1770	Sidewalk	PCC	Divided Slab	1/4" to 1/2"	8		No			Replace Slab	
8475	MEDALLION AVENUE	17212	402-381-17	E2	2	1770	Driveway	PCC	Sidewalk Curb Separation	1" to 2"	20		No			Replace Driveway	Prev grind
8478	MEDALLION AVENUE	17212	402-381-17	E2	2	1770	Sidewalk	PCC	Buckled Slab	1/2" to 1"	14		Yes			Replace Slab(s)	Tilted
8473	MEDALLION AVENUE	17212	402-381-17	E2	2	1770	Sidewalk	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
8479	MEDALLION AVENUE	17232	402-381-16	E2	2	1770	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	Prev grind
8480	MEDALLION AVENUE	17232	402-381-16	E2	2	1770	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
8485	MEDALLION AVENUE	17242	402-381-15	E2	2	1770	Sidewalk	PCC	Corner Break	1/4" to 1/2"	2		Yes			Grind	
8482	MEDALLION AVENUE	17242	402-381-15	E2	2	1770	Sidewalk	PCC	Divided Slab	1/4" to 1/2"	10		No			Replace Slab	
8483	MEDALLION AVENUE	17242	402-381-15	E2	2	1770	Sidewalk	PCC	Divided Slab	No Displacement	8		No			Replace Slab(s)	
8487	MEDALLION AVENUE	17252	402-381-14	E2	2	1770	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
8489	MEDALLION AVENUE	17262	402-381-13	E3	2	1770	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
8607	MITCHELL AVENUE	14111	402-371-40	E3	2	1782	Curb/Gutter	PCC	Spalling	1/2" to 1"	3		No			Replace C&G	
8610	MITCHELL AVENUE	14121	402-331-07	E3	2	1782	Driveway	PCC	Linear Cracking	1/4" to 1/2"	8		No		Yes	Grind	
8611	MITCHELL AVENUE	14121	402-331-07	E3	2	1782	Driveway	PCC	Linear Cracking	1/4" to 1/2"	8		No		Yes	Grind	
8613	MITCHELL AVENUE	17432	402-331-24	E3	2	1782	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		Yes			Grind	Prev grind
8612	MITCHELL AVENUE	17450	402-331-05	E3	2	1782	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes		Yes	Grind	
7604	MOUNTAIN VIEW DRIVE	128	401-521-15	D2	2	1790	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No		Yes	Grind	
7589	MOUNTAIN VIEW DRIVE	129	401-522-26	D3	2	1790	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
7603	MOUNTAIN VIEW DRIVE	138	401-521-17	C2	2	1790	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
7590	MOUNTAIN VIEW DRIVE	155	401-522-04	C3	2	1790	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	4		No			Grind	
7591	MOUNTAIN VIEW DRIVE	165	401-522-25	C3	2	1790	Driveway	PCC	Sidewalk Curb Separation	1/2" to 1"	5		Yes			Patch	
7602	MOUNTAIN VIEW DRIVE	168	401-521-23	C2	2	1790	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
7601	MOUNTAIN VIEW DRIVE	17332	401-512-01	C2	2	1790	Driveway	PCC	Other - Leave Comment	1/4" to 1/2"			No			Patch	Scaling
7599	MOUNTAIN VIEW DRIVE	17332	401-512-01	C2	2	1790	Sidewalk	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
7600	MOUNTAIN VIEW DRIVE	17332	401-512-01	C2	2	1790	Sidewalk	PCC	Spalling	1/4" to 1/2"	3		No			Grind	
7594	MOUNTAIN VIEW DRIVE	17400	401-513-01	C3	2	1790	Sidewalk	PCC	Other - Leave Comment	1/2" to 1"		3"	No			Grind	Hole
7593	MOUNTAIN VIEW DRIVE	17400	401-513-01	C3	2	1790	Driveway	PCC	Linear Cracking	1/2" to 1"	4		No			Grind	
7595	MOUNTAIN VIEW DRIVE	17400	401-513-01	C3	2	1790	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	25		No			Grind	
7592	MOUNTAIN VIEW DRIVE	17400	401-513-01	C3	2	1790	Curb/Gutter	PCC	Spalling	Over 2"	1		No			Replace C&G	
7588	MOUNTAIN VIEW DRIVE	465	401-522-10	D3	2	1790	Ramp	PCC	Divided Slab	No Displacement	18		No		Yes	Replace Slab(s)	
7605	MOUNTAIN VIEW DRIVE	501	401-521-14	D2	2	1790	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes		Yes	Grind	
11106	MYRTLE AVENUE	140	401-302-05	C2	2	1801	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No		Yes	Grind	
8778	MYRTLE AVENUE	14701	402-133-07	E2	2	1798	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
11108	MYRTLE AVENUE	14851	401-302-14	C2	2	1801	Sidewalk	PCC	Faulting	1/2" to 1"	4		No		Yes	Ramp	
11107	MYRTLE AVENUE	14851	401-302-14	C2	2	1801	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes		Yes	Grind	
11109	MYRTLE AVENUE	14851	401-302-14	C2	2	1801	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No		Yes	Grind	
8538	MYRTLE AVENUE	15482	402-351-04	E2	2	1799	Driveway	PCC	Faulting	1/4" to 1/2"	5		No			Grind Driveway	
8536	MYRTLE AVENUE	15482	402-351-04	E2	2	1799	Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	5		No			Grind	
8533				E2	2	1799	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	16		Yes			Replace Slab	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
8535	MYRTLE AVENUE	15482	402-351-04	E2	2	1799	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	6		Yes			Grind	
8541	MYRTLE AVENUE	15622	402-383-22	E2	2	1799	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
8540	MYRTLE AVENUE	15622	402-383-22	E2	2	1799	Cross Gutter	PCC	Linear Cracking	1/4" to 1/2"	7		No			Grind	
8543	MYRTLE AVENUE	15632	402-383-21	E2	2	1799	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
8591	MYRTLE AVENUE	15661	402-384-06	E2	2	1799	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
8589	MYRTLE AVENUE	15661	402-384-06	E2	2	1799	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
8592	MYRTLE AVENUE	15661	402-384-06	E2	2	1799	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
8593	MYRTLE AVENUE	15661	402-384-06	E2	2	1799	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
8590	MYRTLE AVENUE	15661	402-384-06	E2	2	1799	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
8594	MYRTLE AVENUE	15671	402-384-07	E2	2	1799	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
8595	MYRTLE AVENUE	15671	402-384-07	E2	2	1799	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
8596	MYRTLE AVENUE	15671	402-384-07	E2	2	1799	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
8544	MYRTLE AVENUE	15672	402-383-18	E2	2	1799	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
8546	MYRTLE AVENUE	15672	402-383-18	E2	2	1799	Sidewalk	PCC	Corner Break	1/4" to 1/2"	4		No			Grind	
8598	MYRTLE AVENUE	15681	402-384-08	E2	2	1799	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	Prev grind
8597	MYRTLE AVENUE	15681	402-384-08	E2	2	1799	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
8599	MYRTLE AVENUE	15681	402-384-08	E2	2	1799	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
8547	MYRTLE AVENUE	15682	402-383-17	E2	2	1799	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight displacement
8548	MYRTLE AVENUE	15682	402-383-17	E2	2	1799	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
8600	MYRTLE AVENUE	15701	402-384-09	E2	2	1799	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
8549	MYRTLE AVENUE	15702	402-383-16	E2	2	1799	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
8550	MYRTLE AVENUE	15702	402-383-16	E2	2	1799	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
8555	MYRTLE AVENUE	15712	402-383-15	E2	2	1799	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	Prev grind
8553	MYRTLE AVENUE	15712	402-383-15	E2	2	1799	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
8554	MYRTLE AVENUE	15712	402-383-15	E2	2	1799	Driveway	PCC	Sidewalk Curb Separation	1" to 2"	15		Yes			Replace Driveway	
8601	MYRTLE AVENUE	15731	402-384-11	E2	2	1799	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
8602	MYRTLE AVENUE	15731	402-384-11	E2	2	1799	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
8556	MYRTLE AVENUE	15732	402-383-14	E2	2	1799	Sidewalk	PCC	Divided Slab	No Displacement	5		No			Replace Slab(s)	
8603	MYRTLE AVENUE	15741	402-384-12	E2	2	1799	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
8557	MYRTLE AVENUE	15742	402-383-13	E2	2	1799	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	Slight displacement
8605	MYRTLE AVENUE	15761	402-384-14	E2	2	1799	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
8604	MYRTLE AVENUE	15761	402-384-14	E2	2	1799	Driveway	PCC	Linear Cracking	1/4" to 1/2"	8		No			Grind	
8606	MYRTLE AVENUE	15771	402-384-15	E2	2	1799	Sidewalk	PCC	Divided Slab	No Displacement	16		No			Replace Slab(s)	
8721	MYRTLE AVENUE	15802	402-123-01	E2	2	1798	Driveway	PCC	Linear Cracking	1/4" to 1/2"	5		No			Grind	
8722	MYRTLE AVENUE	15822	402-123-02	E2	2	1798	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
8720	MYRTLE AVENUE	15825	402-122-05	E2	2	1798	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
8723	MYRTLE AVENUE	15832	402-123-03	E2	2	1798	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
8725	MYRTLE AVENUE	15852	402-123-04	E2	2	1798	Driveway	PCC	Linear Cracking	1/4" to 1/2"	5		No			Grind	
8727	MYRTLE AVENUE	15852	402-123-04	E2	2	1798	Sidewalk	PCC	Linear Cracking	1/2" to 1"	4		Yes			Grind	
8724	MYRTLE AVENUE	15852	402-123-04	E2	2	1798	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
8726	MYRTLE AVENUE	15852	402-123-04	E2	2	1798	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	2		No			Grind	
8728	MYRTLE AVENUE	15862	402-123-05	E2	2	1798	Sidewalk	PCC	Divided Slab	No Displacement	12		Yes			Replace Slab(s)	
8729	MYRTLE AVENUE	15862	402-123-05	E2	2	1798	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
8730	MYRTLE AVENUE	15862	402-123-05	E2	2	1798	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
8719	MYRTLE AVENUE	15871	402-122-09	E2	2	1798	Driveway	PCC	Linear Cracking	1/4" to 1/2"	6		No			Grind	
8733	MYRTLE AVENUE	15872	402-123-06	E2	2	1798	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Prev grind
8732	MYRTLE AVENUE	15872	402-123-06	E2	2	1798	Driveway	PCC	Linear Cracking	1/4" to 1/2"	5		No			Grind	
8731	MYRTLE AVENUE	15872	402-123-06	E2	2	1798	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
8718	MYRTLE AVENUE	15881	402-122-10	E2	2	1798	Sidewalk	PCC	Spalling	1/4" to 1/2"	2		No			Grind	
8735	MYRTLE AVENUE	15882	402-123-07	E2	2	1798	Sidewalk	PCC	Linear Cracking	1/2" to 1"	4		No			Grind	
8734	MYRTLE AVENUE	15882	402-123-07	E2	2	1798	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
8717	MYRTLE AVENUE	15891	402-122-11	E2	2	1798	Driveway	PCC	Linear Cracking	1/4" to 1/2"	6		No			Grind	
8738	MYRTLE AVENUE	15892	402-123-08	E2	2	1798	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	Prev grind
8737	MYRTLE AVENUE	15892	402-123-08	E2	2	1798	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
8736	MYRTLE AVENUE	15892	402-123-08	E2	2	1798	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
8716	MYRTLE AVENUE	15911	402-122-12	E2	2	1798	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
8715	MYRTLE AVENUE	15911	402-122-12	E2	2	1798	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
8739	MYRTLE AVENUE	15912	402-123-09	E2	2	1798	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
8714	MYRTLE AVENUE	15921	402-122-13	E2	2	1798	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
8740	MYRTLE AVENUE	15922	402-123-10	E2	2	1798	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
8741	MYRTLE AVENUE	15922	402-123-10	E2	2	1798	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
8712	MYRTLE AVENUE	15941	402-122-14	E2	2	1798	Driveway	PCC	Linear Cracking	1/4" to 1/2"	5		No			Grind	
8713	MYRTLE AVENUE	15941	402-122-14	E2	2	1798	Sidewalk	PCC	Spalling	1/2" to 1"	2		Yes			Replace C&G	
8742				E2	2	1798	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
8744	MYRTLE AVENUE	15942	402-123-11	E2	2	1798	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
8747	MYRTLE AVENUE	15942	402-123-11	E2	2	1798	Curb/Gutter	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
8748	MYRTLE AVENUE	15942	402-123-11	E2	2	1798	Curb/Gutter	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
8743	MYRTLE AVENUE	15942	402-123-11	E2	2	1798	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
8745	MYRTLE AVENUE	15942	402-123-11	E2	2	1798	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
8746	MYRTLE AVENUE	15942	402-123-11	E2	2	1798	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
8752	MYRTLE AVENUE	15962	402-134-01	E2	2	1798	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
8753	MYRTLE AVENUE	15962	402-134-01	E2	2	1798	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
8754	MYRTLE AVENUE	15962	402-134-01	E2	2	1798	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
8750	MYRTLE AVENUE	15962	402-134-01	E2	2	1798	Driveway	PCC	Linear Cracking	1/4" to 1/2"	5		No			Grind	
8749	MYRTLE AVENUE	15962	402-134-01	E2	2	1798	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
8751	MYRTLE AVENUE	15962	402-134-01	E2	2	1798	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
8775	MYRTLE AVENUE	15981	402-133-06	E2	2	1798	Sidewalk	PCC	Faulting	1/2" to 1"	2		Yes			Ramp	Prev grind
8776	MYRTLE AVENUE	15981	402-133-06	E2	2	1798	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	Prev grind
8774	MYRTLE AVENUE	15981	402-133-06	E2	2	1798	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	
8777	MYRTLE AVENUE	15981	402-133-06	E2	2	1798	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
8755	MYRTLE AVENUE	16002	402-134-02	E2	2	1798	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
8756	MYRTLE AVENUE	16002	402-134-02	E2	2	1798	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
8711	MYRTLE AVENUE	17111	402-132-01	E2	2	1798	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	
8529	MYRTLE AVENUE	17191	402-385-09	E2	2	1799	Curb/Gutter	PCC	Spalling	1/2" to 1"	2		No			Replace C&G	
8464	MYRTLE AVENUE	17192	402-381-19	E2	2	1799	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	Prev grind
8462	MYRTLE AVENUE	17192	402-381-19	E2	2	1799	Cross Gutter	PCC	Linear Cracking	1/4" to 1/2"	8		No			Grind	
8461	MYRTLE AVENUE	17192	402-381-19	E2	2	1799	Curb/Gutter	PCC	Linear Cracking	1/2" to 1"	4		No			Grind	
8460	MYRTLE AVENUE	17192	402-381-19	E2	2	1799	Curb/Gutter	PCC	Linear Cracking	Over 2"	2		No			Replace C&G	
8465	MYRTLE AVENUE	17192	402-381-19	E2	2	1799	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
8467	MYRTLE AVENUE	17192	402-381-19	E2	2	1799	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	2		No			Grind	
11117	MYRTLE AVENUE	180	401-541-06	D2	2	1800	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
11118	MYRTLE AVENUE	205	401-551-31	D2	2	1800	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
11119	MYRTLE AVENUE	215	401-551-30	D2	2	1800	Sidewalk	PCC	Faulting	1/2" to 1"	2		Yes			Ramp	
11120	MYRTLE AVENUE	215	401-551-30	D2	2	1800	Sidewalk	PCC	Faulting	1/2" to 1"	2		Yes			Ramp	
11121	MYRTLE AVENUE	215	401-551-30	D2	2	1800	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		No			Ramp	
10914	MYRTLE AVENUE	280	401-542-05	D2	2	1800	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
10916	MYRTLE AVENUE	330	401-542-08	D2	2	1800	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
10915	MYRTLE AVENUE	330	401-542-08	D2	2	1800	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
11104	MYRTLE AVENUE	661	401-302-07	D2	2	1801	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No		Yes	Grind	
11105	MYRTLE AVENUE	661	401-302-07	D2	2	1801	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No		Yes	Grind	
11122	MYRTLE AVENUE	690	401-551-07	D2	2	1800	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No		Yes	Grind	
6498	MYRTLE AVENUE	695	401-552-12	D2	2	1800	Cross Gutter	PCC	Linear Cracking	1/2" to 1"	9		No			Replace Slab(s)	
6499	MYRTLE AVENUE	705	401-542-10	D2	2	1800	Cross Gutter	PCC	Other - Leave Comment	1/2" to 1"	30		No			Grind	Spalling
6497	MYRTLE AVENUE	705	401-542-10	D2	2	1800	Cross Gutter	PCC	Linear Cracking	1/4" to 1/2"	5		No			Grind	
11110	MYRTLE AVENUE	721	401-302-08	C2	2	1801	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes		Yes	Grind	
11111	MYRTLE AVENUE	721	401-302-08	C2	2	1801	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No		Yes	Grind	
11112	MYRTLE AVENUE	721	401-302-08	C2	2	1801	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes		Yes	Grind	
11113	MYRTLE AVENUE	721	401-302-08	C2	2	1801	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No		Yes	Grind	
11114	MYRTLE AVENUE	721	401-302-08	C2	2	1801	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		Yes		Yes	Grind	
11115	MYRTLE AVENUE	721	401-302-08	D2	2	1801	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No		Yes	Grind	
11116	MYRTLE AVENUE	730	401-541-02	D2	2	1800	Driveway	PCC	Linear Cracking	1/4" to 1/2"	2		No		Yes	Grind	
7965	NEWPORT AVENUE	13341	401-601-04	D3	2	1160	Sidewalk	PCC	Patch / Utility Cut	1" to 2"	2		No		Yes	Ramp	Util cover
7964	NEWPORT AVENUE	13451	401-601-06	D3	2	1160	Curb/Gutter	PCC	Spalling	1" to 2"	1		No		Yes	Patch	
7962	NEWPORT AVENUE	13561	401-612-05	D3	2	1175	Curb/Gutter	PCC	Linear Cracking	1" to 2"	3		No		Yes	Grind	
7961	NEWPORT AVENUE	13561	401-612-05	D3	2	1175	Driveway	PCC	Linear Cracking	1/4" to 1/2"	5		No		Yes	Grind	
7960	NEWPORT AVENUE	13561	401-612-05	D3	2	1175	Cross Gutter	PCC	Spalling	1/2" to 1"	0.5		No		Yes	Patch	
9331	NEWPORT AVENUE	13771	401-611-06	D3	2	1173	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
9332	NEWPORT AVENUE	13771	401-611-06	D3	2	1173	Sidewalk	PCC	Faulting	1/4" to 1/2"	6		Yes			Grind	Prev grind
9323	NEWPORT AVENUE	13771	401-611-06	D3	2	1175	Sidewalk	PCC	Corner Break	1/2" to 1"	4		Yes			Ramp	
9330	NEWPORT AVENUE	13771	401-611-06	D3	2	1173	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
9333	NEWPORT AVENUE	13771	401-611-06	D3	2	1173	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
9334	NEWPORT AVENUE	13771	401-611-06	D3	2	1173	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
9324	NEWPORT AVENUE	13771	401-611-06	D3	2	1175	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
9327	NEWPORT AVENUE	13771	401-611-06	D3	2	1175	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No			Grind	
9320	NEWPORT AVENUE	13771	401-611-06	D3	2	1175	Curb/Gutter	PCC	Linear Cracking	1/2" to 1"	6		No			Grind	
9322	NEWPORT AVENUE	13771	401-611-06	D3	2	1175	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	5		Yes			Grind	
9325	NEWPORT AVENUE	13771	401-611-06	D3	2	1175	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	7		Yes			Grind	
9319				i	D3	2	1175	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	2		No		Grind	



3548 Seagate Way, Suite 230
Oceanside, CA 92056
T: (760) 216-6529
www.bucknam-inc.com

Bucknam understands that the City will make all final decisions on sidewalk improvement types and repair locations

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
9321	NEWPORT AVENUE	13771	401-611-06	D3	2	1175	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	5		Yes			Grind	
9328	NEWPORT AVENUE	13771	401-611-06	D3	2	1175	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	7		No			Grind	
9326	NEWPORT AVENUE	13771	401-611-06	D3	2	1175	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	5		Yes			Grind	
9329	NEWPORT AVENUE	13771	401-611-06	D3	2	1173	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
9336	NEWPORT AVENUE	13821	401-642-11	D3	2	1173	Sidewalk	PCC	Faulting	1/4" to 1/2"	6		Yes			Grind	Prev grind
9335	NEWPORT AVENUE	13821	401-642-11	D3	2	1173	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
9337	NEWPORT AVENUE	13821	401-642-11	D3	2	1173	Cross Gutter	PCC	Linear Cracking	1/4" to 1/2"	12		No			Grind	
9341	NEWPORT AVENUE	13821	401-642-11	D3	2	1173	Curb/Gutter	PCC	Sidewalk Curb Separation	1" to 2"	6		No			Replace Curb	
9338	NEWPORT AVENUE	13891	401-642-10	D3	2	1173	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
9340	NEWPORT AVENUE	13891	401-642-10	D3	2	1173	Curb/Gutter	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
9339	NEWPORT AVENUE	13891	401-642-10	D3	2	1173	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
9342	NEWPORT AVENUE	14001	401-641-11	D3	2	1171	Sidewalk	PCC	Spalling	1/2" to 1"	3		No		Yes	Replace C&G	Util cover
9344	NEWPORT AVENUE	14001	401-641-11	D3	2	1171	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No		Yes	Grind	
9343	NEWPORT AVENUE	14001	401-641-11	D3	2	1171	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	3		No		Yes	Grind	
9345	NEWPORT AVENUE	14001	401-641-11	D3	2	1171	Sidewalk	PCC	Patch / Utility Cut	1" to 2"	2		No		Yes	Ramp	
9349	NEWPORT AVENUE	14041	402-371-36	E3	2	1162	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
9348	NEWPORT AVENUE	14041	402-371-36	E3	2	1162	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
9350	NEWPORT AVENUE	14041	402-371-36	E3	2	1162	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No			Grind	
9351	NEWPORT AVENUE	14041	402-371-36	E3	2	1162	Cross Gutter	PCC	Linear Cracking	1/4" to 1/2"	5		No			Grind	
9352	NEWPORT AVENUE	14051	402-371-32	E3	2	1162	Cross Gutter	PCC	Linear Cracking	1/4" to 1/2"	10		No			Grind	
9353	NEWPORT AVENUE	14051	402-371-32	E3	2	1162	Cross Gutter	PCC	Spalling	1/2" to 1"	2		No			Patch	
9354	NEWPORT AVENUE	14071	402-371-42	E3	2	1162	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
11426	NEWPORT AVENUE	14161	402-331-09	E3	2	1162	Driveway	PCC	Corner Break	1/4" to 1/2"	3		No		Yes	Grind	
11427	NEWPORT AVENUE	14161	402-331-09	E3	2	1162	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes		Yes	Grind	
11428	NEWPORT AVENUE	14161	402-331-09	E3	2	1162	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes		Yes	Grind	
11425	NEWPORT AVENUE	14181	402-331-10	E3	2	1162	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	4		No		Yes	Grind	
11424	NEWPORT AVENUE	14191	402-331-11	E3	2	1162	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No		Yes	Grind	
11423	NEWPORT AVENUE	14211	402-331-12	E3	2	1162	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No		Yes	Grind	
11422	NEWPORT AVENUE	14211	402-331-12	E3	2	1162	Sidewalk	PCC	Spalling	1" to 2"	6		No		Yes	Patch	
11454	NEWPORT AVENUE	14391	402-152-04	E3	2	1163	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes		Yes	Grind	
11455	NEWPORT AVENUE	14415	402-152-03	E3	2	1163	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No		Yes	Grind	
11456	NEWPORT AVENUE	14415	402-152-03	E3	2	1163	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No		Yes	Grind	
11447	NEWPORT AVENUE	14501	402-151-03	E3	2	1164	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes		Yes	Grind	
11446	NEWPORT AVENUE	14591	402-151-07	E3	2	1164	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No		Yes	Grind	
11444	NEWPORT AVENUE	14611	402-134-03	E2	2	1164	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
11445	NEWPORT AVENUE	14611	402-134-03	E3	2	1164	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No		Yes	Grind	
8780	NEWPORT AVENUE	14711	402-133-08	E2	2	1164	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
8781	NEWPORT AVENUE	14711	402-133-08	E2	2	1164	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
8779	NEWPORT AVENUE	14711	402-133-08	E2	2	1164	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
8782	NEWPORT AVENUE	14721	402-133-09	E2	2	1164	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
8784	NEWPORT AVENUE	14721	402-133-09	E2	2	1164	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
8783	NEWPORT AVENUE	14721	402-133-09	E2	2	1164	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
8785	NEWPORT AVENUE	14731	402-133-10	E2	2	1164	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
8786	NEWPORT AVENUE	14741	402-133-11	E2	2	1164	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
8787	NEWPORT AVENUE	14751	402-133-12	E2	2	1164	Ramp	PCC	Corner Break	1/4" to 1/2"	4		No			Grind	
2424	NEWPORT AVENUE	14781	402-142-22	E2	2	1165	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
2395	NEWPORT AVENUE	14801	402-142-19	E2	2	1165	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	At grate
2393	NEWPORT AVENUE	14801	402-142-19	E2	2	1165	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
2394	NEWPORT AVENUE	14801	402-142-19	E2	2	1165	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
2397	NEWPORT AVENUE	14811	402-142-05	E2	2	1165	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No			Grind	Running parallel with sidewalk
2396	NEWPORT AVENUE	14811	402-142-05	E2	2	1165	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
2392	NEWPORT AVENUE	14901	402-142-24	E2	2	1165	Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	1.5		Yes			Grind	At&t box sunken slightly
2380	NEWPORT AVENUE	14901	402-142-24	F2	2	1165	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		Yes			Grind	Prev grind
2387	NEWPORT AVENUE	14901	402-142-24	F2	2	1165	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	Prev grind
2381	NEWPORT AVENUE	14901	402-142-24	F2	2	1165	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	5		Yes			Replace Slab	Prev grind
2388	NEWPORT AVENUE	14901	402-142-24	F2	2	1165	Sidewalk	PCC	Faulting	1" to 2"	4		No			Replace Slab	
2379	NEWPORT AVENUE	14901	402-142-24	F2	2	1165	Sidewalk	PCC	Faulting	1/2" to 1"	3		No			Ramp	
2391	NEWPORT AVENUE	14901	402-142-24	F2	2	1165	Sidewalk	PCC	Faulting	1/2" to 1"	3.5		No			Ramp	
2378	NEWPORT AVENUE	14901	402-142-24	F2	2	1165	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
2386	NEWPORT AVENUE	14901	402-142-24	F2	2	1165	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
2389	NEWPORT AVENUE	14901	402-142-24	F2	2	1165	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	5		Yes			Replace Slab	
2390	NEWPORT AVENUE	14901	402-142-24	F2	2	1165	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	12		Yes			Replace Slab	
2382	NEWPORT AVENUE	14901	402-142-24	F2	2	1165	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	3		Yes			Grind	
2383				F2	2	1165	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	1		No			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
2384	NEWPORT AVENUE	14901	402-142-24	F2	2	1165	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	3		Yes			Grind	
2385	NEWPORT AVENUE	14901	402-142-24	F2	2	1165	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	10		Yes			Grind	
8108	NEWPORT AVENUE	14971	401-292-12	D4	2	1178	Sidewalk	PCC	Patch / Utility Cut	1/2" to 1"	3		No		Yes	Grind	Util cover
7963	NEWPORT AVENUE	540	401-601-01	D3	2	1175	Curb/Gutter	PCC	Linear Cracking	1/2" to 1"	1		No		Yes	Grind	
8126	NEWPORT AVENUE		401-283-05	C4	2	1178	Sidewalk	PCC	Linear Cracking	No Displacement	14		No		Yes	Joint Seal	Slight displacement
9346	NEWPORT AVENUE		432-073-05	E3	2	1161	Sidewalk	PCC	Faulting	1/2" to 1"	7		No			Ramp	
9347	NEWPORT AVENUE		432-073-05	E3	2	1161	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	7		No			Grind	
8653	NISSON RD	15482	402-351-04	D2	2	1803	Sidewalk	PCC	Corner Break	1/4" to 1/2"	4		Yes			Grind	
8655	NISSON RD	15482	402-351-04	D2	2	1803	Sidewalk	PCC	Faulting	1/2" to 1"	6					Ramp	
8654	NISSON RD	15482	402-351-04	D2	2	1803	Sidewalk	PCC	Faulting	1/4" to 1/2"	6		No			Grind	
8656	NISSON RD	15482	402-351-04	D2	2	1803	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
8657	NISSON RD	15482	402-351-04	D2	2	1803	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
8658	NISSON RD	15482	402-351-04	D2	2	1803	Driveway	PCC	Linear Cracking	1/2" to 1"	9		No			Grind	
8659	NISSON RD	15482	402-351-04	D2	2	1803	Driveway	PCC	Linear Cracking	1/2" to 1"	5		No			Grind	
8652	NISSON RD	15482	402-351-04	D2	2	1803	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	16		Yes			Grind	
8650	NISSON RD	15482	402-351-04	D2	2	1803	Driveway	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
8651	NISSON RD	15482	402-351-04	D2	2	1803	Driveway	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
8815	NISSON RD	15491	402-362-22	D2	2	1803	Sidewalk	PCC	Linear Cracking	No Displacement	4		Yes			Joint Seal	Slight displacement
8816	NISSON RD	15491	402-362-22	D2	2	1803	Sidewalk	PCC	Linear Cracking	No Displacement	4		Yes			Joint Seal	Slight displacement
8813	NISSON RD	15491	402-362-22	D2	2	1803	Sidewalk	PCC	Corner Break	1/4" to 1/2"	3		No			Grind	
8814	NISSON RD	15491	402-362-22	D2	2	1803	Driveway	PCC	Linear Cracking	1/2" to 1"	8		No			Grind	
8817	NISSON RD	15491	402-362-22	D2	2	1803	Driveway	PCC	Linear Cracking	1/4" to 1/2"	8		No			Grind	
8818	NISSON RD	15491	402-362-22	D2	2	1803	Driveway	PCC	Linear Cracking	1/4" to 1/2"	8		No			Grind	
8812	NISSON RD	15491	402-362-22	D2	2	1803	Sidewalk	PCC	Spalling	1/2" to 1"	2		No			Replace C&G	
8660	NISSON RD	15500	402-361-02	D2	2	1803	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
8661	NISSON RD	15500	402-361-01	D2	2	1803	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
8662	NISSON RD	15500	402-361-01	D2	2	1803	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
8648	NISSON RD		402-341-07	D3	2	1803	Sidewalk	PCC	Buckled Slab	Over 2"	12		Yes			Replace Slab(s)	Slab cracked
8649	NISSON RD		402-352-81	D2	2	1803	Sidewalk	PCC	Divided Slab	1/4" to 1/2"	12		Yes			Replace Slab	
11166	ORANGEWOOD LANE	125	401-532-22	C3	2	1815	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
11167	ORANGEWOOD LANE	125	401-532-22	C3	2	1815	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
11168	ORANGEWOOD LANE	125	401-532-22	C3	2	1815	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
11192	ORANGEWOOD LANE	130	401-533-01	C3	2	1815	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		Yes			Grind	Prev grind
11165	ORANGEWOOD LANE	135	401-532-21	C3	2	1815	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
11193	ORANGEWOOD LANE	140	401-533-02	C3	2	1815	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	Prev grind
11194	ORANGEWOOD LANE	140	401-533-02	C3	2	1815	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
11195	ORANGEWOOD LANE	160	401-533-04	C3	2	1815	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
11164	ORANGEWOOD LANE	175	401-532-17	C3	2	1815	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
11162	ORANGEWOOD LANE	185	401-532-16	C3	2	1815	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	Prev grind
11163	ORANGEWOOD LANE	185	401-532-16	C3	2	1815	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
10983	PACIFIC STREET	130	401-551-08	D2	2	1820	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No		Yes	Grind	Prev grind
10985	PACIFIC STREET	150	401-551-10	D2	2	1820	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
10986	PACIFIC STREET	150	401-551-10	D2	2	1820	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
10984	PACIFIC STREET	150	401-551-10	D2	2	1820	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
8586	PACIFIC STREET	15622	402-382-21	E2	2	1818	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
8572	PACIFIC STREET	15631	402-383-02	E2	2	1818	Sidewalk	PCC	Buckled Slab	1/4" to 1/2"	10		Yes			Replace Slab(s)	Slight tent
8573	PACIFIC STREET	15631	402-383-02	E2	2	1818	Driveway	PCC	Temporary Ramp	1/2" to 1"	4		Yes			Replace Slab	
8574	PACIFIC STREET	15631	402-383-02	E2	2	1818	Sidewalk	PCC	Temporary Ramp	1/2" to 1"	4		No			Replace Slab	
8585	PACIFIC STREET	15632	402-382-20	E2	2	1818	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
8575	PACIFIC STREET	15641	402-383-03	E2	2	1818	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
8577	PACIFIC STREET	15641	402-383-03	E2	2	1818	Driveway	PCC	Faulting	1/4" to 1/2"	6		No			Grind Driveway	
8576	PACIFIC STREET	15641	402-383-03	E2	2	1818	Driveway	PCC	Linear Cracking	1/4" to 1/2"	8		No			Grind	
8584	PACIFIC STREET	15672	402-382-17	E2	2	1818	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
8583	PACIFIC STREET	15672	402-382-17	E2	2	1818	Driveway	PCC	Linear Cracking	1/4" to 1/2"	8		No			Grind	
8581	PACIFIC STREET	15682	402-382-16	E2	2	1818	Sidewalk	PCC	Linear Cracking	No Displacement	4		Yes			Joint Seal	Slight displacement
8582	PACIFIC STREET	15682	402-382-16	E2	2	1818	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		Yes			Grind	
10973	PACIFIC STREET	157	401-361-18	D2	2	1820	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
8579	PACIFIC STREET	15711	402-383-08	E2	2	1818	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
8578	PACIFIC STREET	15711	402-383-08	E2	2	1818	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
8580	PACIFIC STREET	15731	402-383-09	E2	2	1818	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
10987	PACIFIC STREET	160	401-551-11	D2	2	1820	Sidewalk	AC	Patch / Utility Cut	No Displacement	4	2"	No			AC Patch	
10988	PACIFIC STREET	170	401-551-12	D2	2	1820	Sidewalk	PCC	Spalling	1" to 2"	0.5		No			Patch	Corner
10989	PACIFIC STREET	210	401-551-16	D2	2	1820	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
10990				D2	2	1820	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
10991	PACIFIC STREET	260	401-551-20	D2	2	1820	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
10919	PACIFIC STREET	314	401-552-02	D2	2	1820	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
6471	PACIFIC STREET	435	401-372-37	D3	2	1819	Driveway	PCC	Corner Break	1/2" to 1"	2.5		Yes			Ramp	
6472	PACIFIC STREET	435	401-372-37	D3	2	1819	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
6380	PACIFIC STREET	440	401-371-04	D2	2	1819	Sidewalk	PCC	Divided Slab	1/4" to 1/2"	6		Yes			Replace Slab(s)	
6382	PACIFIC STREET	440	401-371-04	D2	2	1819	Curb/Gutter	PCC	Faulting	1" to 2"	1		Yes			Replace C&G	
6381	PACIFIC STREET	440	401-371-04	D2	2	1819	Curb/Gutter	PCC	Faulting	Over 2"	1		Yes			Replace Curb	
6470	PACIFIC STREET	445	401-372-36	D3	2	1819	Driveway	PCC	Linear Cracking	1/4" to 1/2"	7		No			Grind	
6469	PACIFIC STREET	455	401-372-34	D3	2	1819	Sidewalk	PCC	Temporary Ramp	1/2" to 1"	4		Yes			Replace Slab	Filled spall
6468	PACIFIC STREET	455	401-372-34	D3	2	1819	Driveway	PCC	Corner Break	1/2" to 1"	2.5		Yes			Ramp	
6451	PACIFIC STREET	465	401-372-29	D3	2	1819	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
6452	PACIFIC STREET	465	401-372-29	D3	2	1819	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
6453	PACIFIC STREET	465	401-372-29	D3	2	1819	Sidewalk	PCC	Spalling	1" to 2"	1		No			Patch	
6383	PACIFIC STREET	470	401-371-05	D2	2	1819	Curb/Gutter	PCC	Sidewalk Curb Separation	1" to 2"	12		Yes			Replace Curb	
6384	PACIFIC STREET	510	401-371-06	D2	2	1819	Sidewalk	Brick	Other - Leave Comment	1" to 2"	20		Yes			Remove & Replace	Bricks lifted
6385	PACIFIC STREET	510	401-371-06	D2	2	1819	Sidewalk	PCC	Corner Break	1/4" to 1/2"	2		Yes			Grind	
6467	PACIFIC STREET	515	401-372-33	D3	2	1819	Sidewalk	PCC	Divided Slab	No Displacement	5		Yes			Replace Slab	Low
6462	PACIFIC STREET	515	401-372-33	D3	2	1819	Driveway	PCC	Faulting	1/2" to 1"	5		No			Grind Driveway	
6463	PACIFIC STREET	515	401-372-33	D3	2	1819	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
6464	PACIFIC STREET	515	401-372-33	D3	2	1819	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
6466	PACIFIC STREET	515	401-372-33	D3	2	1819	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
6465	PACIFIC STREET	515	401-372-33	D3	2	1819	Curb/Gutter	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
6386	PACIFIC STREET	520	401-371-07	D2	2	1819	Driveway	PCC	Corner Break	1/4" to 1/2"	4		Yes			Grind	
6323	PACIFIC STREET	520	401-372-01	D3	2	1819	Curb/Gutter	PCC	Spalling	1/2" to 1"	5		No			Replace C&G	
6324	PACIFIC STREET	520	401-372-01	D3	2	1819	Sidewalk	PCC	Spalling	1/2" to 1"	0.5		No			Replace C&G	
6387	PACIFIC STREET	530	401-371-08	D2	2	1819	Driveway	PCC	Divided Slab	No Displacement	10		No			Replace Slab(s)	
10925	PACIFIC STREET	535	401-364-03	D2	2	1820	Sidewalk	PCC	Other - Leave Comment	No Displacement			No		Yes	Field Assess-Monitor	No distress
10921	PACIFIC STREET	535	401-364-03	D2	2	1820	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes		Yes	Grind	Prev grind
6460	PACIFIC STREET	535	401-372-32	D3	2	1819	Driveway	PCC	Corner Break	1/4" to 1/2"	2		No			Grind	
6507	PACIFIC STREET	535	401-364-03	D2	2	1820	Cross Gutter	PCC	Linear Cracking	1/4" to 1/2"	7		No		Yes	Grind	
6378	PACIFIC STREET	535	401-364-03	D2	2	1820	Ramp	PCC	Linear Cracking	No Displacement	10		No	Yes	Yes	Joint Seal	
6459	PACIFIC STREET	535	401-372-32	D3	2	1819	Driveway	PCC	Sidewalk Curb Separation	1/2" to 1"	9		Yes			Replace Driveway	
6461	PACIFIC STREET	535	401-372-32	D3	2	1819	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
6456	PACIFIC STREET	545	401-372-31	D3	2	1819	Driveway	PCC	Linear Cracking	1/4" to 1/2"	5		No			Grind	
6458	PACIFIC STREET	545	401-372-31	D3	2	1819	Sidewalk	PCC	Spalling	1/2" to 1"	5		Yes			Replace C&G	
6454	PACIFIC STREET	555	401-372-30	D3	2	1819	Driveway	PCC	Corner Break	1" to 2"	2		No			Replace Slab	
6455	PACIFIC STREET	555	401-372-30	D3	2	1819	Driveway	PCC	Linear Cracking	1/4" to 1/2"	8		No			Grind	
6457	PACIFIC STREET	555	401-372-30	D3	2	1819	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
10974	PACIFIC STREET	560	401-361-21	D2	2	1820	Sidewalk	PCC	Buckled Slab	1" to 2"	8		Yes		Yes	Replace Slab	Lifted, temp ramp
6388	PACIFIC STREET	560	401-371-11	D2	2	1819	Sidewalk	PCC	Faulting	1" to 2"	6		Yes			Replace Slab	
10918	PACIFIC STREET	610	401-552-01	D2	2	1820	Sidewalk	PCC	Buckled Slab	1/2" to 1"	16		Yes			Replace Slab(s)	Tented
10981	PACIFIC STREET	610	401-551-01	D2	2	1820	Sidewalk	PCC	Divided Slab	1/2" to 1"	10		Yes		Yes	Replace Slab(s)	
10980	PACIFIC STREET	610	401-551-01	D2	2	1820	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	7		Yes		Yes	Replace Slab	
10977	PACIFIC STREET	610	401-551-01	D2	2	1820	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	20		Yes		Yes	Grind	
10976	PACIFIC STREET	610	401-551-01	D2	2	1820	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	5		Yes		Yes	Grind	
10978	PACIFIC STREET	610	401-551-01	D2	2	1820	Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	6		Yes		Yes	Replace Slab(s)	
10979	PACIFIC STREET	610	401-551-01	D2	2	1820	Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	6		Yes		Yes	Replace Slab(s)	
10982	PACIFIC STREET	610	401-551-01	D2	2	1820	Curb/Gutter	PCC	Spalling	Over 2"	2		No		Yes	Replace C&G	
6508	PACIFIC STREET	615	401-552-06	D2	2	1820	Cross Gutter	PCC	Linear Cracking	1/4" to 1/2"	7		No		Yes	Grind	
10920	PACIFIC STREET	615	401-552-06	D2	2	1820	Curb/Gutter	PCC	Linear Cracking	1" to 2"	1		No			Grind	
10910	PASADENA AVENUE	145	401-541-11	D2	2	1834	Sidewalk	PCC	Buckled Slab	1" to 2"	6		Yes			Replace Slab	Tilted
8819	PASADENA AVENUE	15491	402-362-22	D2	2	1832	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
10909	PASADENA AVENUE	155	401-541-10	D2	2	1834	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
8663	PASADENA AVENUE	15500	402-361-01	D2	2	1832	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
8664	PASADENA AVENUE	15500	402-361-01	D2	2	1832	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
8665	PASADENA AVENUE	15500	402-361-01	D2	2	1832	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
8820	PASADENA AVENUE	15501	402-362-02	D2	2	1832	Driveway	PCC	Divided Slab	1" to 2"	10		No			Replace Slab(s)	
8823	PASADENA AVENUE	15501	402-362-02	D2	2	1832	Driveway	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
8821	PASADENA AVENUE	15501	402-362-02	D2	2	1832	Driveway	PCC	Spalling	Over 2"	1		No			Patch	
8825	PASADENA AVENUE	15531	402-362-06	D2	2	1832	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
8822	PASADENA AVENUE	15551	402-362-04	D2	2	1832	Driveway	PCC	Spalling	1" to 2"	1		No			Patch	
8666	PASADENA AVENUE	15552	402-361-05	D2	2	1832	Driveway	PCC	Linear Cracking	1/4" to 1/2"	16		No			Grind	
8824	PASADENA AVENUE	15561	402-362-05	D2	2	1832	Driveway	PCC	Sidewalk Curb Separation	1/2" to 1"	10		No			Replace Driveway	
8667				D2	2	1832	Sidewalk	PCC	Spalling	1/4" to 1/2"	2		No			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
8668	PASADENA AVENUE	15592	402-361-08	E2	2	1832	Driveway	PCC	Divided Slab	1/2" to 1"	20		Yes			Replace Slab(s)	
8669	PASADENA AVENUE	15592	402-361-08	E2	2	1832	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
8670	PASADENA AVENUE	15602	402-361-09	E2	2	1832	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
8671	PASADENA AVENUE	15612	402-361-10	E2	2	1832	Driveway	PCC	Linear Cracking	1/4" to 1/2"	16		No			Grind	
8673	PASADENA AVENUE	15622	402-171-01	E2	2	1832	Driveway	PCC	Divided Slab	1/2" to 1"	20		No			Replace Slab(s)	
8672	PASADENA AVENUE	15622	402-171-01	E2	2	1832	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
8845	PASADENA AVENUE	15641	402-172-01	E2	2	1832	Driveway	PCC	Linear Cracking	1/2" to 1"	7		No			Grind	
8843	PASADENA AVENUE	15641	402-172-01	E2	2	1832	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
8844	PASADENA AVENUE	15641	402-172-01	E2	2	1832	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
8846	PASADENA AVENUE	15641	402-172-01	E2	2	1832	Sidewalk	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
8674	PASADENA AVENUE	15642	402-171-02	E2	2	1832	Sidewalk	PCC	Corner Break	1/2" to 1"	6		No			Ramp	
8675	PASADENA AVENUE	15660	402-171-03	E2	2	1832	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
8676	PASADENA AVENUE	15660	402-171-03	E2	2	1832	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
8677	PASADENA AVENUE	15660	402-171-03	E2	2	1832	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
8867	PASADENA AVENUE	15731	402-172-15	E2	2	1832	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
8868	PASADENA AVENUE	15731	402-172-15	E2	2	1832	Sidewalk	PCC	Divided Slab	No Displacement	14		No			Replace Slab(s)	Slight displacement
8864	PASADENA AVENUE	15731	402-172-15	E2	2	1832	Driveway	PCC	Divided Slab	1/4" to 1/2"	18		No			Replace Slab	
8865	PASADENA AVENUE	15731	402-172-15	E2	2	1832	Driveway	PCC	Divided Slab	No Displacement	18		No			Replace Slab(s)	
8866	PASADENA AVENUE	15731	402-172-15	E2	2	1832	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
8687	PASADENA AVENUE	15811	402-121-04	E2	2	1831	Sidewalk	PCC	Faulting	1" to 2"	4		Yes			Replace Slab	Prev grind
8685	PASADENA AVENUE	15811	402-121-04	E2	2	1831	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
8689	PASADENA AVENUE	15811	402-121-04	E2	2	1831	Driveway	PCC	Divided Slab	Over 2"	20		No			Replace Slab(s)	Severe
8686	PASADENA AVENUE	15811	402-121-04	E2	2	1831	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
8688	PASADENA AVENUE	15811	402-121-04	E2	2	1831	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
8803	PASADENA AVENUE	15822	402-122-16	E2	2	1831	Driveway	PCC	Linear Cracking	1/4" to 1/2"	7		No		Yes	Grind	
8804	PASADENA AVENUE	15822	402-122-16	E2	2	1831	Driveway	PCC	Linear Cracking	1/4" to 1/2"	7		No		Yes	Grind	
8805	PASADENA AVENUE	15822	402-122-16	E2	2	1831	Driveway	PCC	Linear Cracking	1/4" to 1/2"	7		No		Yes	Grind	
8802	PASADENA AVENUE	15822	402-122-16	E2	2	1831	Driveway	PCC	Spalling	1/2" to 1"	1		No		Yes	Replace C&G	
8691	PASADENA AVENUE	15851	402-121-02	E2	2	1831	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
8692	PASADENA AVENUE	15851	402-121-02	E2	2	1831	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
8690	PASADENA AVENUE	15851	402-121-02	E2	2	1831	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
8799	PASADENA AVENUE	15910	402-122-01	E2	2	1831	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No		Yes	Grind	
8800	PASADENA AVENUE	15910	402-122-01	E2	2	1831	Driveway	PCC	Linear Cracking	1/2" to 1"	7		No		Yes	Grind	
8801	PASADENA AVENUE	15910	402-122-01	E2	2	1831	Driveway	PCC	Linear Cracking	1/4" to 1/2"	7		No		Yes	Grind	
8798	PASADENA AVENUE	15910	402-122-01	E2	2	1831	Curb/Gutter	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
8706	PASADENA AVENUE	16001	402-131-04	E2	2	1831	Sidewalk	PCC	Faulting	1/2" to 1"	4		No	Yes		Ramp	
8792	PASADENA AVENUE	16002	402-133-01	E2	2	1831	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
8793	PASADENA AVENUE	16002	402-133-01	E2	2	1831	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
10898	PASADENA AVENUE	170	401-543-18	D2	2	1833	Sidewalk	PCC	Other - Leave Comment	No Displacement			No		Yes	Field Assess-Monitor	Double sidewalk lines here
10900	PASADENA AVENUE	170	401-543-18	D2	2	1833	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes		Yes	Grind	Prev grind
10899	PASADENA AVENUE	170	401-543-18	D2	2	1833	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes		Yes	Ramp	
10913	PASADENA AVENUE	170	401-543-18	D2	2	1833	Sidewalk	PCC	Faulting	1/2" to 1"	5		Yes		Yes	Ramp	
10912	PASADENA AVENUE	170	401-543-18	D2	2	1834	Sidewalk	PCC	Faulting	1/2" to 1"	5		Yes		Yes	Ramp	
8693	PASADENA AVENUE	17061	402-131-01	E2	2	1831	Driveway	PCC	Linear Cracking	1/4" to 1/2"	6		No			Grind	
8839	PASADENA AVENUE	17082	402-362-18	E2	2	1832	Driveway	PCC	Linear Cracking	1/4" to 1/2"	8		No			Grind	
8840	PASADENA AVENUE	17082	402-362-18	E2	2	1832	Sidewalk	PCC	Linear Cracking	1/2" to 1"	4		No			Grind	
8841	PASADENA AVENUE	17082	402-362-18	E2	2	1832	Sidewalk	PCC	Linear Cracking	1/2" to 1"	4		No			Grind	
8842	PASADENA AVENUE	17082	402-362-18	E2	2	1832	Sidewalk	PCC	Linear Cracking	1/2" to 1"	4		No			Grind	
8806	PASADENA AVENUE	17102	402-122-03	E2	2	1831	Sidewalk	PCC	Faulting	1/2" to 1"	5		No		Yes	Ramp	
8796	PASADENA AVENUE	17111	402-132-01	E2	2	1831	Driveway	PCC	Linear Cracking	1/4" to 1/2"	6		No			Grind	
8797	PASADENA AVENUE	17111	402-132-01	E2	2	1831	Driveway	PCC	Spalling	1/2" to 1"	2		No			Replace C&G	
10908	PASADENA AVENUE	175	401-541-08	D2	2	1834	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
10901	PASADENA AVENUE	270	401-543-14	D2	2	1833	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes		Yes	Grind	
10902	PASADENA AVENUE	310	401-543-13	D2	2	1833	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
10903	PASADENA AVENUE	310	401-543-13	D2	2	1833	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
10904	PASADENA AVENUE	340	401-543-07	D2	2	1833	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	
10905	PASADENA AVENUE	350	401-543-16	D2	2	1833	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
10906	PASADENA AVENUE	740	401-542-22	D2	2	1833	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
10907	PASADENA AVENUE	740	401-542-22	D2	2	1833	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
10911	PASADENA AVENUE	750	401-541-17	D2	2	1834	Curb/Gutter	PCC	Spalling	1/4" to 1/2"	1.5		No		Yes	Grind	
8682	PASADENA AVENUE		402-171-04	E2	2	1832	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		Yes			Grind	Prev grind
8807	PASADENA AVENUE		402-172-15	E2	2	1832	Cross Gutter	PCC	Linear Cracking	1/4" to 1/2"	6		No			Grind	
8679	PASADENA AVENUE		402-171-04	E2	2	1832	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	12		No			Grind	
8681				E2	2	1832	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	12		Yes			Replace Slab	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
8680	PASADENA AVENUE		402-171-04	E2	2	1832	Driveway	PCC	Spalling	1/2" to 1"	4		No			Replace C&G	
8678	PASADENA AVENUE		402-171-04	E2	2	1832	Sidewalk	PCC	Spalling	1/4" to 1/2"	2		No			Grind	
7280	PREBLE DRIVE	164	401-591-14	D3	2	1856	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
7281	PREBLE DRIVE	164	401-591-14	D3	2	1856	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	3		Yes			Grind	
7282	PREBLE DRIVE	172	401-591-15	D3	2	1856	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
7283	PREBLE DRIVE	210	401-591-18	D3	2	1856	Driveway	PCC	Linear Cracking	1/2" to 1"	10		No			Grind	
7284	PREBLE DRIVE	210	401-591-18	D3	2	1856	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
7516	PREBLE DRIVE	215	401-592-05	D3	2	1856	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
7286	PREBLE DRIVE	230	401-591-20	D3	2	1856	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
7285	PREBLE DRIVE	230	401-591-20	D3	2	1856	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	12		No			Grind	
7287	PREBLE DRIVE	240	401-591-21	D3	2	1856	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
7288	PREBLE DRIVE	240	401-591-21	D3	2	1856	Curb/Gutter	PCC	Spalling	1" to 2"	5		No			Patch	
7289	PREBLE DRIVE	240	401-591-21	D3	2	1856	Curb/Gutter	PCC	Spalling	1" to 2"	3		No			Patch	
7515	PREBLE DRIVE	245	401-592-08	D3	2	1856	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
7514	PREBLE DRIVE	305	401-592-09	D3	2	1856	Sidewalk	PCC	Other - Leave Comment	1/4" to 1/2"		1"	No			Grind	Popouts
7509	PREBLE DRIVE	310	401-592-19	D3	2	1856	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes		Yes	Grind	Prev grind
7517	PREBLE DRIVE	340	401-592-04	D3	2	1856	Sidewalk	PCC	Spalling	1/4" to 1/2"		1"	No			Grind	
7418	PROSPECT AVENUE	105	401-581-03	D3	2	1152	Driveway	PCC	Corner Break	1/2" to 1"	5		No		Yes	Ramp	
7420	PROSPECT AVENUE	105	401-581-03	D3	2	1152	Driveway	PCC	Divided Slab	1/4" to 1/2"	10		No		Yes	Replace Slab(s)	
7416	PROSPECT AVENUE	105	401-581-03	D3	2	1152	Sidewalk	PCC	Faulting	1/4" to 1/2"	6		No	Yes	Yes	Grind	
7417	PROSPECT AVENUE	105	401-581-03	D3	2	1152	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes		Yes	Grind	
7421	PROSPECT AVENUE	105	401-581-03	D3	2	1152	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No		Yes	Grind	
7422	PROSPECT AVENUE	105	401-581-03	D3	2	1152	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No		Yes	Grind	
7419	PROSPECT AVENUE	105	401-581-03	D3	2	1152	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No		Yes	Grind	
11204	PROSPECT AVENUE	115	401-141-05	D3	2	1153	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes		Yes	Ramp	Prev grind
11205	PROSPECT AVENUE	115	401-141-05	D3	2	1153	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No		Yes	Grind	
11203	PROSPECT AVENUE	115	401-141-05	D3	2	1153	Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	10		Yes		Yes	Replace Slab(s)	
11206	PROSPECT AVENUE	121	401-141-04	C3	2	1153	Sidewalk	PCC	Faulting	1/4" to 1/2"	6		No		Yes	Grind	
11202	PROSPECT AVENUE	14982	401-141-06	D3	2	1153	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No		Yes	Grind	
11200	PROSPECT AVENUE	14982	401-141-06	D3	2	1153	Driveway	PCC	Linear Cracking	1/4" to 1/2"	6		No		Yes	Grind	
11201	PROSPECT AVENUE	14982	401-141-06	D3	2	1153	Driveway	PCC	Linear Cracking	1/4" to 1/2"	5		No		Yes	Grind	
7423	PROSPECT AVENUE	150	401-583-01	D3	2	1152	Curb/Gutter	PCC	Faulting	1/2" to 1"	1		Yes		Yes	Replace C&G	
7426	PROSPECT AVENUE	150	401-583-01	D3	2	1152	Sidewalk	PCC	Faulting	1/2" to 1"	3		No		Yes	Ramp	
7427	PROSPECT AVENUE	150	401-583-03	D3	2	1152	Sidewalk	PCC	Faulting	1/4" to 1/2"	7		No		Yes	Grind	
7424	PROSPECT AVENUE	150	401-583-01	D3	2	1152	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes		Yes	Grind	
7425	PROSPECT AVENUE	150	401-583-01	D3	2	1152	Driveway	PCC	Linear Cracking	1/2" to 1"	10		No		Yes	Grind	
7415	PROSPECT AVENUE	153	401-581-11	D3	2	1152	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes		Yes	Grind	
7414	PROSPECT AVENUE	153	401-581-06	D3	2	1152	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	5		Yes		Yes	Grind	
7412	PROSPECT AVENUE	153	401-581-06	D3	2	1152	Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	15		Yes		Yes	Replace Slab(s)	
7413	PROSPECT AVENUE	153	401-581-11	D3	2	1152	Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	15		Yes		Yes	Replace Slab(s)	
11198	PROSPECT AVENUE	171	401-532-36	D3	2	1153	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes		Yes	Ramp	
11199	PROSPECT AVENUE	171	401-532-36	D3	2	1153	Sidewalk	PCC	Faulting	1/2" to 1"	2		No		Yes	Ramp	
11160	PROSPECT AVENUE	17742	401-042-09	C3	2	1153	Driveway	PCC	Faulting	1/4" to 1/2"	2		No			Grind Driveway	
11158	PROSPECT AVENUE	17742	401-042-09	C3	2	1153	Sidewalk	PCC	Faulting	1/4" to 1/2"	6		No			Grind	
11159	PROSPECT AVENUE	17742	401-042-09	C3	2	1153	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
11212	PROSPECT AVENUE	17772	401-141-14	C3	2	1153	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes		Yes	Grind	Prev work
7431	PROSPECT AVENUE	180	401-583-16	D3	2	1152	Curb/Gutter	PCC	Linear Cracking	1/4" to 1/2"	6		No		Yes	Grind	
7429	PROSPECT AVENUE	180	401-583-16	D3	2	1152	Driveway	PCC	Linear Cracking	1/4" to 1/2"	8		No		Yes	Grind	
7430	PROSPECT AVENUE	180	401-583-16	D3	2	1152	Driveway	PCC	Linear Cracking	1/4" to 1/2"	8		No		Yes	Grind	
7434	PROSPECT AVENUE	180	401-583-16	D3	2	1152	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	20		Yes		Yes	Replace Slab	
7435	PROSPECT AVENUE	180	401-583-16	D3	2	1152	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	11		No		Yes	Replace Slab	
7428	PROSPECT AVENUE	180	401-583-16	D3	2	1152	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	6		Yes		Yes	Grind	
7432	PROSPECT AVENUE	180	401-583-16	D3	2	1152	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	6		Yes		Yes	Grind	
7433	PROSPECT AVENUE	180	401-583-16	D3	2	1152	Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	20		Yes		Yes	Replace Slab(s)	
7411	PROSPECT AVENUE	185	401-581-08	D3	2	1152	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	5		No		Yes	Patch	Partially spalled too
11197	PROSPECT AVENUE	190	401-533-08	C3	2	1153	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
11196	PROSPECT AVENUE	190	401-533-07	C3	2	1153	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
11161	PROSPECT AVENUE	195	401-532-15	C3	2	1153	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
11208	PROSPECT AVENUE	201	401-141-55	C3	2	1153	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
11207	PROSPECT AVENUE	201	401-141-55	C3	2	1153	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	5		Yes			Grind	
7410	PROSPECT AVENUE	215	401-581-09	D3	2	1152	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes		Yes	Grind	Prev grind
7400	PROSPECT AVENUE	215	401-581-09	D3	2	1151	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
7408	PROSPECT AVENUE	215	401-581-09	D3	2	1151	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
7409					D3	2	1151	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes		Grind	Prev grind

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP	Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
7402	PROSPECT AVENUE	215	401-581-09	D3	2	1151		Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
7300	PROSPECT AVENUE	215	401-581-09	D3	2	1151		Curb/Gutter	PCC	Linear Cracking	1/2" to 1"	3		No			Grind	
7407	PROSPECT AVENUE	215	401-581-09	D3	2	1151		Curb/Gutter	PCC	Linear Cracking	1/2" to 1"	5		No		Yes	Grind	
7406	PROSPECT AVENUE	215	401-581-09	D3	2	1151		Driveway	PCC	Linear Cracking	1/2" to 1"	9		No			Grind	
7405	PROSPECT AVENUE	215	401-581-09	D3	2	1151		Sidewalk	PCC	Temporary Ramp	1/2" to 1"	4		Yes			Replace Slab	
7502	PROSPECT AVENUE	230	401-584-02	D3	2	1151		Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	5		No		Yes	Grind	
7394	PROSPECT AVENUE	235	401-582-03	D3	2	1150		Sidewalk	PCC	Divided Slab	No Displacement	15		No		Yes	Replace Slab(s)	
7397	PROSPECT AVENUE	235	401-582-03	D3	2	1150		Sidewalk	PCC	Faulting	1/4" to 1/2"	6		Yes		Yes	Grind	
7503	PROSPECT AVENUE	240	401-584-03	D3	2	1151		Sidewalk	PCC	Corner Break	1/4" to 1/2"	2		No		Yes	Grind	
7504	PROSPECT AVENUE	240	401-584-03	D3	2	1151		Sidewalk	PCC	Spalling	1/2" to 1"	2		No		Yes	Replace C&G	
7505	PROSPECT AVENUE	250	401-584-04	D3	2	1151		Driveway	PCC	Divided Slab	1" to 2"	10		Yes		Yes	Replace Slab(s)	
7506	PROSPECT AVENUE	250	401-584-04	D3	2	1151		Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes		Yes	Grind	
11210	PROSPECT AVENUE		401-141-56	C3	2	1153		Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
11211	PROSPECT AVENUE		401-141-56	C3	2	1153		Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No			Grind	
11209	PROSPECT AVENUE		401-141-56	C3	2	1153		Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	8		Yes			Grind	
7442	SECOND STREET	125	401-583-08	D3	2	1901		Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	6		Yes		Yes	Grind	
7527	SECOND STREET	160	401-591-09	D3	2	1902		Sidewalk	PCC	Linear Cracking	No Displacement	4		No		Yes	Joint Seal	Slight displacement
7266	SECOND STREET	160	401-591-09	D3	2	1902		Driveway	PCC	Divided Slab	1/2" to 1"	8		No		Yes	Replace Slab(s)	
7499	SECOND STREET	160	401-584-01	D3	2	1901		Sidewalk	Brick	Faulting	1" to 2"	8		Yes		Yes	AC Patch	
7500	SECOND STREET	160	401-584-01	D3	2	1901		Sidewalk	PCC	Faulting	1/2" to 1"	18		Yes		Yes	Ramp	
7501	SECOND STREET	160	401-584-01	D3	2	1901		Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No		Yes	Grind	
7265	SECOND STREET	160	401-591-09	D3	2	1902		Driveway	PCC	Linear Cracking	1" to 2"	9		No		Yes	Replace Driveway	
7526	SECOND STREET	160	401-591-09	D3	2	1902		Driveway	PCC	Linear Cracking	1/4" to 1/2"	10		No		Yes	Grind	
7267	SECOND STREET	160	401-591-09	D3	2	1902		Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No		Yes	Grind	
7441	SECOND STREET	180	401-583-16	D3	2	1901		Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No		Yes	Grind	Prev grind
7436	SECOND STREET	180	401-583-16	D3	2	1901		Cross Gutter	PCC	Linear Cracking	1/2" to 1"	13		No		Yes	Replace Slab(s)	
7440	SECOND STREET	180	401-583-16	D3	2	1901		Curb/Gutter	PCC	Linear Cracking	1/4" to 1/2"	7	1	No		Yes	Grind	
7437	SECOND STREET	180	401-583-16	D3	2	1901		Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	9		No		Yes	Grind	
7439	SECOND STREET	180	401-583-16	D3	2	1901		Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	15	1	Yes		Yes	Grind	
7438	SECOND STREET	180	401-583-16	D3	2	1901		Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	7		Yes		Yes	Grind	
10972	SECOND STREET	185	401-361-16	D2	2	1899		Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
7472	SECOND STREET	190	401-571-07	D3	2	1900		Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No		Yes	Grind	
7471	SECOND STREET	190	401-571-07	D3	2	1900		Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	3		Yes		Yes	Grind	
7470	SECOND STREET	190	401-571-07	D3	2	1900		Sidewalk	PCC	Spalling	1/2" to 1"	1		No		Yes	Replace C&G	
7498	SECOND STREET	205	401-584-11	D3	2	1901		Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	10		No		Yes	Grind	
7476	SECOND STREET	220	401-572-06	D3	2	1900		Driveway	PCC	Divided Slab	1/4" to 1/2"			No		Yes	Replace Slab	
7475	SECOND STREET	250	401-572-03	D3	2	1900		Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes		Yes	Grind	Prev grind
7473	SECOND STREET	250	401-572-03	D3	2	1900		Curb/Gutter	PCC	Faulting	1/2" to 1"	1		Yes		Yes	Replace C&G	
7474	SECOND STREET	250	401-572-03	D3	2	1900		Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes		Yes	Grind	
10964	SECOND STREET	305	401-561-09	D3	2	1899		Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
7279	SECOND STREET	325	401-591-13	D3	2	1902		Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
10965	SECOND STREET	325	401-561-10	D3	2	1899		Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
10966	SECOND STREET	325	401-561-10	D3	2	1899		Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
7277	SECOND STREET	331	401-591-12	D3	2	1902		Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
7278	SECOND STREET	331	401-591-12	D3	2	1902		Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
10967	SECOND STREET	335	401-561-11	D3	2	1899		Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
7518	SECOND STREET	340	401-592-04	D3	2	1902		Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
7520	SECOND STREET	380	401-592-03	D3	2	1902		Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
7519	SECOND STREET	380	401-592-03	D3	2	1902		Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
7271	SECOND STREET	415	401-591-10	D3	2	1902		Sidewalk	PCC	Divided Slab	No Displacement	5		Yes			Replace Slab	
7275	SECOND STREET	415	401-591-10	D3	2	1902		Sidewalk	PCC	Divided Slab	No Displacement	5		Yes			Replace Slab	
7269	SECOND STREET	415	401-591-10	D3	2	1902		Sidewalk	PCC	Linear Cracking	1/2" to 1"	10		Yes		Yes	Grind	
7268	SECOND STREET	415	401-591-10	D3	2	1902		Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No		Yes	Grind	
7270	SECOND STREET	415	401-591-10	D3	2	1902		Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
7273	SECOND STREET	415	401-591-10	D3	2	1902		Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
10969	SECOND STREET	430	401-362-22	D3	2	1899		Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
7522	SECOND STREET	436	401-592-02	D3	2	1902		Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	Prev grind
7521	SECOND STREET	436	401-592-02	D3	2	1902		Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
10970	SECOND STREET	465	401-361-11	D3	2	1899		Sidewalk	PCC	Faulting	1/2" to 1"	4		No			Ramp	
10971	SECOND STREET	535	401-361-15	D2	2	1899		Curb/Gutter	PCC	Linear Cracking	1/4" to 1/2"	2		No			Grind	
7525	SECOND STREET		401-592-01	D3	2	1902		Sidewalk	PCC	Faulting	1/4" to 1/2"	8		No			Grind	
7524	SECOND STREET		401-592-01	D3	2	1902		Curb/Gutter	PCC	Spalling	1" to 2"	1		No			Patch	
7523	SECOND STREET		401-592-01	D3	2	1902		Sidewalk	PCC	Spalling	1/2" to 1"	0.5		No			Replace C&G	
8200				i	D3	2	1918	Driveway	PCC	Other - Leave Comment	1/4" to 1/2"	25		No			Patch	Scaling

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
8202	SIXTH STREET	13771	401-611-06	D3	2	1918	Sidewalk	PCC	Faulting	1/2" to 1"	5		Yes			Ramp	
8199	SIXTH STREET	13771	401-611-06	D3	2	1918	Sidewalk	PCC	Spalling	1/2" to 1"	2		No			Replace C&G	
8201	SIXTH STREET	13771	401-611-06	D3	2	1918	Sidewalk	PCC	Spalling	1/2" to 1"	2		Yes			Replace C&G	
8198	SIXTH STREET	13821	401-642-11	D3	2	1918	Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	3		No			Grind	Pole base
8197	SIXTH STREET	13821	401-642-11	D3	2	1918	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
8203	SIXTH STREET	275	401-623-07	D3	2	1918	Driveway	PCC	Divided Slab	1/2" to 1"	12		No			Replace Slab(s)	
8204	SIXTH STREET	275	401-623-07	D3	2	1918	Driveway	PCC	Linear Cracking	1/4" to 1/2"	3		No		Yes	Grind	
8205	SIXTH STREET	275	401-623-07	D3	2	1918	Driveway	PCC	Linear Cracking	1/4" to 1/2"	6		No		Yes	Grind	
8206	SIXTH STREET	275	401-623-07	D3	2	1918	Curb/Gutter	PCC	Spalling	Over 2"	2		No		Yes	Replace C&G	
6411	SIXTH STREET	550	401-341-07	D3	2	1917	Driveway	PCC	Spalling	1/2" to 1"	1.5		No			Replace C&G	
6424	SIXTH STREET	560	401-622-17	D3	2	1917	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No		Yes	Grind	
6440	SIXTH STREET	570	401-622-33	D3	2	1917	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	4		Yes			Grind	
6404	SIXTH STREET	580	401-341-06	D2	2	1916	Sidewalk	PCC	Faulting	1/2" to 1"	4		No		Yes	Ramp	Prev grind
6407	SIXTH STREET	580	401-341-06	D2	2	1916	Sidewalk	PCC	Linear Cracking	No Displacement	6		No		Yes	Joint Seal	Slight displacement
6410	SIXTH STREET	580	401-341-06	D2	2	1916	Sidewalk	PCC	Corner Break	1/4" to 1/2"	5		No		Yes	Grind	
6408	SIXTH STREET	580	401-341-06	D2	2	1916	Sidewalk	PCC	Faulting	1/2" to 1"	5		No		Yes	Ramp	
6409	SIXTH STREET	580	401-341-06	D3	2	1916	Sidewalk	PCC	Faulting	1/2" to 1"	5		No		Yes	Ramp	
6406	SIXTH STREET	580	401-341-06	D2	2	1916	Sidewalk	PCC	Spalling	1/2" to 1"	1		No		Yes	Replace C&G	
6405	SIXTH STREET	580	401-341-06	D2	2	1916	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No		Yes	Grind	
6402	SIXTH STREET	600	401-341-01	D2	2	1916	Sidewalk	PCC	Divided Slab	1/4" to 1/2"	12		No		Yes	Replace Slab	Low
6403	SIXTH STREET	600	401-341-01	D2	2	1916	Sidewalk	PCC	Divided Slab	1/2" to 1"	12		No		Yes	Replace Slab(s)	Med/high
6400	SIXTH STREET	600	401-341-01	D2	2	1916	Sidewalk	PCC	Faulting	1/2" to 1"	5		Yes		Yes	Ramp	
6396	SIXTH STREET	600	401-341-01	D2	2	1916	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes		Yes	Grind	
6397	SIXTH STREET	600	401-341-01	D2	2	1916	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes		Yes	Grind	
6399	SIXTH STREET	600	401-341-01	D2	2	1916	Sidewalk	PCC	Faulting	1/4" to 1/2"	10		No		Yes	Grind	
6401	SIXTH STREET	600	401-341-01	D2	2	1916	Driveway	PCC	Sidewalk Curb Separation	1" to 2"	9		No		Yes	Replace Driveway	
6398	SIXTH STREET	600	401-341-01	D2	2	1916	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	7		Yes		Yes	Replace Slab	
8195	SIXTH STREET	607	401-642-14	D3	2	1918	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes		Yes	Grind	
6421	SIXTH STREET	621	401-631-08	D3	2	1917	Driveway	PCC	Linear Cracking	1/4" to 1/2"	8		No		Yes	Grind	
6422	SIXTH STREET	630	401-631-01	D3	2	1917	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes		Yes	Grind	
6423	SIXTH STREET	630	401-631-01	D3	2	1917	Sidewalk	PCC	Faulting	1/4" to 1/2"	6		Yes		Yes	Grind	
6392	SIXTH STREET	644	401-331-02	D2	2	1916	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight displacement
6393	SIXTH STREET	644	401-331-02	D2	2	1916	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
6394	SIXTH STREET	644	401-331-02	D2	2	1916	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
6395	SIXTH STREET	644	401-331-02	D2	2	1916	Sidewalk	PCC	Faulting	No Displacement	4		No			Joint Seal	
6389	SIXTH STREET	644	401-331-02	D2	2	1916	Driveway	PCC	Linear Cracking	1/4" to 1/2"	7		No			Grind	
6390	SIXTH STREET	644	401-331-02	D2	2	1916	Driveway	PCC	Linear Cracking	1/4" to 1/2"	7		No			Grind	
6391	SIXTH STREET	644	401-331-02	D2	2	1916	Sidewalk	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
8196	SIXTH STREET		401-661-39	D3	2	1918	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
8207	SIXTH STREET		401-623-15	D3	2	1918	Sidewalk	PCC	Spalling	1/4" to 1/2"	2		No		Yes	Grind	
8789	SYCAMORE AVENUE	14751	402-133-12	E2	2	1218	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		Yes			Grind	
8788	SYCAMORE AVENUE	14751	402-133-12	E2	2	1218	Sidewalk	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
8791	SYCAMORE AVENUE	16002	402-133-01	E2	2	1218	Curb/Gutter	PCC	Linear Cracking	1/2" to 1"	2		No			Grind	
8790	SYCAMORE AVENUE	16021	402-133-05	E2	2	1218	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		Yes			Grind	
7308	THIRD STREET	155	401-572-05	D3	2	1929	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	9		Yes		Yes	Replace Slab	
7298	THIRD STREET	215	401-581-09	D3	2	1931	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Prev grind
7299	THIRD STREET	215	401-581-09	D3	2	1931	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Prev grind
7295	THIRD STREET	215	401-581-09	D3	2	1931	Driveway	PCC	Divided Slab	1" to 2"	12		No			Replace Slab(s)	
7294	THIRD STREET	215	401-581-09	D3	2	1931	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
7297	THIRD STREET	215	401-581-09	D3	2	1931	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
11631	THIRD STREET	215	401-581-09	D3	2	1931	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
11632	THIRD STREET	215	401-581-09	D3	2	1931	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
7296	THIRD STREET	215	401-581-09	D3	2	1931	Sidewalk	PCC	Linear Cracking	1/2" to 1"	4		No			Grind	
7291	THIRD STREET	215	401-581-09	D3	2	1931	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	9		No			Grind	
7292	THIRD STREET	215	401-581-09	D3	2	1931	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
7293	THIRD STREET	215	401-581-09	D3	2	1931	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	1		Yes			Grind	
7508	THIRD STREET	240	401-582-05	D3	2	1931	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes		Yes	Grind	
7305	THIRD STREET	250	401-572-03	D3	2	1929	Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	20		Yes		Yes	Replace Slab(s)	
7306	THIRD STREET	250	401-572-03	D3	2	1929	Curb/Gutter	PCC	Spalling	1/2" to 1"	3		No		Yes	Replace C&G	
7307	THIRD STREET	250	401-572-03	D3	2	1929	Sidewalk	PCC	Spalling	1/2" to 1"	1		No		Yes	Replace C&G	
7302	THIRD STREET	255	401-584-06	D3	2	1930	Sidewalk	PCC	Corner Break	1/4" to 1/2"	2		Yes		Yes	Grind	
7381	THIRD STREET	300	401-573-01	D3	2	1929	Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	8		Yes		Yes	Replace Slab(s)	Temp ramps also
7378	THIRD STREET	300	401-573-01	D3	2	1929	Sidewalk	PCC	Linear Cracking	No Displacement	12		Yes		Yes	Joint Seal	
7376				D3	2	1929	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	15		Yes		Yes	Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
7389	THIRD STREET	305	401-585-02	D3	2	1930	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		Yes		Yes	Grind	Prev grind
7372	THIRD STREET	305	401-573-11	D3	2	1929	Curb/Gutter	PCC	Faulting	1" to 2"	1		Yes		Yes	Replace C&G	
7374	THIRD STREET	305	401-573-11	D3	2	1929	Driveway	PCC	Faulting	1/4" to 1/2"	6		No		Yes	Grind Driveway	
7512	THIRD STREET	305	401-592-09	D3	2	1932	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7513	THIRD STREET	305	401-592-09	D3	2	1932	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
7385	THIRD STREET	305	401-585-02	D3	2	1930	Driveway	PCC	Linear Cracking	1/4" to 1/2"	12		No		Yes	Grind	
7390	THIRD STREET	305	401-585-02	D3	2	1930	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	12		Yes		Yes	Grind	
7386	THIRD STREET	305	401-585-02	D3	2	1930	Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	14		Yes		Yes	Replace Slab(s)	
7510	THIRD STREET	310	401-592-19	D3	2	1932	Sidewalk	PCC	Faulting	1/2" to 1"	2		Yes		Yes	Ramp	Prev grind
7511	THIRD STREET	310	401-592-19	D3	2	1932	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes		Yes	Grind	Prev grind
10930	THIRD STREET	340	401-563-07	D3	2	1928	Sidewalk	PCC	Temporary Ramp	1" to 2"	4		No			Replace Slab	
10922	THIRD STREET	500	401-364-06	D3	2	1927	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Prev grind
10923	THIRD STREET	500	401-364-06	D3	2	1927	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
10924	THIRD STREET	500	401-364-06	D3	2	1927	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
10917	THIRD STREET	610	401-552-01	D2	2	1926	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
10992	THIRD STREET	645	401-551-21	D2	2	1926	Sidewalk	PCC	Linear Cracking	1" to 2"	8		No			Replace Slab(s)	
7301	THIRD STREET		401-584-05	D3	2	1930	Sidewalk	PCC	Corner Break	1/4" to 1/2"	4		No		Yes	Grind	
7507	THIRD STREET		401-582-04	D3	2	1931	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No		Yes	Grind	
11331	TUSTIN AVENUE, NORTH	100	400-091-13	D2	2	2100	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No		Yes	Grind	
11332	TUSTIN AVENUE, NORTH	100	400-091-13	D2	2	2100	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	5		No		Yes	Grind	
11328	TUSTIN AVENUE, NORTH	131	400-032-12	C2	2	2100	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	2		No		Yes	Grind	
11329	TUSTIN AVENUE, NORTH	151	400-032-10	C2	2	2100	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No		Yes	Grind	
11330	TUSTIN AVENUE, NORTH	171	400-032-04	C2	2	2100	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No		Yes	Grind	
11398	TUSTIN VILLAGE WAY	15610	402-251-05	E2	2	1940	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
11399	TUSTIN VILLAGE WAY	15610	402-251-05	E2	2	1940	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
11400	TUSTIN VILLAGE WAY	15701	402-292-15	E2	2	1940	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
11401	TUSTIN VILLAGE WAY	15701	402-292-15	E2	2	1940	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
11402	TUSTIN VILLAGE WAY	15701	402-292-15	E2	2	1940	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
11397	TUSTIN VILLAGE WAY	15762	402-252-07	E2	2	1939	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No		Yes	Grind	
11404	TUSTIN VILLAGE WAY	16801	402-301-05	E2	2	1939	Sidewalk	PCC	Corner Break	1/4" to 1/2"	4		No		Yes	Grind	
11406	TUSTIN VILLAGE WAY	16801	402-301-05	E2	2	1939	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No		Yes	Grind	
11403	TUSTIN VILLAGE WAY	16801	402-301-05	E2	2	1939	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	3	1	No		Yes	Grind	
11405	TUSTIN VILLAGE WAY	16801	402-301-05	E2	2	1939	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	25		No		Yes	Grind	
11396	TUSTIN VILLAGE WAY	16851	402-252-03	E2	2	1939	Driveway	PCC	Faulting	1/4" to 1/2"	2		No		Yes	Grind Driveway	at pole/patxh
11394	TUSTIN VILLAGE WAY	16851	402-252-03	E2	2	1939	Driveway	PCC	Divided Slab	1/4" to 1/2"			No		Yes	Replace Slab	
11393	TUSTIN VILLAGE WAY	16851	402-252-03	E2	2	1939	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No		Yes	Grind	
11395	TUSTIN VILLAGE WAY	16851	402-252-03	E2	2	1939	Driveway	PCC	Linear Cracking	1/4" to 1/2"			No		Yes	Grind	
10485	TUSTIN VILLAGE WAY		999-000-02	D2	2	1941	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
10482	TUSTIN VILLAGE WAY		402-261-05	D2	2	1941	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10484	TUSTIN VILLAGE WAY		999-000-02	D2	2	1941	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
10483	TUSTIN VILLAGE WAY		402-261-05	D2	2	1941	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
10486	TUSTIN VILLAGE WAY		999-000-02	D2	2	1941	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	6		Yes			Grind	
10487	TUSTIN VILLAGE WAY		999-000-02	D2	2	1941	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	12		Yes			Grind	
11450	WALNUT AVENUE	17272	402-151-02	E3	2	1258	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	Prev grind
11449	WALNUT AVENUE	17272	402-151-02	E3	2	1258	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev work
11448	WALNUT AVENUE	17272	402-151-02	E3	2	1258	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No		Yes	Grind	
11451	WALNUT AVENUE	17272	402-151-02	E3	2	1258	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
11457	WALNUT AVENUE	17292	402-152-05	E3	2	1258	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No		Yes	Grind	
11458	WALNUT AVENUE	17292	402-152-05	E3	2	1258	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		Yes		Yes	Grind	
11460	WALNUT AVENUE	17292	402-152-05	E3	2	1258	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No		Yes	Grind	
11459	WALNUT AVENUE	17292	402-152-05	E3	2	1258	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	25		No		Yes	Grind	
8856	WHITBY CIRCLE	17021	402-172-18	E2	2	1964	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
8855	WHITBY CIRCLE	17021	402-172-18	E2	2	1964	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight displacement
8854	WHITBY CIRCLE	17041	402-172-06	E2	2	1964	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight displacement
8857	WHITBY CIRCLE	17042	402-172-10	E2	2	1964	Sidewalk	PCC	Divided Slab	No Displacement	6		Yes			Replace Slab(s)	
8859	WHITBY CIRCLE	17042	402-172-10	E2	2	1964	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"		4	Yes			Grind	
8858	WHITBY CIRCLE	17042	402-172-10	E2	2	1964	Curb/Gutter	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
8853	WHITBY CIRCLE	17051	402-172-05	E2	2	1964	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
8860	WHITBY CIRCLE	17052	402-172-11	E2	2	1964	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
8861	WHITBY CIRCLE	17052	402-172-11	E2	2	1964	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
8862	WHITBY CIRCLE	17062	402-172-12	E2	2	1964	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
8850	WHITBY CIRCLE	17081	402-172-03	E2	2	1964	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
8849	WHITBY CIRCLE	17081	402-172-03	E2	2	1964	Sidewalk	PCC	Temporary Ramp	1" to 2"	4		No			Replace Slab	Prev grind
8851				E2	2	1964	Driveway	PCC	Linear Cracking	1/2" to 1"	6		No			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
8852	WHITBY CIRCLE	17081	402-172-03	E2	2	1964	Sidewalk	PCC	Linear Cracking	1/2" to 1"	4		No			Grind	
8863	WHITBY CIRCLE	17082	402-172-13	E2	2	1964	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
8848	WHITBY CIRCLE	17091	402-172-02	E2	2	1964	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
8847	WHITBY CIRCLE	17091	402-172-02	E2	2	1964	Cross Gutter	PCC	Linear Cracking	1/4" to 1/2"	6		No			Grind	
10507	WILLIAMS STREET	15202	402-271-16	D2	2	1271	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10508	WILLIAMS STREET	15202	402-271-16	D2	2	1271	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10499	WILLIAMS STREET	15352	402-271-18	D2	2	1270	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
10501	WILLIAMS STREET	15352	402-271-18	D2	2	1270	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
10497	WILLIAMS STREET	15352	402-271-18	D2	2	1270	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	3		No			Grind	
10498	WILLIAMS STREET	15352	402-271-18	D2	2	1270	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
10500	WILLIAMS STREET	15352	402-271-18	D2	2	1270	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
10509	WILLIAMS STREET	15401	402-011-02	D2	2	1270	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	
10511	WILLIAMS STREET	15401	402-011-03	D2	2	1270	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
10510	WILLIAMS STREET	15401	402-011-02	D2	2	1270	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	3		Yes			Grind	
10512	WILLIAMS STREET	15481	402-021-01	D2	2	1270	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
10513	WILLIAMS STREET	15481	402-021-01	D2	2	1270	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
10514	WILLIAMS STREET	15481	402-021-01	D2	2	1270	Sidewalk	PCC	Linear Cracking	1/2" to 1"	4		Yes			Grind	
10496	WILLIAMS STREET	15502	402-281-02	D2	2	1270	Sidewalk	PCC	Spalling	1" to 2"	1		No			Patch	
10515	WILLIAMS STREET	15571	402-021-07	E2	2	1270	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes		Yes	Grind	
11978	WILLIAMS STREET	15600	402-292-19	E2	2	1269	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
11987	WILLIAMS STREET	15631	402-031-06	E2	2	1269	Curb/Gutter	PCC	Linear Cracking	1/2" to 1"	2		No			Grind	6 cracks
11984	WILLIAMS STREET	15631	402-031-06	E2	2	1269	Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	3		No			Grind	Pole base
11985	WILLIAMS STREET	15631	402-031-06	E2	2	1269	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
11988	WILLIAMS STREET	15631	402-031-06	E2	2	1269	Driveway	PCC	Linear Cracking	1/4" to 1/2"	8		No			Grind	
10517	WILLIAMS STREET	15631	402-031-06	E2	2	1269	Curb/Gutter	PCC	Sidewalk Curb Separation	1" to 2"	7		Yes			Replace Curb	
11986	WILLIAMS STREET	15631	402-031-06	E2	2	1269	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	5		Yes			Grind	
11983	WILLIAMS STREET	15631	402-031-06	E2	2	1269	Curb/Gutter	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
10516	WILLIAMS STREET	15631	402-031-06	E2	2	1269	Sidewalk	PCC	Spalling	1/2" to 1"	1		Yes			Replace C&G	
11981	WILLIAMS STREET	15631	402-031-06	E2	2	1269	Sidewalk	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
11982	WILLIAMS STREET	15631	402-031-06	E2	2	1269	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
11976	WILLIAMS STREET	15652	402-292-18	E2	2	1269	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
10528	WILLIAMS STREET	15652	402-292-18	E2	2	1269	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
11975	WILLIAMS STREET	15652	402-292-18	E2	2	1269	Curb/Gutter	PCC	Linear Cracking	1/2" to 1"	2		No			Grind	
11977	WILLIAMS STREET	15652	402-292-18	E2	2	1269	Driveway	PCC	Linear Cracking	1/4" to 1/2"	15		No			Grind	
11997	WILLIAMS STREET	15701	402-031-07	E2	2	1269	Curb/Gutter	PCC	Linear Cracking	1/2" to 1"	2		No		Yes	Grind	6 cracks
10518	WILLIAMS STREET	15701	402-031-07	E2	2	1269	Sidewalk	PCC	Faulting	1" to 2"	4		Yes			Replace Slab	
10523	WILLIAMS STREET	15701	402-031-07	E2	2	1269	Sidewalk	PCC	Faulting	1" to 2"	3		Yes			Replace Slab	
10521	WILLIAMS STREET	15701	402-031-07	E2	2	1269	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	
11994	WILLIAMS STREET	15701	402-031-07	E2	2	1269	Sidewalk	PCC	Faulting	1/2" to 1"	6		Yes			Ramp	
11995	WILLIAMS STREET	15701	402-031-07	E2	2	1269	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
11996	WILLIAMS STREET	15701	402-031-07	E2	2	1269	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No		Yes	Grind	
11993	WILLIAMS STREET	15701	402-031-07	E2	2	1269	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	10		No			Grind	
10519	WILLIAMS STREET	15701	402-031-07	E2	2	1269	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	8		Yes			Replace Slab	
10522	WILLIAMS STREET	15701	402-031-07	E2	2	1269	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	12		Yes			Replace Slab	
10524	WILLIAMS STREET	15701	402-031-07	E2	2	1269	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	8		Yes			Replace Slab	
10525	WILLIAMS STREET	15701	402-031-07	E2	2	1269	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	8		Yes		Yes	Replace Slab	
11991	WILLIAMS STREET	15701	402-031-07	E2	2	1269	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	12		Yes			Replace Slab	
11992	WILLIAMS STREET	15701	402-031-07	E2	2	1269	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	4		Yes			Grind	
11990	WILLIAMS STREET	15701	402-031-07	E2	2	1269	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	12		Yes			Grind	
10520	WILLIAMS STREET	15701	402-031-07	E2	2	1269	Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	10		Yes			Replace Slab(s)	
11989	WILLIAMS STREET	15701	402-031-07	E2	2	1269	Driveway	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
11998	WILLIAMS STREET	15701	402-031-07	E2	2	1269	Sidewalk	PCC	Spalling	1/4" to 1/2"	2		No		Yes	Grind	
11971	WILLIAMS STREET	15742	402-301-01	E2	2	1269	Sidewalk	PCC	Faulting	1" to 2"	4		Yes			Replace Slab	Prev grind
11973	WILLIAMS STREET	15742	402-301-01	E2	2	1269	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	Prev grind
10526	WILLIAMS STREET	15742	402-301-01	E2	2	1269	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
11974	WILLIAMS STREET	15742	402-301-01	E2	2	1269	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
10527	WILLIAMS STREET	15742	402-301-01	E2	2	1269	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	
11970	WILLIAMS STREET	15742	402-301-01	E2	2	1269	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
11972	WILLIAMS STREET	15742	402-301-01	E2	2	1269	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
10495	WILLIAMS STREET	16501	402-291-02	E2	2	1270	Sidewalk	PCC	Faulting	1/2" to 1"	4		No			Ramp	
11980	WILLIAMS STREET	16502	402-292-01	E2	2	1269	Driveway	PCC	Divided Slab	1" to 2"	10		No			Replace Slab(s)	
10529	WILLIAMS STREET	16502	402-292-01	E2	2	1269	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	3		No			Grind	
11979	WILLIAMS STREET	16502	402-292-01	E2	2	1269	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
11099				D2	2	1272	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No		Yes	Grind	Prev grind

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
11098	YORBA STREET	140	401-302-05	D2	2	1272	Sidewalk	PCC	Faulting	1/2" to 1"	2.5		Yes			Ramp	
11096	YORBA STREET	14891	401-302-15	C2	2	1272	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No		Yes	Grind	
11097	YORBA STREET	14891	401-302-15	C2	2	1272	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	8		Yes			Grind	
11128	YORBA STREET	17332	401-512-01	C2	2	1272	Sidewalk	PCC		1/4" to 1/2"	1.5		No			Grind	
11127	YORBA STREET	177	401-521-01	C2	2	1272	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
Zone 3																	
9425	ANDREWS STREET	1032	500-171-17	D3	3	1519	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
9288	ANDREWS STREET	1052	500-171-15	D3	3	1519	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
9289	ANDREWS STREET	1062	500-171-14	D3	3	1519	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
9291	ANDREWS STREET	1082	500-171-13	D3	3	1519	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
9290	ANDREWS STREET	1082	500-171-13	D3	3	1519	Driveway	PCC	Linear Cracking	1/4" to 1/2"	8		No			Grind	
9292	ANDREWS STREET	1092	500-171-12	D3	3	1519	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
9294	ANDREWS STREET	1092	500-171-12	D3	3	1519	Driveway	PCC	Linear Cracking	1/4" to 1/2"	6		No			Grind	
9293	ANDREWS STREET	1092	500-171-12	D3	3	1519	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	2		No			Grind	
3892	ANDREWS STREET	1151	500-171-27	D3	3	1520	Sidewalk	PCC	Corner Break	1/4" to 1/2"	2		No		Yes	Grind	Light post
3890	ANDREWS STREET	1151	500-171-27	D3	3	1520	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No		Yes	Grind	
3893	ANDREWS STREET	1151	500-171-27	D3	3	1520	Curb/Gutter	PCC	Linear Cracking	1/2" to 1"	2		No		Yes	Grind	
3894	ANDREWS STREET	1151	500-171-27	D3	3	1520	Ramp	PCC	Sidewalk Curb Separation	1" to 2"	8		No		Yes	Replace Ramp	
3891	ANDREWS STREET	1151	500-171-27	D3	3	1520	Sidewalk	PCC		1/2" to 1"	1		No		Yes	Replace C&G	
3895	ANDREWS STREET	1252	500-091-18	D3	3	1520	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No		Yes	Grind	Prev grind
3896	ANDREWS STREET	1302	500-091-13	D4	3	1520	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
3897	ANDREWS STREET	1322	500-091-12	D4	3	1520	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
3898	ANDREWS STREET	1342	500-091-11	D4	3	1520	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
3899	ANDREWS STREET	1352	500-091-10	D4	3	1520	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
3889	ANDREWS STREET	13631	500-093-01	D3	3	1520	Sidewalk	PCC	Faulting	1/4" to 1/2"	6		No		Yes	Grind	
3900	ANDREWS STREET	13631	500-092-14	D4	3	1520	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
3907	ANDREWS STREET	13632	500-092-01	D4	3	1520	Sidewalk	PCC	Linear Cracking	No Displacement	6		No			Joint Seal	
9310	ANDREWS STREET	13661	500-171-04	D3	3	1519	Driveway	PCC	Linear Cracking	1/4" to 1/2"	6		No			Grind	
9309	ANDREWS STREET	13661	500-171-04	D3	3	1519	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	10		Yes			Grind	
9316	ANDREWS STREET	13662	500-171-02	D3	3	1519	Sidewalk	PCC	Linear Cracking	No Displacement	12		Yes			Joint Seal	Slight displacement
9317	ANDREWS STREET	13662	500-171-02	D3	3	1519	Sidewalk	PCC	Linear Cracking	No Displacement	12		Yes			Joint Seal	Slight displacement
9315	ANDREWS STREET	13662	500-171-28	D3	3	1519	Sidewalk	PCC	Faulting	1/4" to 1/2"	6		No			Grind	
9311	ANDREWS STREET	13662	500-171-28	D3	3	1519	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	6		No			Grind	
9314	ANDREWS STREET	13662	500-171-28	D3	3	1519	Curb/Gutter	PCC	Spalling	1" to 2"	2		No			Patch	
9312	ANDREWS STREET	13662	500-171-28	D3	3	1519	Driveway	PCC	Spalling	1/2" to 1"	2		No			Replace C&G	
9313	ANDREWS STREET	13662	500-171-28	D3	3	1519	Driveway	PCC	Spalling	1/2" to 1"	2		No			Replace C&G	
9424	ANDREWS STREET	13682	500-171-18	D3	3	1519	Sidewalk	PCC	Corner Break	1/4" to 1/2"	2		No			Grind	
9423	ANDREWS STREET	13682	500-171-18	D3	3	1519	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	6		No			Grind	
9295	ANDREWS STREET	13688	500-171-11	D3	3	1519	Sidewalk	PCC	Faulting	1/2" to 1"	5		No			Ramp	
9296	ANDREWS STREET	13688	500-171-11	D3	3	1519	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No			Grind	
6892	ANDREWS STREET	1761	103-743-09	E4	3	1521	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
6893	ANDREWS STREET	1761	103-743-09	E4	3	1521	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	3		Yes			Grind	
6517	ANDREWS STREET	1782	103-742-46	E4	3	1521	Driveway	PCC	Sidewalk Curb Separation	1/4" to 1/2"	1		No			Grind	Between driveway and curb
6518	ANDREWS STREET	1782	103-742-46	E4	3	1521	Sidewalk	PCC		1/4" to 1/2"	1		No			Grind	
6519	ANDREWS STREET	1792	103-742-45	E4	3	1521	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	Prev grind
6890	ANDREWS STREET	1801	103-743-12	E4	3	1521	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	Prev grind
6889	ANDREWS STREET	1801	103-743-12	E4	3	1521	Sidewalk	PCC	Faulting	1/2" to 1"	1		Yes			Ramp	
6888	ANDREWS STREET	1801	103-743-12	E4	3	1521	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
6891	ANDREWS STREET	1801	103-743-12	E4	3	1521	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
6522	ANDREWS STREET	1802	103-742-44	E4	3	1521	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No			Grind	Running parallel to sidewalk
6520	ANDREWS STREET	1802	103-742-44	E4	3	1521	Sidewalk	PCC	Faulting	1/2" to 1"	2		No			Ramp	
6524	ANDREWS STREET	1802	103-742-44	E4	3	1521	Sidewalk	PCC	Faulting	1/2" to 1"	2		No			Ramp	
6521	ANDREWS STREET	1802	103-742-44	E4	3	1521	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		Yes			Grind	
6523	ANDREWS STREET	1802	103-742-44	E4	3	1521	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
4397	ARLOURA WAY	1291	103-633-21	D4	3	1527	Driveway	PCC	Linear Cracking	1/2" to 1"	5		Yes			Grind	
4398	ARLOURA WAY	1291	103-633-21	D4	3	1527	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	5		No			Grind	
4399	ARLOURA WAY	1291	103-633-21	D4	3	1527	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
4404	ARLOURA WAY	1292	103-633-20	D4	3	1527	Driveway	PCC	Faulting	1/4" to 1/2"	5		No			Grind Driveway	
4403	ARLOURA WAY	1292	103-633-20	D4	3	1527	Driveway	PCC	Linear Cracking	1/4" to 1/2"	5		No				
4400	ARLOURA WAY	1292	103-633-20	D4	3	1527	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
4401	ARLOURA WAY	1292	103-633-20	D4	3	1527	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
4402	ARLOURA WAY	1292	103-633-20	D4	3	1527	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
4406				I	D4	3	1527	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes		Ramp	Prev grind

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
4405	ARLOURA WAY	1302	103-633-19	D4	3	1527	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	Prev grind
4396	ARLOURA WAY	1311	103-633-23	D4	3	1527	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
4407	ARLOURA WAY	1312	103-633-18	D4	3	1527	Sidewalk	PCC	Linear Cracking	No Displacement	4		Yes			Joint Seal	Prev grind
4408	ARLOURA WAY	1332	103-633-17	D4	3	1527	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
3736	BONITA STREET	1022	500-151-17	D3	3	1557	Driveway	PCC	Other - Leave Comment	1/4" to 1/2"	5		No		Yes	Patch	Scaling
3735	BONITA STREET	1022	500-151-17	D3	3	1557	Sidewalk	PCC	Linear Cracking	No Displacement	3		No		Yes	Joint Seal	
3732	BONITA STREET	1043	500-152-04	D3	3	1557	Curb/Gutter	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind C&G	
3737	BONITA STREET	1052	500-151-14	D3	3	1557	Sidewalk	PCC	Faulting	Over 2"	4		No			Replace Slab	Driveway
3738	BONITA STREET	1062	500-151-13	D3	3	1557	Sidewalk	PCC	Faulting	1/4" to 1/2"	4	1"	No			Grind	Prev grind
3739	BONITA STREET	1062	500-151-13	D3	3	1557	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
3740	BONITA STREET	1062	500-151-13	D3	3	1557	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
3731	BONITA STREET	1071	500-152-07	D3	3	1557	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
3730	BONITA STREET	1100	500-151-09	D3	3	1557	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Prev grind
3733	BONITA STREET	13882	500-152-27	D3	3	1557	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	6		Yes		Yes	Replace Slab	
3729	BONITA STREET	13891	500-152-11	D3	3	1557	Cross Gutter	PCC	Linear Cracking	No Displacement	10		No		Yes	Joint Seal	
3734	BONITA STREET	13920	500-151-18	D3	3	1557	Driveway	PCC	Sidewalk Curb Separation	1" to 2"	12		No		Yes	Patch	
6817	BROWNING AVENUE	13451	103-421-36	E4	3	1004	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	Prev grind
6814	BROWNING AVENUE	13451	103-421-36	E4	3	1004	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6815	BROWNING AVENUE	13451	103-421-36	E4	3	1004	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
6816	BROWNING AVENUE	13451	103-421-36	E4	3	1004	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
1318	BROWNING AVENUE	13601	103-261-01	E4	3	1329	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No		Yes	Grind	At edison patch
1317	BROWNING AVENUE	13601	103-261-01	E4	3	1329	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No		Yes	Grind	
1319	BROWNING AVENUE	13601	103-261-01	E4	3	1329	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No		Yes	Grind	
1320	BROWNING AVENUE	13601	103-261-01	E4	3	1329	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No		Yes	Grind	
1321	BROWNING AVENUE	13601	103-261-01	E4	3	1329	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No		Yes	Grind	
1322	BROWNING AVENUE	13601	103-261-01	E4	3	1329	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No		Yes	Grind	
1323	BROWNING AVENUE	13601	103-261-01	E4	3	1330	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No		Yes	Grind	
1288	BROWNING AVENUE	13941	500-071-11	E4	3	1328	Driveway	PCC	Faulting	1/2" to 1"	2		No			Grind Driveway	
1310	BROWNING AVENUE	1971	500-074-10	E4	3	1328	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
1289	BROWNING AVENUE	1972	500-073-17	E4	3	1328	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
6818	BROWNING AVENUE	1972	103-421-37	E4	3	1004	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
6819	BROWNING AVENUE	1972	103-421-37	E4	3	1004	Sidewalk	PCC	Spalling	1/4" to 1/2"	1.5		No			Grind	
6812	BROWNING AVENUE		999-000-66	E4	3	1004	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Prev grind
1315	BROWNING AVENUE		500-074-11	E4	3	1328	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	Prev grind
1316	BROWNING AVENUE		500-074-11	E4	3	1328	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		Yes			Grind	Prev grind
6813	BROWNING AVENUE		999-000-66	E4	3	1004	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
6822	BROWNING AVENUE		999-000-66	E4	3	1004	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
1311	BROWNING AVENUE		500-074-11	E4	3	1328	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
1312	BROWNING AVENUE		500-074-11	E4	3	1328	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
1313	BROWNING AVENUE		500-074-11	E4	3	1328	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
1314	BROWNING AVENUE		500-074-11	E4	3	1328	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6840	BRYAN (FRONTAGE) AVENUE	1871	103-421-26	E4	3	1571	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6830	BRYAN (FRONTAGE) AVENUE	1911	103-421-23	E4	3	1571	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
6831	BRYAN (FRONTAGE) AVENUE	1911	103-421-23	E4	3	1571	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Prev grind
6832	BRYAN (FRONTAGE) AVENUE	1911	103-421-23	E4	3	1571	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
6833	BRYAN (FRONTAGE) AVENUE	1911	103-421-23	E4	3	1571	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	Prev grind
6835	BRYAN (FRONTAGE) AVENUE	1911	103-421-23	E4	3	1571	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
6838	BRYAN (FRONTAGE) AVENUE	1911	103-421-23	E4	3	1571	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		Yes			Grind	Prev grind
6839	BRYAN (FRONTAGE) AVENUE	1911	103-421-23	E4	3	1571	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	Prev grind
6834	BRYAN (FRONTAGE) AVENUE	1911	103-421-23	E4	3	1571	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
6837	BRYAN (FRONTAGE) AVENUE	1911	103-421-23	E4	3	1571	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
6836	BRYAN (FRONTAGE) AVENUE	1911	103-421-23	E4	3	1571	Driveway	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
6000	BRYAN AVENUE	1051	500-131-08	D3	3	1006	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No		Yes	Grind	Prev grind
5997	BRYAN AVENUE	1051	500-131-08	D3	3	1006	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes		Yes	Grind	
5998	BRYAN AVENUE	1051	500-131-08	D3	3	1006	Driveway	PCC	Linear Cracking	1/2" to 1"	3		No		Yes	Grind	
6001	BRYAN AVENUE	1051	500-131-08	D3	3	1006	Sidewalk	PCC	Patch / Utility Cut	1/2" to 1"	5		No		Yes	Grind	
5999	BRYAN AVENUE	1051	500-131-08	D3	3	1006	Sidewalk	AC	Patch / Utility Cut	1/4" to 1/2"	5		No		Yes	AC Patch	
6007	BRYAN AVENUE	1082	500-162-02	D3	3	1006	Driveway	PCC	Linear Cracking	1/2" to 1"	7		No			Patch	Partially filled
11962	BRYAN AVENUE	1082	500-162-02	D3	3	1006	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
11963	BRYAN AVENUE	1082	500-162-02	D3	3	1006	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
5996	BRYAN AVENUE	1091	500-131-09	D3	3	1006	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes		Yes	Grind	
5995	BRYAN AVENUE	1101	500-131-10	D3	3	1006	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes		Yes	Grind	
6010	BRYAN AVENUE	1131	500-162-03	D3	3	1006	Sidewalk	PCC	Divided Slab	1/4" to 1/2"			No			Replace Slab	Low
11964					D3	3	1006	Curb/Gutter	PCC	Linear Cracking	1/4" to 1/2"	2		No		Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
6009	BRYAN AVENUE	1131	500-162-03	D3	3	1006	Driveway	PCC	Linear Cracking	1/4" to 1/2"	7		No			Grind	
6030	BRYAN AVENUE	1262	500-093-21	D4	3	1007	Sidewalk	PCC	Corner Break	1/4" to 1/2"	4		Yes			Grind	
6031	BRYAN AVENUE	1262	500-093-21	D4	3	1007	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	6		Yes			Grind	
6162	BRYAN AVENUE	1332	500-122-22	D4	3	1007	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
6160	BRYAN AVENUE	1342	500-122-23	D4	3	1007	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	4		No			Grind	
6161	BRYAN AVENUE	1342	500-122-23	D4	3	1007	Sidewalk	PCC	Spalling	1" to 2"	0.5		No			Patch	
6866	BRYAN AVENUE	13461	103-332-31	E4	3	1008	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
5994	BRYAN AVENUE	13461	500-131-16	D3	3	1006	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes		Yes	Grind	
6708	BRYAN AVENUE	13471	103-523-16	D4	3	1008	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		Yes			Ramp	Running parallel with sidewalk
6707	BRYAN AVENUE	13471	103-523-16	D4	3	1008	Sidewalk	PCC	Faulting	1/4" to 1/2"	8		No			Grind	Running parallel with sidewalk
6853	BRYAN AVENUE	13471	103-252-11	E4	3	1009	Sidewalk	PCC	Faulting	1" to 2"	2		No			Replace Slab	
6706	BRYAN AVENUE	13471	103-523-16	D4	3	1008	Sidewalk	PCC	Faulting	1/2" to 1"	1		No			Ramp	
6844	BRYAN AVENUE	13471	103-252-18	E4	3	1009	Sidewalk	PCC	Faulting	1/2" to 1"	3		No			Ramp	
6709	BRYAN AVENUE	13471	103-523-16	D4	3	1008	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
6842	BRYAN AVENUE	13471	103-252-18	E4	3	1009	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
6846	BRYAN AVENUE	13471	103-252-18	E4	3	1009	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
6847	BRYAN AVENUE	13471	103-252-18	E4	3	1009	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
6854	BRYAN AVENUE	13471	103-252-11	E4	3	1009	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
6856	BRYAN AVENUE	13471	103-252-11	E4	3	1009	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
6855	BRYAN AVENUE	13471	103-252-11	E4	3	1009	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	8		Yes			Replace Slab	
6843	BRYAN AVENUE	13471	103-252-18	E4	3	1009	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	3.5		No			Grind	
6845	BRYAN AVENUE	13471	103-252-18	E4	3	1009	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	4		Yes			Grind	
5915	BRYAN AVENUE	13471	500-121-01	D4	3	1007	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	8		No			Grind	
6857	BRYAN AVENUE	13471	103-252-11	E4	3	1009	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	5		No			Grind	
6710	BRYAN AVENUE	13471	103-523-16	D4	3	1008	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
6711	BRYAN AVENUE	13472	103-523-17	D4	3	1008	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	Prev grind
6848	BRYAN AVENUE	13472	103-252-12	E4	3	1009	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	Prev grind
6849	BRYAN AVENUE	13472	103-252-12	E4	3	1009	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
6627	BRYAN AVENUE	13472	103-522-01	D4	3	1008	Sidewalk	PCC	Faulting	1" to 2"	6		Yes			Replace Slab	Running parallel with sidewalk
6712	BRYAN AVENUE	13472	103-523-17	D4	3	1008	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Running parallel with sidewalk
6625	BRYAN AVENUE	13472	103-522-01	D4	3	1008	Sidewalk	PCC	Faulting	1/2" to 1"	3.5		No			Ramp	
6867	BRYAN AVENUE	13472	103-332-54	E4	3	1008	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
6622	BRYAN AVENUE	13472	103-522-01	D4	3	1008	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
6623	BRYAN AVENUE	13472	103-522-01	D4	3	1008	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6628	BRYAN AVENUE	13472	103-522-01	D4	3	1008	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
6713	BRYAN AVENUE	13472	103-523-17	D4	3	1008	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6850	BRYAN AVENUE	13472	103-252-12	E4	3	1009	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
6851	BRYAN AVENUE	13472	103-252-12	E4	3	1009	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
6852	BRYAN AVENUE	13472	103-252-12	E4	3	1009	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
6858	BRYAN AVENUE	13472	103-252-01	E4	3	1009	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
6626	BRYAN AVENUE	13472	103-522-01	D4	3	1008	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	6		Yes			Replace Slab	
6624	BRYAN AVENUE	13472	103-522-01	D4	3	1008	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	2.5		No			Grind	
6780	BRYAN AVENUE	13501	103-731-18	E4	3	1008	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	Prev grind
6740	BRYAN AVENUE	13501	500-052-21	D4	3	1008	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
6735	BRYAN AVENUE	13501	500-052-07	D4	3	1008	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
6781	BRYAN AVENUE	13501	103-731-18	E4	3	1008	Sidewalk	PCC	Faulting	1" to 2"	3		No			Replace Slab	Running parallel to sidewalk
6792	BRYAN AVENUE	13501	103-741-07	E4	3	1008	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6778	BRYAN AVENUE	13501	103-731-18	D4	3	1008	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
6779	BRYAN AVENUE	13501	103-731-18	D4	3	1008	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6738	BRYAN AVENUE	13501	500-052-21	D4	3	1008	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
6739	BRYAN AVENUE	13501	500-052-21	D4	3	1008	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
6795	BRYAN AVENUE	13501	103-742-17	E4	3	1009	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
6796	BRYAN AVENUE	13501	103-742-17	E4	3	1009	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6776	BRYAN AVENUE	13502	500-051-19	D4	3	1008	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
6777	BRYAN AVENUE	13502	500-051-19	D4	3	1008	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		Yes			Ramp	Running parallel with sidewalk
6773	BRYAN AVENUE	13502	500-051-19	D4	3	1008	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		Yes			Grind	
6774	BRYAN AVENUE	13502	500-051-19	D4	3	1008	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
6736	BRYAN AVENUE	13502	500-052-08	D4	3	1008	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6737	BRYAN AVENUE	13502	500-052-08	D4	3	1008	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6797	BRYAN AVENUE	13502	103-742-16	E4	3	1009	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
6798	BRYAN AVENUE	13502	103-742-16	E4	3	1009	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No		Yes	Grind	
6793	BRYAN AVENUE	13502	103-742-29	E4	3	1009	Sidewalk	PCC	Faulting	1/4" to 1/2"	4.5		No			Grind	
6794	BRYAN AVENUE	13502	103-742-29	E4	3	1009	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
6775				I	D4	3	1008	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	15		No		Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
6787	BRYAN AVENUE	13511	103-732-16	E4	3	1008	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Running parallel with sidewalk
6788	BRYAN AVENUE	13511	103-732-16	E4	3	1008	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
6789	BRYAN AVENUE	13512	103-732-17	E4	3	1008	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
6790	BRYAN AVENUE	13512	103-732-17	E4	3	1008	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
6791	BRYAN AVENUE	13512	103-732-17	E4	3	1008	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
6782	BRYAN AVENUE	13512	103-732-01	E4	3	1008	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
6008	BRYAN AVENUE	13522	500-162-01	D3	3	1006	Driveway	PCC	Linear Cracking	1/2" to 1"	7		No			Patch	Partially filled
6002	BRYAN AVENUE	13522	500-162-01	D3	3	1006	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
6003	BRYAN AVENUE	13522	500-162-01	D3	3	1006	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
6004	BRYAN AVENUE	13522	500-162-01	D3	3	1006	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
6005	BRYAN AVENUE	13522	500-162-01	D3	3	1006	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
11961	BRYAN AVENUE	13522	500-162-01	D3	3	1006	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
6006	BRYAN AVENUE	13522	500-162-01	D3	3	1006	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	7		No			Grind	
6806	BRYAN AVENUE	13601	103-261-01	E4	3	1009	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No		Yes	Grind	Prev grind
6799	BRYAN AVENUE	13601	103-261-01	E4	3	1009	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No		Yes	Grind	
6801	BRYAN AVENUE	13601	103-261-01	E4	3	1009	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No		Yes	Grind	
6802	BRYAN AVENUE	13601	103-261-01	E4	3	1009	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No		Yes	Grind	
6803	BRYAN AVENUE	13601	103-261-01	E4	3	1009	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes		Yes	Grind	
6804	BRYAN AVENUE	13601	103-261-01	E4	3	1009	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No		Yes	Grind	
6805	BRYAN AVENUE	13601	103-261-01	E4	3	1009	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No		Yes	Grind	
6807	BRYAN AVENUE	13601	103-261-01	E4	3	1009	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No		Yes	Grind	
6810	BRYAN AVENUE	13601	103-261-01	E4	3	1009	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No		Yes	Grind	
6811	BRYAN AVENUE	13601	103-261-01	E4	3	1009	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No		Yes	Grind	
6800	BRYAN AVENUE	13601	103-261-01	E4	3	1009	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	3		Yes		Yes	Grind	
6808	BRYAN AVENUE	13601	103-261-01	E4	3	1009	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	2.5		No		Yes	Grind	
6809	BRYAN AVENUE	13601	103-261-01	E4	3	1009	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No		Yes	Grind	
3875	BRYAN AVENUE	1372	500-094-08	D4	3	1007	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	4		No			Grind	
11533	BRYAN AVENUE	1402	500-083-09	D4	3	1007	Sidewalk	PCC	Other - Leave Comment	No Displacement			No		Yes	N/A	No distresses on this section
6784	BRYAN AVENUE	1671	103-732-02	E4	3	1008	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		No			Ramp	
6783	BRYAN AVENUE	1671	103-732-02	E4	3	1008	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6785	BRYAN AVENUE	1671	103-732-02	E4	3	1008	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6786	BRYAN AVENUE	1671	103-732-02	E4	3	1008	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6865	BRYAN AVENUE	1692	103-332-30	E4	3	1008	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	5		Yes			Grind	
6864	BRYAN AVENUE	1692	103-332-30	E4	3	1008	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
6861	BRYAN AVENUE	1702	103-332-29	E4	3	1008	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
6863	BRYAN AVENUE	1702	103-332-29	E4	3	1008	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
6862	BRYAN AVENUE	1702	103-332-29	E4	3	1008	Curb/Gutter	PCC	Sidewalk Curb Separation	Over 2"	8		Yes			Replace C&G	
6860	BRYAN AVENUE	1732	103-332-28	E4	3	1008	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	6		No			Grind	
6859	BRYAN AVENUE	1742	103-332-27	E4	3	1008	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	6		No			Grind	
6827	BRYAN AVENUE	1911	103-421-23	E4	3	1009	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Prev grind
6825	BRYAN AVENUE	1911	103-421-23	E4	3	1009	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
6826	BRYAN AVENUE	1911	103-421-23	E4	3	1009	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
6828	BRYAN AVENUE	1911	103-421-23	E4	3	1009	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6829	BRYAN AVENUE	1911	103-421-23	E4	3	1009	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
6158	BRYAN AVENUE		999-000-34	D4	3	1007	Sidewalk	PCC	Faulting	1/4" to 1/2"	6		No			Grind	
6029	BRYAN AVENUE		500-164-24	D4	3	1007	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
6823	BRYAN AVENUE		999-000-66	E4	3	1009	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
6824	BRYAN AVENUE		999-000-66	E4	3	1009	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
6159	BRYAN AVENUE		999-000-34	D4	3	1007	Sidewalk	PCC	Spalling	1/4" to 1/2"	2		No			Grind	
4425	CHARLOMA DRIVE	1261	103-633-10	D4	3	1610	Sidewalk	PCC	Linear Cracking	No Displacement	4		Yes			Joint Seal	Prev grind
4424	CHARLOMA DRIVE	1261	103-633-10	D4	3	1610	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
3884	CHARLOMA DRIVE	1261	500-093-07	D4	3	1607	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight displacement
5622	CHARLOMA DRIVE	1261	500-121-10	D4	3	1608	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
4421	CHARLOMA DRIVE	1261	103-633-10	D4	3	1610	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
4426	CHARLOMA DRIVE	1261	103-633-10	D4	3	1610	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
4427	CHARLOMA DRIVE	1261	103-633-10	D4	3	1610	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	8		No			Grind	
4434	CHARLOMA DRIVE	1262	103-633-03	D4	3	1610	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
4422	CHARLOMA DRIVE	1271	103-633-11	D4	3	1610	Driveway	PCC	Linear Cracking	1/4" to 1/2"	7		No			Grind	
4423	CHARLOMA DRIVE	1271	103-633-11	D4	3	1610	Driveway	PCC	Sidewalk Curb Separation	1/2" to 1"	10		No			Replace Driveway	
3910	CHARLOMA DRIVE	1272	500-092-05	D4	3	1607	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
4560	CHARLOMA DRIVE	1282	103-634-04	D4	3	1610	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
4561	CHARLOMA DRIVE	1282	103-634-04	D4	3	1610	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
4563	CHARLOMA DRIVE	1282	103-634-04	D4	3	1610	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	12		Yes			Grind	
4428				D4	3	1610	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
4429	CHARLOMA DRIVE	13111	103-633-07	D4	3	1610	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Prev grind
4430	CHARLOMA DRIVE	13111	103-633-07	D4	3	1610	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Prev grind
4559	CHARLOMA DRIVE	13112	103-634-03	D4	3	1610	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
4431	CHARLOMA DRIVE	13121	103-633-06	D4	3	1610	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Prev grind
4433	CHARLOMA DRIVE	13131	103-633-05	D4	3	1610	Sidewalk	PCC	Corner Break	1/4" to 1/2"	4		No			Grind	
4432	CHARLOMA DRIVE	13131	103-633-05	D4	3	1610	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
4558	CHARLOMA DRIVE	13132	103-634-01	D4	3	1610	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
4702	CHARLOMA DRIVE	13272	103-592-01	D4	3	1609	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
4703	CHARLOMA DRIVE	13272	103-592-01	D4	3	1609	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
4699	CHARLOMA DRIVE	13291	103-591-26	D4	3	1609	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
4700	CHARLOMA DRIVE	13301	103-591-27	D4	3	1609	Cross Gutter	PCC	Linear Cracking	1/4" to 1/2"	16		No			Grind	
4701	CHARLOMA DRIVE	13302	103-592-24	D4	3	1609	Cross Gutter	PCC	Linear Cracking	1/4" to 1/2"	7		No			Grind	
5623	CHARLOMA DRIVE	13361	500-121-09	D4	3	1608	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
5624	CHARLOMA DRIVE	13361	500-121-09	D4	3	1608	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight displacement
5625	CHARLOMA DRIVE	13371	500-121-08	D4	3	1608	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
6179	CHARLOMA DRIVE	13372	500-122-08	D4	3	1608	Sidewalk	PCC	Linear Cracking	No Displacement	4		Yes			Joint Seal	Prev fault
6178	CHARLOMA DRIVE	13372	500-122-08	D4	3	1608	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
5626	CHARLOMA DRIVE	13381	500-121-07	D4	3	1608	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
6177	CHARLOMA DRIVE	13382	500-122-07	D4	3	1608	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
6176	CHARLOMA DRIVE	13382	500-122-07	D4	3	1608	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
5627	CHARLOMA DRIVE	13401	500-121-06	D4	3	1608	Driveway	PCC	Faulting	1/4" to 1/2"	5		No			Grind Driveway	
5628	CHARLOMA DRIVE	13411	500-121-05	D4	3	1608	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight displacement
6175	CHARLOMA DRIVE	13412	500-122-05	D4	3	1608	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
5629	CHARLOMA DRIVE	13421	500-121-04	D4	3	1608	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight displacement
6173	CHARLOMA DRIVE	13422	500-122-04	D4	3	1608	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
6172	CHARLOMA DRIVE	13422	500-122-04	D4	3	1608	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
6174	CHARLOMA DRIVE	13422	500-122-04	D4	3	1608	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
5630	CHARLOMA DRIVE	13441	500-121-03	D4	3	1608	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight displacement
6168	CHARLOMA DRIVE	13442	500-122-03	D4	3	1608	Sidewalk	PCC	Divided Slab	No Displacement			No			Replace Slab	Low
6171	CHARLOMA DRIVE	13442	500-122-03	D4	3	1608	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	Prev fault
6170	CHARLOMA DRIVE	13442	500-122-03	D4	3	1608	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
6169	CHARLOMA DRIVE	13442	500-122-03	D4	3	1608	Driveway	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
5631	CHARLOMA DRIVE	13451	500-121-02	D4	3	1608	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight displacement
5908	CHARLOMA DRIVE	13451	500-121-02	D4	3	1608	Driveway	PCC	Corner Break	1/4" to 1/2"	4		Yes			Grind	
5911	CHARLOMA DRIVE	13451	500-121-02	D4	3	1608	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
6167	CHARLOMA DRIVE	13452	500-122-02	D4	3	1608	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	
5913	CHARLOMA DRIVE	13471	500-121-01	D4	3	1608	Driveway	PCC	Linear Cracking	1/2" to 1"	7		No			Grind	
5912	CHARLOMA DRIVE	13471	500-121-01	D4	3	1608	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
5914	CHARLOMA DRIVE	13471	500-121-01	D4	3	1608	Driveway	PCC	Spalling	1/2" to 1"	3		No			Replace C&G	
6164	CHARLOMA DRIVE	13472	500-122-01	D4	3	1608	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
6165	CHARLOMA DRIVE	13472	500-122-01	D4	3	1608	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
6166	CHARLOMA DRIVE	13472	500-122-01	D4	3	1608	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
6163	CHARLOMA DRIVE	13472	500-122-01	D4	3	1608	Ramp	PCC	Sidewalk Curb Separation	1/4" to 1/2"	4		No			Grind	
3885	CHARLOMA DRIVE	13581	500-093-06	D4	3	1607	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight displacement
3886	CHARLOMA DRIVE	13601	500-093-04	D4	3	1607	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
3887	CHARLOMA DRIVE	13621	500-093-02	D4	3	1607	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Prev grind
3888	CHARLOMA DRIVE	13631	500-093-01	D4	3	1607	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
3908	CHARLOMA DRIVE	13632	500-092-01	D4	3	1607	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
3909	CHARLOMA DRIVE	13632	500-092-01	D4	3	1607	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
3680	CHARLOMA DRIVE	13701	500-091-04	D3	3	1606	Driveway	PCC	Divided Slab	1/2" to 1"			No			Replace Slab(s)	Med/high
3679	CHARLOMA DRIVE	13701	500-091-04	D3	3	1606	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
3678	CHARLOMA DRIVE	13702	500-091-05	D3	3	1606	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	Prev grind
3681	CHARLOMA DRIVE	13711	500-091-03	D3	3	1606	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
3682	CHARLOMA DRIVE	13711	500-091-03	D3	3	1606	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
3674	CHARLOMA DRIVE	13712	500-091-06	D3	3	1606	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight displacement
3675	CHARLOMA DRIVE	13712	500-091-06	D3	3	1606	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
3676	CHARLOMA DRIVE	13712	500-091-06	D3	3	1606	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
3677	CHARLOMA DRIVE	13712	500-091-06	D3	3	1606	Curb/Gutter	PCC	Spalling	1/2" to 1"	0.5		No			Replace C&G	
3672	CHARLOMA DRIVE	13722	500-091-07	D3	3	1606	Driveway	PCC	Corner Break	1/2" to 1"	5		Yes			Ramp	
3673	CHARLOMA DRIVE	13722	500-091-07	D3	3	1606	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
3684	CHARLOMA DRIVE	13731	500-091-02	D3	3	1606	Driveway	PCC	Corner Break	1/2" to 1"	5		No			Ramp	
3683	CHARLOMA DRIVE	13731	500-091-02	D3	3	1606	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
3685	CHARLOMA DRIVE	13731	500-091-02	D3	3	1606	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
3686				!	D3	3	1606	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes		Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
3687	CHARLOMA DRIVE	13731	500-091-02	D3	3	1606	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
3688	CHARLOMA DRIVE	13731	500-091-02	D3	3	1606	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
3669	CHARLOMA DRIVE	13732	500-091-08	D3	3	1606	Driveway	PCC	Corner Break	1" to 2"	2.5		No			Replace Slab	
3667	CHARLOMA DRIVE	13732	500-091-08	D3	3	1606	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
3668	CHARLOMA DRIVE	13732	500-091-08	D3	3	1606	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
3671	CHARLOMA DRIVE	13732	500-091-08	D3	3	1606	Driveway	PCC	Linear Cracking	1/4" to 1/2"	6		No			Grind	
3670	CHARLOMA DRIVE	13732	500-091-08	D3	3	1606	Driveway	PCC	Spalling	1/2" to 1"	2.5		No			Replace C&G	
5977	CINDY LANE	1201	500-132-06	D4	3	1617	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
5978	CINDY LANE	1201	500-132-06	D4	3	1617	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
5972	CINDY LANE	1202	500-131-11	D4	3	1617	Sidewalk	PCC	Linear Cracking	No Displacement	10		No			Joint Seal	Slight displacement
5979	CINDY LANE	1202	500-132-04	D4	3	1617	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
5973	CINDY LANE	1202	500-131-11	D4	3	1617	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	6		No			Grind	
5993	CINDY LANE	1202	500-131-11	D4	3	1617	Sidewalk	PCC	Spalling	1/2" to 1"	2		No			Replace C&G	
5935	CINDY LANE	13372	500-131-28	D4	3	1617	Driveway	PCC	Linear Cracking	No Displacement	7		No			Joint Seal	Slight displacement
5934	CINDY LANE	13392	500-131-29	D4	3	1617	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight displacement
5932	CINDY LANE	13392	500-131-29	D4	3	1617	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
5933	CINDY LANE	13392	500-131-29	D4	3	1617	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
5930	CINDY LANE	13412	500-131-30	D4	3	1617	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
5931	CINDY LANE	13412	500-131-30	D4	3	1617	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	Prev grind
5927	CINDY LANE	13422	500-131-31	D4	3	1617	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
5929	CINDY LANE	13422	500-131-31	D4	3	1617	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
5924	CINDY LANE	13432	500-131-32	D4	3	1617	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
5925	CINDY LANE	13432	500-131-32	D4	3	1617	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
5926	CINDY LANE	13432	500-131-32	D4	3	1617	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	16		No			Grind	
5920	CINDY LANE	13452	500-131-33	D4	3	1617	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight displacement
5922	CINDY LANE	13452	500-131-33	D4	3	1617	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
5923	CINDY LANE	13452	500-131-33	D4	3	1617	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
5918	CINDY LANE	13472	500-131-34	D4	3	1617	Driveway	PCC	Linear Cracking	1/4" to 1/2"	7		No			Grind	
5917	CINDY LANE	13472	500-131-34	D4	3	1617	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
5916	CINDY LANE	13472	500-131-34	D4	3	1617	Ramp	PCC	Sidewalk Curb Separation	1/4" to 1/2"	8		No			Grind	
4715	CORAL REEF ROAD	13301	103-592-12	D4	3	1624	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight displacement
4714	CORAL REEF ROAD	13301	103-592-12	D4	3	1624	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
4680	CORAL REEF ROAD	13302	103-591-07	D4	3	1624	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight Displacement
4681	CORAL REEF ROAD	13302	103-591-07	D4	3	1624	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight Displacement
4679	CORAL REEF ROAD	13302	103-591-07	D4	3	1624	Driveway	PCC	Faulting	1/4" to 1/2"	12		No			Grind Driveway	
4678	CORAL REEF ROAD	13302	103-591-07	D4	3	1624	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
4682	CORAL REEF ROAD	13302	103-591-07	D4	3	1624	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
4677	CORAL REEF ROAD	13311	103-591-04	D4	3	1624	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
4676	CORAL REEF ROAD	13311	103-591-04	D4	3	1624	Sidewalk	PCC	Linear Cracking	1/2" to 1"	12		No			Grind	
4675	CORAL REEF ROAD	13311	103-591-04	D4	3	1624	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
4674	CORAL REEF ROAD	13321	103-591-05	D4	3	1624	Sidewalk	PCC	Punchout	1/4" to 1/2"	5		No			Replace Slab	
4795	CORAL REEF ROAD	13371	103-594-04	D4	3	1623	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
4796	CORAL REEF ROAD	13381	103-594-05	D4	3	1623	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
4797	CORAL REEF ROAD	13381	103-594-05	D4	3	1623	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
4799	CORAL REEF ROAD	13392	103-594-07	D4	3	1623	Driveway	PCC	Faulting	1/4" to 1/2"	4		No			Grind Driveway	
4798	CORAL REEF ROAD	13392	103-594-07	D4	3	1623	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
6951	CROMWELL DRIVE	13261	103-332-45	D4	3	1629	Driveway	PCC	Faulting	1/4" to 1/2"	5		No			Grind Driveway	Between driveway and sidewalk
6950	CROMWELL DRIVE	13261	103-332-45	D4	3	1629	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
6948	CROMWELL DRIVE	13262	103-332-46	D4	3	1629	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	Prev grind
6946	CROMWELL DRIVE	13262	103-332-46	D4	3	1629	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
6947	CROMWELL DRIVE	13262	103-332-46	D4	3	1629	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
6949	CROMWELL DRIVE	13262	103-332-46	D4	3	1629	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6944	CROMWELL DRIVE	13302	103-332-47	D4	3	1629	Driveway	PCC	Faulting	1/4" to 1/2"	6		No			Grind Driveway	Between driveway and sidewalk
6942	CROMWELL DRIVE	13302	103-332-47	D4	3	1629	Sidewalk	PCC	Faulting	1/2" to 1"	2		Yes			Ramp	Prev grind
6943	CROMWELL DRIVE	13302	103-332-47	D4	3	1629	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
6945	CROMWELL DRIVE	13302	103-332-47	D4	3	1629	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
6941	CROMWELL DRIVE	13312	103-332-48	D4	3	1629	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	Prev grind
6939	CROMWELL DRIVE	13312	103-332-48	D4	3	1629	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
6940	CROMWELL DRIVE	13312	103-332-48	D4	3	1629	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
6952	CROMWELL DRIVE	13341	103-332-40	D4	3	1628	Sidewalk	PCC	Faulting	1/2" to 1"	3.5		Yes			Ramp	Prev grind
6953	CROMWELL DRIVE	13351	103-332-39	D4	3	1628	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		Yes			Ramp	
6954	CROMWELL DRIVE	13351	103-332-39	D4	3	1628	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
7000	CROMWELL DRIVE	13352	103-333-13	D4	3	1628	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
6955				}	D4	3	1628	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No		Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
6999	CROMWELL DRIVE	13372	103-333-11	D4	3	1628	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6956	CROMWELL DRIVE	13391	103-332-35	D4	3	1628	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
6957	CROMWELL DRIVE	13461	103-332-31	E4	3	1628	Driveway	PCC	Sidewalk Curb Separation	1" to 2"	4		No			Patch	Between driveway and curb
6958	CROMWELL DRIVE	1692	103-332-30	E4	3	1628	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
6995	CROMWELL DRIVE	1701	103-333-03	E4	3	1628	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
6591	DEAN STREET	13511	103-732-16	E4	3	1635	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Between driveway and sidewalk
6592	DEAN STREET	13521	103-732-15	E4	3	1635	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		No			Ramp	
6590	DEAN STREET	13522	103-732-18	E4	3	1635	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
6593	DEAN STREET	13531	103-732-14	E4	3	1635	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6589	DEAN STREET	13532	103-732-19	E4	3	1635	Curb/Gutter	PCC	Faulting	1/4" to 1/2"			No			Grind C&G	
6594	DEAN STREET	13541	103-732-13	E4	3	1635	Sidewalk	PCC	Faulting	1/2" to 1"	1		Yes			Ramp	
6587	DEAN STREET	13542	103-732-20	E4	3	1635	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Prev grind
6588	DEAN STREET	13542	103-732-20	E4	3	1635	Sidewalk	PCC	Corner Break	1/4" to 1/2"	1		No			Grind	
6595	DEAN STREET	13561	103-732-12	E4	3	1635	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
6586	DEAN STREET	13562	103-732-21	E4	3	1635	Driveway	PCC	Sidewalk Curb Separation	1/4" to 1/2"	7		No			Grind	Between curb and driveway
6585	DEAN STREET	13562	103-732-21	E4	3	1635	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
6596	DEAN STREET	13571	103-732-11	E4	3	1635	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	3		No			Grind	
6583	DEAN STREET	13572	103-732-22	E4	3	1635	Sidewalk	PCC	Faulting	1/2" to 1"	1		No			Ramp	
6582	DEAN STREET	13572	103-732-22	E4	3	1635	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
6584	DEAN STREET	13572	103-732-22	E4	3	1635	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
6597	DEAN STREET	13581	103-732-10	E4	3	1635	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6581	DEAN STREET	1731	103-732-23	E4	3	1635	Sidewalk	PCC	Faulting	1/2" to 1"	2.5		No			Ramp	
6580	DEAN STREET	1731	103-732-23	E4	3	1635	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
6183	DEL CERRO DRIVE	13371	500-122-09	D4	3	1644	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
6184	DEL CERRO DRIVE	13381	500-122-10	D4	3	1644	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	Prev grind
6185	DEL CERRO DRIVE	13381	500-122-10	D4	3	1644	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	Prev grind
6186	DEL CERRO DRIVE	13381	500-122-10	D4	3	1644	Driveway	PCC	Faulting	1/4" to 1/2"	5		No			Grind Driveway	
6187	DEL CERRO DRIVE	13401	500-122-11	D4	3	1644	Driveway	PCC	Linear Cracking	No Displacement	6		No			Joint Seal	
6188	DEL CERRO DRIVE	13402	500-122-14	D4	3	1644	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Prev grind
6650	DIAMOND HEAD DRIVE	13292	103-522-16	D4	3	1649	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
6649	DIAMOND HEAD DRIVE	13302	103-522-15	D4	3	1649	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
6646	DIAMOND HEAD DRIVE	13302	103-522-15	D4	3	1649	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
6648	DIAMOND HEAD DRIVE	13302	103-522-15	D4	3	1649	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
6647	DIAMOND HEAD DRIVE	13322	103-522-14	D4	3	1649	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
6644	DIAMOND HEAD DRIVE	13332	103-522-13	D4	3	1649	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
6645	DIAMOND HEAD DRIVE	13332	103-522-13	D4	3	1649	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6641	DIAMOND HEAD DRIVE	13342	103-522-12	D4	3	1648	Sidewalk	PCC	Faulting	1/2" to 1"	2		No			Ramp	
6643	DIAMOND HEAD DRIVE	13342	103-522-12	D4	3	1648	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6640	DIAMOND HEAD DRIVE	13342	103-522-12	D4	3	1648	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	1.5		No			Grind	
6642	DIAMOND HEAD DRIVE	13342	103-522-12	D4	3	1648	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
6639	DIAMOND HEAD DRIVE	13352	103-522-11	D4	3	1648	Driveway	PCC	Faulting	1/4" to 1/2"	4		No			Grind Driveway	Between driveway and sidewalk
6638	DIAMOND HEAD DRIVE	13352	103-522-11	D4	3	1648	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		No			Ramp	
6636	DIAMOND HEAD DRIVE	13352	103-522-11	D4	3	1648	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
6637	DIAMOND HEAD DRIVE	13352	103-522-11	D4	3	1648	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6688	DIAMOND HEAD DRIVE	13361	103-523-07	D4	3	1648	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Prev grind
6689	DIAMOND HEAD DRIVE	13361	103-523-07	D4	3	1648	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
6635	DIAMOND HEAD DRIVE	13362	103-522-10	D4	3	1648	Driveway	PCC	Sidewalk Curb Separation	1/2" to 1"	2.5		No			Patch	Between curb and driveway
6691	DIAMOND HEAD DRIVE	13371	103-523-08	D4	3	1648	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
6690	DIAMOND HEAD DRIVE	13371	103-523-08	D4	3	1648	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
6634	DIAMOND HEAD DRIVE	13372	103-522-09	D4	3	1648	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		No			Ramp	
6693	DIAMOND HEAD DRIVE	13381	103-523-09	D4	3	1648	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	Prev grind
6694	DIAMOND HEAD DRIVE	13381	103-523-09	D4	3	1648	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
6695	DIAMOND HEAD DRIVE	13381	103-523-09	D4	3	1648	Sidewalk	PCC	Faulting	1/2" to 1"	1		Yes			Ramp	
6692	DIAMOND HEAD DRIVE	13381	103-523-09	D4	3	1648	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
6632	DIAMOND HEAD DRIVE	13392	103-522-07	D4	3	1648	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
6633	DIAMOND HEAD DRIVE	13392	103-522-07	D4	3	1648	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6696	DIAMOND HEAD DRIVE	13411	103-523-11	D4	3	1648	Driveway	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind Driveway	Between driveway and sidewalk
6697	DIAMOND HEAD DRIVE	13411	103-523-11	D4	3	1648	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
6701	DIAMOND HEAD DRIVE	13421	103-523-12	D4	3	1648	Driveway	PCC	Sidewalk Curb Separation	1/2" to 1"	5		No			Patch	Between driveway and curb
6698	DIAMOND HEAD DRIVE	13421	103-523-12	D4	3	1648	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		Yes			Ramp	
6699	DIAMOND HEAD DRIVE	13421	103-523-12	D4	3	1648	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
6700	DIAMOND HEAD DRIVE	13421	103-523-12	D4	3	1648	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
6702	DIAMOND HEAD DRIVE	13431	103-523-13	D4	3	1648	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
6703				D4	3	1648	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	Prev grind

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
6631	DIAMOND HEAD DRIVE	13432	103-522-04	D4	3	1648	Sidewalk	PCC	Faulting	1/2" to 1"	2		No			Ramp	Running parallel with sidewalk
6704	DIAMOND HEAD DRIVE	13441	103-523-14	D4	3	1648	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
6705	DIAMOND HEAD DRIVE	13461	103-523-15	D4	3	1648	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6630	DIAMOND HEAD DRIVE	13462	103-522-02	D4	3	1648	Driveway	PCC	Faulting	1/4" to 1/2"	2		No			Grind Driveway	Running parallel with sidewalk
6629	DIAMOND HEAD DRIVE	13472	103-522-01	D4	3	1648	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
6741	DIAMOND HEAD DRIVE	13511	500-052-20	D4	3	1647	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6742	DIAMOND HEAD DRIVE	13511	500-052-20	D4	3	1647	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
6743	DIAMOND HEAD DRIVE	13531	500-052-19	D4	3	1647	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
6772	DIAMOND HEAD DRIVE	13532	500-051-17	D4	3	1647	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
6771	DIAMOND HEAD DRIVE	13542	500-051-16	E4	3	1647	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Prev grind
6767	DIAMOND HEAD DRIVE	13562	500-051-14	E4	3	1647	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
6769	DIAMOND HEAD DRIVE	13562	500-051-14	E4	3	1647	Sidewalk	PCC	Faulting	1/2" to 1"	2		No			Ramp	
6768	DIAMOND HEAD DRIVE	13562	500-051-14	E4	3	1647	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6770	DIAMOND HEAD DRIVE	13562	500-051-14	E4	3	1647	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6744	DIAMOND HEAD DRIVE	13581	500-052-15	E4	3	1647	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
6765	DIAMOND HEAD DRIVE	13592	500-051-12	E4	3	1647	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6766	DIAMOND HEAD DRIVE	13592	500-051-12	E4	3	1647	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
6764	DIAMOND HEAD DRIVE	13602	500-051-11	E4	3	1647	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
6668	DIAMOND HEAD DRIVE	1581	103-522-31	D4	3	1649	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	Between curb and driveway
6682	DIAMOND HEAD DRIVE	1582	103-523-06	D4	3	1648	Driveway	PCC	Faulting	1/4" to 1/2"	3		No			Grind Driveway	
6683	DIAMOND HEAD DRIVE	1582	103-523-06	D4	3	1648	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6684	DIAMOND HEAD DRIVE	1582	103-523-06	D4	3	1648	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
6685	DIAMOND HEAD DRIVE	1582	103-523-06	D4	3	1648	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
6687	DIAMOND HEAD DRIVE	1582	103-523-06	D4	3	1648	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
6763	DIAMOND HEAD DRIVE	1582	500-051-09	E4	3	1647	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
6686	DIAMOND HEAD DRIVE	1582	103-523-06	D4	3	1648	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	1		No			Grind	
9412	EL CAMINO REAL	1081	500-151-20	E3	3	1325	Curb/Gutter	PCC	Spalling	1/2" to 1"	2		No		Yes	Replace C&G	
9407	EL CAMINO REAL	1171	500-141-24	E3	3	1324	Sidewalk	PCC	Corner Break	1/4" to 1/2"	3		No		Yes	Grind	
9408	EL CAMINO REAL	1171	500-141-24	E3	3	1324	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes		Yes	Grind	
9409	EL CAMINO REAL	1171	500-141-24	E3	3	1324	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes		Yes	Grind	
9410	EL CAMINO REAL	1171	500-141-24	E3	3	1324	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes		Yes	Grind	
9406	EL CAMINO REAL	1171	500-141-24	E3	3	1324	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	6		Yes		Yes	Grind	
9411	EL CAMINO REAL	1171	500-141-24	E3	3	1324	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	8		Yes		Yes	Grind	
9405	EL CAMINO REAL	1171	500-141-26	E3	3	1324	Sidewalk	PCC	Spalling	1/4" to 1/2"	2		No		Yes	Grind	Hole in traffic signal patch
1407	EL CAMINO REAL	13872	500-022-01	E4	3	1326	Sidewalk	PCC	Patch / Utility Cut	No Displacement			No		Yes	Patch	
1409	EL CAMINO REAL	13872	500-022-01	E4	3	1326	Driveway	PCC	Faulting	1/4" to 1/2"	3		No		Yes	Grind Driveway	
1408	EL CAMINO REAL	13872	500-022-01	E4	3	1326	Sidewalk	PCC	Spalling	1/4" to 1/2"			No		Yes	Grind	
1386	EL CAMINO REAL	13881	500-041-07	E4	3	1326	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
1389	EL CAMINO REAL	13881	500-041-07	E4	3	1326	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
1390	EL CAMINO REAL	13881	500-041-07	E4	3	1326	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
1391	EL CAMINO REAL	13881	500-041-07	E4	3	1326	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
1392	EL CAMINO REAL	13881	500-041-07	E4	3	1326	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
1393	EL CAMINO REAL	13881	500-041-07	E4	3	1326	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
1387	EL CAMINO REAL	13881	500-041-07	E4	3	1326	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
1388	EL CAMINO REAL	13881	500-041-07	E4	3	1326	Curb/Gutter	PCC	Spalling	Over 2"			No			Replace C&G	
9397	EL CAMINO REAL	13891	500-141-12	E3	3	1323	Driveway	PCC	Linear Cracking	1/2" to 1"	6		No		Yes	Grind	
9398	EL CAMINO REAL	13891	500-141-12	E3	3	1323	Driveway	PCC	Linear Cracking	1/2" to 1"	6		No		Yes	Grind	
9399	EL CAMINO REAL	13891	500-141-12	E3	3	1323	Driveway	PCC	Linear Cracking	1/2" to 1"	6		No		Yes	Grind	
9395	EL CAMINO REAL	13891	500-141-12	E3	3	1323	Curb/Gutter	PCC	Spalling	1/2" to 1"	2		No		Yes	Replace C&G	Replace C&G
9396	EL CAMINO REAL	13891	500-141-12	E3	3	1323	Sidewalk	PCC	Spalling	1/2" to 1"	2		No		Yes	Replace C&G	
1410	EL CAMINO REAL	13922	500-042-01	E4	3	1327	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
1411	EL CAMINO REAL	13922	500-042-01	E4	3	1327	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
1412	EL CAMINO REAL	13922	500-042-01	E4	3	1327	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
9400	EL CAMINO REAL	1431	500-141-19	E3	3	1323	Sidewalk	PCC	Other - Leave Comment	Over 2"	1		No		Yes	Replace Slab	
9401	EL CAMINO REAL	1431	500-141-19	E3	3	1323	Driveway	PCC	Spalling	1/2" to 1"	1		No		Yes	Replace C&G	Hole in util cover
9402	EL CAMINO REAL	1431	500-141-19	E3	3	1323	Sidewalk	PCC	Spalling	1/2" to 1"	2		No		Yes	Replace C&G	
1404	EL CAMINO REAL	1571	500-022-02	E4	3	1326	Sidewalk	PCC	Linear Cracking	No Displacement	10		No		Yes	Joint Seal	
1401	EL CAMINO REAL	1571	500-022-02	E4	3	1326	Driveway	PCC	Divided Slab	1/4" to 1/2"			No		Yes	Replace Slab(s)	Whole driveway has cracks
1403	EL CAMINO REAL	1571	500-022-02	E4	3	1326	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No		Yes	Grind	
1405	EL CAMINO REAL	1571	500-022-02	E4	3	1326	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No		Yes	Grind	
1402	EL CAMINO REAL	1571	500-022-02	E4	3	1326	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No		Yes	Grind	Field Assess-Monitor
1406	EL CAMINO REAL	1571	500-022-02	E4	3	1326	Curb/Gutter	PCC	Spalling	No Displacement			No		Yes	Field Assess-Monitor	
1400	EL CAMINO REAL	1611	500-022-08	E4	3	1326	Driveway	PCC	Linear Cracking	No Displacement	10		No		Yes	Joint Seal	
1413				E4	3	1327	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
1414	EL CAMINO REAL	1881	500-071-15	E4	3	1327	Sidewalk	PCC	Linear Cracking	No Displacement	8		No			Joint Seal	
1416	EL CAMINO REAL		500-071-12	E4	3	1327	Sidewalk	AC	Patch / Utility Cut	1/2" to 1"	5		No			AC Patch	At water patches
1397	EL CAMINO REAL		500-041-09	E4	3	1326	Driveway	PCC	Divided Slab	1/4" to 1/2"		4"	No		Yes	Replace Slab(s)	Driveway divided with cracks.
9403	EL CAMINO REAL		500-141-29	E3	3	1323	Sidewalk	PCC	Other - Leave Comment	Over 2"	1		No			Replace Slab	Hole in util cover
9404	EL CAMINO REAL		500-141-29	E3	3	1323	Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	4		No			Grind	Hydrant
1415	EL CAMINO REAL		500-071-12	E4	3	1327	Sidewalk	AC	Bumps and Sags	1/4" to 1/2"	0.5		No			AC Patch	
1398	EL CAMINO REAL		500-041-02	E4	3	1326	Driveway	PCC	Faulting	1/4" to 1/2"	5		No		Yes	Grind Driveway	
1394	EL CAMINO REAL		500-041-09	E4	3	1326	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No		Yes	Grind	
1395	EL CAMINO REAL		500-041-09	E4	3	1326	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No		Yes	Grind	
1396	EL CAMINO REAL		500-041-09	E4	3	1326	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No		Yes	Grind	
1399	EL CAMINO REAL		500-041-02	E4	3	1326	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No		Yes	Grind	
1417	EL CAMINO REAL		500-071-12	E4	3	1327	Sidewalk	PCC	Faulting	Over 2"	6		No			Replace Slab	
9193	ELIZABETH WAY	1095	501-081-24	C4	3	1659	Driveway	PCC	Corner Break	1/2" to 1"	6		No		Yes	Ramp	
9194	ELIZABETH WAY	1095	501-081-24	C4	3	1659	Driveway	PCC	Divided Slab	1" to 2"	12		No		Yes	Replace Slab(s)	
9198	ELIZABETH WAY	1095	501-081-24	C4	3	1659	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes		Yes	Ramp	
9199	ELIZABETH WAY	1095	501-081-24	C4	3	1659	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes		Yes	Grind	
9197	ELIZABETH WAY	1095	501-081-24	C4	3	1659	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	3		Yes		Yes	Grind	
9195	ELIZABETH WAY	1095	501-081-24	C4	3	1659	Curb/Gutter	PCC	Spalling	1" to 2"	3		No		Yes	Patch	
9196	ELIZABETH WAY	1095	501-081-24	C4	3	1659	Curb/Gutter	PCC	Spalling	Over 2"	2		No		Yes	Replace C&G	
5959	ELIZABETH WAY	1132	500-131-15	D4	3	1658	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
5960	ELIZABETH WAY	1132	500-131-15	D4	3	1658	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
5962	ELIZABETH WAY	1132	500-131-15	D4	3	1658	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
5990	ELIZABETH WAY	1151	500-132-09	D4	3	1658	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
5991	ELIZABETH WAY	1151	500-132-09	D4	3	1658	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
5985	ELIZABETH WAY	1152	500-132-01	D4	3	1658	Sidewalk	PCC	Faulting	1" to 2"	3		Yes			Replace Slab	Prev grind
5984	ELIZABETH WAY	1152	500-132-01	D4	3	1658	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
5986	ELIZABETH WAY	1152	500-132-01	D4	3	1658	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
9286	ELIZABETH WAY	1161	501-081-14	C4	3	1659	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes		Yes	Grind	
9285	ELIZABETH WAY	1161	501-081-14	C4	3	1659	Driveway	PCC	Linear Cracking	1/4" to 1/2"	6		No		Yes	Grind	
9287	ELIZABETH WAY	1161	501-081-14	C4	3	1659	Driveway	PCC	Sidewalk Curb Separation	Over 2"	8		No		Yes	Replace Driveway	
9185	ELIZABETH WAY	12911	501-081-12	C4	3	1659	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes		Yes	Ramp	
9187	ELIZABETH WAY	12911	501-081-12	C4	3	1659	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes		Yes	Ramp	
9186	ELIZABETH WAY	12911	501-081-12	C4	3	1659	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes		Yes	Grind	
9188	ELIZABETH WAY	12911	501-081-12	C4	3	1659	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes		Yes	Grind	
9192	ELIZABETH WAY	12951	501-081-23	C4	3	1659	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		Yes		Yes	Grind	Prev grind
9189	ELIZABETH WAY	12951	501-081-23	C4	3	1659	Driveway	PCC	Corner Break	1" to 2"	3		No		Yes	Replace Slab	
9191	ELIZABETH WAY	12951	501-081-23	C4	3	1659	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No		Yes	Grind	
9190	ELIZABETH WAY	12951	501-081-23	C4	3	1659	Curb/Gutter	PCC	Linear Cracking	1/2" to 1"	2		No		Yes	Grind	
5947	ELIZABETH WAY	13371	500-131-21	D4	3	1658	Driveway	PCC	Corner Break	1/4" to 1/2"	2		No			Grind	
5948	ELIZABETH WAY	13391	500-131-20	D4	3	1658	Driveway	PCC	Faulting	1" to 2"	9		Yes			Replace Driveway	Prev grind
5950	ELIZABETH WAY	13391	500-131-20	D4	3	1658	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	Prev grind
5949	ELIZABETH WAY	13391	500-131-20	D4	3	1658	Driveway	PCC	Sidewalk Curb Separation	1" to 2"	15		Yes			Replace Driveway	
5954	ELIZABETH WAY	13411	500-131-19	D4	3	1658	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	Prev grind
5953	ELIZABETH WAY	13411	500-131-19	D4	3	1658	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
5952	ELIZABETH WAY	13411	500-131-19	D4	3	1658	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
5987	ELIZABETH WAY	13422	500-132-10	D4	3	1658	Sidewalk	PCC	Corner Break	1/4" to 1/2"	1		No			Grind	
5989	ELIZABETH WAY	13422	500-132-10	D4	3	1658	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
5988	ELIZABETH WAY	13422	500-132-10	D4	3	1658	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	
5956	ELIZABETH WAY	13431	500-131-18	D4	3	1658	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	Prev grind
5957	ELIZABETH WAY	13431	500-131-18	D4	3	1658	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
5958	ELIZABETH WAY	13461	500-131-16	D4	3	1658	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
6722	EPPING WAY	13361	103-523-27	D4	3	1663	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	Prev grind
6723	EPPING WAY	13361	103-523-27	D4	3	1663	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
6720	EPPING WAY	13362	103-523-26	D4	3	1663	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
6721	EPPING WAY	13362	103-523-26	D4	3	1663	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
6724	EPPING WAY	13371	103-523-28	D4	3	1663	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
6719	EPPING WAY	13372	103-523-25	D4	3	1663	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		No			Ramp	Between sidewalk and driveway
6725	EPPING WAY	13381	103-523-29	D4	3	1663	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	Between driveway sidewalk
6726	EPPING WAY	13381	103-523-29	D4	3	1663	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
6717	EPPING WAY	13382	103-523-24	D4	3	1663	Driveway	PCC	Faulting	1/4" to 1/2"	4		No			Grind Driveway	
6718	EPPING WAY	13382	103-523-24	D4	3	1663	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6727	EPPING WAY	13391	103-523-30	D4	3	1663	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6728	EPPING WAY	13411	103-523-31	D4	3	1663	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	Prev grind
6729		.		D4	3	1663	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
6716	EPPING WAY	13412	103-523-22	D4	3	1663	Driveway	PCC	Sidewalk Curb Separation	1/4" to 1/2"	10		No			Grind	Between driveway and curb
6730	EPPING WAY	13441	103-523-34	D4	3	1663	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6731	EPPING WAY	13461	103-523-35	D4	3	1663	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	Prev grind
6732	EPPING WAY	13461	103-523-35	D4	3	1663	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	Prev grind
6714	EPPING WAY	13462	103-523-18	D4	3	1663	Driveway	PCC	Sidewalk Curb Separation	1/4" to 1/2"	3		No			Grind	Between curb and driveway
6715	EPPING WAY	13462	103-523-18	D4	3	1663	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
6733	EPPING WAY	13471	103-523-36	D4	3	1663	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
6734	EPPING WAY	13471	103-523-36	D4	3	1663	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6750	EPPING WAY	13501	500-052-07	D4	3	1662	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
6751	EPPING WAY	13501	500-052-07	D4	3	1662	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
6749	EPPING WAY	13502	500-052-08	D4	3	1662	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	1.5		No			Grind	
6752	EPPING WAY	13531	500-052-05	D4	3	1662	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
6748	EPPING WAY	13542	500-052-11	D4	3	1662	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	Prev grind
6753	EPPING WAY	13551	500-052-03	D4	3	1662	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
6747	EPPING WAY	13552	500-052-12	D4	3	1662	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6754	EPPING WAY	13581	500-052-01	D4	3	1662	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
9304	ESTERO CIRCLE	13628	500-171-07	D3	3	1664	Driveway	PCC	Linear Cracking	1/4" to 1/2"	6		No			Grind	
9300	ESTERO CIRCLE	13637	500-171-06	D3	3	1664	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
9302	ESTERO CIRCLE	13647	500-171-05	D3	3	1664	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	Prev grind
9303	ESTERO CIRCLE	13647	500-171-05	D3	3	1664	Driveway	PCC	Divided Slab	1/4" to 1/2"	15		No			Replace Slab	
9301	ESTERO CIRCLE	13647	500-171-05	D3	3	1664	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
9305	ESTERO CIRCLE	13647	500-171-05	D3	3	1664	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
9298	ESTERO CIRCLE	13654	500-171-09	D3	3	1664	Driveway	PCC	Divided Slab	1/4" to 1/2"	15		No			Replace Slab	
9297	ESTERO CIRCLE	13654	500-171-09	D3	3	1664	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
9299	ESTERO CIRCLE	13654	500-171-09	D3	3	1664	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	5		Yes			Grind	
9306	ESTERO CIRCLE	13661	500-171-04	D3	3	1664	Driveway	PCC	Corner Break	1/4" to 1/2"	5		No			Grind	
9307	ESTERO CIRCLE	13661	500-171-04	D3	3	1664	Driveway	PCC	Linear Cracking	1/2" to 1"	8		No			Grind	
9308	ESTERO CIRCLE	13661	500-171-04	D3	3	1664	Driveway	PCC	Sidewalk Curb Separation	1/2" to 1"	8		No			Replace Driveway	
6552	FALMOUTH DRIVE	13501	103-742-17	E4	3	1672	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
6553	FALMOUTH DRIVE	13511	103-742-18	E4	3	1672	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
6550	FALMOUTH DRIVE	13532	103-742-14	E4	3	1672	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
6551	FALMOUTH DRIVE	13532	103-742-14	E4	3	1672	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
6554	FALMOUTH DRIVE	13541	103-742-20	E4	3	1672	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
6555	FALMOUTH DRIVE	13561	103-742-21	E4	3	1672	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
6548	FALMOUTH DRIVE	13582	103-742-11	E4	3	1672	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	Prev grind
6547	FALMOUTH DRIVE	13582	103-742-11	E4	3	1672	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		Yes			Grind	
6549	FALMOUTH DRIVE	13582	103-742-11	E4	3	1672	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
6546	FALMOUTH DRIVE	13592	103-742-10	E4	3	1671	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
6544	FALMOUTH DRIVE	13602	103-742-09	E4	3	1671	Sidewalk	PCC	Faulting	1/2" to 1"	2		No			Ramp	
6543	FALMOUTH DRIVE	13602	103-742-09	E4	3	1671	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6545	FALMOUTH DRIVE	13602	103-742-09	E4	3	1671	Driveway	PCC	Sidewalk Curb Separation	1/4" to 1/2"	5		No			Grind	
6542	FALMOUTH DRIVE	13662	103-742-33	E4	3	1670	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
6540	FALMOUTH DRIVE	13662	103-742-33	E4	3	1670	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
6541	FALMOUTH DRIVE	13662	103-742-33	E4	3	1670	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
6530	FALMOUTH DRIVE	13671	103-742-43	E4	3	1670	Driveway	PCC	Sidewalk Curb Separation	1/2" to 1"	2		No			Patch	Between driveway and curb
6531	FALMOUTH DRIVE	13691	103-742-42	E4	3	1670	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6538	FALMOUTH DRIVE	13692	103-742-35	E4	3	1670	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
6539	FALMOUTH DRIVE	13692	103-742-35	E4	3	1670	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
6532	FALMOUTH DRIVE	13701	103-742-41	E4	3	1670	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
6533	FALMOUTH DRIVE	13701	103-742-41	E4	3	1670	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
6537	FALMOUTH DRIVE	13702	103-742-36	E4	3	1670	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
6536	FALMOUTH DRIVE	13712	103-742-37	E4	3	1670	Driveway	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind Driveway	Between sidewalk and driveway
6535	FALMOUTH DRIVE	13712	103-742-37	E4	3	1670	Sidewalk	PCC	Faulting	1/2" to 1"	1		No			Ramp	
6534	FALMOUTH DRIVE	13732	103-742-38	E4	3	1670	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6887	FALMOUTH DRIVE	1801	103-743-12	E4	3	1671	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	Prev grind
6556	FALMOUTH DRIVE	1801	103-742-22	E4	3	1672	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6886	FALMOUTH DRIVE	1801	103-743-12	E4	3	1671	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
6557	FALMOUTH DRIVE	1801	103-742-22	E4	3	1672	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
6528	FALMOUTH DRIVE	1802	103-742-44	E4	3	1670	Sidewalk	PCC	Faulting	1" to 2"	4		No			Replace Slab	Running parallel to sidewalk
6883	FALMOUTH DRIVE	1802	103-743-13	E4	3	1671	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		Yes			Ramp	
6884	FALMOUTH DRIVE	1802	103-743-13	E4	3	1671	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		Yes			Ramp	
6885	FALMOUTH DRIVE	1802	103-743-13	E4	3	1671	Sidewalk	PCC	Faulting	1/2" to 1"	3.5		No			Ramp	
6525	FALMOUTH DRIVE	1802	103-742-44	E4	3	1670	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
6527				E4	3	1670	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
6529	FALMOUTH DRIVE	1802	103-742-44	E4	3	1670	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
6526	FALMOUTH DRIVE	1802	103-742-44	E4	3	1670	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	8		Yes			Replace Slab	
7013	FALMOUTH PLACE	13411	103-252-07	E4	3	1673	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
7014	FALMOUTH PLACE	13421	103-252-08	E4	3	1673	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
7031	FALMOUTH PLACE	13422	103-252-15	E4	3	1673	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
7032	FALMOUTH PLACE	13422	103-252-15	E4	3	1673	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
7033	FALMOUTH PLACE	13422	103-252-15	E4	3	1673	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	Prev grind
7034	FALMOUTH PLACE	13422	103-252-15	E4	3	1673	Sidewalk	PCC	Faulting	1/4" to 1/2"	4.5		No			Grind	
7015	FALMOUTH PLACE	13431	103-252-09	E4	3	1673	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
7016	FALMOUTH PLACE	13431	103-252-09	E4	3	1673	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
7030	FALMOUTH PLACE	13432	103-252-14	E4	3	1673	Driveway	PCC	Faulting	1/4" to 1/2"	6		No			Grind Driveway	Between driveway and sidewalk
7024	FALMOUTH PLACE	13432	103-252-14	E4	3	1673	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	Prev grind
7026	FALMOUTH PLACE	13432	103-252-14	E4	3	1673	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	Prev grind
7029	FALMOUTH PLACE	13432	103-252-14	E4	3	1673	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	Prev grind
7028	FALMOUTH PLACE	13432	103-252-14	E4	3	1673	Sidewalk	PCC	Faulting	1/2" to 1"	2		No			Ramp	
7025	FALMOUTH PLACE	13432	103-252-14	E4	3	1673	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7027	FALMOUTH PLACE	13432	103-252-14	E4	3	1673	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
7017	FALMOUTH PLACE	13451	103-252-10	E4	3	1673	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		Yes			Ramp	
7023	FALMOUTH PLACE	13452	103-252-13	E4	3	1673	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	Prev grind
7020	FALMOUTH PLACE	13452	103-252-13	E4	3	1673	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
7021	FALMOUTH PLACE	13452	103-252-13	E4	3	1673	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
7022	FALMOUTH PLACE	13452	103-252-13	E4	3	1673	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	2.5		Yes			Grind	
7019	FALMOUTH PLACE	13471	103-252-11	E4	3	1673	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
7018	FALMOUTH PLACE	13471	103-252-11	E4	3	1673	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		No			Ramp	
6979	FARMINGTON ROAD	13381	103-254-05	E4	3	1676	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
6980	FARMINGTON ROAD	13381	103-254-05	E4	3	1676	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6976	FARMINGTON ROAD	13392	103-252-06	E4	3	1676	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
6977	FARMINGTON ROAD	13392	103-252-06	E4	3	1676	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
6978	FARMINGTON ROAD	13392	103-252-06	E4	3	1676	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
6983	FARMINGTON ROAD	13411	103-254-03	E4	3	1676	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
6981	FARMINGTON ROAD	13411	103-254-03	E4	3	1676	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
6982	FARMINGTON ROAD	13411	103-254-03	E4	3	1676	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6984	FARMINGTON ROAD	13411	103-254-03	E4	3	1676	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6985	FARMINGTON ROAD	13411	103-254-03	E4	3	1676	Driveway	PCC	Linear Cracking	1/4" to 1/2"	3		No			Grind	
6975	FARMINGTON ROAD	13412	103-252-05	E4	3	1676	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	Prev grind
6974	FARMINGTON ROAD	13412	103-252-05	E4	3	1676	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
6973	FARMINGTON ROAD	13412	103-252-05	E4	3	1676	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
6986	FARMINGTON ROAD	13421	103-254-02	E4	3	1676	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6971	FARMINGTON ROAD	13422	103-252-04	E4	3	1676	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	Prev grind
6972	FARMINGTON ROAD	13422	103-252-04	E4	3	1676	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
6970	FARMINGTON ROAD	13432	103-252-03	E4	3	1676	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
6968	FARMINGTON ROAD	13452	103-252-02	E4	3	1676	Driveway	PCC	Sidewalk Curb Separation	1/4" to 1/2"	5		No			Grind	Between driveway and curb
6969	FARMINGTON ROAD	13452	103-252-02	E4	3	1676	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		No			Ramp	
6967	FARMINGTON ROAD	13452	103-252-02	E4	3	1676	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
6963	FARMINGTON ROAD	13471	103-253-01	E4	3	1676	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
6964	FARMINGTON ROAD	13471	103-253-01	E4	3	1676	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
6962	FARMINGTON ROAD	13471	103-253-01	E4	3	1676	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
6966	FARMINGTON ROAD	13472	103-252-01	E4	3	1676	Driveway	PCC	Sidewalk Curb Separation	1/4" to 1/2"	10		No			Grind	Between driveway and curb
6965	FARMINGTON ROAD	13472	103-252-01	E4	3	1676	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
6568	FARMINGTON ROAD	13501	103-741-07	E4	3	1675	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6567	FARMINGTON ROAD	13502	103-742-29	E4	3	1675	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
6569	FARMINGTON ROAD	13511	103-741-06	E4	3	1675	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
6570	FARMINGTON ROAD	13511	103-741-06	E4	3	1675	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		Yes			Grind	
6571	FARMINGTON ROAD	13511	103-741-06	E4	3	1675	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
6566	FARMINGTON ROAD	13512	103-742-28	E4	3	1675	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
6572	FARMINGTON ROAD	13531	103-741-05	E4	3	1675	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		Yes			Grind	Prev grind
6563	FARMINGTON ROAD	13532	103-742-27	E4	3	1675	Driveway	PCC	Faulting	1/4" to 1/2"	6		No			Grind Driveway	Between driveway and sidewalk
6564	FARMINGTON ROAD	13532	103-742-27	E4	3	1675	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
6565	FARMINGTON ROAD	13532	103-742-27	E4	3	1675	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6561	FARMINGTON ROAD	13542	103-742-26	E4	3	1675	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		No			Ramp	Prev grind
6562	FARMINGTON ROAD	13542	103-742-26	E4	3	1675	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
6573	FARMINGTON ROAD	13561	103-741-03	E4	3	1675	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6559	FARMINGTON ROAD	13562	103-742-25	E4	3	1675	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6560				E4	3	1675	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
6894	FARMINGTON ROAD	13641	103-743-07	E4	3	1674	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
6895	FARMINGTON ROAD	13671	103-743-05	E4	3	1674	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
6513	FARMINGTON ROAD	13672	103-742-47	E4	3	1674	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6512	FARMINGTON ROAD	13692	103-742-48	E4	3	1674	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
6896	FARMINGTON ROAD	13731	103-743-01	E4	3	1674	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6510	FARMINGTON ROAD	13732	103-742-51	E4	3	1674	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6511	FARMINGTON ROAD	13732	103-742-51	E4	3	1674	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
6987	FARMINGTON ROAD	1751	103-254-01	E4	3	1676	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
6988	FARMINGTON ROAD	1751	103-254-01	E4	3	1676	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
6574	FARMINGTON ROAD	1751	103-741-02	E4	3	1675	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
6575	FARMINGTON ROAD	1751	103-741-02	E4	3	1675	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6558	FARMINGTON ROAD	1781	103-742-24	E4	3	1675	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
6514	FARMINGTON ROAD	1782	103-742-46	E4	3	1674	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
6515	FARMINGTON ROAD	1782	103-742-46	E4	3	1674	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
6516	FARMINGTON ROAD	1782	103-742-46	E4	3	1674	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	25		No			Grind	
3905	FIELDING DRIVE	13611	500-092-18	D4	3	1680	Sidewalk	PCC		Linear Cracking	1/4" to 1/2"	4	Yes			Grind	Prev grind
3904	FIELDING DRIVE	13612	500-092-17	D4	3	1680	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
3903	FIELDING DRIVE	13612	500-092-17	D4	3	1680	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
3906	FIELDING DRIVE	13621	500-092-19	D4	3	1680	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	
3902	FIELDING DRIVE	13622	500-092-16	D4	3	1680	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
3901	FIELDING DRIVE	13632	500-092-15	D4	3	1680	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
4773	FIRST STREET	1022	500-062-02	D4	3	1029	Driveway	PCC	Linear Cracking	1/4" to 1/2"	6		No		Yes	Grind	
4774	FIRST STREET	1022	500-062-02	D4	3	1029	Driveway	PCC	Linear Cracking	1/4" to 1/2"	6		No		Yes	Grind	
4772	FIRST STREET	1022	500-062-02	D4	3	1029	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	7		No		Yes	Replace Slab	
4776	FIRST STREET	1076	500-062-04	D4	3	1029	Sidewalk	PCC	Linear Cracking	1/2" to 1"	25		Yes		Yes	Grind	
4777	FIRST STREET	1076	500-062-04	D4	3	1029	Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	12		Yes		Yes	Replace Slab(s)	
4775	FIRST STREET	1076	500-062-04	D4	3	1029	Driveway	PCC	Spalling	1/4" to 1/2"	1		No		Yes	Grind	
4778	FIRST STREET	1132	500-062-06	D4	3	1029	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
4779	FIRST STREET	1142	500-062-07	D4	3	1029	Driveway	PCC	Linear Cracking	1/4" to 1/2"	6		No			Grind	
4783	FIRST STREET	1252	103-593-02	D4	3	1029	Driveway	PCC	Corner Break	1/4" to 1/2"	3		No			Grind	
4735	FIRST STREET	1291	103-592-23	D4	3	1030	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
4732	FIRST STREET	1301	103-592-22	D4	3	1030	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	Prev grind
4733	FIRST STREET	1301	103-592-22	D4	3	1030	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
4734	FIRST STREET	1301	103-592-22	D4	3	1030	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
4731	FIRST STREET	1301	103-592-22	D4	3	1030	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
4785	FIRST STREET	1312	103-593-06	D4	3	1030	Sidewalk	PCC	Faulting	1/2" to 1"	2		Yes			Ramp	Prev grind
4784	FIRST STREET	1312	103-593-06	D4	3	1030	Sidewalk	PCC	Faulting	1/2" to 1"	2		Yes			Ramp	
4730	FIRST STREET	1321	103-592-21	D4	3	1030	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
4728	FIRST STREET	1321	103-592-21	D4	3	1030	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
4786	FIRST STREET	1322	103-593-07	D4	3	1030	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
4787	FIRST STREET	1322	103-593-07	D4	3	1030	Sidewalk	PCC	Faulting	1/2" to 1"	5		No			Ramp	
4764	FIRST STREET	13270	500-061-08	D4	3	1029	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes		Yes	Grind	Prev grind
4757	FIRST STREET	13270	500-061-08	D4	3	1029	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes		Yes	Grind	Prev grind
4759	FIRST STREET	13270	500-061-08	D4	3	1029	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		Yes		Yes	Grind	
4760	FIRST STREET	13270	500-061-08	D4	3	1029	Sidewalk	PCC	Faulting	1/4" to 1/2"	8		Yes		Yes	Grind	
4761	FIRST STREET	13270	500-061-08	D4	3	1029	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes		Yes	Grind	
4756	FIRST STREET	13270	500-061-08	D4	3	1029	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	12		Yes		Yes	Replace Slab	
4758	FIRST STREET	13270	500-061-08	D4	3	1029	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	10		Yes		Yes	Grind	
4762	FIRST STREET	13270	500-061-08	D4	3	1029	Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	5		Yes		Yes	Replace Slab(s)	
4763	FIRST STREET	13270	500-061-08	D4	3	1029	Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	10		Yes		Yes	Replace Slab(s)	
4767	FIRST STREET	13300	500-061-02	D4	3	1029	Sidewalk	PCC	Faulting	1/2" to 1"	6		Yes		Yes	Ramp	
4768	FIRST STREET	13300	500-061-02	D4	3	1029	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No		Yes	Grind	
4771	FIRST STREET	13300	500-061-02	D4	3	1029	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No		Yes	Grind	
4770	FIRST STREET	13300	500-061-02	D4	3	1029	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	8		No		Yes	Grind	
4769	FIRST STREET	13300	500-061-02	D4	3	1029	Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	14		Yes		Yes	Replace Slab(s)	
4738	FIRST STREET	13301	103-591-27	D4	3	1029	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
4739	FIRST STREET	13301	103-591-27	D4	3	1029	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
4740	FIRST STREET	13301	103-591-27	D4	3	1029	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
4741	FIRST STREET	13301	103-591-27	D4	3	1029	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
4742	FIRST STREET	13301	103-591-27	D4	3	1029	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
4736	FIRST STREET	13302	103-592-24	D4	3	1030	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
4737	FIRST STREET	13302	103-592-24	D4	3	1030	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
4729	FIRST STREET	1331	103-592-20	D4	3	1030	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	Prev grind
4725			)	D4	3	1030	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Spalling

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
4726	FIRST STREET	1331	103-592-20	D4	3	1030	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
4727	FIRST STREET	1331	103-592-20	D4	3	1030	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
4670	FIRST STREET	13321	103-591-05	D4	3	1030	Sidewalk	PCC	Other - Leave Comment	1/4" to 1/2"	1		No			Grind	Filled hole
4671	FIRST STREET	13321	103-591-05	D4	3	1030	Sidewalk	PCC	Faulting	1" to 2"	12		Yes			Replace Slab	
4672	FIRST STREET	13321	103-591-05	D4	3	1030	Sidewalk	PCC	Faulting	1/4" to 1/2"	6		Yes			Grind	
4673	FIRST STREET	13321	103-591-05	D4	3	1030	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	6		Yes			Grind	
4716	FIRST STREET	13331	103-592-13	D4	3	1030	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Prev grind
4793	FIRST STREET	13342	103-594-02	D4	3	1030	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	5		Yes			Grind	
4792	FIRST STREET	13351	103-593-11	D4	3	1030	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
4794	FIRST STREET	13361	103-594-03	D4	3	1030	Sidewalk	PCC	Spalling	1/4" to 1/2"	2		No			Grind	
4800	FIRST STREET	13362	103-594-10	D4	3	1030	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
4724	FIRST STREET	1341	103-592-19	D4	3	1030	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
4788	FIRST STREET	1342	103-593-08	D4	3	1030	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
4721	FIRST STREET	1351	103-592-18	D4	3	1030	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	Prev grind
4722	FIRST STREET	1351	103-592-18	D4	3	1030	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
4723	FIRST STREET	1351	103-592-18	D4	3	1030	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
4720	FIRST STREET	1351	103-592-18	D4	3	1030	Driveway	PCC	Sidewalk Curb Separation	1/2" to 1"	10		Yes			Replace Driveway	
4719	FIRST STREET	1361	103-592-17	D4	3	1030	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	Prev grind
4718	FIRST STREET	1361	103-592-17	D4	3	1030	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
4791	FIRST STREET	1362	103-593-10	D4	3	1030	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	Prev grind
4789	FIRST STREET	1362	103-593-10	D4	3	1030	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
4790	FIRST STREET	1362	103-593-10	D4	3	1030	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
4717	FIRST STREET	1391	103-592-15	D4	3	1030	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
4744	FIRST STREET		999-000-40	D4	3	1029	Driveway	PCC	Divided Slab	1/2" to 1"	20		No			Replace Slab(s)	Med
4780	FIRST STREET		500-062-08	D4	3	1029	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
4750	FIRST STREET		999-000-40	D4	3	1029	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
4781	FIRST STREET		500-062-08	D4	3	1029	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	Prev grind
4782	FIRST STREET		500-062-08	D4	3	1029	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	Prev grind
4748	FIRST STREET		999-000-40	D4	3	1029	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight displacement
4766	FIRST STREET		500-061-03	D4	3	1029	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes		Yes	Ramp	
4743	FIRST STREET		999-000-40	D4	3	1029	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
4749	FIRST STREET		999-000-40	D4	3	1029	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
4751	FIRST STREET		999-000-40	D4	3	1029	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
4752	FIRST STREET		999-000-40	D4	3	1029	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
4755	FIRST STREET		999-000-40	D4	3	1029	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes		Yes	Grind	
4765	FIRST STREET		500-061-03	D4	3	1029	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No		Yes	Grind	
4745	FIRST STREET		999-000-40	D4	3	1029	Curb/Gutter	PCC	Linear Cracking	1/2" to 1"	6		No			Grind	
4746	FIRST STREET		999-000-40	D4	3	1029	Curb/Gutter	PCC	Linear Cracking	1/2" to 1"	15		No			Grind	
4753	FIRST STREET		999-000-40	D4	3	1029	Curb/Gutter	PCC	Linear Cracking	1/2" to 1"	15		No			Grind	
4747	FIRST STREET		999-000-40	D4	3	1029	Driveway	PCC	Linear Cracking	1/4" to 1/2"	8		No			Grind	
4754	FIRST STREET		999-000-40	D4	3	1029	Driveway	PCC	Linear Cracking	1/4" to 1/2"	8		No			Grind	
4420	GARLAND AVENUE	1271	103-633-11	D4	3	1693	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
4419	GARLAND AVENUE	1271	103-633-11	D4	3	1693	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
4562	GARLAND AVENUE	1282	103-634-04	D4	3	1693	Sidewalk	PCC	Linear Cracking	No Displacement	12		Yes			Joint Seal	Slight displacement
4418	GARLAND AVENUE	1301	103-633-14	D4	3	1693	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight displacement
4417	GARLAND AVENUE	1301	103-633-14	D4	3	1693	Driveway	PCC	Faulting	1/4" to 1/2"	8		No			Grind Driveway	
4564	GARLAND AVENUE	1302	103-634-05	D4	3	1693	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
4565	GARLAND AVENUE	1302	103-634-05	D4	3	1693	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
4594	GARLAND AVENUE	13071	103-532-10	D4	3	1694	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
4595	GARLAND AVENUE	13071	103-532-10	D4	3	1694	Driveway	PCC	Faulting	1/4" to 1/2"	10		No			Grind Driveway	
4346	GARLAND AVENUE	13071	103-532-10	D4	3	1694	Sidewalk	PCC	Faulting	1/2" to 1"	3		No			Ramp	
4593	GARLAND AVENUE	13071	103-532-10	D4	3	1694	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
4596	GARLAND AVENUE	13071	103-532-10	D4	3	1694	Driveway	PCC	Sidewalk Curb Separation	1/2" to 1"	10		No			Replace Driveway	
4592	GARLAND AVENUE	13071	103-532-10	D4	3	1694	Ramp	PCC	Sidewalk Curb Separation	1/2" to 1"	5		Yes			Grind	
4591	GARLAND AVENUE	13071	103-532-10	D4	3	1694	Cross Gutter	PCC	Spalling	1/2" to 1"	3		No			Patch	
4371	GARLAND AVENUE	13082	103-636-01	D4	3	1694	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	Prev grind
4372	GARLAND AVENUE	13082	103-636-01	D4	3	1694	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight displacement
4370	GARLAND AVENUE	13082	103-636-01	D4	3	1694	Sidewalk	PCC	Linear Cracking	No Displacement	4		Yes			Joint Seal	Slight displacement
4369	GARLAND AVENUE	13082	103-636-01	D4	3	1694	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
4368	GARLAND AVENUE	13082	103-636-01	D4	3	1694	Sidewalk	PCC	Linear Cracking	1/2" to 1"	4		Yes			Grind	
4570	GARLAND AVENUE	13102	103-635-07	D4	3	1694	Sidewalk	PCC	Linear Cracking	1/2" to 1"	4		No			Grind	Prev grind
4568	GARLAND AVENUE	13102	103-635-07	D4	3	1694	Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	6		Yes			Replace Slab(s)	Slab lifted
4567	GARLAND AVENUE	13102	103-635-07	D4	3	1694	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
4569				D4	3	1694	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
4413	GARLAND AVENUE	1311	103-633-15	D4	3	1693	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Prev grind
4416	GARLAND AVENUE	1311	103-633-15	D4	3	1693	Driveway	PCC	Corner Break	1/2" to 1"	5		No			Ramp	
4415	GARLAND AVENUE	1311	103-633-15	D4	3	1693	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
4414	GARLAND AVENUE	1311	103-633-15	D4	3	1693	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	16		No			Grind	
4566	GARLAND AVENUE	1312	103-634-06	D4	3	1693	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
4366	GARLAND AVENUE	1361	103-532-01	D4	3	1694	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
4367	GARLAND AVENUE	1361	103-532-01	D4	3	1694	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	
4571	GARLAND AVENUE	1362	103-531-02	D4	3	1694	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
4572	GARLAND AVENUE	1362	103-531-02	D4	3	1694	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
4364	GARLAND AVENUE	1371	103-532-02	D4	3	1694	Driveway	PCC	Linear Cracking	1/2" to 1"	7		No			Grind	
4365	GARLAND AVENUE	1371	103-532-02	D4	3	1694	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
4573	GARLAND AVENUE	1372	103-531-03	D4	3	1694	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
4361	GARLAND AVENUE	1391	103-532-03	D4	3	1694	Sidewalk	PCC	Divided Slab	1/4" to 1/2"	5		No			Replace Slab	Low
4363	GARLAND AVENUE	1391	103-532-03	D4	3	1694	Sidewalk	PCC	Divided Slab	1/4" to 1/2"	5		Yes			Replace Slab	Low
4362	GARLAND AVENUE	1391	103-532-03	D4	3	1694	Sidewalk	PCC	Divided Slab	No Displacement	5		No			Replace Slab	Low
4360	GARLAND AVENUE	1391	103-532-03	D4	3	1694	Sidewalk	PCC	Linear Cracking	1/2" to 1"	4		No			Grind	Prev grind
4358	GARLAND AVENUE	1391	103-532-03	D4	3	1694	Sidewalk	PCC	Linear Cracking	1/2" to 1"	4		No			Grind	
4574	GARLAND AVENUE	1392	103-531-04	D4	3	1694	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
4359	GARLAND AVENUE	1401	103-532-04	D4	3	1694	Driveway	PCC	Linear Cracking	1/4" to 1/2"	6		No			Grind	
4357	GARLAND AVENUE	1401	103-532-04	D4	3	1694	Sidewalk	PCC	Linear Cracking	1/2" to 1"	4		No			Grind	
4576	GARLAND AVENUE	1402	103-531-05	D4	3	1694	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
4577	GARLAND AVENUE	1402	103-531-05	D4	3	1694	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
4575	GARLAND AVENUE	1402	103-531-05	D4	3	1694	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
4356	GARLAND AVENUE	1411	103-532-05	D4	3	1694	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
4579	GARLAND AVENUE	1412	103-531-06	D4	3	1694	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
4578	GARLAND AVENUE	1412	103-531-06	D4	3	1694	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
4355	GARLAND AVENUE	1421	103-532-06	D4	3	1694	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight displacement
4353	GARLAND AVENUE	1421	103-532-06	D4	3	1694	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
4351	GARLAND AVENUE	1421	103-532-06	D4	3	1694	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
4352	GARLAND AVENUE	1421	103-532-06	D4	3	1694	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
4350	GARLAND AVENUE	1421	103-532-06	D4	3	1694	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	
4354	GARLAND AVENUE	1421	103-532-06	D4	3	1694	Driveway	PCC	Spalling	1" to 2"	1		No			Patch	
4580	GARLAND AVENUE	1422	103-531-07	D4	3	1694	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
4581	GARLAND AVENUE	1422	103-531-07	D4	3	1694	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
4349	GARLAND AVENUE	1431	103-532-07	D4	3	1694	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
4583	GARLAND AVENUE	1432	103-531-08	D4	3	1694	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
4582	GARLAND AVENUE	1432	103-531-08	D4	3	1694	Driveway	PCC	Sidewalk Curb Separation	Over 2"	7		No			Replace Driveway	
4348	GARLAND AVENUE	1451	103-532-08	D4	3	1694	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
4584	GARLAND AVENUE	1452	103-531-09	D4	3	1694	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
4347	GARLAND AVENUE	1461	103-532-09	D4	3	1694	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight displacement
4345	GARLAND AVENUE	1461	103-532-09	D4	3	1694	Sidewalk	PCC	Linear Cracking	1/2" to 1"	8		No			Grind	Some spalling
4587	GARLAND AVENUE	1462	103-531-10	D4	3	1694	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
4585	GARLAND AVENUE	1462	103-531-10	D4	3	1694	Driveway	PCC	Linear Cracking	1/4" to 1/2"	10		No			Grind	
4586	GARLAND AVENUE	1462	103-531-10	D4	3	1694	Sidewalk	PCC	Linear Cracking	1/2" to 1"	4		No			Grind	
4588	GARLAND AVENUE	1472	103-531-11	D4	3	1694	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	Prev grind
4589	GARLAND AVENUE	1472	103-531-11	D4	3	1694	Cross Gutter	PCC	Linear Cracking	1/2" to 1"	6		No			Replace Slab	
3833	GREEN VALLEY AVENUE	13611	500-081-15	D4	3	1700	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Prev grind
3832	GREEN VALLEY AVENUE	13611	500-081-15	D4	3	1700	Driveway	PCC	Linear Cracking	No Displacement	5		No			Joint Seal	Slight displacement
3831	GREEN VALLEY AVENUE	13611	500-081-15	D4	3	1700	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
3848	GREEN VALLEY AVENUE	13622	500-082-11	D4	3	1700	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
3834	GREEN VALLEY AVENUE	13641	500-081-17	D4	3	1700	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
3847	GREEN VALLEY AVENUE	13642	500-082-09	D4	3	1700	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
3846	GREEN VALLEY AVENUE	13642	500-082-09	D4	3	1700	Driveway	PCC	Spalling	1/4" to 1/2"	2		No			Grind	
3845	GREEN VALLEY AVENUE	13652	500-082-08	D4	3	1700	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
3844	GREEN VALLEY AVENUE	13652	500-082-08	D4	3	1700	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
3835	GREEN VALLEY AVENUE	13661	500-081-19	D4	3	1700	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
3836	GREEN VALLEY AVENUE	13661	500-081-19	D4	3	1700	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
3837	GREEN VALLEY AVENUE	13671	500-081-20	D4	3	1700	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
3843	GREEN VALLEY AVENUE	13672	500-082-06	E4	3	1700	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
3839	GREEN VALLEY AVENUE	13691	500-081-21	E4	3	1700	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
3838	GREEN VALLEY AVENUE	13691	500-081-21	E4	3	1700	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	
3842	GREEN VALLEY AVENUE	13702	500-082-03	E4	3	1700	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
3840	GREEN VALLEY AVENUE	1421	500-081-22	E4	3	1700	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
3804				E4	3	1700	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	4	1"	No			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
3829	GREEN VALLEY AVENUE	1422	500-081-14	D4	3	1700	Sidewalk	PCC	Linear Cracking	No Displacement	4		Yes			Joint Seal	Slight displacement
3830	GREEN VALLEY AVENUE	1422	500-081-14	D4	3	1700	Sidewalk	PCC	Linear Cracking	No Displacement	4		Yes			Joint Seal	Slight displacement
3841	GREEN VALLEY AVENUE	1431	500-082-01	E4	3	1700	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
3849	GREEN VALLEY AVENUE	1452	500-082-13	D4	3	1700	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	
3851	GREEN VALLEY AVENUE	1452	500-082-13	D4	3	1700	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
3850	GREEN VALLEY AVENUE	1452	500-082-13	D4	3	1700	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
3852	GREEN VALLEY AVENUE	1452	500-082-13	D4	3	1700	Sidewalk	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
4438	GWYNETH DRIVE	1312	103-633-28	D4	3	1703	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
4440	GWYNETH DRIVE	1312	103-633-28	D4	3	1703	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
4439	GWYNETH DRIVE	1312	103-633-28	D4	3	1703	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
4437	GWYNETH DRIVE	13195	103-633-37	D4	3	1703	Sidewalk	PCC	Temporary Ramp	1/2" to 1"	4		No			Replace Slab	
11545	IRVINE BLVD	1030	500-102-01	C4	3	1103	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No		Yes	Grind	
9264	IRVINE BLVD	1082	500-101-09	C4	3	1112	Curb/Gutter	PCC	Spalling	1/4" to 1/2"	2		No		Yes	Grind	
9283	IRVINE BLVD	1161	501-081-14	C4	3	1113	Driveway	PCC	Linear Cracking	1/4" to 1/2"	6		No		Yes	Grind	
9284	IRVINE BLVD	1161	501-081-14	C4	3	1112	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
9282	IRVINE BLVD	1201	501-081-21	C4	3	1113	Driveway	PCC	Corner Break	1/4" to 1/2"	1		No		Yes	Grind	
11536	IRVINE BLVD	1212	500-102-02	C4	3	1104	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No		Yes	Grind	
11537	IRVINE BLVD	1212	500-102-02	C4	3	1104	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No		Yes	Grind	
11543	IRVINE BLVD	1212	500-102-02	C4	3	1103	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No		Yes	Grind	
11544	IRVINE BLVD	1212	500-102-02	C4	3	1103	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No		Yes	Grind	
9279	IRVINE BLVD	1241	501-081-22	C4	3	1113	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	3		No		Yes	Grind	
9278	IRVINE BLVD	1241	501-081-22	C4	3	1113	Driveway	PCC		1/2" to 1"	3		No		Yes	Replace C&G	
9280	IRVINE BLVD	1241	501-081-22	C4	3	1113	Sidewalk	PCC	Spalling	1/2" to 1"	1		No		Yes	Replace C&G	
9281	IRVINE BLVD	1241	501-081-22	C4	3	1113	Sidewalk	PCC	Spalling	1/2" to 1"	1		No		Yes	Replace C&G	
9276	IRVINE BLVD	1241	501-081-22	C4	3	1113	Sidewalk	PCC	Spalling	1/4" to 1/2"	3		No		Yes	Grind	
9277	IRVINE BLVD	1241	501-081-22	C4	3	1113	Curb/Gutter	PCC	Spalling	Over 2"	2		No		Yes	Replace C&G	
11540	IRVINE BLVD	1252	103-633-36	D4	3	1104	Sidewalk	PCC	Faulting	1/2" to 1"	2.5		No			Ramp	Prev grind
11538	IRVINE BLVD	1252	103-633-36	C4	3	1104	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
11539	IRVINE BLVD	1252	103-633-36	C4	3	1104	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
11541	IRVINE BLVD	1252	103-633-36	D4	3	1104	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
11542	IRVINE BLVD	1252	103-633-36	D4	3	1104	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
9265	IRVINE BLVD	13052	500-101-13	C4	3	1112	Ramp	PCC	Faulting	1/4" to 1/2"	3		No		Yes	Grind Ramp	
4392	IRVINE BLVD	1331	103-633-24	D4	3	1104	Cross Gutter	PCC	Spalling	1/2" to 1"	1		No			Patch	
4597	IRVINE BLVD	1372	103-532-20	D4	3	1104	Sidewalk	PCC	Divided Slab	No Displacement			No		Yes	Replace Slab	Low
4600	IRVINE BLVD	1372	103-532-20	D4	3	1104	Sidewalk	PCC	Buckled Slab	1" to 2"	6		Yes		Yes	Replace Slab	
4605	IRVINE BLVD	1372	103-532-20	D4	3	1104	Sidewalk	PCC	Corner Break	1/4" to 1/2"	4		No		Yes	Grind	
4602	IRVINE BLVD	1372	103-532-20	D4	3	1104	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes		Yes	Grind	
4603	IRVINE BLVD	1372	103-532-20	D4	3	1104	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes		Yes	Grind	
4608	IRVINE BLVD	1372	103-532-20	D4	3	1104	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No		Yes	Grind	
4606	IRVINE BLVD	1372	103-532-20	D4	3	1104	Driveway	PCC	Linear Cracking	1/4" to 1/2"	6		No		Yes	Grind	
4607	IRVINE BLVD	1372	103-532-20	D4	3	1104	Driveway	PCC	Linear Cracking	1/4" to 1/2"	6		No		Yes	Grind	
4604	IRVINE BLVD	1372	103-532-20	D4	3	1104	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	6		Yes		Yes	Grind	
4601	IRVINE BLVD	1372	103-532-20	D4	3	1104	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	30		Yes		Yes	Replace Slab	
4599	IRVINE BLVD	1372	103-532-20	D4	3	1104	Sidewalk	PCC		No Displacement	10	1"	No		Yes	Field Assess-Monitor	
4598	IRVINE BLVD	1372	103-532-20	D4	3	1104	Sidewalk	PCC	Spalling	Over 2"	1		No		Yes	Patch	
4610	IRVINE BLVD	1442	103-532-18	D4	3	1104	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
4611	IRVINE BLVD	1442	103-532-18	D4	3	1104	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
4609	IRVINE BLVD	1442	103-532-18	D4	3	1104	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	6		No		Yes	Grind	
4615	IRVINE BLVD	1442	103-532-18	D4	3	1104	Sidewalk	PCC		1/2" to 1"	6		Yes			Grind	
4616	IRVINE BLVD	1442	103-532-18	D4	3	1104	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	12	1"	Yes			Grind	
4614	IRVINE BLVD	1442	103-532-18	D4	3	1104	Sidewalk	PCC		Over 2"	6		No			Replace Slab(s)	
4612	IRVINE BLVD	1442	103-532-18	D4	3	1104	Sidewalk	PCC	Spalling	1/4" to 1/2"	2		No			Grind	
4613	IRVINE BLVD	1442	103-532-18	D4	3	1104	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
1303	JAN MARIE PLACE	1861	500-074-01	E4	3	1720	Sidewalk	PCC	Faulting	1/2" to 1"	4.5		No			Ramp	
1302	JAN MARIE PLACE	1862	500-072-05	E4	3	1720	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
1304	JAN MARIE PLACE	1871	500-074-02	E4	3	1720	Sidewalk	PCC	Faulting	1/4" to 1/2"	4.5		Yes			Grind	Prev grind
1301	JAN MARIE PLACE	1872	500-072-06	E4	3	1720	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
1305	JAN MARIE PLACE	1881	500-074-03	E4	3	1720	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
1300	JAN MARIE PLACE	1902	500-073-11	E4	3	1720	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
1306	JAN MARIE PLACE	1911	500-074-05	E4	3	1720	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
1299	JAN MARIE PLACE	1912	500-073-12	E4	3	1720	Sidewalk	PCC	Faulting	1/4" to 1/2"	4.5		Yes			Grind	
1307	JAN MARIE PLACE	1921	500-074-06	E4	3	1720	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
1298	JAN MARIE PLACE	1922	500-073-13	E4	3	1720	Sidewalk	PCC	Faulting	1/4" to 1/2"	4.5		No			Grind	Prev grind
1308				E4	3	1720	Driveway	PCC	Linear Cracking	No Displacement	6		No			Joint Seal	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
1297	JAN MARIE PLACE	1932	500-073-14	E4	3	1720	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
1296	JAN MARIE PLACE	1932	500-073-14	E4	3	1720	Driveway	PCC	Linear Cracking	No Displacement	6		No			Joint Seal	
1295	JAN MARIE PLACE	1942	500-073-15	E4	3	1720	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
1309	JAN MARIE PLACE	1951	500-074-09	E4	3	1720	Driveway	PCC	Linear Cracking	1/4" to 1/2"	6		No			Grind	
1294	JAN MARIE PLACE	1952	500-073-16	E4	3	1720	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Prev grind
1293	JAN MARIE PLACE	1952	500-073-16	E4	3	1720	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
1292	JAN MARIE PLACE	1952	500-073-16	E4	3	1720	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	1		No			Grind	
1291	JAN MARIE PLACE	1972	500-073-17	E4	3	1720	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Prev grind
1290	JAN MARIE PLACE	1972	500-073-17	E4	3	1720	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4.5		No			Grind	
5619	KALUA LANE	1271	500-121-11	D4	3	1721	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	Prev grind
5620	KALUA LANE	1271	500-121-11	D4	3	1721	Driveway	PCC	Linear Cracking	No Displacement	7		No			Joint Seal	Slight displacement
5621	KALUA LANE	1271	500-121-11	D4	3	1721	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight displacement
5618	KALUA LANE	1271	500-121-11	D4	3	1721	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
5617	KALUA LANE	1291	500-121-12	D4	3	1721	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight displacement
5616	KALUA LANE	1321	500-121-14	D4	3	1721	Driveway	PCC	Linear Cracking	No Displacement	7		No			Joint Seal	Slight displacement
5614	KALUA LANE	1331	500-121-15	D4	3	1721	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	Prev grind
5611	KALUA LANE	1331	500-121-15	D4	3	1721	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
5612	KALUA LANE	1331	500-121-15	D4	3	1721	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
5613	KALUA LANE	1331	500-121-15	D4	3	1721	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
5615	KALUA LANE	1331	500-121-15	D4	3	1721	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
6182	KALUA LANE	13371	500-122-09	D4	3	1721	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	
6180	KALUA LANE	13372	500-122-08	D4	3	1721	Sidewalk	PCC	Divided Slab	No Displacement	15		No			Replace Slab(s)	Low
6189	KALUA LANE	13372	500-122-16	D4	3	1721	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
6190	KALUA LANE	13372	500-122-16	D4	3	1721	Sidewalk	PCC	Linear Cracking	No Displacement	4		Yes			Joint Seal	
6181	KALUA LANE	13372	500-122-08	D4	3	1721	Sidewalk	PCC	Linear Cracking	No Displacement	4		Yes			Joint Seal	
6192	KALUA LANE	13381	500-122-17	D4	3	1721	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	Prev grind
6191	KALUA LANE	13381	500-122-17	D4	3	1721	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
6194	KALUA LANE	13381	500-122-17	D4	3	1721	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	12		No			Grind	Prev grind
6193	KALUA LANE	13381	500-122-17	D4	3	1721	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
5610	KALUA LANE	1351	500-121-16	D4	3	1721	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
5606	KALUA LANE	1351	500-121-16	D4	3	1721	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	Prev grind
5607	KALUA LANE	1351	500-121-16	D4	3	1721	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
5608	KALUA LANE	1351	500-121-16	D4	3	1721	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
5609	KALUA LANE	1351	500-121-16	D4	3	1721	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
5605	KALUA LANE	1361	500-121-17	D4	3	1721	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
5603	KALUA LANE	1371	500-121-18	D4	3	1721	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	Prev grind
5600	KALUA LANE	1371	500-121-18	D4	3	1721	Sidewalk	PCC	Linear Cracking	No Displacement	12		No			Joint Seal	Slight displacement
5604	KALUA LANE	1371	500-121-18	D4	3	1721	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
5602	KALUA LANE	1371	500-121-18	D4	3	1721	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	7	1"	No			Grind	
6672	KALUA LANE	1511	103-522-36	D4	3	1722	Driveway	PCC	Sidewalk Curb Separation	1/4" to 1/2"	5		No			Grind	Between curb and driveway
6674	KALUA LANE	1511	103-522-36	D4	3	1722	Sidewalk	PCC	Faulting	1/2" to 1"	2.5		No			Ramp	Prev grind
6673	KALUA LANE	1511	103-522-36	D4	3	1722	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
6671	KALUA LANE	1511	103-522-36	D4	3	1722	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
6675	KALUA LANE	1512	103-523-01	D4	3	1722	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6676	KALUA LANE	1512	103-523-01	D4	3	1722	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
6670	KALUA LANE	1521	103-522-35	D4	3	1722	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6669	KALUA LANE	1541	103-522-34	D4	3	1722	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	Prev grind
6677	KALUA LANE	1542	103-523-03	D4	3	1722	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
6678	KALUA LANE	1542	103-523-03	D4	3	1722	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6679	KALUA LANE	1552	103-523-04	D4	3	1722	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
6680	KALUA LANE	1572	103-523-05	D4	3	1722	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	1		No			Grind	
6681	KALUA LANE	1582	103-523-06	D4	3	1722	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	Prev grind
6998	KENT PLACE	13382	103-333-10	D4	3	1726	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6997	KENT PLACE	1741	103-333-08	D4	3	1726	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
6996	KENT PLACE	1742	103-333-07	E4	3	1726	Driveway	PCC	Faulting	1/4" to 1/2"	3		No			Grind Driveway	Prev grinded, between driveway and sidewalk
4517	LABURNUM DRIVE	13121	103-531-18	D4	3	1733	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
4516	LABURNUM DRIVE	13121	103-531-18	D4	3	1733	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
4513	LABURNUM DRIVE	13122	103-531-19	D4	3	1733	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
4515	LABURNUM DRIVE	13122	103-531-19	D4	3	1733	Sidewalk	PCC	Linear Cracking	1/2" to 1"	4		No			Grind	Prev grind
4514	LABURNUM DRIVE	13122	103-531-19	D4	3	1733	Driveway	PCC	Sidewalk Curb Separation	Over 2"	12		No			Replace Driveway	
4518	LABURNUM DRIVE	13131	103-531-17	D4	3	1733	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
4511	LABURNUM DRIVE	13132	103-531-20	D4	3	1733	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
4512	LABURNUM DRIVE	13132	103-531-20	D4	3	1733	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	Prev grind
4519				i	D4	3	1733	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No		Grind	Prev grind

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
4521	LABURNUM DRIVE	13141	103-531-16	D4	3	1733	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
4520	LABURNUM DRIVE	13141	103-531-16	D4	3	1733	Driveway	PCC	Spalling	1" to 2"	0.5		No			Patch	
4508	LABURNUM DRIVE	13142	103-531-21	D4	3	1733	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
4509	LABURNUM DRIVE	13142	103-531-21	D4	3	1733	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
4510	LABURNUM DRIVE	13142	103-531-21	D4	3	1733	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
4507	LABURNUM DRIVE	13152	103-531-22	D4	3	1733	Driveway	PCC	Linear Cracking	1/4" to 1/2"	7		No			Grind	
4505	LABURNUM DRIVE	13152	103-531-22	D4	3	1733	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
4506	LABURNUM DRIVE	13152	103-531-22	D4	3	1733	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
4522	LABURNUM DRIVE	13161	103-531-14	D4	3	1733	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
4523	LABURNUM DRIVE	13161	103-531-14	D4	3	1733	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
4504	LABURNUM DRIVE	13162	103-531-23	D4	3	1733	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	Prev grind
4503	LABURNUM DRIVE	13162	103-531-23	D4	3	1733	Cross Gutter	PCC	Spalling	1" to 2"	1		No			Patch	
4524	LABURNUM DRIVE	13181	103-531-13	D4	3	1733	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
4502	LABURNUM DRIVE	13182	103-531-24	D4	3	1733	Driveway	PCC	Sidewalk Curb Separation	1/2" to 1"	6		No			Replace Driveway	
4501	LABURNUM DRIVE	13182	103-531-24	D4	3	1733	Cross Gutter	PCC	Spalling	Over 2"	1		No			Replace C&G	
4500	LABURNUM DRIVE	13192	103-531-25	D4	3	1733	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	6		No			Replace Slab	
6657	LANAI WAY	1511	103-522-24	D4	3	1735	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
6658	LANAI WAY	1511	103-522-24	D4	3	1735	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
6659	LANAI WAY	1512	103-522-25	D4	3	1735	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
6660	LANAI WAY	1522	103-522-26	D4	3	1735	Driveway	PCC	Faulting	1/4" to 1/2"	5		No			Grind Driveway	Between sidewalk and driveway
6661	LANAI WAY	1522	103-522-26	D4	3	1735	Sidewalk	PCC	Corner Break	1/4" to 1/2"	1		No			Grind	
6662	LANAI WAY	1542	103-522-27	D4	3	1735	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
6663	LANAI WAY	1542	103-522-27	D4	3	1735	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
6664	LANAI WAY	1552	103-522-28	D4	3	1735	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
6665	LANAI WAY	1552	103-522-28	D4	3	1735	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6656	LANAI WAY	1571	103-522-20	D4	3	1735	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
6655	LANAI WAY	1581	103-522-19	D4	3	1735	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6666	LANAI WAY	1582	103-522-30	D4	3	1735	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	Prev grind
6667	LANAI WAY	1582	103-522-30	D4	3	1735	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
6654	LANAI WAY	1591	103-522-18	D4	3	1735	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6651	LANAI WAY	1591	103-522-18	D4	3	1735	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	2		No			Grind	
6652	LANAI WAY	1591	103-522-18	D4	3	1735	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	1		No			Grind	
6653	LANAI WAY	1591	103-522-18	D4	3	1735	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	1.5		No			Grind	
3883	LANCE DRIVE	1271	500-093-08	D4	3	1736	Sidewalk	PCC	Linear Cracking	No Displacement	4		Yes			Joint Seal	Slight displacement
3911	LANCE DRIVE	1272	500-092-05	D4	3	1736	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
3913	LANCE DRIVE	1272	500-092-05	D4	3	1736	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
3912	LANCE DRIVE	1272	500-092-05	D4	3	1736	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	4		No			Grind	
3914	LANCE DRIVE	1282	500-092-06	D4	3	1736	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
3915	LANCE DRIVE	1282	500-092-06	D4	3	1736	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
3882	LANCE DRIVE	1291	500-093-10	D4	3	1736	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
3880	LANCE DRIVE	1311	500-093-11	D4	3	1736	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
3881	LANCE DRIVE	1311	500-093-11	D4	3	1736	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
3916	LANCE DRIVE	1312	500-092-08	D4	3	1736	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
3917	LANCE DRIVE	1312	500-092-08	D4	3	1736	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
3918	LANCE DRIVE	1312	500-092-08	D4	3	1736	Sidewalk	PCC	Spalling	1/4" to 1/2"	2		Yes			Grind	
3919	LANCE DRIVE	1322	500-092-09	D4	3	1736	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
3920	LANCE DRIVE	1342	500-092-10	D4	3	1736	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	Prev grind
3921	LANCE DRIVE	1342	500-092-10	D4	3	1736	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	3		No			Grind	
3870	LANCE DRIVE	13572	500-094-01	D4	3	1736	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
6598	LANCE DRIVE	13581	103-732-10	E4	3	1738	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6599	LANCE DRIVE	13581	103-732-10	E4	3	1738	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
6745	LANCE DRIVE	13581	500-052-15	E4	3	1737	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
6755	LANCE DRIVE	13581	500-052-01	D4	3	1737	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6756	LANCE DRIVE	13581	500-052-01	D4	3	1737	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
6605	LANCE DRIVE	13582	103-732-07	E4	3	1738	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
6746	LANCE DRIVE	13582	500-052-14	E4	3	1737	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
3867	LANCE DRIVE	1381	500-083-01	D4	3	1736	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
3868	LANCE DRIVE	1381	500-083-01	D4	3	1736	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
3869	LANCE DRIVE	1381	500-083-01	D4	3	1736	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
3822	LANCE DRIVE	1382	500-081-11	D4	3	1736	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
3866	LANCE DRIVE	1391	500-083-02	D4	3	1736	Sidewalk	PCC	Faulting	1/2" to 1"	4		No			Ramp	Prev grind
3865	LANCE DRIVE	1391	500-083-02	D4	3	1736	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
3823	LANCE DRIVE	1392	500-081-12	D4	3	1736	Sidewalk	PCC	Faulting	1/4" to 1/2"	7		Yes			Grind	
3864				D4	3	1736	Sidewalk	PCC	Corner Break	1/4" to 1/2"	1		No			Grind	Small

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
3826	LANCE DRIVE	1412	500-081-13	D4	3	1736	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
3825	LANCE DRIVE	1412	500-081-13	D4	3	1736	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	Prev grind
3824	LANCE DRIVE	1412	500-081-13	D4	3	1736	Sidewalk	PCC	Faulting	1/4" to 1/2"	4					Grind	
3827	LANCE DRIVE	1422	500-081-14	D4	3	1736	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
3828	LANCE DRIVE	1422	500-081-14	D4	3	1736	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
3863	LANCE DRIVE	1441	500-083-05	D4	3	1736	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight displacement
3862	LANCE DRIVE	1441	500-083-05	D4	3	1736	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
3861	LANCE DRIVE	1471	500-083-07	D4	3	1736	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
3853	LANCE DRIVE	1472	500-082-14	D4	3	1736	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	Prev grind
3854	LANCE DRIVE	1472	500-082-14	D4	3	1736	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	Prev grind
3859	LANCE DRIVE	1481	500-083-08	D4	3	1736	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight displacement
3860	LANCE DRIVE	1481	500-083-08	D4	3	1736	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight displacement
3857	LANCE DRIVE	1481	500-083-08	D4	3	1736	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
3858	LANCE DRIVE	1481	500-083-08	D4	3	1736	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
3855	LANCE DRIVE	1482	500-082-15	D4	3	1736	Cross Gutter	PCC	Linear Cracking	1/4" to 1/2"	8		No			Grind	
6757	LANCE DRIVE	1502	500-051-03	D4	3	1737	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
6758	LANCE DRIVE	1512	500-051-04	E4	3	1737	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
6759	LANCE DRIVE	1542	500-051-06	E4	3	1737	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6760	LANCE DRIVE	1552	500-051-07	E4	3	1737	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
6761	LANCE DRIVE	1552	500-051-07	E4	3	1737	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
6762	LANCE DRIVE	1572	500-051-08	E4	3	1737	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6604	LANCE DRIVE	1671	103-732-08	E4	3	1738	Driveway	PCC	Sidewalk Curb Separation	1/4" to 1/2"	7		No			Grind	Between curb and driveway
6602	LANCE DRIVE	1671	103-732-08	E4	3	1738	Sidewalk	PCC		1/4" to 1/2"	2		Yes			Grind	Prev grind
6601	LANCE DRIVE	1671	103-732-08	E4	3	1738	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
6603	LANCE DRIVE	1671	103-732-08	E4	3	1738	Driveway	PCC	Linear Cracking	1/4" to 1/2"	4.5		No			Grind	
6875	LANCE DRIVE	1672	103-731-07	E4	3	1738	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6600	LANCE DRIVE	1681	103-732-09	E4	3	1738	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
6876	LANCE DRIVE	1692	103-731-05	E4	3	1738	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
6877	LANCE DRIVE	1692	103-731-05	E4	3	1738	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
6878	LANCE DRIVE	1722	103-731-03	E4	3	1738	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6578	LANCE DRIVE	1731	103-732-23	E4	3	1738	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
6579	LANCE DRIVE	1731	103-732-23	E4	3	1738	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6879	LANCE DRIVE	1742	103-743-18	E4	3	1738	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
6576	LANCE DRIVE	1751	103-741-02	E4	3	1738	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
6577	LANCE DRIVE	1751	103-741-02	E4	3	1738	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
6880	LANCE DRIVE	1762	103-743-16	E4	3	1738	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	At water patch
6881	LANCE DRIVE	1782	103-743-15	E4	3	1738	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
6882	LANCE DRIVE	1792	103-743-14	E4	3	1738	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
3878	LEAR LANE	1281	500-093-17	D4	3	1749	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
3879	LEAR LANE	1292	500-093-15	D4	3	1749	Driveway	PCC	Linear Cracking	1/4" to 1/2"	10		No			Grind	
3877	LEAR LANE	1321	500-093-20	D4	3	1749	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
6618	LEAR LANE	13512	103-732-01	E4	3	1750	Sidewalk	PCC	Corner Break	1/2" to 1"	1		No			Ramp	
6619	LEAR LANE	13512	103-732-01	E4	3	1750	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
6614	LEAR LANE	1652	103-732-06	E4	3	1750	Sidewalk	PCC	Faulting	1/2" to 1"	1		Yes			Ramp	
6612	LEAR LANE	1652	103-732-06	E4	3	1750	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
6613	LEAR LANE	1652	103-732-06	E4	3	1750	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
6617	LEAR LANE	1671	103-732-02	E4	3	1750	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
6615	LEAR LANE	1672	103-732-05	E4	3	1750	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
6616	LEAR LANE	1681	103-732-03	E4	3	1750	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5963	LETTY LANE	1132	500-131-15	D4	3	1751	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
5965	LETTY LANE	1152	500-131-14	D4	3	1751	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
5964	LETTY LANE	1152	500-131-14	D4	3	1751	Sidewalk	PCC	Linear Cracking	1/2" to 1"	4		Yes			Grind	
5992	LETTY LANE	1161	500-132-08	D4	3	1751	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
5967	LETTY LANE	1162	500-131-13	D4	3	1751	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	Prev grind
5970	LETTY LANE	1182	500-131-12	D4	3	1751	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	Prev grind
5968	LETTY LANE	1182	500-131-12	D4	3	1751	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
5969	LETTY LANE	1182	500-131-12	D4	3	1751	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight displacement
5971	LETTY LANE	1182	500-131-12	D4	3	1751	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
5975	LETTY LANE	1201	500-132-06	D4	3	1751	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	8		No			Grind	
5976	LETTY LANE	1201	500-132-06	D4	3	1751	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	10		No			Grind	
5974	LETTY LANE	1202	500-131-11	D4	3	1751	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	8		No			Grind	
6018	MAIN ST	1082	500-163-01	D3	3	1042	Driveway	PCC	Linear Cracking	1/2" to 1"	7		No			Grind	
6019	MAIN ST	1082	500-163-01	D3	3	1042	Driveway	PCC	Linear Cracking	1/4" to 1/2"	7		No			Grind	
6020					D3	3	1042	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	4		Yes		Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
6021	MAIN ST	1082	500-163-01	D3	3	1042	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	14		Yes			Grind	
6022	MAIN ST	1092	500-163-02	D3	3	1042	Driveway	PCC	Linear Cracking	1/4" to 1/2"	7		No			Grind	
6023	MAIN ST	1092	500-163-02	D3	3	1042	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	14		Yes			Grind	
6011	MAIN ST	13572	500-162-04	D3	3	1042	Sidewalk	PCC	Patch / Utility Cut	1/2" to 1"	3		No			Grind	Pole base
11968	MAIN ST	13572	500-162-04	D3	3	1042	Curb/Gutter	PCC	Faulting	1/2" to 1"	2		No			Replace C&G	Water pooling
11967	MAIN ST	13572	500-162-04	D3	3	1042	Curb/Gutter	PCC	Linear Cracking	1" to 2"	2		No			Grind	
11965	MAIN ST	13572	500-162-04	D3	3	1042	Curb/Gutter	PCC	Linear Cracking	1/2" to 1"	2		No			Grind	
11966	MAIN ST	13572	500-162-04	D3	3	1042	Curb/Gutter	PCC	Linear Cracking	1/2" to 1"	2		No			Grind	
11955	MAIN ST	13572	500-162-04	D3	3	1042	Curb/Gutter	PCC	Linear Cracking	1/4" to 1/2"	2		No			Grind	
11956	MAIN ST	13572	500-162-04	D3	3	1042	Sidewalk	PCC	Spalling	1/4" to 1/2"	0.5		No			Grind	
11958	MAIN ST	13612	500-162-05	D3	3	1042	Curb/Gutter	PCC	Linear Cracking	1/2" to 1"	2		No			Grind	2 cracks
6014	MAIN ST	13612	500-162-05	D3	3	1042	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
11960	MAIN ST	13612	500-162-05	D3	3	1042	Sidewalk	PCC	Faulting	1/4" to 1/2"	8		No			Grind	
11957	MAIN ST	13612	500-162-05	D3	3	1042	Curb/Gutter	PCC	Linear Cracking	1/2" to 1"	2		No			Grind	
11959	MAIN ST	13612	500-162-05	D3	3	1042	Curb/Gutter	PCC	Linear Cracking	1/2" to 1"	2		No			Grind	
6012	MAIN ST	13612	500-162-05	D3	3	1042	Driveway	PCC	Linear Cracking	1/2" to 1"	7		No			Grind	
6013	MAIN ST	13612	500-162-05	D3	3	1042	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	8		Yes			Replace Slab	
6015	MAIN ST	13612	500-162-05	D3	3	1042	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	12		Yes			Replace Slab	
6016	MAIN ST	13612	500-162-05	D3	3	1042	Curb/Gutter	PCC	Spalling	1/4" to 1/2"	6		No			Grind	
6017	MAIN ST	13662	500-171-28	D3	3	1042	Driveway	PCC	Spalling	1" to 2"	4		No			Patch	
6026	MAIN ST		500-164-24	D4	3	1042	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
6025	MAIN ST		500-164-24	D3	3	1042	Curb/Gutter	PCC	Linear Cracking	1/2" to 1"	3		No			Grind	
6024	MAIN ST		500-164-24	D3	3	1042	Driveway	PCC	Linear Cracking	1/4" to 1/2"	7		No			Grind	
6027	MAIN ST		500-164-24	D4	3	1042	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	4		No			Replace Slab	
6028	MAIN ST		500-164-24	D4	3	1042	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	6		No			Grind	
4696	MAUNA LOA ROAD	1301	103-591-20	D4	3	1767	Driveway	PCC	Corner Break	1/4" to 1/2"	2		No			Grind	
4694	MAUNA LOA ROAD	1301	103-591-20	D4	3	1767	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
4695	MAUNA LOA ROAD	1301	103-591-20	D4	3	1767	Sidewalk	PCC	Linear Cracking	No Displacement	4		Yes			Joint Seal	
4693	MAUNA LOA ROAD	1311	103-591-19	D4	3	1767	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
4692	MAUNA LOA ROAD	1321	103-591-18	D4	3	1767	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
4704	MAUNA LOA ROAD	1322	103-592-04	D4	3	1767	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
4697	MAUNA LOA ROAD	13261	103-591-24	D4	3	1767	Driveway	PCC	Faulting	1/2" to 1"	8		No			Grind Driveway	
4698	MAUNA LOA ROAD	13261	103-591-24	D4	3	1767	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
4683	MAUNA LOA ROAD	13282	103-591-08	D4	3	1767	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
4705	MAUNA LOA ROAD	1332	103-592-05	D4	3	1767	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
4691	MAUNA LOA ROAD	1341	103-591-17	D4	3	1767	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
4706	MAUNA LOA ROAD	1342	103-592-06	D4	3	1767	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
4707	MAUNA LOA ROAD	1342	103-592-06	D4	3	1767	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
4708	MAUNA LOA ROAD	1352	103-592-07	D4	3	1767	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
4690	MAUNA LOA ROAD	1361	103-591-15	D4	3	1767	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
4689	MAUNA LOA ROAD	1371	103-591-14	D4	3	1767	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
4688	MAUNA LOA ROAD	1381	103-591-13	D4	3	1767	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
4710	MAUNA LOA ROAD	1382	103-592-09	D4	3	1767	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
4709	MAUNA LOA ROAD	1382	103-592-09	D4	3	1767	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
4712	MAUNA LOA ROAD	1392	103-592-10	D4	3	1767	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
4711	MAUNA LOA ROAD	1392	103-592-10	D4	3	1767	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
4687	MAUNA LOA ROAD	1401	103-591-12	D4	3	1767	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
4686	MAUNA LOA ROAD	1401	103-591-12	D4	3	1767	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
4713	MAUNA LOA ROAD	1402	103-592-11	D4	3	1767	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
4685	MAUNA LOA ROAD	1411	103-591-11	D4	3	1767	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight displacement
4684	MAUNA LOA ROAD	1411	103-591-11	D4	3	1767	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
7313	MELVIN WAY	13152	103-472-09	D4	3	1775	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No		Yes	Grind	
7315	MELVIN WAY	13152	103-472-09	D4	3	1775	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No		Yes	Grind	
7312	MELVIN WAY	13152	103-472-09	D4	3	1775	Sidewalk	PCC	Linear Cracking	1/2" to 1"	3.5		No		Yes	Grind	
7403	MELVIN WAY	1531	103-471-42	D4	3	1775	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
7404	MELVIN WAY	1531	103-471-42	D4	3	1775	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7319	MELVIN WAY	1532	103-472-08	D4	3	1775	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No		Yes	Grind	Prev grind
7316	MELVIN WAY	1532	103-472-08	D4	3	1775	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	2		No		Yes	Grind	
7401	MELVIN WAY	1541	103-471-43	D4	3	1775	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7399	MELVIN WAY	1551	103-471-44	D4	3	1775	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
7324	MELVIN WAY	1552	103-472-06	D4	3	1775	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No		Yes	Grind	Prev grind
7321	MELVIN WAY	1552	103-472-06	D4	3	1775	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	3.5		No		Yes	Grind	Prev grind
7325	MELVIN WAY	1552	103-472-06	D4	3	1775	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No		Yes	Grind	
7398				i	D4	3	1775	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No		Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
7327	MELVIN WAY	1562	103-472-05	D4	3	1775	Sidewalk	PCC	Corner Break	1/4" to 1/2"	2.5		No		Yes	Grind	
7329	MELVIN WAY	1562	103-472-05	D4	3	1775	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No		Yes	Grind	
7332	MELVIN WAY	1582	103-472-04	D4	3	1775	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No		Yes	Grind	
7333	MELVIN WAY	1582	103-472-04	D4	3	1775	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7335	MELVIN WAY	1582	103-472-04	D4	3	1775	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7331	MELVIN WAY	1582	103-472-04	D4	3	1775	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	1		No		Yes	Grind	
7338	MELVIN WAY	1592	103-472-03	D4	3	1775	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7340	MELVIN WAY	1592	103-472-03	D4	3	1775	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
7337	MELVIN WAY	1592	103-472-03	D4	3	1775	Driveway	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
7342	MELVIN WAY	1602	103-472-02	D4	3	1775	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
7345	MELVIN WAY	1612	103-472-01	D4	3	1775	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	Prev grind
7346	MELVIN WAY	1612	103-472-01	D4	3	1775	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
7343	MELVIN WAY	1612	103-472-01	D4	3	1775	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7396	MELVIN WAY	1621	103-223-01	D4	3	1775	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	Prev grind
7392	MELVIN WAY	1631	103-223-02	D4	3	1775	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
7395	MELVIN WAY	1631	103-223-02	D4	3	1775	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
7348	MELVIN WAY	1632	103-222-01	D4	3	1775	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
7393	MELVIN WAY	1641	103-223-03	D4	3	1775	Driveway	PCC	Faulting	1/2" to 1"	8		No			Grind Driveway	Between driveway and sidewalk
7391	MELVIN WAY	1651	103-223-04	D4	3	1775	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
7387	MELVIN WAY	1652	103-222-15	D4	3	1775	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
7388	MELVIN WAY	1661	103-223-05	D4	3	1775	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	1.5		No			Grind	
9209	NEWPORT AVENUE	12872	501-081-01	C4	3	1179	Sidewalk	PCC	Faulting	1/4" to 1/2"	5	Yes			Yes	Grind	
9211	NEWPORT AVENUE	12872	501-081-01	C4	3	1179	Curb/Gutter	PCC	Linear Cracking	1" to 2"	2		No		Yes	Grind	
9210	NEWPORT AVENUE	12892	501-081-03	C4	3	1179	Curb/Gutter	PCC	Spalling	1/2" to 1"	4		No		Yes	Replace C&G	
9206	NEWPORT AVENUE	12932	501-081-30	C4	3	1179	Sidewalk	PCC	Faulting	1/2" to 1"	4		No		Yes	Ramp	
9207	NEWPORT AVENUE	12932	501-081-30	C4	3	1179	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes		Yes	Grind	
9208	NEWPORT AVENUE	12932	501-081-30	C4	3	1179	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes		Yes	Grind	
9205	NEWPORT AVENUE	12972	501-081-05	C4	3	1179	Sidewalk	PCC	Spalling	1/2" to 1"	1		Yes		Yes	Replace C&G	
8131	NEWPORT AVENUE	13224	500-111-07	C4	3	1177	Driveway	PCC	Punchout	1/2" to 1"	4		No			Replace Slab	
8130	NEWPORT AVENUE	13224	500-111-07	C4	3	1177	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	4		No	Yes		Grind	
8136	NEWPORT AVENUE	13300	500-061-02	D4	3	1177	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No	Yes	Yes	Grind	
8137	NEWPORT AVENUE	13300	500-061-02	D4	3	1177	Curb/Gutter	PCC	Spalling	Over 2"	3		No		Yes	Replace C&G	
8138	NEWPORT AVENUE	13400	500-131-02	D3	3	1176	Sidewalk	PCC	Other - Leave Comment	1" to 2"		2"	No		Yes	Ramp	Hole
8139	NEWPORT AVENUE	13420	500-131-04	D3	3	1176	Driveway	PCC	Linear Cracking	1/4" to 1/2"	4		No		Yes	Grind	
8140	NEWPORT AVENUE	13444	500-131-35	D3	3	1176	Driveway	PCC	Linear Cracking	1/4" to 1/2"	8		No		Yes	Grind	
8141	NEWPORT AVENUE	13572	500-162-04	D3	3	1174	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	4		No			Replace Slab	
8142	NEWPORT AVENUE	13612	500-162-05	D3	3	1174	Driveway	PCC	Linear Cracking	1/4" to 1/2"	7		No			Grind	
9318	NEWPORT AVENUE	13662	500-171-02	D3	3	1174	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No	Yes		Grind	
9422	NEWPORT AVENUE	13682	500-171-18	D3	3	1174	Sidewalk	PCC	Linear Cracking	No Displacement	3		No			Joint Seal	Slight displacement
9420	NEWPORT AVENUE	13682	500-171-18	D3	3	1174	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
9421	NEWPORT AVENUE	13682	500-171-18	D3	3	1174	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
9419	NEWPORT AVENUE	13812	500-153-01	D3	3	1172	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
9416	NEWPORT AVENUE	13882	500-152-27	D3	3	1172	Driveway	PCC	Spalling	1/4" to 1/2"	1		No		Yes	Grind	
9414	NEWPORT AVENUE	13920	500-151-18	D3	3	1172	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No		Yes	Grind	
9415	NEWPORT AVENUE	13920	500-151-18	D3	3	1172	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes		Yes	Grind	
9413	NEWPORT AVENUE	13920	500-151-18	D3	3	1172	Driveway	PCC	Punchout	1/2" to 1"	4		No		Yes	Replace Slab	
9418	NEWPORT AVENUE		500-152-25	D3	3	1172	Sidewalk	PCC	Corner Break	1/4" to 1/2"	2		No		Yes	Grind	
8132	NEWPORT AVENUE		999-000-42	C4	3	1177	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
9417	NEWPORT AVENUE		500-152-25	D3	3	1172	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes		Yes	Grind	
8128	NEWPORT AVENUE		500-111-06	C4	3	1177	Curb/Gutter	PCC	Linear Cracking	1/4" to 1/2"	2		No			Grind	
8129	NEWPORT AVENUE		500-111-06	C4	3	1177	Curb/Gutter	PCC	Linear Cracking	1/4" to 1/2"	2		No			Grind	
8127	NEWPORT AVENUE		500-111-06	C4	3	1177	Driveway	PCC	Linear Cracking	1/4" to 1/2"	8		No			Grind	
8135	NEWPORT AVENUE		999-000-42	D4	3	1177	Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	5		No		Yes	Grind	
8134	NEWPORT AVENUE		999-000-42	C4	3	1177	Curb/Gutter	PCC	Spalling	1" to 2"	6		Yes			Patch	
8133	NEWPORT AVENUE		999-000-42	D4	3	1177	Sidewalk	PCC	Spalling	1/2" to 1"	1		Yes			Replace C&G	
11506	NIXON CIRCLE	13261	103-255-47	D4	3	1806	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
11507	NIXON CIRCLE	13271	103-255-08	D4	3	1806	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
11508	NIXON CIRCLE	13291	103-255-09	D4	3	1806	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
11509	NIXON CIRCLE	13321	103-255-12	D4	3	1806	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	1		No			Grind	
11518	NIXON CIRCLE	13332	103-255-20	D4	3	1806	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	Prev grind
11520	NIXON CIRCLE	13332	103-255-20	D4	3	1806	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
11519	NIXON CIRCLE	13332	103-255-20	D4	3	1806	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
11510	NIXON CIRCLE	13341	103-255-14	D4	3	1806	Driveway	PCC	Faulting	1/2" to 1"	5		No			Grind Driveway	Between sidewalk and driveway
11511				D4	3	1806	Driveway	PCC	Faulting	1/4" to 1/2"	4		No			Grind Driveway	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
11517	NIXON CIRCLE	13352	103-255-19	D4	3	1806	Sidewalk	PCC	Faulting	1/2" to 1"	6		No			Ramp	Between sidewalk and driveway
11513	NIXON CIRCLE	13361	103-255-16	E4	3	1806	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
11512	NIXON CIRCLE	13361	103-255-16	D4	3	1806	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
11515	NIXON CIRCLE	13372	103-255-18	E4	3	1806	Sidewalk	PCC	Faulting	1/2" to 1"	15		No			Ramp	Between sidewalk and driveway
11516	NIXON CIRCLE	13372	103-255-18	E4	3	1806	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
11514	NIXON CIRCLE	13372	103-255-18	E4	3	1806	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
11503	NIXON CIRCLE	1781	103-255-06	D4	3	1806	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
11504	NIXON CIRCLE	1781	103-255-06	D4	3	1806	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
11505	NIXON CIRCLE	1781	103-255-06	D4	3	1806	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
11524	NIXON CIRCLE	1802	103-255-21	D4	3	1806	Sidewalk	PCC	Faulting	1/2" to 1"	3		No			Ramp	
11521	NIXON CIRCLE	1802	103-255-21	D4	3	1806	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
11522	NIXON CIRCLE	1802	103-255-21	D4	3	1806	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
11523	NIXON CIRCLE	1802	103-255-21	D4	3	1806	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		Yes			Grind	
9258	OLD IRVINE BOULEVARD	1062	500-101-08	C4	3	2011	Driveway	PCC	Buckled Slab	Over 2"	10		No		Yes	Replace Slab(s)	
9259	OLD IRVINE BOULEVARD	1062	500-101-08	C4	3	2011	Curb/Gutter	PCC	Linear Cracking	1/2" to 1"	6		No		Yes	Grind	
9256	OLD IRVINE BOULEVARD	1062	500-101-08	C4	3	2011	Driveway	PCC	Linear Cracking	1/2" to 1"	7		No		Yes	Grind	
9257	OLD IRVINE BOULEVARD	1062	500-101-08	C4	3	2011	Driveway	PCC	Linear Cracking	1/2" to 1"	7		No		Yes	Grind	
9263	OLD IRVINE BOULEVARD	1082	500-101-09	C4	3	2011	Sidewalk	AC	Alligator Cracking	1/4" to 1/2"	50		No		Yes	Remove & Replace	Possibly part of parking lot
9260	OLD IRVINE BOULEVARD	1082	500-101-09	C4	3	2011	Driveway	PCC	Linear Cracking	1" to 2"	8		No		Yes	Replace Driveway	
9262	OLD IRVINE BOULEVARD	1082	500-101-09	C4	3	2011	Driveway	PCC	Linear Cracking	1" to 2"	8		No		Yes	Replace Driveway	
9261	OLD IRVINE BOULEVARD	1082	500-101-09	C4	3	2011	Driveway	PCC	Linear Cracking	1/2" to 1"	8		No		Yes	Grind	
9201	OLD IRVINE BOULEVARD	1091	501-081-06	C4	3	2011	Curb/Gutter	PCC	Spalling	1" to 2"	1		No		Yes	Patch	
9200	OLD IRVINE BOULEVARD	1095	501-081-24	C4	3	2011	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes		Yes	Grind	
9202	OLD IRVINE BOULEVARD	12932	501-081-30	C4	3	2011	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes		Yes	Grind	
9203	OLD IRVINE BOULEVARD	12932	501-081-30	C4	3	2011	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes		Yes	Grind	
9204	OLD IRVINE BOULEVARD	12932	501-081-30	C4	3	2011	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	5		Yes		Yes	Grind	
4435	OLWYN DRIVE	1272	103-633-02	D4	3	1811	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Prev grind
4436	OLWYN DRIVE	1272	103-633-02	D4	3	1811	Sidewalk	PCC	Linear Cracking	No Displacement	4		Yes			Joint Seal	Prev grind
4554	OLWYN DRIVE	1301	103-634-12	D4	3	1811	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight displacement
4553	OLWYN DRIVE	1301	103-634-12	D4	3	1811	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
4556	OLWYN DRIVE	1301	103-634-12	D4	3	1811	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
4555	OLWYN DRIVE	1301	103-634-12	D4	3	1811	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
4551	OLWYN DRIVE	1311	103-634-11	D4	3	1811	Driveway	PCC	Faulting	1/4" to 1/2"	4		No			Grind Driveway	
4552	OLWYN DRIVE	1311	103-634-11	D4	3	1811	Curb/Gutter	PCC	Spalling	1/2" to 1"	10		No			Replace C&G	
4557	OLWYN DRIVE	13132	103-634-01	D4	3	1811	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
4525	OLWYN DRIVE	13181	103-531-13	D4	3	1812	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
4528	OLWYN DRIVE	13181	103-531-13	D4	3	1812	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
4526	OLWYN DRIVE	13181	103-531-13	D4	3	1812	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
4529	OLWYN DRIVE	13181	103-531-13	D4	3	1812	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
4527	OLWYN DRIVE	13181	103-531-13	D4	3	1812	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	2		No			Grind	
4499	OLWYN DRIVE	13192	103-531-25	D4	3	1812	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight displacement
4495	OLWYN DRIVE	13192	103-531-25	D4	3	1812	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
4498	OLWYN DRIVE	13192	103-531-25	D4	3	1812	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
4497	OLWYN DRIVE	13192	103-531-25	D4	3	1812	Driveway	PCC	Linear Cracking	1/4" to 1/2"	6		No			Grind	
4496	OLWYN DRIVE	13192	103-531-25	D4	3	1812	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
4493	OLWYN DRIVE	13201	103-531-26	D4	3	1812	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	3		Yes			Grind	Prev grind
4491	OLWYN DRIVE	13201	103-531-26	D4	3	1812	Driveway	PCC	Faulting	1/4" to 1/2"	7		No			Grind Driveway	
4492	OLWYN DRIVE	13201	103-531-26	D4	3	1812	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
4494	OLWYN DRIVE	13201	103-531-26	D4	3	1812	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
4461	OLWYN DRIVE	13202	103-531-40	D4	3	1812	Sidewalk	PCC	Faulting	1/2" to 1"	3		No			Ramp	
4459	OLWYN DRIVE	13202	103-531-40	D4	3	1812	Sidewalk	PCC	Linear Cracking	1" to 2"	5		No			Replace Slab	
4460	OLWYN DRIVE	13202	103-531-40	D4	3	1812	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
11939	OLWYN DRIVE	13202	103-531-40	D4	3	1812	Sidewalk	PCC	Spalling	1/2" to 1"	0.5		No			Replace C&G	
4442	OLWYN DRIVE	1332	103-633-29	D4	3	1811	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	Prev grind
4443	OLWYN DRIVE	1332	103-633-29	D4	3	1811	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight displacement
4441	OLWYN DRIVE	1332	103-633-29	D4	3	1811	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
11926	OLWYN DRIVE	1342	103-633-30	D4	3	1812	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
4533	OLWYN DRIVE	1351	103-635-02	D4	3	1812	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight displacement
4536	OLWYN DRIVE	1351	103-635-02	D4	3	1812	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
4534	OLWYN DRIVE	1351	103-635-02	D4	3	1812	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
4535	OLWYN DRIVE	1351	103-635-02	D4	3	1812	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
4444	OLWYN DRIVE	1352	103-633-31	D4	3	1812	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
4445	OLWYN DRIVE	1352	103-633-31	D4	3	1812	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
4447				D4	3	1812	Sidewalk	PCC	Divided Slab	No Displacement	8		No			Replace Slab(s)	Low

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
4446	OLWYN DRIVE	1354	103-633-32	D4	3	1812	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
4530	OLWYN DRIVE	1355	103-635-01	D4	3	1812	Sidewalk	PCC	Linear Cracking	No Displacement	4		Yes			Joint Seal	Slight displacement
4532	OLWYN DRIVE	1355	103-635-01	D4	3	1812	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
4531	OLWYN DRIVE	1355	103-635-01	D4	3	1812	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	14		No			Grind	
11927	OLWYN DRIVE	1362	103-533-01	D4	3	1812	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
4448	OLWYN DRIVE	1382	103-533-03	D4	3	1812	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
4449	OLWYN DRIVE	1392	103-533-04	D4	3	1812	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
4450	OLWYN DRIVE	1422	103-533-06	D4	3	1812	Sidewalk	PCC	Linear Cracking	No Displacement	2		No			Joint Seal	Slight Displacement
11928	OLWYN DRIVE	1422	103-533-06	D4	3	1812	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
4452	OLWYN DRIVE	1432	103-533-07	D4	3	1812	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
4451	OLWYN DRIVE	1432	103-533-07	D4	3	1812	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
4453	OLWYN DRIVE	1432	103-533-07	D4	3	1812	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
11929	OLWYN DRIVE	1432	103-533-07	D4	3	1812	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
4455	OLWYN DRIVE	1452	103-533-08	D4	3	1812	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
4454	OLWYN DRIVE	1452	103-533-08	D4	3	1812	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
4456	OLWYN DRIVE	1472	103-533-09	D4	3	1812	Sidewalk	PCC	Faulting	1/2" to 1"	3		No			Ramp	Prev grind
4457	OLWYN DRIVE	1472	103-533-09	D4	3	1812	Driveway	PCC	Patch / Utility Cut	1" to 2"	6	2'	No			Grind	
11930	OLWYN DRIVE	1472	103-533-09	D4	3	1812	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
3712	ORANGE STREET	1072	500-154-27	D3	3	1813	Driveway	PCC	Sidewalk Curb Separation	1" to 2"	7		Yes		Yes	Patch	
3711	ORANGE STREET	1072	500-154-27	D3	3	1813	Curb/Gutter	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
3746	ORANGE STREET	1111	500-151-19	E3	3	1813	Driveway	PCC	Other - Leave Comment	No Displacement			No		Yes	Field Assess-Monitor	Scaling
3713	ORANGE STREET	1111	500-153-11	D3	3	1813	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No		Yes	Grind	Util cover
3714	ORANGE STREET	1111	500-153-11	D3	3	1813	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No		Yes	Grind	Util cover
3747	ORANGE STREET	1111	500-151-19	E3	3	1813	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes		Yes	Grind	
3748	ORANGE STREET	1111	500-151-19	E3	3	1813	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes		Yes	Grind	
3715	ORANGE STREET	1111	500-153-11	D3	3	1813	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes		Yes	Grind	
3743	ORANGE STREET	1111	500-151-19	E3	3	1813	Driveway	PCC	Linear Cracking	1/4" to 1/2"	8		No		Yes	Grind	
3744	ORANGE STREET	1111	500-151-19	E3	3	1813	Driveway	PCC	Linear Cracking	1/4" to 1/2"	8		No		Yes	Grind	
3745	ORANGE STREET	1111	500-151-19	E3	3	1813	Driveway	PCC	Linear Cracking	1/4" to 1/2"	4		No		Yes	Grind	
3742	ORANGE STREET	1111	500-151-19	E3	3	1813	Sidewalk	PCC	Spalling	Over 2"	0.5		No		Yes	Patch	
3741	ORANGE STREET	1114	500-151-08	D3	3	1813	Sidewalk	PCC	Linear Cracking	No Displacement	4		No		Yes	Joint Seal	Slight displacement
3753	ORANGE STREET	1171	500-141-24	D3	3	1813	Driveway	PCC	Punchout	1/4" to 1/2"	6		No		Yes	Replace Slab	Low
3759	ORANGE STREET	1171	500-141-24	D3	3	1813	Sidewalk	PCC	Corner Break	Over 2"	3		No		Yes	Replace Slab	
3757	ORANGE STREET	1171	500-141-24	D3	3	1813	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No		Yes	Grind	
3758	ORANGE STREET	1171	500-141-24	D3	3	1813	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No		Yes	Grind	
3751	ORANGE STREET	1171	500-141-24	D3	3	1813	Sidewalk	PCC	Faulting	Over 2"	4		No		Yes	Replace Slab	
3752	ORANGE STREET	1171	500-141-24	D3	3	1813	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	4		No		Yes	Grind	
3749	ORANGE STREET	1171	500-141-24	E3	3	1813	Curb/Gutter	PCC	Spalling	1" to 2"	0.5		No		Yes	Patch	
3750	ORANGE STREET	1171	500-141-24	D3	3	1813	Curb/Gutter	PCC	Spalling	1" to 2"	0.5		No		Yes	Patch	
3756	ORANGE STREET	1171	500-141-24	D3	3	1813	Sidewalk	PCC	Spalling	1" to 2"	0.5		No		Yes	Patch	
3754	ORANGE STREET	1171	500-141-24	D3	3	1813	Sidewalk	PCC	Spalling	1/4" to 1/2"	2		No		Yes	Grind	
3755	ORANGE STREET	1171	500-141-24	D3	3	1813	Sidewalk	PCC	Spalling	1/4" to 1/2"	2		No		Yes	Grind	
3728	ORANGE STREET	13811	500-152-16	D3	3	1813	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No		Yes	Grind	
4824	RED HILL AVENUE	13002	103-471-50	D4	3	1206	Sidewalk	AC	Faulting	1" to 2"	6		No			AC Patch	
4823	RED HILL AVENUE	13022	103-471-02	D4	3	1206	Driveway	PCC	Divided Slab	1" to 2"	12		No			Replace Slab(s)	High
4825	RED HILL AVENUE	13022	103-471-02	D4	3	1206	Sidewalk	AC	Alligator Cracking	No Displacement	25		No			Remove & Replace	Low
4822	RED HILL AVENUE	13032	103-471-03	D4	3	1206	Sidewalk	AC	Alligator Cracking	No Displacement	25		No			Remove & Replace	Low
4821	RED HILL AVENUE	13052	103-471-04	D4	3	1206	Sidewalk	AC	Alligator Cracking	No Displacement	25		No			Remove & Replace	Low
4820	RED HILL AVENUE	13062	103-471-05	D4	3	1206	Sidewalk	AC	Alligator Cracking	No Displacement	25		No			Remove & Replace	Low
4819	RED HILL AVENUE	13062	103-471-05	D4	3	1206	Driveway	PCC	Divided Slab	1/4" to 1/2"	15		No			Replace Slab(s)	Med
4628	RED HILL AVENUE	13071	103-532-10	D4	3	1205	Sidewalk	PCC	Divided Slab	1/4" to 1/2"	5		No			Replace Slab	Manhole
4629	RED HILL AVENUE	13071	103-532-10	D4	3	1205	Sidewalk	PCC	Faulting	1/4" to 1/2"	6		No			Grind	
4630	RED HILL AVENUE	13071	103-532-10	D4	3	1205	Sidewalk	PCC	Faulting	1/4" to 1/2"	6		No			Grind	
4633	RED HILL AVENUE	13071	103-532-10	D4	3	1205	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
4590	RED HILL AVENUE	13071	103-532-10	D4	3	1205	Cross Gutter	PCC	Linear Cracking	1/4" to 1/2"	6		No			Grind	
4632	RED HILL AVENUE	13071	103-532-10	D4	3	1205	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
4631	RED HILL AVENUE	13071	103-532-10	D4	3	1205	Sidewalk	PCC	Spalling	1/2" to 1"	2		No			Replace C&G	
4634	RED HILL AVENUE	13071	103-532-10	D4	3	1205	Sidewalk	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
4818	RED HILL AVENUE	13082	103-471-06	D4	3	1206	Sidewalk	AC	Alligator Cracking	No Displacement	25		No			Remove & Replace	Low
11935	RED HILL AVENUE	13132	103-531-34	D4	3	1205	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
11933	RED HILL AVENUE	13132	103-531-34	D4	3	1205	Curb/Gutter	PCC	Linear Cracking	1/2" to 1"	2		No			Grind	
4640	RED HILL AVENUE	13132	103-531-34	D4	3	1205	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
11934	RED HILL AVENUE	13132	103-531-34	D4	3	1205	Curb/Gutter	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
11936				D4	3	1203	Curb/Gutter	PCC	Faulting	1/2" to 1"	2		No	Yes		Replace C&G	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
4641	RED HILL AVENUE	13152	103-531-36	D4	3	1203	Sidewalk	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
11937	RED HILL AVENUE	13162	103-531-37	D4	3	1203	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Spall also
4642	RED HILL AVENUE	13162	103-531-37	D4	3	1203	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
4643	RED HILL AVENUE	13162	103-531-37	D4	3	1203	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
11938	RED HILL AVENUE	13162	103-531-37	D4	3	1203	Sidewalk	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
4646	RED HILL AVENUE	13172	103-531-38	D4	3	1203	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
4644	RED HILL AVENUE	13172	103-531-38	D4	3	1203	Sidewalk	PCC	Linear Cracking	1/2" to 1"	4		No			Grind	
4647	RED HILL AVENUE	13192	103-531-39	D4	3	1203	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
4645	RED HILL AVENUE	13192	103-531-39	D4	3	1203	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	
4648	RED HILL AVENUE	13192	103-531-39	D4	3	1203	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
4649	RED HILL AVENUE	13192	103-531-39	D4	3	1203	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
4815	RED HILL AVENUE	13200	103-472-14	D4	3	1204	Driveway	PCC	Divided Slab	1/2" to 1"	16		No		Yes	Replace Slab(s)	High
4814	RED HILL AVENUE	13200	103-472-14	D4	3	1204	Sidewalk	PCC	Divided Slab	No Displacement	12		No		Yes	Replace Slab(s)	Low
4813	RED HILL AVENUE	13200	103-472-14	D4	3	1204	Sidewalk	PCC	Divided Slab	1/4" to 1/2"	14		No		Yes	Replace Slab(s)	Med
4664	RED HILL AVENUE	13282	103-591-08	D4	3	1203	Sidewalk	PCC	Buckled Slab	1/2" to 1"	12		No			Replace Slab(s)	Cracked
4661	RED HILL AVENUE	13282	103-591-08	D4	3	1203	Sidewalk	PCC	Spalling	1/2" to 1"	2		No			Replace C&G	Filled
4662	RED HILL AVENUE	13282	103-591-08	D4	3	1203	Sidewalk	PCC	Spalling	1/2" to 1"	3		No			Replace C&G	Filled
4660	RED HILL AVENUE	13282	103-591-08	D4	3	1203	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
4663	RED HILL AVENUE	13282	103-591-08	D4	3	1203	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
4658	RED HILL AVENUE	13282	103-591-08	D4	3	1203	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No	Yes		Grind	
4659	RED HILL AVENUE	13282	103-591-08	D4	3	1203	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No	Yes		Grind	
4657	RED HILL AVENUE	13282	103-591-08	D4	3	1203	Sidewalk	PCC	Temporary Ramp	Over 2"	5		Yes			Replace Slab	
4665	RED HILL AVENUE	13302	103-591-07	D4	3	1203	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	Filled spall
4666	RED HILL AVENUE	13311	103-591-04	D4	3	1203	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
4667	RED HILL AVENUE	13321	103-591-05	D4	3	1203	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Prev grind
4668	RED HILL AVENUE	13321	103-591-05	D4	3	1203	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
4669	RED HILL AVENUE	13321	103-591-05	D4	3	1203	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	5		No			Grind	
4805	RED HILL AVENUE	13371	103-523-28	D4	3	1202	Sidewalk	AC	Patch / Utility Cut	1/2" to 1"	1		No			AC Patch	
4804	RED HILL AVENUE	13381	103-523-29	D4	3	1202	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
4803	RED HILL AVENUE	13411	103-523-31	D4	3	1202	Sidewalk	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
4801	RED HILL AVENUE	13441	103-523-34	D4	3	1202	Sidewalk	PCC	Other - Leave Comment	1/2" to 1"	8		No			Grind	Cracks and asphalt patch?
4802	RED HILL AVENUE	13441	103-523-34	D4	3	1202	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	10		No			Grind	
6156	RED HILL AVENUE	13531	500-052-05	D4	3	1199	Sidewalk	PCC	Buckled Slab	1" to 2"			No			Replace Slab	
6154	RED HILL AVENUE	13531	500-052-05	D4	3	1199	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
6155	RED HILL AVENUE	13531	500-052-05	D4	3	1199	Sidewalk	PCC	Linear Cracking	1/2" to 1"	4		Yes			Grind	
6153	RED HILL AVENUE	13531	500-052-05	D4	3	1199	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	3		Yes			Grind	
6157	RED HILL AVENUE	13531	500-052-05	D4	3	1199	Sidewalk	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
6151	RED HILL AVENUE	13541	500-052-04	D4	3	1199	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
6152	RED HILL AVENUE	13541	500-052-04	D4	3	1199	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
6147	RED HILL AVENUE	13551	500-052-03	D4	3	1199	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev fault
6148	RED HILL AVENUE	13551	500-052-03	D4	3	1199	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev fault
6145	RED HILL AVENUE	13551	500-052-03	D4	3	1199	Sidewalk	PCC	Buckled Slab	1" to 2"	3		Yes			Replace Slab	
6146	RED HILL AVENUE	13551	500-052-03	D4	3	1199	Sidewalk	PCC	Buckled Slab	1" to 2"	3		Yes			Replace Slab	
6144	RED HILL AVENUE	13551	500-052-03	D4	3	1199	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		Yes			Grind	
6149	RED HILL AVENUE	13551	500-052-03	D4	3	1199	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
6150	RED HILL AVENUE	13551	500-052-03	D4	3	1199	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	10		No			Grind	
6141	RED HILL AVENUE	13561	500-052-02	D4	3	1199	Sidewalk	PCC	Buckled Slab	1" to 2"	4		No			Replace Slab	
6142	RED HILL AVENUE	13561	500-052-02	D4	3	1199	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
6143	RED HILL AVENUE	13561	500-052-02	D4	3	1199	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
6135	RED HILL AVENUE	13581	500-052-01	D4	3	1199	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	5		No			Grind	Prev fault
6136	RED HILL AVENUE	13581	500-052-01	D4	3	1199	Sidewalk	PCC	Buckled Slab	1" to 2"	4		No			Replace Slab	
6137	RED HILL AVENUE	13581	500-052-01	D4	3	1199	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No			Grind	
6138	RED HILL AVENUE	13581	500-052-01	D4	3	1199	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No			Grind	
6139	RED HILL AVENUE	13581	500-052-01	D4	3	1199	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No			Grind	
6134	RED HILL AVENUE	13581	500-052-01	D4	3	1199	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
6140	RED HILL AVENUE	13581	500-052-01	D4	3	1199	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	8		No			Grind	
6036	RED HILL AVENUE	13611	500-082-16	D4	3	1200	Sidewalk	PCC	Buckled Slab	1" to 2"	4		No			Replace Slab	Prev grind
6034	RED HILL AVENUE	13611	500-082-16	D4	3	1200	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
6035	RED HILL AVENUE	13611	500-082-16	D4	3	1200	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
6037	RED HILL AVENUE	13611	500-082-16	D4	3	1200	Curb/Gutter	PCC	Sidewalk Curb Separation	1" to 2"	5		Yes	Yes		Replace Curb	
6039	RED HILL AVENUE	13621	500-082-26	D4	3	1200	Sidewalk	PCC	Other - Leave Comment	1" to 2"	0.5		No			Ramp	Hole
6038	RED HILL AVENUE	13621	500-082-26	D4	3	1200	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
6040	RED HILL AVENUE	13641	500-082-18	E4	3	1200	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		Yes			Grind	
6041				E4	3	1200	Driveway	PCC	Sidewalk Curb Separation	1/2" to 1"	3		No			Patch	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
6044	RED HILL AVENUE	13681	500-082-20	E4	3	1200	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
6043	RED HILL AVENUE	13681	500-082-20	E4	3	1200	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	5		No			Grind	
6042	RED HILL AVENUE	13681	500-082-20	E4	3	1200	Curb/Gutter	PCC	Spalling	1/2" to 1"	0.5		No			Replace C&G	
6047	RED HILL AVENUE	13691	500-082-21	E4	3	1200	Driveway	PCC	Linear Cracking	1/4" to 1/2"	6		No			Grind	
6045	RED HILL AVENUE	13691	500-082-21	E4	3	1200	Driveway	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
6046	RED HILL AVENUE	13691	500-082-21	E4	3	1200	Driveway	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
6048	RED HILL AVENUE	13701	500-082-22	E4	3	1200	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
6049	RED HILL AVENUE	13701	500-082-22	E4	3	1200	Sidewalk	PCC	Patch / Utility Cut	1/2" to 1"	3		No			Grind	
6050	RED HILL AVENUE	13701	500-082-22	E4	3	1200	Sidewalk	PCC	Spalling	1" to 2"	2		No			Patch	
6112	RED HILL AVENUE	13742	500-022-07	E4	3	1197	Sidewalk	PCC	Faulting	1/2" to 1"	5		No	Yes	Yes	Ramp	
6055	RED HILL AVENUE	13751	500-141-09	E4	3	1198	Driveway	PCC	Linear Cracking	1/4" to 1/2"	10		No		Yes	Grind	
3796	RED HILL AVENUE	13751	500-141-09	E4	3	1198	Ramp	PCC	Linear Cracking	No Displacement	10		No		Yes	Joint Seal	
6110	RED HILL AVENUE	13802	500-022-11	E4	3	1197	Sidewalk	PCC	Corner Break	1/4" to 1/2"	5		No		Yes	Grind	
6108	RED HILL AVENUE	13802	500-022-11	E4	3	1197	Driveway	PCC	Linear Cracking	1/2" to 1"	7		No		Yes	Grind	
6109	RED HILL AVENUE	13802	500-022-11	E4	3	1197	Driveway	PCC	Linear Cracking	1/2" to 1"	7		No		Yes	Grind	
6111	RED HILL AVENUE	13802	500-022-11	E4	3	1197	Driveway	PCC	Linear Cracking	1/2" to 1"	7		No		Yes	Grind	
6104	RED HILL AVENUE	13822	500-022-12	E4	3	1197	Sidewalk	PCC	Divided Slab	Over 2"	10		No		Yes	Replace Slab(s)	Severe
6106	RED HILL AVENUE	13822	500-022-12	E4	3	1197	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No		Yes	Grind	
6107	RED HILL AVENUE	13822	500-022-12	E4	3	1197	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No		Yes	Grind	
6099	RED HILL AVENUE	13822	500-022-12	E4	3	1197	Driveway	PCC	Linear Cracking	1/2" to 1"	7		No		Yes	Grind	
6100	RED HILL AVENUE	13822	500-022-12	E4	3	1197	Driveway	PCC	Linear Cracking	1/2" to 1"	7		No		Yes	Grind	
6097	RED HILL AVENUE	13822	500-022-12	E4	3	1197	Curb/Gutter	PCC	Spalling	1" to 2"	0.5		No		Yes	Patch	
6101	RED HILL AVENUE	13822	500-022-12	E4	3	1197	Sidewalk	PCC	Spalling	1" to 2"	1		No		Yes	Patch	
6103	RED HILL AVENUE	13822	500-022-12	E4	3	1197	Curb/Gutter	PCC	Spalling	1/2" to 1"	0.5		No		Yes	Replace C&G	
6102	RED HILL AVENUE	13822	500-022-12	E4	3	1197	Sidewalk	PCC	Spalling	1/2" to 1"	1		No		Yes	Replace C&G	
6105	RED HILL AVENUE	13822	500-022-12	E4	3	1197	Curb/Gutter	PCC	Spalling	1/4" to 1/2"	1		No		Yes	Grind	
6064	RED HILL AVENUE	13841	500-141-10	E4	3	1198	Sidewalk	PCC	Corner Break	1/4" to 1/2"	5		Yes		Yes	Grind	
6056	RED HILL AVENUE	13841	500-141-10	E4	3	1198	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes		Yes	Ramp	
6057	RED HILL AVENUE	13841	500-141-10	E4	3	1198	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes		Yes	Ramp	
6058	RED HILL AVENUE	13841	500-141-10	E4	3	1198	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes		Yes	Ramp	
6059	RED HILL AVENUE	13841	500-141-10	E4	3	1198	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes		Yes	Ramp	
6060	RED HILL AVENUE	13841	500-141-10	E4	3	1198	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes		Yes	Ramp	
6061	RED HILL AVENUE	13841	500-141-10	E4	3	1198	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes		Yes	Grind	
6062	RED HILL AVENUE	13841	500-141-10	E4	3	1198	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes		Yes	Grind	
6063	RED HILL AVENUE	13841	500-141-10	E4	3	1198	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		Yes		Yes	Grind	
6096	RED HILL AVENUE	13852	500-022-04	E4	3	1197	Sidewalk	PCC	Corner Break	1/2" to 1"	2		No		Yes	Ramp	
6094	RED HILL AVENUE	13852	500-022-04	E4	3	1197	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes		Yes	Grind	
6088	RED HILL AVENUE	13852	500-022-04	E4	3	1197	Curb/Gutter	PCC	Linear Cracking	1" to 2"	4		No		Yes	Grind	
6090	RED HILL AVENUE	13852	500-022-04	E4	3	1197	Driveway	PCC	Linear Cracking	1/2" to 1"	7		No		Yes	Grind	
6091	RED HILL AVENUE	13852	500-022-04	E4	3	1197	Driveway	PCC	Linear Cracking	1/2" to 1"	7		No		Yes	Grind	
6092	RED HILL AVENUE	13852	500-022-04	E4	3	1197	Driveway	PCC	Linear Cracking	1/2" to 1"	7		No		Yes	Grind	
6098	RED HILL AVENUE	13852	500-022-04	E4	3	1197	Driveway	PCC	Linear Cracking	1/2" to 1"	7		No		Yes	Grind	
6093	RED HILL AVENUE	13852	500-022-04	E4	3	1197	Sidewalk	PCC	Patch / Utility Cut	1/2" to 1"	6		Yes		Yes	Grind	
6087	RED HILL AVENUE	13852	500-022-04	E4	3	1197	Driveway	PCC	Sidewalk Curb Separation	1/2" to 1"	9		No		Yes	Replace Driveway	
6086	RED HILL AVENUE	13852	500-022-04	E4	3	1197	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	5		No		Yes	Grind	
6089	RED HILL AVENUE	13852	500-022-04	E4	3	1197	Curb/Gutter	PCC	Spalling	1" to 2"	1		No		Yes	Patch	
6085	RED HILL AVENUE	13852	500-022-04	E4	3	1197	Sidewalk	PCC	Spalling	1/4" to 1/2"	2		No		Yes	Grind	
6095	RED HILL AVENUE	13852	500-022-04	E4	3	1197	Sidewalk	PCC	Spalling	1/4" to 1/2"	2		No		Yes	Grind	
6065	RED HILL AVENUE	13871	500-141-11	E4	3	1198	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes		Yes	Grind	
6078	RED HILL AVENUE	13872	500-022-01	E4	3	1197	Driveway	PCC	Divided Slab	1/2" to 1"	15		No		Yes	Replace Slab(s)	High
6079	RED HILL AVENUE	13872	500-022-01	E4	3	1197	Driveway	PCC	Faulting	1/4" to 1/2"	4		No		Yes	Grind Driveway	
6082	RED HILL AVENUE	13872	500-022-01	E4	3	1197	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No		Yes	Grind	
6083	RED HILL AVENUE	13872	500-022-01	E4	3	1197	Driveway	PCC	Linear Cracking	1/4" to 1/2"	7		No		Yes	Grind	
6076	RED HILL AVENUE	13872	500-022-01	E4	3	1197	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No		Yes	Grind	
6084	RED HILL AVENUE	13872	500-022-01	E4	3	1197	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	5		No		Yes	Grind	
6081	RED HILL AVENUE	13872	500-022-01	E4	3	1197	Curb/Gutter	PCC	Spalling	1/2" to 1"	2		No		Yes	Replace C&G	
6080	RED HILL AVENUE	13872	500-022-01	E4	3	1197	Sidewalk	PCC	Spalling	1/2" to 1"	2		No		Yes	Replace C&G	
6077	RED HILL AVENUE	13872	500-022-01	E4	3	1197	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No		Yes	Grind	
6068	RED HILL AVENUE	13891	500-141-12	E4	3	1198	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No		Yes	Grind	
6074	RED HILL AVENUE	13891	500-141-12	E3	3	1198	Curb/Gutter	PCC	Linear Cracking	1/4" to 1/2"	1		No		Yes	Grind	
6071	RED HILL AVENUE	13891	500-141-12	E4	3	1198	Driveway	PCC	Linear Cracking	1/4" to 1/2"	7		No		Yes	Grind	
6072	RED HILL AVENUE	13891	500-141-12	E4	3	1198	Driveway	PCC	Linear Cracking	1/4" to 1/2"	7		No		Yes	Grind	
6073	RED HILL AVENUE	13891	500-141-12	E3	3	1198	Driveway	PCC	Linear Cracking	1/4" to 1/2"	7		No		Yes	Grind	
6067				E4	3	1198	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No		Yes	Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
6066	RED HILL AVENUE	13891	500-141-12	E4	3	1198	Curb/Gutter	PCC	Spalling	1/2" to 1"	1		No		Yes	Replace C&G	
6069	RED HILL AVENUE	13891	500-141-12	E4	3	1198	Curb/Gutter	PCC	Spalling	1/2" to 1"	1		No		Yes	Replace C&G	
6070	RED HILL AVENUE	13891	500-141-12	E3	3	1198	Curb/Gutter	PCC	Spalling	1/2" to 1"	1		No		Yes	Replace C&G	
6075	RED HILL AVENUE	13891	500-141-12	E3	3	1198	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No		Yes	Grind	
4618	RED HILL AVENUE	1442	103-532-18	D4	3	1205	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
4624	RED HILL AVENUE	1442	103-532-18	D4	3	1205	Driveway	PCC	Linear Cracking	1/4" to 1/2"	6		No			Grind	
4620	RED HILL AVENUE	1442	103-532-18	D4	3	1205	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	10		Yes			Grind	
4623	RED HILL AVENUE	1442	103-532-18	D4	3	1205	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	6		Yes			Grind	
4627	RED HILL AVENUE	1442	103-532-18	D4	3	1205	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	5		No			Grind	
4622	RED HILL AVENUE	1442	103-532-18	D4	3	1205	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	12		Yes			Replace Slab	
4617	RED HILL AVENUE	1442	103-532-18	D4	3	1205	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	12		Yes	Yes		Grind	
4619	RED HILL AVENUE	1442	103-532-18	D4	3	1205	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	12		Yes			Grind	
4621	RED HILL AVENUE	1442	103-532-18	D4	3	1205	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	12		Yes			Grind	
4625	RED HILL AVENUE	1442	103-532-18	D4	3	1205	Driveway	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
4626	RED HILL AVENUE	1442	103-532-18	D4	3	1205	Sidewalk	PCC	Spalling	1/2" to 1"	5		No			Replace C&G	
11535	RED HILL AVENUE	1451	103-341-22	D4	3	1207	Sidewalk	PCC	Other - Leave Comment	No Displacement			No			Field Assess-Monitor	Only 1 fault on this whole section
11534	RED HILL AVENUE	1451	103-341-22	D4	3	1207	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6053	RED HILL AVENUE	1471	500-082-23	E4	3	1200	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
6052	RED HILL AVENUE	1471	500-082-23	E4	3	1200	Curb/Gutter	PCC	Linear Cracking	1/2" to 1"	2		No			Grind	
6054	RED HILL AVENUE	1471	500-082-23	E4	3	1200	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	8		No			Grind	
6051	RED HILL AVENUE	1471	500-082-23	E4	3	1200	Driveway	PCC	Sidewalk Curb Separation	1/4" to 1/2"	5		No			Grind	
4639	RED HILL AVENUE	1472	103-531-11	D4	3	1205	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Prev grind
4651	RED HILL AVENUE	1472	103-533-09	D4	3	1203	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	Prev grind
4636	RED HILL AVENUE	1472	103-531-11	D4	3	1205	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight displacement
4637	RED HILL AVENUE	1472	103-531-11	D4	3	1205	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight displacement
4638	RED HILL AVENUE	1472	103-531-11	D4	3	1205	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Some spalls
11932	RED HILL AVENUE	1472	103-531-11	D4	3	1205	Curb/Gutter	PCC	Faulting	1/2" to 1"	2		No			Replace C&G	
4635	RED HILL AVENUE	1472	103-531-11	D4	3	1205	Sidewalk	PCC	Faulting	1/2" to 1"	1		No			Ramp	
4650	RED HILL AVENUE	1472	103-533-09	D4	3	1203	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
4652	RED HILL AVENUE	1472	103-533-09	D4	3	1203	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No	Yes		Grind	
4458	RED HILL AVENUE	1472	103-533-09	D4	3	1203	Ramp	PCC	Sidewalk Curb Separation	1/2" to 1"	5		No			Grind	
11931	RED HILL AVENUE	1472	103-531-11	D4	3	1205	Curb/Gutter	PCC	Spalling	1/2" to 1"	2		No			Replace C&G	
11532	RED HILL AVENUE	1481	500-083-08	D4	3	1200	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No		Yes	Grind	
3856	RED HILL AVENUE	1481	500-083-08	D4	3	1200	Cross Gutter	PCC	Linear Cracking	1/4" to 1/2"	8		No			Grind	
6033	RED HILL AVENUE	1482	500-082-15	D4	3	1200	Sidewalk	PCC	Spalling	1/2" to 1"	2		No			Replace C&G	
6032	RED HILL AVENUE	1482	500-082-15	D4	3	1200	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
6133	RED HILL AVENUE	1502	500-051-03	D4	3	1199	Sidewalk	PCC	Divided Slab	1/4" to 1/2"	12		No			Replace Slab(s)	Med
6132	RED HILL AVENUE	1502	500-051-03	D4	3	1199	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Prev fault
4816	RED HILL AVENUE	1502	103-471-38	D4	3	1206	Driveway	AC	Alligator Cracking	1/4" to 1/2"	12		No			AC Patch	
4817	RED HILL AVENUE	1502	103-471-38	D4	3	1206	Sidewalk	AC	Alligator Cracking	No Displacement	30		No			Remove & Replace	
6131	RED HILL AVENUE	1502	500-051-03	D4	3	1199	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
4807	RED HILL AVENUE	1511	103-522-36	D4	3	1204	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
4808	RED HILL AVENUE	1511	103-522-36	D4	3	1204	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
4809	RED HILL AVENUE	1511	103-522-24	D4	3	1204	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
4806	RED HILL AVENUE	1512	103-523-01	D4	3	1202	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
6116	RED HILL AVENUE		500-051-21	E4	3	1199	Driveway	PCC	Divided Slab	1/2" to 1"	16		No			Replace Slab(s)	Med
4653	RED HILL AVENUE		103-533-12	D4	3	1203	Sidewalk	PCC	Linear Cracking	No Displacement	10		No			Joint Seal	Slight displacement
4810	RED HILL AVENUE		999-000-66	D4	3	1204	Driveway	PCC	Corner Break	1/4" to 1/2"	5		No			Grind	
4812	RED HILL AVENUE		999-000-66	D4	3	1204	Driveway	PCC	Corner Break	1/4" to 1/2"	5		No		Yes	Grind	
6114	RED HILL AVENUE		500-051-21	E4	3	1199	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
6117	RED HILL AVENUE		500-051-02	E4	3	1199	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
6120	RED HILL AVENUE		500-051-02	E4	3	1199	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
4811	RED HILL AVENUE		999-000-66	D4	3	1204	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
4654	RED HILL AVENUE		999-000-42	D4	3	1203	Driveway	PCC	Linear Cracking	1/4" to 1/2"	7		No			Grind	
4655	RED HILL AVENUE		999-000-42	D4	3	1203	Driveway	PCC	Linear Cracking	1/4" to 1/2"	7		No			Grind	
4656	RED HILL AVENUE		999-000-42	D4	3	1203	Driveway	PCC	Linear Cracking	1/4" to 1/2"	7		No			Grind	
6118	RED HILL AVENUE		500-051-02	E4	3	1199	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	4		No			Grind	
6119	RED HILL AVENUE		500-051-02	E4	3	1199	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	4		No			Grind	
6121	RED HILL AVENUE		500-051-02	E4	3	1199	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	4		No			Grind	
6122	RED HILL AVENUE		500-051-02	E4	3	1199	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	4		No			Grind	
6123	RED HILL AVENUE		500-051-02	E4	3	1199	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	4		No			Grind	
6124	RED HILL AVENUE		500-051-02	E4	3	1199	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	4		No			Grind	
6125	RED HILL AVENUE		500-051-02	E4	3	1199	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	4		No			Grind	
6126				E4	3	1199	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	4		No			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
6127	RED HILL AVENUE		500-051-02	E4	3	1199	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	4		No			Grind	
6128	RED HILL AVENUE		500-051-02	E4	3	1199	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	4		No			Grind	
6129	RED HILL AVENUE		500-051-02	E4	3	1199	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	4		No			Grind	
6130	RED HILL AVENUE		500-051-02	E4	3	1199	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	4		No			Grind	
6115	RED HILL AVENUE		500-051-21	E4	3	1199	Sidewalk	PCC	Spalling	1/2" to 1"	2		Yes			Replace C&G	
6113	RED HILL AVENUE		500-051-21	E4	3	1199	Sidewalk	PCC	Spalling	1/4" to 1/2"	2		Yes			Grind	
6821	RED MILL CIRCLE	1922	103-421-33	E4	3	1867	Sidewalk	PCC	Faulting	1/2" to 1"	10		No			Ramp	Between sidewalk and driveway
6820	RED MILL CIRCLE	1972	103-421-37	E4	3	1867	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
11502	RIVER FORD ROAD	1781	103-255-06	D4	3	1871	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
11526	RIVER FORD ROAD	1802	103-255-21	D4	3	1871	Sidewalk	PCC	Faulting	1/2" to 1"	4		No			Ramp	Prev grind
11525	RIVER FORD ROAD	1802	103-255-21	D4	3	1871	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
11528	RIVER FORD ROAD	1812	103-255-22	D4	3	1871	Sidewalk	PCC	Corner Break	1/4" to 1/2"	2		No			Grind	
11527	RIVER FORD ROAD	1812	103-255-22	D4	3	1871	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
11501	RIVER FORD ROAD	1821	103-255-02	D4	3	1871	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
11530	RIVER FORD ROAD	1842	103-255-24	D4	3	1871	Sidewalk	PCC	Faulting	1/2" to 1"	10		No			Ramp	Between driveway and sidewalk
11529	RIVER FORD ROAD	1842	103-255-24	D4	3	1871	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
11531	RIVER FORD ROAD	1842	103-255-24	D4	3	1871	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	4		No			Grind	
3701	SAN JUAN STREET	1041	500-171-22	D3	3	1885	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight displacement
3706	SAN JUAN STREET	1042	500-153-18	D3	3	1885	Driveway	PCC	Divided Slab	1/2" to 1"	6		No			Replace Slab(s)	
3705	SAN JUAN STREET	1042	500-153-18	D3	3	1885	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
3707	SAN JUAN STREET	1042	500-153-18	D3	3	1885	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
3708	SAN JUAN STREET	1052	500-153-17	D3	3	1885	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Prev grind
3699	SAN JUAN STREET	1061	500-171-23	D3	3	1885	Driveway	PCC	Spalling	1" to 2"	1		No			Patch	
3700	SAN JUAN STREET	1071	500-171-24	D3	3	1885	Sidewalk	PCC	Punchout	1/4" to 1/2"	5		No			Replace Slab	
3709	SAN JUAN STREET	1072	500-154-26	D3	3	1885	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
3710	SAN JUAN STREET	1072	500-154-27	D3	3	1885	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
3697	SAN JUAN STREET	1081	500-171-25	D3	3	1885	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
3698	SAN JUAN STREET	1081	500-171-25	D3	3	1885	Driveway	PCC	Linear Cracking	No Displacement	10		No			Joint Seal	
3693	SAN JUAN STREET	1151	500-171-27	D3	3	1885	Curb/Gutter	PCC	Faulting	1/4" to 1/2"	0.5		No		Yes	Grind C&G	
3695	SAN JUAN STREET	1151	500-171-27	D3	3	1885	Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	4		No		Yes	Grind	
3694	SAN JUAN STREET	1151	500-171-27	D3	3	1885	Sidewalk	PCC	Spalling	1" to 2"	0.5		No		Yes	Patch	
3696	SAN JUAN STREET	1151	500-171-27	D3	3	1885	Sidewalk	PCC	Spalling	1" to 2"	1		No		Yes	Patch	
3692	SAN JUAN STREET	1151	500-171-27	D3	3	1885	Sidewalk	PCC	Spalling	1/2" to 1"	0.5		No		Yes	Replace C&G	
3768	SAN JUAN STREET	1171	500-141-02	D3	3	1885	Sidewalk	PCC	Faulting	1/2" to 1"	5		Yes		Yes	Ramp	Prev grind
3764	SAN JUAN STREET	1171	500-141-02	D3	3	1885	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No		Yes	Grind	
3765	SAN JUAN STREET	1171	500-141-02	D3	3	1885	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes		Yes	Grind	
3762	SAN JUAN STREET	1171	500-141-02	D3	3	1885	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	4		Yes		Yes	Grind	
3763	SAN JUAN STREET	1171	500-141-02	D3	3	1885	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	4		No		Yes	Grind	
3766	SAN JUAN STREET	1171	500-141-02	D3	3	1885	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	5		Yes		Yes	Grind	
3767	SAN JUAN STREET	1171	500-141-02	D3	3	1885	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	8		Yes		Yes	Grind	
3761	SAN JUAN STREET	1171	500-141-24	D3	3	1885	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	6		No		Yes	Grind	
3760	SAN JUAN STREET	1171	500-141-24	D3	3	1885	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	6	1"	No		Yes	Grind	
3814	SAN JUAN STREET	1341	500-091-09	D3	3	1885	Driveway	PCC	Divided Slab	1/4" to 1/2"	15		No			Replace Slab(s)	Med/high
3811	SAN JUAN STREET	1341	500-091-09	D4	3	1885	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
3813	SAN JUAN STREET	1341	500-091-09	D4	3	1885	Sidewalk	PCC	Spalling	1/2" to 1"	6		No			Replace C&G	Prev grind
3817	SAN JUAN STREET	1341	500-091-09	D3	3	1885	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight displacement
3812	SAN JUAN STREET	1341	500-091-09	D4	3	1885	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
3816	SAN JUAN STREET	1341	500-091-09	D3	3	1885	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No			Grind	
3808	SAN JUAN STREET	1341	500-091-09	D4	3	1885	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	5		No			Grind	
3815	SAN JUAN STREET	1341	500-091-09	D3	3	1885	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
3810	SAN JUAN STREET	1341	500-091-09	D4	3	1885	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	10		No		Yes	Grind	
3809	SAN JUAN STREET	1341	500-091-09	D4	3	1885	Sidewalk	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
1331	SAN JUAN STREET	13601	103-261-01	E4	3	1887	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No		Yes	Grind	
1332	SAN JUAN STREET	13601	103-261-01	E4	3	1887	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No		Yes	Grind	
1333	SAN JUAN STREET	13601	103-261-01	E4	3	1887	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No		Yes	Grind	
1334	SAN JUAN STREET	13601	103-261-01	E4	3	1887	Driveway	PCC	Linear Cracking	1/4" to 1/2"	10		No		Yes	Grind	
1338	SAN JUAN STREET	13731	103-743-01	E4	3	1886	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No		Yes	Grind	
3689	SAN JUAN STREET	13731	500-091-02	D3	3	1885	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
1335	SAN JUAN STREET	13731	103-742-39	E4	3	1887	Sidewalk	PCC	Spalling	1/4" to 1/2"	0.5		No			Grind	
3666	SAN JUAN STREET	13732	500-091-08	D3	3	1885	Sidewalk	PCC	Faulting	1/4" to 1/2"	6		Yes		Yes	Grind	
1336	SAN JUAN STREET	13732	103-742-51	E4	3	1887	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
1337	SAN JUAN STREET	13732	103-742-51	E4	3	1887	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6509	SAN JUAN STREET	13732	103-742-51	E4	3	1887	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
1365				E4	3	1886	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	5		No		Yes	Grind	Running parallel with sidewalk

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
1	SAN JUAN STREET	13742	500-022-07	E4	3	1886	Sidewalk	PCC	Bumps and Sags	1/4" to 1/2"			No		Yes	Field Assess-Monitor	
1364	SAN JUAN STREET	13742	500-022-07	E4	3	1886	Sidewalk	PCC	Faulting	1/4" to 1/2"	4.5		No		Yes	Grind	
3794	SAN JUAN STREET	13751	500-141-09	E4	3	1885	Sidewalk	PCC	Faulting	1/2" to 1"	3		No		Yes	Ramp	Prev grind
3795	SAN JUAN STREET	13751	500-141-09	E4	3	1885	Curb/Gutter	PCC	Faulting	Over 2"	1		No		Yes	Replace Curb	
3785	SAN JUAN STREET	13751	500-141-09	E4	3	1885	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No		Yes	Grind	
3791	SAN JUAN STREET	13751	500-141-09	E4	3	1885	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No		Yes	Grind	
3792	SAN JUAN STREET	13751	500-141-09	E4	3	1885	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No		Yes	Grind	
3793	SAN JUAN STREET	13751	500-141-09	E4	3	1885	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No		Yes	Grind	
3787	SAN JUAN STREET	13751	500-141-09	E4	3	1885	Driveway	PCC	Linear Cracking	No Displacement	7		No		Yes	Joint Seal	
3788	SAN JUAN STREET	13751	500-141-09	E4	3	1885	Driveway	PCC	Linear Cracking	No Displacement	7		No		Yes	Joint Seal	
3789	SAN JUAN STREET	13751	500-141-09	E4	3	1885	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No		Yes	Grind	
3790	SAN JUAN STREET	13751	500-141-09	E4	3	1885	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No		Yes	Grind	
3786	SAN JUAN STREET	13751	500-141-09	E4	3	1885	Sidewalk	PCC	Spalling	1/4" to 1/2"	12		No		Yes	Grind	
3704	SAN JUAN STREET	13762	500-153-19	D3	3	1885	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	5		No			Grind	Prev grind
3703	SAN JUAN STREET	13762	500-153-19	D3	3	1885	Driveway	PCC	Linear Cracking	1/4" to 1/2"	7		No			Grind	
3702	SAN JUAN STREET	13762	500-153-19	D3	3	1885	Driveway	PCC	Linear Cracking	No Displacement	7		No			Joint Seal	
3774	SAN JUAN STREET	1380	500-141-05	E4	3	1885	Driveway	PCC	Linear Cracking	1/4" to 1/2"	5		No			Grind	
1433	SAN JUAN STREET	13802	500-032-01	E4	3	1886	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
1434	SAN JUAN STREET	13802	500-032-01	E4	3	1886	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
1435	SAN JUAN STREET	13802	500-032-01	E4	3	1886	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
1368	SAN JUAN STREET	13822	500-022-12	E4	3	1886	Driveway	PCC	Divided Slab	1/4" to 1/2"			No		Yes	Replace Slab	
1366	SAN JUAN STREET	13822	500-022-12	E4	3	1886	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No		Yes	Grind	
1367	SAN JUAN STREET	13822	500-022-12	E4	3	1886	Sidewalk	PCC	Faulting	1/4" to 1/2"	4.5		No		Yes	Grind	
1374	SAN JUAN STREET	13841	500-031-01	E4	3	1886	Sidewalk	PCC	Faulting	1/2" to 1"	4.5		No			Ramp	Prev grind
1369	SAN JUAN STREET	13841	500-031-01	E4	3	1886	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No		Yes	Grind	
1372	SAN JUAN STREET	13841	500-031-01	E4	3	1886	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
1373	SAN JUAN STREET	13841	500-031-01	E4	3	1886	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
1375	SAN JUAN STREET	13841	500-031-01	E4	3	1886	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
1376	SAN JUAN STREET	13841	500-031-01	E4	3	1886	Sidewalk	PCC	Faulting	1/4" to 1/2"	4.5		No			Grind	
1377	SAN JUAN STREET	13841	500-031-01	E4	3	1886	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
1378	SAN JUAN STREET	13841	500-031-01	E4	3	1886	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
1370	SAN JUAN STREET	13841	500-031-01	E4	3	1886	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	10		No			Grind	
1371	SAN JUAN STREET	13841	500-031-01	E4	3	1886	Sidewalk	PCC	Linear Cracking	No Displacement	10		No			Joint Seal	
3777	SAN JUAN STREET	1390	500-141-06	E4	3	1885	Sidewalk	PCC	Faulting	1/2" to 1"	7		No			Ramp	
3776	SAN JUAN STREET	1390	500-141-06	E4	3	1885	Driveway	PCC	Linear Cracking	1/4" to 1/2"	5		No			Grind	
3775	SAN JUAN STREET	1390	500-141-06	E4	3	1885	Driveway	PCC	Sidewalk Curb Separation	1" to 2"	7		No			Replace Driveway	
3780	SAN JUAN STREET	1392	500-141-07	E4	3	1885	Driveway	PCC	Divided Slab	1/4" to 1/2"	8		No			Replace Slab(s)	
3782	SAN JUAN STREET	1392	500-141-07	E4	3	1885	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
3778	SAN JUAN STREET	1392	500-141-07	E4	3	1885	Curb/Gutter	PCC	Linear Cracking	1/4" to 1/2"	8		No			Grind	
3779	SAN JUAN STREET	1392	500-141-07	E4	3	1885	Curb/Gutter	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
3807	SAN JUAN STREET	1401	500-081-24	E4	3	1885	Driveway	PCC	Spalling	1" to 2"	2		No			Patch	
3805	SAN JUAN STREET	1411	500-081-23	E4	3	1885	Sidewalk	PCC	Divided Slab	1/4" to 1/2"			No			Replace Slab(s)	High
3806	SAN JUAN STREET	1411	500-081-23	E4	3	1885	Sidewalk	PCC	Divided Slab	1/4" to 1/2"			No			Replace Slab(s)	Med
3803	SAN JUAN STREET	1431	500-082-01	E4	3	1885	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
3784	SAN JUAN STREET	1432	500-141-08	E4	3	1885	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No		Yes	Grind	Prev grind
3783	SAN JUAN STREET	1432	500-141-08	E4	3	1885	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
3781	SAN JUAN STREET	1432	500-141-08	E4	3	1885	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	9		No			Grind	
3802	SAN JUAN STREET	1441	500-082-02	E4	3	1885	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	9		No		Yes	Grind	
3797	SAN JUAN STREET	1461	500-082-24	E4	3	1885	Sidewalk	PCC	Corner Break	1/4" to 1/2"	1		No			Grind	
3800	SAN JUAN STREET	1461	500-082-24	E4	3	1885	Driveway	PCC	Linear Cracking	No Displacement	8		No			Joint Seal	
3799	SAN JUAN STREET	1461	500-082-24	E4	3	1885	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
3801	SAN JUAN STREET	1461	500-082-24	E4	3	1885	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	14		No			Grind	
3798	SAN JUAN STREET	1471	500-082-23	E4	3	1885	Driveway	PCC	Linear Cracking	1/4" to 1/2"	5		No			Grind	
1343	SAN JUAN STREET	1701	103-731-01	E4	3	1886	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No		Yes	Grind	Prev grind
1347	SAN JUAN STREET	1701	103-731-01	E4	3	1886	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No		Yes	Grind	Prev grind
1348	SAN JUAN STREET	1701	103-731-01	E4	3	1886	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes		Yes	Grind	Prev grind
1351	SAN JUAN STREET	1701	103-731-01	E4	3	1886	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No		Yes	Grind	Prev grind
1339	SAN JUAN STREET	1701	103-731-01	E4	3	1886	Sidewalk	PCC	Faulting	1/2" to 1"	2		No		Yes	Ramp	Prev grinded. Some fault 1/4
1350	SAN JUAN STREET	1701	103-731-01	E4	3	1886	Sidewalk	PCC	Corner Break	1/4" to 1/2"	3		No		Yes	Grind	
1340	SAN JUAN STREET	1701	103-731-01	E4	3	1886	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No		Yes	Grind	
1341	SAN JUAN STREET	1701	103-731-01	E4	3	1886	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No		Yes	Grind	
1344	SAN JUAN STREET	1701	103-731-01	E4	3	1886	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No		Yes	Grind	
1345	SAN JUAN STREET	1701	103-731-01	E4	3	1886	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No		Yes	Grind	
1342		.		E4	3	1886	Driveway	PCC	Linear Cracking	1/4" to 1/2"	15		No		Yes	Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
1346	SAN JUAN STREET	1701	103-731-01	E4	3	1886	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	2		No		Yes	Grind	
1349	SAN JUAN STREET	1701	103-731-01	E4	3	1886	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	1		No		Yes	Grind	
1436	SAN JUAN STREET	1762	500-032-02	E4	3	1887	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
1437	SAN JUAN STREET	1762	500-032-02	E4	3	1887	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
1438	SAN JUAN STREET	1792	500-032-03	E4	3	1887	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No		Yes	Grind	
1440	SAN JUAN STREET	1800	500-032-05	E4	3	1887	Driveway	PCC	Divided Slab	1/4" to 1/2"			No		Yes	Replace Slab	Divided slabs throughout most of driveway
1439	SAN JUAN STREET	1800	500-032-05	E4	3	1887	Sidewalk	PCC	Faulting	1/4" to 1/2"	6		No		Yes	Grind	Prev grind
1441	SAN JUAN STREET	1800	500-032-05	E4	3	1887	Sidewalk	PCC	Corner Break	1/4" to 1/2"	4		No		Yes	Grind	
1442	SAN JUAN STREET	1800	500-032-05	E4	3	1887	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No		Yes	Grind	
1443	SAN JUAN STREET	1852	500-032-04	E4	3	1887	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No		Yes	Grind	
1363	SAN JUAN STREET		500-051-21	E4	3	1886	Curb/Gutter	PCC	Divided Slab	No Displacement			No			Replace Slab	Gutter has lots of cracks
3771	SAN JUAN STREET		500-141-18	D3	3	1885	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	10		Yes		Yes	Replace Slab	Prev grind
3769	SAN JUAN STREET		500-141-18	D3	3	1885	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	5		Yes		Yes	Grind	Prev grind
3770	SAN JUAN STREET		500-141-18	D3	3	1885	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	5		Yes		Yes	Grind	Prev grind
3772	SAN JUAN STREET		500-141-18	D3	3	1885	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	6		Yes		Yes	Grind	Prev grind
1353	SAN JUAN STREET		500-051-21	E4	3	1886	Sidewalk	PCC	Faulting	1/2" to 1"	2		Yes			Ramp	Prev grind
1359	SAN JUAN STREET		500-051-21	E4	3	1886	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
1445	SAN JUAN STREET		500-074-11	E4	3	1887	Driveway	PCC	Faulting	1/4" to 1/2"	8		No			Grind Driveway	
1352	SAN JUAN STREET		500-051-21	E4	3	1886	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
1354	SAN JUAN STREET		500-051-21	E4	3	1886	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
1355	SAN JUAN STREET		500-051-21	E4	3	1886	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
1356	SAN JUAN STREET		500-051-21	E4	3	1886	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
1357	SAN JUAN STREET		500-051-21	E4	3	1886	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
1361	SAN JUAN STREET		500-051-21	E4	3	1886	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
1444	SAN JUAN STREET		500-074-11	E4	3	1887	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
1446	SAN JUAN STREET		500-074-11	E4	3	1887	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
1447	SAN JUAN STREET		500-074-11	E4	3	1887	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
1448	SAN JUAN STREET		500-074-11	E4	3	1887	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
1449	SAN JUAN STREET		500-074-11	E4	3	1887	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
1450	SAN JUAN STREET		500-074-11	E4	3	1887	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
1451	SAN JUAN STREET		500-074-11	E4	3	1887	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
1452	SAN JUAN STREET		500-074-11	E4	3	1887	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
1453	SAN JUAN STREET		500-074-11	E4	3	1887	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
1358	SAN JUAN STREET		500-051-21	E4	3	1886	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4.5		Yes			Grind	
1360	SAN JUAN STREET		500-051-21	E4	3	1886	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	2		No			Grind	
1362	SAN JUAN STREET		500-051-21	E4	3	1886	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	0.5		No			Grind	
3691	SAN JUAN STREET		500-091-19	D3	3	1885	Driveway	PCC	Sidewalk Curb Separation	1" to 2"	9		No		Yes	Replace Driveway	
3690	SAN JUAN STREET		500-091-19	D3	3	1885	Curb/Gutter	PCC	Spalling	1" to 2"	1		No		Yes	Patch	
3773	SAN JUAN STREET		500-141-16	E4	3	1885	Curb/Gutter	PCC	Spalling	1/4" to 1/2"	1		No		Yes	Grind	
6960	SAYBROOK LANE	13471	103-253-01	E4	3	1895	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
6961	SAYBROOK LANE	13471	103-253-01	E4	3	1895	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
6959	SAYBROOK LANE	1692	103-332-30	E4	3	1895	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
6993	SAYBROOK LANE	1701	103-333-03	E4	3	1895	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
6994	SAYBROOK LANE	1701	103-333-03	E4	3	1895	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	12		No			Grind	
6992	SAYBROOK LANE	1731	103-333-02	E4	3	1895	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
6991	SAYBROOK LANE	1751	103-254-01	E4	3	1895	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
6989	SAYBROOK LANE	1751	103-254-01	E4	3	1895	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
6990	SAYBROOK LANE	1751	103-254-01	E4	3	1895	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	2		No			Grind	
11945	SILVER BIRCH DRIVE	13122	103-531-33	D4	3	1912	Curb/Gutter	PCC	Linear Cracking	1/4" to 1/2"	2		No			Grind	
11946	SILVER BIRCH DRIVE	13122	103-531-33	D4	3	1912	Driveway	PCC	Sidewalk Curb Separation	1/4" to 1/2"	4		No			Grind	
11947	SILVER BIRCH DRIVE	13131	103-531-32	D4	3	1912	Curb/Gutter	PCC	Linear Cracking	1/4" to 1/2"	2		No			Grind	
11948	SILVER BIRCH DRIVE	13131	103-531-32	D4	3	1912	Curb/Gutter	PCC	Linear Cracking	1/4" to 1/2"	2		No			Grind	
11949	SILVER BIRCH DRIVE	13131	103-531-32	D4	3	1912	Curb/Gutter	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
4475	SILVER BIRCH DRIVE	13132	103-531-34	D4	3	1912	Driveway	PCC	Faulting	1/2" to 1"	12		No			Grind Driveway	
11944	SILVER BIRCH DRIVE	13132	103-531-34	D4	3	1912	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
11950	SILVER BIRCH DRIVE	13141	103-531-31	D4	3	1912	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
4474	SILVER BIRCH DRIVE	13142	103-531-35	D4	3	1912	Driveway	PCC	Faulting	1/2" to 1"	6		No			Grind Driveway	
4473	SILVER BIRCH DRIVE	13142	103-531-35	D4	3	1912	Driveway	PCC	Linear Cracking	1/4" to 1/2"	6		No			Grind	
4471	SILVER BIRCH DRIVE	13142	103-531-35	D4	3	1912	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
4472	SILVER BIRCH DRIVE	13142	103-531-35	D4	3	1912	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
4477	SILVER BIRCH DRIVE	13142	103-531-35	D4	3	1912	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
4478	SILVER BIRCH DRIVE	13142	103-531-35	D4	3	1912	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
4476	SILVER BIRCH DRIVE	13142	103-531-35	D4	3	1912	Curb/Gutter	PCC	Spalling	1" to 2"	1		No			Patch	
4482			)	D4	3	1912	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
4479	SILVER BIRCH DRIVE	13151	103-531-30	D4	3	1912	Driveway	PCC	Faulting	1" to 2"	1		No			Replace Driveway	
4480	SILVER BIRCH DRIVE	13151	103-531-30	D4	3	1912	Driveway	PCC	Faulting	1" to 2"	3		No			Replace Driveway	
4481	SILVER BIRCH DRIVE	13151	103-531-30	D4	3	1912	Driveway	PCC	Linear Cracking	1/4" to 1/2"	6		No			Grind	
4483	SILVER BIRCH DRIVE	13151	103-531-30	D4	3	1912	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
11951	SILVER BIRCH DRIVE	13151	103-531-30	D4	3	1912	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
4470	SILVER BIRCH DRIVE	13152	103-531-36	D4	3	1912	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
4485	SILVER BIRCH DRIVE	13161	103-531-29	D4	3	1912	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
4484	SILVER BIRCH DRIVE	13161	103-531-29	D4	3	1912	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
4468	SILVER BIRCH DRIVE	13162	103-531-37	D4	3	1912	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	Prev grind
4466	SILVER BIRCH DRIVE	13162	103-531-37	D4	3	1912	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	Prev grind
4467	SILVER BIRCH DRIVE	13162	103-531-37	D4	3	1912	Sidewalk	PCC	Linear Cracking	No Displacement	4		Yes			Joint Seal	Slight displacement
4469	SILVER BIRCH DRIVE	13162	103-531-37	D4	3	1912	Sidewalk	PCC	Linear Cracking	No Displacement	4		Yes			Joint Seal	Slight displacement
11943	SILVER BIRCH DRIVE	13162	103-531-37	D4	3	1912	Sidewalk	PCC	Linear Cracking	No Displacement	4		Yes			Joint Seal	Slight displacement
11952	SILVER BIRCH DRIVE	13171	103-531-28	D4	3	1912	Curb/Gutter	PCC	Linear Cracking	1/4" to 1/2"	2		No			Grind	
4486	SILVER BIRCH DRIVE	13171	103-531-28	D4	3	1912	Sidewalk	PCC	Spalling	1" to 2"	1		No			Patch	
11941	SILVER BIRCH DRIVE	13172	103-531-38	D4	3	1912	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
11942	SILVER BIRCH DRIVE	13172	103-531-38	D4	3	1912	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
4487	SILVER BIRCH DRIVE	13191	103-531-27	D4	3	1912	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Prev grind
11953	SILVER BIRCH DRIVE	13191	103-531-27	D4	3	1912	Curb/Gutter	PCC	Linear Cracking	1/4" to 1/2"	1.5		No			Grind	
11954	SILVER BIRCH DRIVE	13191	103-531-27	D4	3	1912	Curb/Gutter	PCC	Linear Cracking	1/4" to 1/2"	1.5		No			Grind	
4489	SILVER BIRCH DRIVE	13191	103-531-27	D4	3	1912	Driveway	PCC	Linear Cracking	1/4" to 1/2"	7		No			Grind	
4488	SILVER BIRCH DRIVE	13191	103-531-27	D4	3	1912	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
4465	SILVER BIRCH DRIVE	13192	103-531-39	D4	3	1912	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	Prev grind
4464	SILVER BIRCH DRIVE	13192	103-531-39	D4	3	1912	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
4463	SILVER BIRCH DRIVE	13192	103-531-39	D4	3	1912	Driveway	PCC	Spalling	1" to 2"	1		No			Patch	
4490	SILVER BIRCH DRIVE	13201	103-531-26	D4	3	1912	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
4462	SILVER BIRCH DRIVE	13202	103-531-40	D4	3	1912	Driveway	PCC	Spalling	1" to 2"	1		No			Patch	
11940	SILVER BIRCH DRIVE	13202	103-531-40	D4	3	1912	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
6938	STONEHENGE DRIVE	13312	103-332-48	D4	3	1922	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
7006	STONEHENGE DRIVE	13381	103-254-05	E4	3	1922	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
7007	STONEHENGE DRIVE	13381	103-254-05	E4	3	1922	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7008	STONEHENGE DRIVE	13392	103-252-06	E4	3	1922	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
7009	STONEHENGE DRIVE	13392	103-252-06	E4	3	1922	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
7010	STONEHENGE DRIVE	13392	103-252-06	E4	3	1922	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	3		No			Grind	
7011	STONEHENGE DRIVE	13411	103-252-07	E4	3	1922	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
7012	STONEHENGE DRIVE	13411	103-252-07	E4	3	1922	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
7035	STONEHENGE DRIVE	13422	103-252-15	E4	3	1922	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	Prev grind
7036	STONEHENGE DRIVE	13422	103-252-15	E4	3	1922	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
7037	STONEHENGE DRIVE	13422	103-252-15	E4	3	1922	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
7039	STONEHENGE DRIVE	13441	103-252-16	E4	3	1922	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
7040	STONEHENGE DRIVE	13441	103-252-16	E4	3	1922	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
7038	STONEHENGE DRIVE	13441	103-252-16	E4	3	1922	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	1		No			Grind	
7041	STONEHENGE DRIVE	13451	103-252-17	E4	3	1922	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7042	STONEHENGE DRIVE	13451	103-252-17	E4	3	1922	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
6841	STONEHENGE DRIVE	13471	103-252-18	E4	3	1922	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		No			Ramp	
7001	STONEHENGE DRIVE	1704	103-333-15	D4	3	1922	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6937	STONEHENGE DRIVE	1705	103-332-50	D4	3	1922	Driveway	PCC	Faulting	1/2" to 1"	2.5		No			Grind Driveway	Running parallel with sidewalk
6935	STONEHENGE DRIVE	1707	103-332-51	D4	3	1922	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
6936	STONEHENGE DRIVE	1707	103-332-51	D4	3	1922	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6934	STONEHENGE DRIVE	1709	103-332-52	D4	3	1922	Driveway	PCC	Sidewalk Curb Separation	1/4" to 1/2"	5		No			Grind	Between curb and driveway
6932	STONEHENGE DRIVE	1711	103-332-53	D4	3	1922	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
6931	STONEHENGE DRIVE	1711	103-332-53	D4	3	1922	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	2.5		No			Grind	
6933	STONEHENGE DRIVE	1711	103-332-53	D4	3	1922	Sidewalk	PCC	Spalling	1/4" to 1/2"	1.5		No			Grind	
7003	STONEHENGE DRIVE	1722	103-254-07	D4	3	1922	Sidewalk	PCC	Faulting	1/2" to 1"	4		No			Ramp	Prev grind
7002	STONEHENGE DRIVE	1722	103-254-07	D4	3	1922	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	Prev grind
6929	STONEHENGE DRIVE	1731	103-251-14	D4	3	1922	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	Prev grind
6930	STONEHENGE DRIVE	1731	103-251-14	D4	3	1922	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	2		No			Grind	Prev grind
7004	STONEHENGE DRIVE	1732	103-254-06	D4	3	1922	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
7005	STONEHENGE DRIVE	1732	103-254-06	E4	3	1922	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
6928	STONEHENGE DRIVE	1741	103-251-15	E4	3	1922	Driveway	PCC	Sidewalk Curb Separation	1/4" to 1/2"	4		No			Grind	Between curb and driveway
6926	STONEHENGE DRIVE	1751	103-251-16	E4	3	1922	Sidewalk	PCC	Faulting	1/2" to 1"	3		No			Ramp	Running parallel to sidewalk
6925	STONEHENGE DRIVE	1751	103-251-16	E4	3	1922	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
6927	STONEHENGE DRIVE	1751	103-251-16	E4	3	1922	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
6923				E4	3	1922	Driveway	PCC	Sidewalk Curb Separation	1/4" to 1/2"	8		No			Grind	Between curb and driveway

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
6922	STONEHENGE DRIVE	1771	103-251-17	E4	3	1922	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
6924	STONEHENGE DRIVE	1771	103-251-17	E4	3	1922	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6921	STONEHENGE DRIVE	1791	103-251-18	E4	3	1922	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
6919	STONEHENGE DRIVE	1791	103-251-18	E4	3	1922	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
6920	STONEHENGE DRIVE	1791	103-251-18	E4	3	1922	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
6916	STONEHENGE DRIVE	1811	103-251-19	E4	3	1922	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	Prev grind
6918	STONEHENGE DRIVE	1811	103-251-19	E4	3	1922	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	Prev grind
6915	STONEHENGE DRIVE	1811	103-251-19	E4	3	1922	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		Yes			Grind	
6917	STONEHENGE DRIVE	1811	103-251-19	E4	3	1922	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
6913	STONEHENGE DRIVE	1821	103-251-20	E4	3	1922	Sidewalk	PCC	Corner Break	1/4" to 1/2"	1		No			Grind	
6911	STONEHENGE DRIVE	1821	103-251-20	E4	3	1922	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6912	STONEHENGE DRIVE	1821	103-251-20	E4	3	1922	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
6914	STONEHENGE DRIVE	1821	103-251-20	E4	3	1922	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
6907	STONEHENGE DRIVE	1831	103-421-30	E4	3	1922	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	Prev grind
6909	STONEHENGE DRIVE	1831	103-421-30	E4	3	1922	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
6908	STONEHENGE DRIVE	1831	103-421-30	E4	3	1922	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
6910	STONEHENGE DRIVE	1831	103-421-30	E4	3	1922	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	3		No			Grind	
6905	STONEHENGE DRIVE	1841	103-421-29	E4	3	1922	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	Prev grind
6906	STONEHENGE DRIVE	1841	103-421-29	E4	3	1922	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
6904	STONEHENGE DRIVE	1841	103-421-29	E4	3	1922	Sidewalk	PCC	Faulting	1/2" to 1"	1		No			Ramp	
6903	STONEHENGE DRIVE	1851	103-421-28	E4	3	1922	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		Yes			Grind	Prev grind
6901	STONEHENGE DRIVE	1861	103-421-27	E4	3	1922	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6902	STONEHENGE DRIVE	1861	103-421-27	E4	3	1922	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
6897	STONEHENGE DRIVE	1871	103-421-26	E4	3	1922	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	Prev grind
6899	STONEHENGE DRIVE	1871	103-421-26	E4	3	1922	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	Prev grind
6900	STONEHENGE DRIVE	1871	103-421-26	E4	3	1922	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
6898	STONEHENGE DRIVE	1871	103-421-26	E4	3	1922	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6208	TIKI CIRCLE	1331	500-122-21	D4	3	1934	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
6207	TIKI CIRCLE	1331	500-122-21	D4	3	1934	Sidewalk	PCC	Linear Cracking	No Displacement	3		Yes			Joint Seal	Prev grind
6209	TIKI CIRCLE	1332	500-122-22	D4	3	1934	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
6206	TIKI CIRCLE	13431	500-122-20	D4	3	1934	Sidewalk	PCC	Divided Slab	No Displacement	14		No			Replace Slab(s)	Low
6204	TIKI CIRCLE	13431	500-122-20	D4	3	1934	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
6205	TIKI CIRCLE	13431	500-122-20	D4	3	1934	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	8		No			Grind	
5943	TIKI LANE	1131	500-131-22	D4	3	1935	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
5944	TIKI LANE	1131	500-131-22	D4	3	1935	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
5946	TIKI LANE	1131	500-131-22	D4	3	1935	Sidewalk	PCC	Buckled Slab	1" to 2"	10		Yes			Replace Slab(s)	Slabs raised
5945	TIKI LANE	1131	500-131-22	D4	3	1935	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight displacement
5941	TIKI LANE	1151	500-131-23	D4	3	1935	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
5983	TIKI LANE	1152	500-132-01	D4	3	1935	Sidewalk	PCC	Linear Cracking	No Displacement	10		No			Joint Seal	Slight displacement
5939	TIKI LANE	1161	500-131-24	D4	3	1935	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
5981	TIKI LANE	1162	500-132-02	D4	3	1935	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
5937	TIKI LANE	1191	500-131-26	D4	3	1935	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
5938	TIKI LANE	1191	500-131-26	D4	3	1935	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
5980	TIKI LANE	1202	500-132-04	D4	3	1935	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
1431	TUSTIN EAST DRIVE	13802	500-032-01	E4	3	1938	Driveway	PCC	Divided Slab	No Displacement			No			Replace Slab	
1425	TUSTIN EAST DRIVE	13802	500-032-01	E4	3	1938	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
1426	TUSTIN EAST DRIVE	13802	500-032-01	E4	3	1938	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
1427	TUSTIN EAST DRIVE	13802	500-032-01	E4	3	1938	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
1428	TUSTIN EAST DRIVE	13802	500-032-01	E4	3	1938	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
1429	TUSTIN EAST DRIVE	13802	500-032-01	E4	3	1938	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
1430	TUSTIN EAST DRIVE	13802	500-032-01	E4	3	1938	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
1432	TUSTIN EAST DRIVE	13802	500-032-01	E4	3	1938	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
1424	TUSTIN EAST DRIVE	13802	500-032-01	E4	3	1938	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	10		No			Grind	
1380	TUSTIN EAST DRIVE	13841	500-041-01	E4	3	1938	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
1381	TUSTIN EAST DRIVE	13841	500-041-01	E4	3	1938	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
1379	TUSTIN EAST DRIVE	13841	500-031-01	E4	3	1938	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
1382	TUSTIN EAST DRIVE	13881	500-041-07	E4	3	1938	Sidewalk	PCC	Faulting	1/4" to 1/2"	6		No			Grind	Running parallel with sidewalk
1383	TUSTIN EAST DRIVE	13881	500-041-07	E4	3	1938	Driveway	PCC	Divided Slab	No Displacement			No			Replace Slab	
1384	TUSTIN EAST DRIVE	13881	500-041-07	E4	3	1938	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
1385	TUSTIN EAST DRIVE	13881	500-041-07	E4	3	1938	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
1421	TUSTIN EAST DRIVE	13882	500-032-08	E4	3	1938	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
1422	TUSTIN EAST DRIVE	13882	500-032-08	E4	3	1938	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
1423	TUSTIN EAST DRIVE	13882	500-032-08	E4	3	1938	Sidewalk	PCC	Linear Cracking	No Displacement	20	4"	No			Joint Seal	
1418				E4	3	1938	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
1419	TUSTIN EAST DRIVE	13922	500-042-01	E4	3	1938	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
1420	TUSTIN EAST DRIVE	13922	500-042-01	E4	3	1938	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
3876	UTT DRIVE	1321	500-093-20	D4	3	1944	Driveway	PCC	Sidewalk Curb Separation	1/2" to 1"	22		No			Replace Driveway	
3927	UTT DRIVE	1341	500-091-09	D4	3	1943	Driveway	PCC	Faulting	1/4" to 1/2"	6		No			Grind Driveway	
3926	UTT DRIVE	1341	500-091-09	D4	3	1943	Driveway	PCC	Linear Cracking	1/4" to 1/2"	10		No			Grind	
3925	UTT DRIVE	1341	500-091-09	D4	3	1943	Driveway	PCC	Linear Cracking	No Displacement	10		No			Joint Seal	
3928	UTT DRIVE	1341	500-091-09	D4	3	1943	Sidewalk	PCC	Punchout	1/4" to 1/2"	7	4'	No			Replace Slab(s)	
3929	UTT DRIVE	1341	500-091-09	D4	3	1943	Sidewalk	PCC	Punchout	1/4" to 1/2"	4	4'	No			Replace Slab	
3930	UTT DRIVE	1341	500-091-09	D4	3	1943	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	5		No			Grind	
3924	UTT DRIVE	1352	500-091-10	D4	3	1943	Driveway	PCC	Linear Cracking	No Displacement	6		No			Joint Seal	
3873	UTT DRIVE	13522	500-094-04	D4	3	1944	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
3874	UTT DRIVE	13522	500-094-04	D4	3	1944	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
3872	UTT DRIVE	13522	500-094-04	D4	3	1944	Driveway	PCC	Spalling	1/2" to 1"	2		No			Replace C&G	
3871	UTT DRIVE	13572	500-094-01	D4	3	1944	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
3923	UTT DRIVE	13611	500-092-12	D4	3	1943	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Small spall
3922	UTT DRIVE	1362	500-092-11	D4	3	1943	Driveway	PCC	Linear Cracking	No Displacement	6		No			Joint Seal	
3818	UTT DRIVE	13622	500-081-09	D4	3	1943	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight displacement
3819	UTT DRIVE	13622	500-081-09	D4	3	1943	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
3932	UTT DRIVE	13702	500-081-03	D4	3	1943	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
3931	UTT DRIVE	1381	500-081-01	D4	3	1943	Sidewalk	PCC	Faulting	1" to 2"	2		No			Replace Slab	Util cover
3821	UTT DRIVE	1382	500-081-11	D4	3	1943	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
3820	UTT DRIVE	1382	500-081-11	D4	3	1943	Driveway	PCC	Linear Cracking	No Displacement	10		No			Joint Seal	
3720	WALNUT STREET	1041	500-153-05	D3	3	1955	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
3717	WALNUT STREET	1081	500-153-08	D3	3	1955	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
3726	WALNUT STREET	1092	500-152-17	D3	3	1955	Sidewalk	PCC	Divided Slab	No Displacement			No			Replace Slab	Low
3727	WALNUT STREET	1092	500-152-17	D3	3	1955	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight displacement
3716	WALNUT STREET	1101	500-153-10	D3	3	1955	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
3721	WALNUT STREET	13812	500-153-20	D3	3	1955	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
3723	WALNUT STREET	13842	500-152-28	D3	3	1955	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
3722	WALNUT STREET	13842	500-152-28	D3	3	1955	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	16		Yes		Yes	Replace Slab	
3724	WALNUT STREET		500-155-14	D3	3	1955	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
3725	WALNUT STREET		500-155-14	D3	3	1955	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
3718	WALNUT STREET		500-153-21	D3	3	1955	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
3719	WALNUT STREET		500-153-21	D3	3	1955	Driveway	PCC	Sidewalk Curb Separation	Over 2"	6		Yes			Replace C&G	
9267	WASS STREET	1040	501-081-02	C4	3	1959	Driveway	PCC	Divided Slab	1/4" to 1/2"	12		No		Yes	Replace Slab	
9268	WASS STREET	1040	501-081-02	C4	3	1959	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No		Yes	Grind	
9269	WASS STREET	1040	501-081-02	C4	3	1959	Sidewalk	PCC	Faulting	1/4" to 1/2"	6		No		Yes	Grind	
9270	WASS STREET	1040	501-081-02	C4	3	1959	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	6		No			Grind	
9274	WASS STREET	1102	501-081-26	C4	3	1959	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
9275	WASS STREET	1200	501-081-20	C4	3	1959	Driveway	PCC	Linear Cracking	1/4" to 1/2"	7		No		Yes	Grind	
9266	WASS STREET	12872	501-081-01	C4	3	1959	Driveway	PCC	Linear Cracking	1/2" to 1"	12		No		Yes	Grind	
9271	WASS STREET		501-081-27	C4	3	1959	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
9272	WASS STREET		501-081-27	C4	3	1959	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
9273	WASS STREET		501-081-27	C4	3	1959	Driveway	PCC	Linear Cracking	1/4" to 1/2"	7		No			Grind	
6221	WHITE SANDS DRIVE	13342	103-594-02	D4	3	1965	Sidewalk	PCC	Corner Break	No Displacement	3		Yes			Patch	
5598	WHITE SANDS DRIVE	13351	103-593-11	D4	3	1965	Driveway	PCC	Linear Cracking	1/4" to 1/2"	7		No			Grind	
5597	WHITE SANDS DRIVE	13351	103-593-11	D4	3	1965	Sidewalk	PCC	Spalling	1/2" to 1"	2		No			Replace C&G	
5596	WHITE SANDS DRIVE	13351	103-593-11	D4	3	1965	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
6195	WHITE SANDS DRIVE	13381	500-122-17	D4	3	1965	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
6197	WHITE SANDS DRIVE	13381	500-122-17	D4	3	1965	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
6196	WHITE SANDS DRIVE	13381	500-122-17	D4	3	1965	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
6198	WHITE SANDS DRIVE	13411	500-122-18	D4	3	1965	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
6199	WHITE SANDS DRIVE	13411	500-122-18	D4	3	1965	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
6219	WHITE SANDS DRIVE	13412	500-123-04	D4	3	1965	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
6220	WHITE SANDS DRIVE	13412	500-123-04	D4	3	1965	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
6200	WHITE SANDS DRIVE	13421	500-122-19	D4	3	1965	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
6201	WHITE SANDS DRIVE	13431	500-122-20	D4	3	1965	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
6202	WHITE SANDS DRIVE	13431	500-122-20	D4	3	1965	Driveway	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind Driveway	
6203	WHITE SANDS DRIVE	13431	500-122-20	D4	3	1965	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
6218	WHITE SANDS DRIVE	13452	500-123-07	D4	3	1965	Sidewalk	PCC	Corner Break	1/4" to 1/2"	2		No			Grind	
6216	WHITE SANDS DRIVE	13452	500-123-07	D4	3	1965	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
6215	WHITE SANDS DRIVE	13452	500-123-07	D4	3	1965	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
6217	WHITE SANDS DRIVE	13452	500-123-07	D4	3	1965	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
6213																	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
6214	WHITE SANDS DRIVE	13472	500-123-08	D4	3	1965	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
6212	WHITE SANDS DRIVE	13472	500-123-08	D4	3	1965	Sidewalk	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
6210	WHITE SANDS DRIVE	1362	500-122-24	D4	3	1965	Sidewalk	PCC	Divided Slab	No Displacement	14		No			Replace Slab(s)	Low
6211	WHITE SANDS DRIVE	1362	500-122-24	D4	3	1965	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
5601	WHITE SANDS DRIVE	1371	500-121-18	D4	3	1965	Sidewalk	PCC	Linear Cracking	No Displacement	12		No			Joint Seal	Slight displacement
5599	WHITE SANDS DRIVE	1371	500-121-18	D4	3	1965	Driveway	PCC	Linear Cracking	1/4" to 1/2"	7		No			Grind	
7353	WOODLAND DRIVE	13161	103-222-02	D4	3	1972	Driveway	PCC	Faulting	1/4" to 1/2"	8		No			Grind Driveway	Between sidewalk and driveway
7357	WOODLAND DRIVE	13161	103-222-02	D4	3	1972	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	Prev grind
7355	WOODLAND DRIVE	13161	103-222-02	D4	3	1972	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
7359	WOODLAND DRIVE	13161	103-222-02	D4	3	1972	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	1.5		No			Grind	
7382	WOODLAND DRIVE	13162	103-222-14	D4	3	1972	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
7360	WOODLAND DRIVE	13181	103-222-03	D4	3	1972	Sidewalk	PCC	Faulting	1/2" to 1"	4		No			Ramp	
7363	WOODLAND DRIVE	13181	103-222-03	D4	3	1972	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
7380	WOODLAND DRIVE	13182	103-222-13	D4	3	1972	Driveway	PCC	Linear Cracking	1/4" to 1/2"	5		No			Grind	
7365	WOODLAND DRIVE	13191	103-222-04	D4	3	1972	Sidewalk	PCC	Faulting	1/2" to 1"	4		No			Ramp	Prev grind
7379	WOODLAND DRIVE	13192	103-222-12	D4	3	1972	Sidewalk	PCC	Faulting	1/2" to 1"	1		No			Ramp	
7377	WOODLAND DRIVE	13192	103-222-12	D4	3	1972	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	2.5		No			Grind	
7367	WOODLAND DRIVE	13221	103-222-06	D4	3	1972	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
7371	WOODLAND DRIVE	13222	103-222-09	D4	3	1972	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		No			Ramp	
7370	WOODLAND DRIVE	13222	103-222-09	D4	3	1972	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7375	WOODLAND DRIVE	13222	103-222-09	D4	3	1972	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7373	WOODLAND DRIVE	13222	103-222-09	D4	3	1972	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	2		No			Grind	
7369	WOODLAND DRIVE	13241	103-222-07	D4	3	1972	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	Prev grind
6868	WOODLAND DRIVE	13501	103-731-18	E4	3	1970	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		Yes			Grind	
6621	WOODLAND DRIVE	13512	103-732-01	E4	3	1970	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		No			Ramp	
6620	WOODLAND DRIVE	13512	103-732-01	E4	3	1970	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
6869	WOODLAND DRIVE	13531	103-731-16	E4	3	1970	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6870	WOODLAND DRIVE	13531	103-731-16	E4	3	1970	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6871	WOODLAND DRIVE	13541	103-731-15	E4	3	1970	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		Yes			Grind	
6872	WOODLAND DRIVE	13541	103-731-15	E4	3	1970	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
6873	WOODLAND DRIVE	13561	103-731-13	E4	3	1970	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6874	WOODLAND DRIVE	13581	103-731-12	E4	3	1970	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
6606	WOODLAND DRIVE	13582	103-732-07	E4	3	1970	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
6607	WOODLAND DRIVE	13582	103-732-07	E4	3	1970	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
6608	WOODLAND DRIVE	1652	103-732-06	E4	3	1970	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
6609	WOODLAND DRIVE	1652	103-732-06	E4	3	1970	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
6610	WOODLAND DRIVE	1652	103-732-06	E4	3	1970	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
6611	WOODLAND DRIVE	1652	103-732-06	E4	3	1970	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
7383	WOODLAND DRIVE	1652	103-222-15	D4	3	1972	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7384	WOODLAND DRIVE	1652	103-222-15	D4	3	1972	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
4391	WOODLAWN AVENUE	13002	103-636-07	D4	3	1975	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
4390	WOODLAWN AVENUE	13002	103-636-07	D4	3	1975	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
4384	WOODLAWN AVENUE	13022	103-636-06	D4	3	1975	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	Prev grind
4385	WOODLAWN AVENUE	13022	103-636-06	D4	3	1975	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	Prev grind
4387	WOODLAWN AVENUE	13022	103-636-06	D4	3	1975	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight displacement
4388	WOODLAWN AVENUE	13022	103-636-06	D4	3	1975	Driveway	PCC	Corner Break	1/2" to 1"	3		No			Ramp	
4389	WOODLAWN AVENUE	13022	103-636-06	D4	3	1975	Driveway	PCC	Faulting	1/4" to 1/2"	5		No			Grind Driveway	
4386	WOODLAWN AVENUE	13022	103-636-06	D4	3	1975	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
4380	WOODLAWN AVENUE	13032	103-636-05	D4	3	1975	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	Prev grind
4379	WOODLAWN AVENUE	13032	103-636-05	D4	3	1975	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	Prev grind
4383	WOODLAWN AVENUE	13032	103-636-05	D4	3	1975	Sidewalk	PCC	Corner Break	1/4" to 1/2"	1		No			Grind	
4382	WOODLAWN AVENUE	13032	103-636-05	D4	3	1975	Driveway	PCC	Linear Cracking	1/4" to 1/2"	7		No			Grind	
4381	WOODLAWN AVENUE	13032	103-636-05	D4	3	1975	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
4378	WOODLAWN AVENUE	13042	103-636-04	D4	3	1975	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
4377	WOODLAWN AVENUE	13042	103-636-04	D4	3	1975	Driveway	PCC	Linear Cracking	1/4" to 1/2"	7		No			Grind	
4376	WOODLAWN AVENUE	13052	103-636-03	D4	3	1975	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight displacement
4375	WOODLAWN AVENUE	13072	103-636-02	D4	3	1975	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
4373	WOODLAWN AVENUE	13082	103-636-01	D4	3	1975	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight displacement
4374	WOODLAWN AVENUE	13082	103-636-01	D4	3	1975	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
4544	WOODLAWN AVENUE	13102	103-635-07	D4	3	1975	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
4548	WOODLAWN AVENUE	13111	103-634-08	D4	3	1975	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
4549	WOODLAWN AVENUE	13111	103-634-08	D4	3	1975	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
4542	WOODLAWN AVENUE	13112	103-635-06	D4	3	1975	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	Prev grind
4543				i	D4	3	1975	Sidewalk	PCC	Linear Cracking	No Displacement	4		No		Joint Seal	Slight displacement

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
4550	WOODLAWN AVENUE	13121	103-634-09	D4	3	1975	Sidewalk	PCC	Linear Cracking	No Displacement	4		Yes			Joint Seal	Prev grind
4541	WOODLAWN AVENUE	13122	103-635-05	D4	3	1975	Sidewalk	PCC	Linear Cracking	No Displacement	4		Yes			Joint Seal	Slight displacement
4540	WOODLAWN AVENUE	13122	103-635-05	D4	3	1975	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
4538	WOODLAWN AVENUE	13142	103-635-03	D4	3	1975	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
4539	WOODLAWN AVENUE	13142	103-635-03	D4	3	1975	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
4412	WOODLAWN AVENUE	1331	103-633-16	D4	3	1975	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
4394	WOODLAWN AVENUE	1331	103-633-24	D4	3	1975	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight displacement
4411	WOODLAWN AVENUE	1331	103-633-16	D4	3	1975	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
4393	WOODLAWN AVENUE	1331	103-633-24	D4	3	1975	Driveway	PCC	Linear Cracking	1/4" to 1/2"	7		No			Grind	
4395	WOODLAWN AVENUE	1331	103-633-24	D4	3	1975	Sidewalk	PCC	Spalling	1/2" to 1"	2		No			Replace C&G	
4547	WOODLAWN AVENUE	1332	103-634-07	D4	3	1975	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
4409	WOODLAWN AVENUE	1332	103-633-17	D4	3	1975	Sidewalk	PCC	Temporary Ramp	1" to 2"			Yes			Replace Slab	Prev grind
4546	WOODLAWN AVENUE	1332	103-634-07	D4	3	1975	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
4545	WOODLAWN AVENUE	1332	103-634-07	D4	3	1975	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
4410	WOODLAWN AVENUE	1332	103-633-17	D4	3	1975	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
4537	WOODLAWN AVENUE	1351	103-635-02	D4	3	1975	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	

Zone 4

9470	ALDER LANE	14502	432-371-22	F4	4	1508	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
9471	ALDER LANE	14502	432-371-22	F4	4	1508	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
9469	ALDER LANE	14512	432-371-42	F4	4	1508	Sidewalk	PCC	Faulting	1/2" to 1"	2.5		No			Ramp	
9472	ALDER LANE	14521	432-371-40	F4	4	1508	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
9468	ALDER LANE	14522	432-371-43	F4	4	1508	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
9476	ALDER LANE	14531	432-371-39	F4	4	1508	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	Prev grind
9473	ALDER LANE	14531	432-371-39	F4	4	1508	Sidewalk	PCC	Faulting	1/2" to 1"	1		No			Ramp	
9475	ALDER LANE	14531	432-371-39	F4	4	1508	Sidewalk	PCC	Faulting	1/2" to 1"	3.5		No			Ramp	
9474	ALDER LANE	14531	432-371-39	F4	4	1508	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
9465	ALDER LANE	14532	432-371-25	F4	4	1508	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
9466	ALDER LANE	14532	432-371-25	F4	4	1508	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
9467	ALDER LANE	14532	432-371-25	F4	4	1508	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9477	ALDER LANE	14541	432-371-18	F4	4	1508	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
9464	ALDER LANE	14542	432-371-26	F4	4	1508	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	Prev grind
9478	ALDER LANE	14551	432-371-17	F4	4	1508	Sidewalk	PCC	Faulting	1/2" to 1"	1		No			Ramp	
9479	ALDER LANE	14551	432-371-17	F4	4	1508	Sidewalk	PCC	Faulting	1/2" to 1"	1		No			Ramp	
9463	ALDER LANE	14552	432-371-27	F4	4	1508	Sidewalk	PCC	Faulting	1/2" to 1"	2		No			Ramp	Between driveway and sidewalk
9480	ALDER LANE	14561	432-371-16	F4	4	1508	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9462	ALDER LANE	14562	432-371-28	F4	4	1508	Sidewalk	PCC	Faulting	1/4" to 1/2"	10		No			Grind	Between driveway and sidewalk
9481	ALDER LANE	14571	432-371-15	F4	4	1508	Sidewalk	PCC	Faulting	1/2" to 1"	2		Yes			Ramp	
9482	ALDER LANE	14581	432-371-14	F4	4	1508	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
9459	ALDER LANE	14582	432-371-30	F4	4	1508	Sidewalk	PCC	Faulting	1/2" to 1"	1		No			Ramp	Between driveway and sidewalk
9461	ALDER LANE	14582	432-371-30	F4	4	1508	Sidewalk	PCC	Faulting	1/2" to 1"	1		No			Ramp	
9460	ALDER LANE	14582	432-371-30	F4	4	1508	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9513	ALDER LANE	14611	432-371-11	F4	4	1507	Sidewalk	PCC	Faulting	1/2" to 1"	3		No			Ramp	
9514	ALDER LANE	14611	432-371-11	F4	4	1507	Sidewalk	PCC	Faulting	1/2" to 1"	4		No			Ramp	
9515	ALDER LANE	14611	432-371-11	F4	4	1507	Sidewalk	PCC	Faulting	1/2" to 1"	0.5		No			Ramp	
9516	ALDER LANE	14641	432-371-08	F4	4	1507	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
9517	ALDER LANE	14641	432-371-08	F4	4	1507	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
9867	ALDER LANE	14642	432-461-24	F4	4	1507	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No		Yes	Grind	
9518	ALDER LANE	14651	432-371-07	F4	4	1507	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
9519	ALDER LANE	14651	432-371-07	F4	4	1507	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
9865	ALDER LANE	14652	432-461-25	F4	4	1507	Sidewalk	PCC	Faulting	1/2" to 1"	2		No			Ramp	Prev grind
9864	ALDER LANE	14652	432-461-25	F4	4	1507	Sidewalk	PCC	Faulting	1/2" to 1"	4		No			Ramp	
9862	ALDER LANE	14652	432-461-25	F4	4	1507	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
9520	ALDER LANE	14661	432-371-06	F4	4	1507	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9861	ALDER LANE	14662	432-461-26	G4	4	1507	Sidewalk	PCC	Faulting	1/2" to 1"	4		No			Ramp	
9521	ALDER LANE	14671	432-371-05	F4	4	1507	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
9858	ALDER LANE	14682	432-461-28	G3	4	1507	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Between driveway and sidewalk
9856	ALDER LANE	14682	432-461-28	G3	4	1507	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Prev grind
9522	ALDER LANE	14691	432-371-03	G3	4	1507	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
9523	ALDER LANE	14691	432-371-03	G3	4	1507	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9527	ALDER LANE	14701	432-371-02	G3	4	1507	Sidewalk	PCC	Faulting	1/2" to 1"	6		No			Ramp	Between driveway and sidewalk
9525	ALDER LANE	14701	432-371-02	G3	4	1507	Sidewalk	PCC	Faulting	1/2" to 1"	3		No			Ramp	Prev grind
9526	ALDER LANE	14701	432-371-02	G3	4	1507	Sidewalk	PCC	Faulting	1/2" to 1"	2		No			Ramp	
9524				G3	4	1507	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
9528	ALDER LANE	14701	432-371-02	G3	4	1507	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
9853	ALDER LANE	14702	432-461-30	G3	4	1507	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
9169	ALDER LANE	14741	432-263-20	G3	4	1506	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	15		No			Grind	
9529	ALDER LANE	14751	432-263-19	G3	4	1506	Sidewalk	PCC		1/4" to 1/2"	1.5		No			Grind	
9530	ALDER LANE	14751	432-263-19	G3	4	1506	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
9535	ALDER LANE	14771	432-263-17	G3	4	1506	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No			Grind	Between sidewalk and driveway
9532	ALDER LANE	14771	432-263-17	G3	4	1506	Sidewalk	PCC	Faulting	1" to 2"	3.5		Yes			Replace Slab	
9531	ALDER LANE	14771	432-263-17	G3	4	1506	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
9533	ALDER LANE	14771	432-263-17	G3	4	1506	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9536	ALDER LANE	14781	432-263-16	G3	4	1506	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Prev grind
9538	ALDER LANE	14781	432-263-16	G3	4	1506	Sidewalk	PCC	Faulting	1/2" to 1"	2.5		No			Ramp	
9534	ALDER LANE	14781	432-263-16	G3	4	1506	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9537	ALDER LANE	14781	432-263-16	G3	4	1506	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
9539	ALDER LANE	14791	432-263-15	G3	4	1506	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
9542	ALDER LANE	14801	432-263-14	G3	4	1506	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
9541	ALDER LANE	14801	432-263-14	G3	4	1506	Sidewalk	PCC	Faulting	1/2" to 1"	2.5		Yes			Ramp	
9540	ALDER LANE	14801	432-263-14	G3	4	1506	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
9544	ALDER LANE	14811	432-263-13	G3	4	1506	Sidewalk	PCC	Faulting	1/2" to 1"	1		No			Ramp	
9543	ALDER LANE	14811	432-263-13	G3	4	1506	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9545	ALDER LANE	14821	432-263-12	G3	4	1506	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
9546	ALDER LANE	14831	432-263-11	G3	4	1506	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9547	ALDER LANE	14851	432-263-09	G3	4	1506	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9548	ALDER LANE	14851	432-263-09	G3	4	1506	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
9795	ALDER LANE	14852	432-265-03	G3	4	1506	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		Yes			Grind	
9796	ALDER LANE	14852	432-265-03	G3	4	1506	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
9797	ALDER LANE	14852	432-265-03	G3	4	1506	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No			Grind	
9549	ALDER LANE	14861	432-263-08	G3	4	1506	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
9793	ALDER LANE	14862	432-265-02	G3	4	1506	Sidewalk	PCC	Faulting	1/2" to 1"	5		No			Ramp	Prev grind
9794	ALDER LANE	14862	432-265-02	G3	4	1506	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
9550	ALDER LANE	14871	432-263-07	G3	4	1506	Sidewalk	PCC	Faulting	1/2" to 1"	1		No			Ramp	Prev grind
9551	ALDER LANE	14871	432-263-07	G3	4	1506	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
9791	ALDER LANE	14872	432-265-01	G3	4	1506	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
9790	ALDER LANE	14872	432-265-01	G3	4	1506	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
9792	ALDER LANE	14872	432-265-01	G3	4	1506	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
9798	ALDER LANE	2171	432-266-12	G3	4	1506	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
9802	ALDER LANE	2171	432-267-01	G3	4	1506	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
9803	ALDER LANE	2171	432-267-01	G3	4	1506	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
9799	ALDER LANE	2172	432-266-01	G3	4	1506	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Prev grind
9805	ALDER LANE	2172	432-461-67	G3	4	1506	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		Yes			Grind	Prev grind
9800	ALDER LANE	2172	432-266-01	G3	4	1506	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
9801	ALDER LANE	2172	432-266-01	G3	4	1506	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
9804	ALDER LANE	2172	432-461-67	G3	4	1506	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
2127	ALMSIDE DRIVE	1252	432-093-12	E3	4	1510	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
2099	ALMSIDE DRIVE	1292	432-091-32	E3	4	1510	Curb/Gutter	PCC		1" to 2"	1		No			Patch	
2129	ALMSIDE DRIVE	14371	432-093-13	E3	4	1510	Curb/Gutter	PCC	Spalling	1" to 2"	0.5		No			Patch	
2128	ALMSIDE DRIVE	14371	432-093-13	E3	4	1510	Curb/Gutter	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
4163	AMHERST ROAD	1612	432-193-25	F3	4	1517	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
4164	AMHERST ROAD	1622	432-193-24	F3	4	1517	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
4165	AMHERST ROAD	1622	432-193-24	F3	4	1517	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
4166	AMHERST ROAD	1632	432-193-23	F3	4	1517	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
4162	AMHERST ROAD	1671	432-194-08	F3	4	1517	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
4167	AMHERST ROAD	1692	432-193-17	F3	4	1517	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
4151	AMHERST ROAD	1712	432-203-08	F3	4	1517	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
4161	AMHERST ROAD	1731	432-203-20	F3	4	1517	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	10		No			Grind	Between curb and driveway
4152	AMHERST ROAD	1732	432-203-10	F3	4	1517	Curb/Gutter	PCC		1/4" to 1/2"	15		No			Grind	Between curb and driveway
4153	AMHERST ROAD	1752	432-203-12	F3	4	1517	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
4160	AMHERST ROAD	1771	432-203-16	F3	4	1517	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
4158	AMHERST ROAD	1772	432-203-14	F3	4	1517	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
4155	AMHERST ROAD	1772	432-203-14	F3	4	1517	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
4156	AMHERST ROAD	1772	432-203-14	F3	4	1517	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
4154	AMHERST ROAD	1772	432-203-14	F3	4	1517	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
4157	AMHERST ROAD	1772	432-203-14	F3	4	1517	Sidewalk	PCC		1/4" to 1/2"	3		No			Grind	
4159	AMHERST ROAD		432-203-15	F3	4	1517	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
9678			)	G4	4	1518	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
9636	ANA TREE PLACE	2301	432-462-15	G4	4	1518	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
9637	ANA TREE PLACE	2301	432-462-15	G4	4	1518	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9638	ANA TREE PLACE	2301	432-462-15	G4	4	1518	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9628	ANA TREE PLACE	2332	432-462-25	G4	4	1518	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
9634	ANA TREE PLACE	2341	432-462-19	G4	4	1518	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
9635	ANA TREE PLACE	2341	432-462-19	G4	4	1518	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
9629	ANA TREE PLACE	2342	432-462-24	G4	4	1518	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
9632	ANA TREE PLACE	2351	432-462-20	G4	4	1518	Sidewalk	PCC	Faulting	1/2" to 1"	4		No			Ramp	
9631	ANA TREE PLACE	2351	432-462-20	G4	4	1518	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
9633	ANA TREE PLACE	2351	432-462-20	G4	4	1518	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9630	ANA TREE PLACE	2352	432-462-23	G4	4	1518	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	Prev grind
9552	APPLE TREE DRIVE	2172	432-263-04	G3	4	1524	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9553	APPLE TREE DRIVE	2172	432-263-04	G3	4	1524	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9785	APPLE TREE DRIVE	2181	432-264-02	G3	4	1524	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
9784	APPLE TREE DRIVE	2181	432-264-02	G3	4	1524	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Repaired new slab
9787	APPLE TREE DRIVE	2181	432-264-02	G3	4	1524	Curb/Gutter	PCC	Faulting	1" to 2"	3		No			Replace C&G	
9786	APPLE TREE DRIVE	2181	432-264-02	G3	4	1524	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
9788	APPLE TREE DRIVE	2181	432-264-02	G3	4	1524	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	6		No			Grind	
9555	APPLE TREE DRIVE	2192	432-263-02	G3	4	1524	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
9554	APPLE TREE DRIVE	2192	432-263-02	G3	4	1524	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
9782	APPLE TREE DRIVE	2211	432-423-20	G3	4	1524	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Repaired new slab
9783	APPLE TREE DRIVE	2211	432-423-20	G3	4	1524	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
12030	APPLE TREE DRIVE	2221	432-423-19	G3	4	1524	Driveway	PCC	Sidewalk Curb Separation	1/2" to 1"	15		No			Replace Driveway	
12031	APPLE TREE DRIVE	2221	432-423-19	G3	4	1524	Driveway	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
9556	APPLE TREE DRIVE	2222	432-424-49	G3	4	1524	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	Prev grind
12023	APPLE TREE DRIVE	2232	432-424-48	G3	4	1524	Driveway	PCC	Sidewalk Curb Separation	1/4" to 1/2"	12		No			Grind	
9781	APPLE TREE DRIVE	2241	432-423-17	G3	4	1524	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
12024	APPLE TREE DRIVE	2242	432-424-47	G3	4	1524	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No			Grind	
9557	APPLE TREE DRIVE	2252	432-424-46	G3	4	1524	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
9558	APPLE TREE DRIVE	2252	432-424-46	G3	4	1524	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		Yes			Grind	
9780	APPLE TREE DRIVE	2261	432-423-15	G3	4	1524	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
9559	APPLE TREE DRIVE	2262	432-424-45	G3	4	1524	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
9777	APPLE TREE DRIVE	2271	432-423-14	G3	4	1524	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Repaired new slab
9778	APPLE TREE DRIVE	2271	432-423-14	G3	4	1524	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		Yes			Grind	Repaired new slab
9779	APPLE TREE DRIVE	2271	432-423-14	G3	4	1524	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	Repaired new slab
12026	APPLE TREE DRIVE	2272	432-424-44	G3	4	1524	Driveway	PCC	Sidewalk Curb Separation	1/2" to 1"	5		No			Patch	
12025	APPLE TREE DRIVE	2272	432-424-44	G3	4	1524	Sidewalk	PCC	Temporary Ramp	1" to 2"	4		Yes			Replace Slab	
9773	APPLE TREE DRIVE	2281	432-423-13	G3	4	1524	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Repaired new slab
9774	APPLE TREE DRIVE	2281	432-423-13	G3	4	1524	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	Repaired new slab
9775	APPLE TREE DRIVE	2281	432-423-13	G3	4	1524	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Repaired new slab
9776	APPLE TREE DRIVE	2281	432-423-13	G3	4	1524	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Repaired new slab
12027	APPLE TREE DRIVE	2282	432-424-43	G3	4	1524	Sidewalk	PCC	Faulting	1/4" to 1/2"	10		No			Grind	
9772	APPLE TREE DRIVE	2291	432-423-12	G3	4	1524	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
9769	APPLE TREE DRIVE	2301	432-423-11	G3	4	1524	Sidewalk	PCC	Faulting	1/2" to 1"	4		No			Ramp	Repaired new slab
9770	APPLE TREE DRIVE	2301	432-423-11	G3	4	1524	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	Repaired new slab
9560	APPLE TREE DRIVE	2302	432-424-41	G3	4	1524	Driveway	PCC	Sidewalk Curb Separation	1/4" to 1/2"	15		No			Grind	Between curb and driveway
9768	APPLE TREE DRIVE	2311	432-423-10	G3	4	1524	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	Repaired new slab
9771	APPLE TREE DRIVE	2311	432-423-10	G3	4	1524	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Repaired new slab
12029	APPLE TREE DRIVE	2311	432-423-10	G3	4	1524	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	4		No			Grind	
9562	APPLE TREE DRIVE	2312	432-424-40	G3	4	1524	Sidewalk	PCC	Faulting	1/2" to 1"	4		No			Ramp	Prev grind
9561	APPLE TREE DRIVE	2312	432-424-40	G3	4	1524	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
9563	APPLE TREE DRIVE	2322	432-424-39	G3	4	1524	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
9564	APPLE TREE DRIVE	2322	432-424-39	G3	4	1524	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
12028	APPLE TREE DRIVE	2331	432-424-25	G3	4	1525	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	20		No			Grind	
9565	APPLE TREE DRIVE	2332	432-424-38	G3	4	1525	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
9579	APPLE TREE DRIVE	2341	432-424-26	G3	4	1525	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
9578	APPLE TREE DRIVE	2351	432-424-27	G4	4	1525	Sidewalk	PCC	Faulting	1/2" to 1"	1		No			Ramp	
9566	APPLE TREE DRIVE	2352	432-424-36	G3	4	1525	Sidewalk	PCC	Faulting	1/2" to 1"	2		No			Ramp	Prev grind
9567	APPLE TREE DRIVE	2352	432-424-36	G3	4	1525	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		No			Ramp	
9568	APPLE TREE DRIVE	2352	432-424-36	G3	4	1525	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
9577	APPLE TREE DRIVE	2361	432-424-28	G4	4	1525	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	Repaired new slab
9576	APPLE TREE DRIVE	2361	432-424-28	G4	4	1525	Sidewalk	PCC	Faulting	1/2" to 1"	1		No			Ramp	
9569	APPLE TREE DRIVE	2362	432-424-35	G3	4	1525	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
9570				i	G3	4	1525	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No		Grind	Prev grind

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
9575	APPLE TREE DRIVE	2371	432-424-29	G4	4	1525	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		Yes			Ramp	
9571	APPLE TREE DRIVE	2372	432-424-34	G4	4	1525	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
9574	APPLE TREE DRIVE	2381	432-424-30	G4	4	1525	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
9573	APPLE TREE DRIVE	2391	432-424-31	G4	4	1525	Sidewalk	PCC	Faulting	1/2" to 1"	2		No			Ramp	Prev grinded, between sidewalk and driveway
9572	APPLE TREE DRIVE	2392	432-424-32	G4	4	1525	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
4003	ASHBURTON AVENUE	14781	432-331-72	F3	4	1529	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
3987	ASHBURTON AVENUE	14782	432-331-81	F3	4	1529	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
4005	ASHBURTON AVENUE	14782	432-331-71	F3	4	1529	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	Prev grind
4004	ASHBURTON AVENUE	14782	432-331-71	F3	4	1529	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
3988	ASHBURTON AVENUE	14782	432-331-81	F3	4	1529	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	6		No			Grind	
4058	ASHBURTON AVENUE	14811	432-331-30	F3	4	1529	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		No			Ramp	
4091	ASHBURTON AVENUE	14811	432-312-01	F3	4	1529	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
4092	ASHBURTON AVENUE	14811	432-312-01	F3	4	1529	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
4093	ASHBURTON AVENUE	14811	432-312-01	F3	4	1529	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No			Grind	
4057	ASHBURTON AVENUE	14811	432-331-30	F3	4	1529	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
4088	ASHBURTON AVENUE	14812	432-331-01	F3	4	1529	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	Prev grind
4089	ASHBURTON AVENUE	14812	432-331-01	F3	4	1529	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
4090	ASHBURTON AVENUE	14812	432-331-01	F3	4	1529	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		No			Ramp	
4056	ASHBURTON AVENUE	14812	432-331-31	F3	4	1529	Sidewalk	PCC	Faulting	1/2" to 1"	1		Yes			Ramp	
4055	ASHBURTON AVENUE	14812	432-331-31	F3	4	1529	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
4087	ASHBURTON AVENUE	14812	432-331-01	F3	4	1529	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	15		No			Grind	
2146	ATHERTON LANE	1272	432-113-13	E3	4	1530	Ramp	PCC	Faulting	1/4" to 1/2"	3		No			Grind Ramp	
2145	ATHERTON LANE	1272	432-113-13	E3	4	1530	Ramp	PCC	Sidewalk Curb Separation	1" to 2"	5		No			Replace Ramp	
2144	ATHERTON LANE	1272	432-113-13	E3	4	1530	Ramp	PCC	Sidewalk Curb Separation	1/4" to 1/2"	10		No			Grind	
10819	ATTBORO PLACE	14751	432-271-44	F3	4	1531	Driveway	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
10820	ATTBORO PLACE	14761	432-271-43	F3	4	1531	Driveway	PCC	Linear Cracking	1/2" to 1"	4		No			Grind	
12005	ATTBORO PLACE	14771	432-271-42	F3	4	1531	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
10821	ATTBORO PLACE	14771	432-271-42	F3	4	1531	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
12007	ATTBORO PLACE	14781	432-271-41	F3	4	1531	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
10822	ATTBORO PLACE	14781	432-271-41	F3	4	1531	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
12006	ATTBORO PLACE	14781	432-271-41	F3	4	1531	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
12008	ATTBORO PLACE	14791	432-271-40	F3	4	1531	Driveway	PCC	Spalling	1/2" to 1"	0.5		No			Replace C&G	
10825	ATTBORO PLACE	14801	432-271-39	F3	4	1531	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
10824	ATTBORO PLACE	14801	432-271-39	F3	4	1531	Driveway	PCC	Buckled Slab	1" to 2"	12		No			Replace Slab(s)	
10823	ATTBORO PLACE	14801	432-271-39	F3	4	1531	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
10826	ATTBORO PLACE	14811	432-271-38	F3	4	1531	Curb/Gutter	PCC	Punchout	1" to 2"	2.5		No			Replace Slab	
10827	ATTBORO PLACE	14821	432-271-37	F3	4	1531	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
10828	ATTBORO PLACE	14821	432-271-37	F3	4	1531	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	35		No			Replace Slab	
10818	ATTBORO PLACE	14822	432-271-52	F3	4	1531	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
9653	BASSWOOD CIRCLE	2312	432-453-30	G4	4	1543	Sidewalk	PCC	Faulting	1/2" to 1"	1		Yes			Ramp	Prev grind
9652	BASSWOOD CIRCLE	2312	432-453-30	G4	4	1543	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	Prev grind
9664	BASSWOOD CIRCLE	2321	432-453-20	G4	4	1543	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9655	BASSWOOD CIRCLE	2322	432-453-29	G4	4	1543	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	Prev grind
9654	BASSWOOD CIRCLE	2322	432-453-29	G4	4	1543	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
9663	BASSWOOD CIRCLE	2331	432-453-21	G4	4	1543	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
9656	BASSWOOD CIRCLE	2332	432-453-28	G4	4	1543	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
9660	BASSWOOD CIRCLE	2341	432-453-22	G4	4	1543	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	Prev grind
9659	BASSWOOD CIRCLE	2341	432-453-22	G4	4	1543	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
9661	BASSWOOD CIRCLE	2341	432-453-22	G4	4	1543	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9662	BASSWOOD CIRCLE	2341	432-453-22	G4	4	1543	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
9657	BASSWOOD CIRCLE	2342	432-453-27	G4	4	1543	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
9658	BASSWOOD CIRCLE	2361	432-453-24	G4	4	1543	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7767	BERKSHIRE PLACE	14621	432-231-08	F3	4	1549	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7780	BERKSHIRE PLACE	14622	432-231-24	F3	4	1549	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
7768	BERKSHIRE PLACE	14631	432-231-09	F3	4	1549	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7779	BERKSHIRE PLACE	14632	432-231-23	F3	4	1549	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
7769	BERKSHIRE PLACE	14641	432-231-10	F3	4	1549	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
7770	BERKSHIRE PLACE	14641	432-231-10	F3	4	1549	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7778	BERKSHIRE PLACE	14642	432-231-22	F3	4	1549	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7771	BERKSHIRE PLACE	14661	432-231-12	F3	4	1549	Sidewalk	PCC	Faulting	1/2" to 1"	0.5		No			Ramp	
7772	BERKSHIRE PLACE	14661	432-231-12	F3	4	1549	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7773	BERKSHIRE PLACE	14681	432-231-14	F3	4	1549	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7774	BERKSHIRE PLACE	14681	432-231-14	F3	4	1549	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7777				}	F3	4	1549	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No		Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
7775	BERKSHIRE PLACE	14691	432-231-15	F3	4	1549	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
7776	BERKSHIRE PLACE	14692	432-231-17	F3	4	1549	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
8223	BIRCHFIELD DRIVE	14455	432-212-17	F3	4	1551	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
8224	BIRCHFIELD DRIVE	14455	432-212-17	F3	4	1551	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
8225	BIRCHFIELD DRIVE	14455	432-212-17	F3	4	1551	Curb/Gutter	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
8254	BIRCHFIELD DRIVE	14461	432-211-21	F3	4	1550	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
8255	BIRCHFIELD DRIVE	14461	432-211-21	F3	4	1550	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
8256	BIRCHFIELD DRIVE	14461	432-211-21	F3	4	1550	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
8257	BIRCHFIELD DRIVE	14462	432-211-20	F3	4	1550	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		No			Ramp	
8228	BIRCHFIELD DRIVE	1611	432-212-20	F3	4	1551	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
8229	BIRCHFIELD DRIVE	1612	432-212-21	F3	4	1551	Sidewalk	PCC	Faulting	1/4" to 1/2"	4.5		No			Grind	
8230	BIRCHFIELD DRIVE	1612	432-212-21	F3	4	1551	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	2		No			Grind	
8227	BIRCHFIELD DRIVE	1625	432-212-19	F3	4	1551	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	2.5		No			Grind	
8226	BIRCHFIELD DRIVE	1641	432-212-18	F3	4	1551	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
8231	BIRCHFIELD DRIVE	1652	432-212-24	F3	4	1551	Sidewalk	PCC	Faulting	1/2" to 1"	3		No			Ramp	
8232	BIRCHFIELD DRIVE	1652	432-212-24	F3	4	1551	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
8233	BIRCHFIELD DRIVE	1662	432-212-25	F3	4	1551	Sidewalk	PCC	Faulting	1/2" to 1"	2		No			Ramp	
8234	BIRCHFIELD DRIVE	1662	432-212-25	F3	4	1551	Curb/Gutter	PCC	Spalling	1/4" to 1/2"	1.5		No			Grind	
8235	BIRCHFIELD DRIVE	1672	432-212-26	F3	4	1550	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	3		No			Grind	Between curb and driveway
8236	BIRCHFIELD DRIVE	1686	432-212-27	F3	4	1550	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	15		No			Grind	Between curb and driveway
8237	BIRCHFIELD DRIVE	1712	432-212-29	F3	4	1550	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	5		No			Grind	
10872	BIRCHWOOD PLACE	14751	432-313-44	F3	4	1552	Driveway	PCC	Linear Cracking	1/2" to 1"	4		No			Grind	
10871	BIRCHWOOD PLACE	14772	432-313-48	F3	4	1552	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
10873	BIRCHWOOD PLACE	14781	432-313-41	F3	4	1552	Sidewalk	PCC	Patch / Utility Cut	1/2" to 1"	4		No			Patch	Patch around pole
10874	BIRCHWOOD PLACE	14801	432-313-39	F3	4	1552	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
10875	BIRCHWOOD PLACE	14811	432-313-38	F3	4	1552	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
10876	BIRCHWOOD PLACE	14811	432-313-38	F3	4	1552	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
10878	BIRCHWOOD PLACE	14821	432-313-37	F3	4	1552	Curb/Gutter	PCC	Linear Cracking	1" to 2"	3		No			Grind	Curb broken
10877	BIRCHWOOD PLACE	14821	432-313-37	F3	4	1552	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
2085	BIRMINGHAM PLACE	1322	432-115-01	E3	4	1553	Curb/Gutter	PCC	Spalling	1" to 2"	0.5		No			Patch	
2091	BIRMINGHAM PLACE	14411	432-112-12	E3	4	1553	Curb/Gutter	PCC	Spalling	1" to 2"	2		No			Patch	
2090	BIRMINGHAM PLACE	14411	432-112-12	E3	4	1553	Curb/Gutter	PCC	Spalling	1/2" to 1"	2		No			Replace C&G	
2151	BIRMINGHAM PLACE	14452	432-117-06	E3	4	1553	Curb/Gutter	PCC	Spalling	1/2" to 1"	0.5		No			Replace C&G	
2150	BIRMINGHAM PLACE	14462	432-117-05	E3	4	1553	Driveway	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	
2149	BIRMINGHAM PLACE	14462	432-117-05	E3	4	1553	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
2148	BIRMINGHAM PLACE	14482	432-117-03	E3	4	1553	Curb/Gutter	PCC	Spalling	1/2" to 1"	2		No			Replace C&G	
4013	BRAEBURN ROAD	14751	432-331-64	F3	4	1561	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
4014	BRAEBURN ROAD	14751	432-331-64	F3	4	1561	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
4015	BRAEBURN ROAD	14751	432-331-64	F3	4	1561	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
4010	BRAEBURN ROAD	14752	432-331-68	F3	4	1561	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
4011	BRAEBURN ROAD	14752	432-331-68	F3	4	1561	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
4012	BRAEBURN ROAD	14752	432-331-68	F3	4	1561	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
4016	BRAEBURN ROAD	14761	432-331-63	F3	4	1561	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
4017	BRAEBURN ROAD	14761	432-331-63	F3	4	1561	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
4009	BRAEBURN ROAD	14762	432-331-69	F3	4	1561	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
4018	BRAEBURN ROAD	14771	432-331-62	F3	4	1561	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
4007	BRAEBURN ROAD	14772	432-331-70	F3	4	1561	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
4008	BRAEBURN ROAD	14772	432-331-70	F3	4	1561	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
4019	BRAEBURN ROAD	14781	432-331-61	F3	4	1561	Sidewalk	PCC	Faulting	1/2" to 1"	2		No			Ramp	
4006	BRAEBURN ROAD	14782	432-331-71	F3	4	1561	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
4020	BRAEBURN ROAD	14791	432-331-60	F3	4	1561	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
4021	BRAEBURN ROAD	14801	432-331-59	F3	4	1561	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	1		No			Grind	
4022	BRAEBURN ROAD	14811	432-331-58	F3	4	1561	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
4053	BRAEBURN ROAD	14812	432-331-31	F3	4	1561	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
4054	BRAEBURN ROAD	14812	432-331-31	F3	4	1561	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	15		No			Grind	
4023	BRAEBURN ROAD	14821	432-331-57	F3	4	1561	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
4052	BRAEBURN ROAD	14822	432-331-32	F3	4	1561	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	Prev grind
4051	BRAEBURN ROAD	14822	432-331-32	F3	4	1561	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	3		No			Grind	
4050	BRAEBURN ROAD	14832	432-331-33	F3	4	1561	Sidewalk	PCC	Faulting	1" to 2"	4		No			Replace Slab	Prev grind
4047	BRAEBURN ROAD	14832	432-331-33	F3	4	1561	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
4048	BRAEBURN ROAD	14832	432-331-33	F3	4	1561	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
4049	BRAEBURN ROAD	14832	432-331-33	F3	4	1561	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
4024	BRAEBURN ROAD	14841	432-331-55	F3	4	1561	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
4046				F3	4	1561	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
4025	BRAEBURN ROAD	14861	432-331-53	F3	4	1561	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	Prev grind
4044	BRAEBURN ROAD	14862	432-331-36	F3	4	1561	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		No			Ramp	
4045	BRAEBURN ROAD	14862	432-331-36	F3	4	1561	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
4026	BRAEBURN ROAD	14871	432-331-52	F3	4	1561	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
4027	BRAEBURN ROAD	14871	432-331-52	F3	4	1561	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
4028	BRAEBURN ROAD	14871	432-331-52	F3	4	1561	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
4041	BRAEBURN ROAD	14882	432-331-38	F3	4	1561	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
4042	BRAEBURN ROAD	14882	432-331-38	F3	4	1561	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
4043	BRAEBURN ROAD	14882	432-331-38	F3	4	1561	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
4029	BRAEBURN ROAD	14901	432-331-49	F3	4	1561	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
4030	BRAEBURN ROAD	14901	432-331-49	F3	4	1561	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
4039	BRAEBURN ROAD	14902	432-331-40	F3	4	1561	Sidewalk	PCC	Faulting	1/2" to 1"	1		No			Ramp	
4040	BRAEBURN ROAD	14902	432-331-40	F3	4	1561	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
4031	BRAEBURN ROAD	14921	432-331-47	F3	4	1561	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
4032	BRAEBURN ROAD	14921	432-331-47	F3	4	1561	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
4037	BRAEBURN ROAD	14922	432-331-42	F3	4	1561	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
4038	BRAEBURN ROAD	14922	432-331-42	F3	4	1561	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
4035	BRAEBURN ROAD	14932	432-331-43	F3	4	1561	Sidewalk	PCC	Faulting	1" to 2"	2		No			Replace Slab	
4034	BRAEBURN ROAD	14932	432-331-43	F3	4	1561	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
4033	BRAEBURN ROAD	14942	432-331-44	F3	4	1561	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
4036	BRAEBURN ROAD		432-331-18	F3	4	1561	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
10886	BRANBURRY PLACE	14752	432-313-29	F3	4	1562	Sidewalk	PCC	Linear Cracking	1/2" to 1"	4		No			Grind	
10885	BRANBURRY PLACE	14772	432-313-31	F3	4	1562	Curb/Gutter	PCC	Sidewalk Curb Separation	1" to 2"	5		No			Replace Curb	
10890	BRANBURRY PLACE	14781	432-313-24	F3	4	1562	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
10888	BRANBURRY PLACE	14781	432-313-24	F3	4	1562	Sidewalk	PCC	Linear Cracking	1/2" to 1"	4		No			Grind	
10889	BRANBURRY PLACE	14781	432-313-24	F3	4	1562	Driveway	PCC	Sidewalk Curb Separation	1" to 2"	6		No			Replace Driveway	
10884	BRANBURRY PLACE	14792	432-313-33	F3	4	1562	Driveway	PCC	Sidewalk Curb Separation	1/2" to 1"	7		No			Replace Driveway	
10883	BRANBURRY PLACE	14792	432-313-33	F3	4	1562	Sidewalk	PCC	Temporary Ramp	1/2" to 1"	15		No			Replace Slab	
10891	BRANBURRY PLACE	14811	432-313-21	F3	4	1562	Sidewalk	PCC	Buckled Slab	1" to 2"	20		No			Replace Slab(s)	One slab raised, other sunken a bit
10892	BRANBURRY PLACE	14811	432-313-21	F3	4	1562	Driveway	PCC	Sidewalk Curb Separation	1" to 2"	4		No			Replace Ramp	Temp ramp
10882	BRANBURRY PLACE	14812	432-313-35	F3	4	1562	Curb/Gutter	PCC	Sidewalk Curb Separation	1" to 2"	4		No			Replace Curb	
10881	BRANBURRY PLACE	14822	432-313-36	F3	4	1562	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10887	BRANBURRY PLACE		432-313-28	F3	4	1562	Sidewalk	PCC	Faulting	1/2" to 1"	5		No			Ramp	
10869	BRIARCLIFF PLACE	14781	432-313-58	F3	4	1565	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
10867	BRIARCLIFF PLACE	14782	432-313-62	F3	4	1565	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
10870	BRIARCLIFF PLACE	14791	432-313-57	F3	4	1565	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
10866	BRIARCLIFF PLACE	14792	432-313-63	F3	4	1565	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
10865	BRIARCLIFF PLACE	14812	432-313-65	F3	4	1565	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
10864	BRIARCLIFF PLACE	14822	432-313-66	F3	4	1565	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Prev grind
10868	BRIARCLIFF PLACE		432-313-60	F3	4	1565	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
3997	BRIDGEPORT ROAD	14741	432-331-76	F3	4	1566	Driveway	PCC	Faulting	1/4" to 1/2"	3		No			Grind Driveway	Between driveway and sidewalk , prev grinded
3995	BRIDGEPORT ROAD	14741	432-331-76	F3	4	1566	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	Prev grind
3994	BRIDGEPORT ROAD	14741	432-331-76	F3	4	1566	Curb/Gutter	PCC	Faulting	1/2" to 1"			No			Replace C&G	
3998	BRIDGEPORT ROAD	14741	432-331-76	F3	4	1566	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
3999	BRIDGEPORT ROAD	14741	432-331-76	F3	4	1566	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
3996	BRIDGEPORT ROAD	14741	432-331-76	F3	4	1566	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	6		No			Grind	
3992	BRIDGEPORT ROAD	14742	432-331-77	F3	4	1566	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
3993	BRIDGEPORT ROAD	14742	432-331-77	F3	4	1566	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
4000	BRIDGEPORT ROAD	14761	432-331-74	F3	4	1566	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Prev grind
3991	BRIDGEPORT ROAD	14762	432-331-79	F3	4	1566	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
4001	BRIDGEPORT ROAD	14771	432-331-73	F3	4	1566	Driveway	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind Driveway	Between driveway and sidewalk
3989	BRIDGEPORT ROAD	14772	432-331-80	F3	4	1566	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
3990	BRIDGEPORT ROAD	14772	432-331-80	F3	4	1566	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
4002	BRIDGEPORT ROAD	14781	432-331-72	F3	4	1566	Sidewalk	PCC	Corner Break	1/4" to 1/2"	3		No			Grind	
4086	BRIDGEPORT ROAD	14812	432-331-01	F3	4	1566	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
4059	BRIDGEPORT ROAD	14821	432-331-29	F3	4	1566	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
4085	BRIDGEPORT ROAD	14832	432-331-03	F3	4	1566	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
4060	BRIDGEPORT ROAD	14851	432-331-26	F3	4	1566	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
4061	BRIDGEPORT ROAD	14851	432-331-26	F3	4	1566	Sidewalk	PCC	Bumps and Sags	1" to 2"			No			Replace Slab	Slab has bump/crack in middle. Slab elevated
4062	BRIDGEPORT ROAD	14851	432-331-26	F3	4	1566	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
4084	BRIDGEPORT ROAD	14852	432-331-05	F3	4	1566	Sidewalk	PCC	Faulting	1/2" to 1"	4		No			Ramp	
4063	BRIDGEPORT ROAD	14861	432-331-25	F3	4	1566	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
4080	BRIDGEPORT ROAD	14862	432-331-06	F3	4	1566	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
4081				F3	4	1566	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	Prev grind

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
4083	BRIDGEPORT ROAD	14862	432-331-06	F3	4	1566	Sidewalk	PCC	Linear Cracking	1/2" to 1"	3.5		No			Grind	
4082	BRIDGEPORT ROAD	14862	432-331-06	F3	4	1566	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	2		Yes			Grind	
4078	BRIDGEPORT ROAD	14892	432-331-09	F3	4	1566	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	Prev grind
4079	BRIDGEPORT ROAD	14892	432-331-09	F3	4	1566	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
4077	BRIDGEPORT ROAD	14892	432-331-09	F3	4	1566	Driveway	PCC	Linear Cracking	1/4" to 1/2"	2		No			Grind	
4064	BRIDGEPORT ROAD	14911	432-331-20	F3	4	1566	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
4076	BRIDGEPORT ROAD	14912	432-331-11	F3	4	1566	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
4065	BRIDGEPORT ROAD	14921	432-331-19	F3	4	1566	Driveway	PCC	Sidewalk Curb Separation	1/2" to 1"	3		No			Patch	Between curb and driveway
4066	BRIDGEPORT ROAD	14921	432-331-19	F3	4	1566	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
4075	BRIDGEPORT ROAD	14922	432-331-12	F3	4	1566	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
4069	BRIDGEPORT ROAD	14931	432-331-17	F3	4	1566	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Between sidewalk ans driveway
4068	BRIDGEPORT ROAD	14931	432-331-17	F3	4	1566	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
4072	BRIDGEPORT ROAD	14932	432-331-14	F3	4	1566	Driveway	PCC	Corner Break	1/4" to 1/2"	3		No			Grind	
4073	BRIDGEPORT ROAD	14932	432-331-14	F3	4	1566	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
4070	BRIDGEPORT ROAD	14941	432-331-16	F3	4	1566	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
4071	BRIDGEPORT ROAD	14942	432-331-15	F3	4	1566	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
4074	BRIDGEPORT ROAD		432-331-13	F3	4	1566	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
4067	BRIDGEPORT ROAD		432-331-18	F3	4	1566	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
4104	BROOKSHIRE AVENUE	1632	432-323-06	F3	4	1569	Ramp	PCC	Sidewalk Curb Separation	1" to 2"	20		No			Replace Ramp	Prev grind
4105	BROOKSHIRE AVENUE	1632	432-323-06	F3	4	1569	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
10536	BROOKSHIRE AVENUE	1632	432-323-06	F3	4	1569	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
4106	BROOKSHIRE AVENUE	1641	432-321-02	F3	4	1569	Driveway	PCC	Faulting	1/4" to 1/2"	5		No			Grind Driveway	Between sidewalk ane driveway
10537	BROOKSHIRE AVENUE	1642	432-323-07	F3	4	1569	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10535	BROOKSHIRE AVENUE	1651	432-321-03	F3	4	1569	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10538	BROOKSHIRE AVENUE	1652	432-323-08	F3	4	1569	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10534	BROOKSHIRE AVENUE	1661	432-321-04	F3	4	1569	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
10689	BROOKSHIRE AVENUE	1661	432-321-04	F3	4	1569	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10688	BROOKSHIRE AVENUE	1681	432-321-06	F3	4	1569	Sidewalk	PCC	Faulting	1" to 2"	4		Yes			Replace Slab	
10687	BROOKSHIRE AVENUE	1691	432-321-07	F3	4	1569	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
10539	BROOKSHIRE AVENUE	1692	432-323-12	F3	4	1569	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
10684	BROOKSHIRE AVENUE	1711	432-321-09	F3	4	1569	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	
10685	BROOKSHIRE AVENUE	1711	432-321-09	F3	4	1569	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
10686	BROOKSHIRE AVENUE	1711	432-321-09	F3	4	1569	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	3		Yes			Grind	
10562	BROOKSHIRE AVENUE	1712	432-323-52	F3	4	1569	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
10563	BROOKSHIRE AVENUE	1712	432-323-52	F3	4	1569	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10683	BROOKSHIRE AVENUE	1721	432-321-10	F3	4	1569	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10682	BROOKSHIRE AVENUE	1721	432-321-10	F3	4	1569	Sidewalk	PCC	Linear Cracking	1/2" to 1"	4		Yes			Grind	
10564	BROOKSHIRE AVENUE	1732	432-323-54	F3	4	1569	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
10859	BROOKSHIRE AVENUE	1751	432-322-01	F3	4	1569	Ramp	PCC	Faulting	1/4" to 1/2"	3		No			Grind Ramp	
10680	BROOKSHIRE AVENUE	1751	432-322-01	F3	4	1569	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	
10681	BROOKSHIRE AVENUE	1751	432-322-01	F3	4	1569	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
10565	BROOKSHIRE AVENUE	1752	432-323-56	F3	4	1569	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
10566	BROOKSHIRE AVENUE	1782	432-323-59	F3	4	1569	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10567	BROOKSHIRE AVENUE	1832	432-281-02	F3	4	1569	Sidewalk	PCC	Faulting	1" to 2"	4		Yes			Replace Slab	
10676	BROOKSHIRE AVENUE	1841	432-271-02	F3	4	1569	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	3		Yes			Grind	
10674	BROOKSHIRE AVENUE	1851	432-271-03	F3	4	1569	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	
10675	BROOKSHIRE AVENUE	1851	432-271-03	F3	4	1569	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	5		Yes			Grind	
10568	BROOKSHIRE AVENUE	1852	432-281-04	F3	4	1569	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10569	BROOKSHIRE AVENUE	1862	432-281-05	F3	4	1569	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10570	BROOKSHIRE AVENUE	1872	432-281-06	F3	4	1569	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
10571	BROOKSHIRE AVENUE	1882	432-281-07	F3	4	1569	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
10673	BROOKSHIRE AVENUE	1891	432-271-63	F3	4	1569	Sidewalk	PCC	Faulting	1/2" to 1"	2		Yes			Ramp	
10672	BROOKSHIRE AVENUE	1891	432-271-63	F3	4	1569	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
10572	BROOKSHIRE AVENUE	1892	432-281-08	F3	4	1569	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10670	BROOKSHIRE AVENUE	1911	432-271-65	G3	4	1569	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10671	BROOKSHIRE AVENUE	1911	432-271-65	F3	4	1569	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
10669	BROOKSHIRE AVENUE	1921	432-271-66	G3	4	1569	Sidewalk	PCC	Faulting	1/2" to 1"	2		Yes			Ramp	
10599	BROOKSHIRE AVENUE	1922	432-281-45	G3	4	1569	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10600	BROOKSHIRE AVENUE	1932	432-281-46	G3	4	1569	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
10668	BROOKSHIRE AVENUE	1941	432-271-68	G3	4	1569	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
10601	BROOKSHIRE AVENUE	1942	432-281-47	G3	4	1569	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
10666	BROOKSHIRE AVENUE	1951	432-271-69	G3	4	1569	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
10667	BROOKSHIRE AVENUE	1951	432-271-69	G3	4	1569	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
10603				G3	4	1569	Sidewalk	PCC	Faulting	1/2" to 1"	2		Yes			Ramp	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
10602	BROOKSHIRE AVENUE	1952	432-281-48	G3	4	1569	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
10665	BROOKSHIRE AVENUE	1961	432-271-70	G3	4	1569	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
10604	BROOKSHIRE AVENUE	1982	432-281-51	G3	4	1569	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	5		Yes			Grind	
10605	BROOKSHIRE AVENUE	1982	432-281-51	G3	4	1569	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	3		Yes			Grind	
10677	BROOKSHIRE AVENUE		432-271-01	F3	4	1569	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
10678	BROOKSHIRE AVENUE		432-271-01	F3	4	1569	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	
10679	BROOKSHIRE AVENUE		432-271-01	F3	4	1569	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
7081	BROWNING AVENUE	14052	432-221-29	F4	4	1333	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	10		Yes			Grind	
7082	BROWNING AVENUE	14072	432-221-28	F4	4	1333	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
7251	BROWNING AVENUE	14092	432-361-03	F4	4	1333	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7253	BROWNING AVENUE	14092	432-361-03	F4	4	1333	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
7254	BROWNING AVENUE	14092	432-361-03	F4	4	1333	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
7257	BROWNING AVENUE	14092	432-361-03	F4	4	1333	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
7255	BROWNING AVENUE	14092	432-361-03	F4	4	1333	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	6		No			Grind	
7252	BROWNING AVENUE	14092	432-361-03	F4	4	1333	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	15		No			Grind	
7256	BROWNING AVENUE	14092	432-361-03	F4	4	1333	Curb/Gutter	PCC	Spalling	1/2" to 1"			No			Replace C&G	
7083	BROWNING AVENUE	14101	432-221-21	F4	4	1333	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
7250	BROWNING AVENUE	14271	432-291-37	F4	4	1332	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
7249	BROWNING AVENUE	14285	432-291-38	F4	4	1332	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	5		No			Grind	
7247	BROWNING AVENUE	14301	432-291-40	F4	4	1332	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No	Yes		Grind	At CATV patch
7182	BROWNING AVENUE	14385	432-302-11	F4	4	1331	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7206	BROWNING AVENUE	14392	432-291-01	F4	4	1331	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No		Yes	Grind	Prev grind
7207	BROWNING AVENUE	14392	432-291-01	F4	4	1331	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No		Yes	Grind	Prev grind
7210	BROWNING AVENUE	14392	432-291-01	F4	4	1331	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No		Yes	Grind	Prev grind
7201	BROWNING AVENUE	14392	432-291-01	F4	4	1331	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No		Yes	Grind	
7202	BROWNING AVENUE	14392	432-291-01	F4	4	1331	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No		Yes	Grind	
7203	BROWNING AVENUE	14392	432-291-01	F4	4	1331	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No		Yes	Grind	
7204	BROWNING AVENUE	14392	432-291-01	F4	4	1331	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No		Yes	Grind	
7205	BROWNING AVENUE	14392	432-291-01	F4	4	1331	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No		Yes	Grind	
7208	BROWNING AVENUE	14392	432-291-01	F4	4	1331	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No		Yes	Grind	
7209	BROWNING AVENUE	14392	432-291-01	F4	4	1331	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No		Yes	Grind	
7197	BROWNING AVENUE	14432	432-302-27	F4	4	1331	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
7198	BROWNING AVENUE	14466	432-302-24	F4	4	1331	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
7200	BROWNING AVENUE	14482	432-302-23	F4	4	1331	Ramp	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind Ramp	
7199	BROWNING AVENUE	14482	432-302-23	F4	4	1331	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
7181	BROWNING AVENUE	1972	432-342-30	F4	4	1331	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
7177	BROWNING AVENUE	1972	432-342-30	F4	4	1332	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
7178	BROWNING AVENUE	1972	432-342-30	F4	4	1332	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
7180	BROWNING AVENUE	1972	432-342-30	F4	4	1331	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	2		No			Grind	
7179	BROWNING AVENUE	1972	432-342-30	F4	4	1332	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	3		Yes			Grind	
7084	BROWNING AVENUE	1981	432-221-20	F4	4	1333	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
7085	BROWNING AVENUE	1981	432-221-20	F4	4	1333	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
7090	BROWNING AVENUE	1982	432-221-13	F4	4	1333	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
7211	BROWNING AVENUE	2012	432-291-02	F4	4	1331	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No		Yes	Grind	
7212	BROWNING AVENUE	2012	432-291-02	F4	4	1331	Sidewalk	PCC	Faulting	1/4" to 1/2"	4.5		No		Yes	Grind	
7213	BROWNING AVENUE	2012	432-291-02	F4	4	1331	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
7248	BROWNING AVENUE		432-291-44	F4	4	1332	Sidewalk	PCC	Faulting	1/4" to 1/2"	4.5		No			Grind	
7785	BUCKINGHAM PLACE	14621	432-231-25	F3	4	1572	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
7795	BUCKINGHAM PLACE	14632	432-231-44	F3	4	1572	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
7793	BUCKINGHAM PLACE	14662	432-231-41	F3	4	1572	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7794	BUCKINGHAM PLACE	14662	432-231-41	F3	4	1572	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
7792	BUCKINGHAM PLACE	14672	432-231-40	F3	4	1572	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
7790	BUCKINGHAM PLACE	14692	432-231-38	F3	4	1572	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
7791	BUCKINGHAM PLACE	14692	432-231-38	F3	4	1572	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
7786	BUCKINGHAM PLACE	14701	432-231-33	F3	4	1572	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
7787	BUCKINGHAM PLACE	14701	432-231-33	F3	4	1572	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
7788	BUCKINGHAM PLACE	14711	432-231-34	F3	4	1572	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
7789	BUCKINGHAM PLACE	14712	432-231-49	F3	4	1572	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
7859	BURLINGAME AVENUE	1892	432-233-08	F3	4	1573	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		Yes			Grind	
7837	BURLINGAME AVENUE	1921	432-243-17	F3	4	1573	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	Prev grind
7838	BURLINGAME AVENUE	1921	432-243-17	F3	4	1573	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
7839	BURLINGAME AVENUE	1921	432-243-17	F3	4	1573	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
7840	BURLINGAME AVENUE	1921	432-243-17	F3	4	1573	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
7836				F3	4	1573	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	4		No			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
7841	BURLINGAME AVENUE	1922	432-243-18	F3	4	1573	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
9183	CANTERBURY AVENUE	14601	432-241-33	F3	4	1585	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
9038	CANTERBURY AVENUE	14602	432-243-04	F3	4	1585	Sidewalk	PCC	Corner Break	1/4" to 1/2"	3		No			Grind	
9039	CANTERBURY AVENUE	14602	432-243-04	F3	4	1585	Driveway	PCC	Linear Cracking	1/4" to 1/2"	8		No			Grind	
9040	CANTERBURY AVENUE	14602	432-243-04	F3	4	1585	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	3		Yes			Grind	
9182	CANTERBURY AVENUE	14611	432-241-34	F3	4	1585	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
9041	CANTERBURY AVENUE	14612	432-243-03	F3	4	1585	Sidewalk	PCC	Faulting	1/4" to 1/2"	10		No			Grind	Between driveway and sidewalk
9181	CANTERBURY AVENUE	14621	432-241-35	F3	4	1585	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Between driveway and sidewalk
9043	CANTERBURY AVENUE	14622	432-243-02	F3	4	1585	Driveway	PCC	Faulting	1/4" to 1/2"	6		No			Grind Driveway	Between driveway and sidewalk
9042	CANTERBURY AVENUE	14622	432-243-02	F3	4	1585	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9044	CANTERBURY AVENUE	14632	432-243-01	F3	4	1585	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No			Grind	Between driveway and sidewalk
9045	CANTERBURY AVENUE	14632	432-243-01	F3	4	1585	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
9180	CANTERBURY AVENUE	14651	432-241-38	F3	4	1585	Sidewalk	PCC	Faulting	1/2" to 1"	3		No			Ramp	Between driveway and sidewalk
9179	CANTERBURY AVENUE	14651	432-241-38	F3	4	1585	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
9128	CANTERBURY AVENUE	14652	432-242-07	F3	4	1585	Driveway	PCC	Sidewalk Curb Separation	1/2" to 1"	12		No			Replace Driveway	Between driveway and curb
9129	CANTERBURY AVENUE	14662	432-242-06	F3	4	1585	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	1.5		Yes			Grind	
9130	CANTERBURY AVENUE	14672	432-242-05	F3	4	1585	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Between driveway and sidewalk
9131	CANTERBURY AVENUE	14672	432-242-05	F3	4	1585	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	1		No			Grind	Prev grind
9132	CANTERBURY AVENUE	14672	432-242-05	F3	4	1585	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9178	CANTERBURY AVENUE	14681	432-241-41	F3	4	1585	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
9133	CANTERBURY AVENUE	14682	432-242-04	F3	4	1585	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
9134	CANTERBURY AVENUE	14682	432-242-04	F3	4	1585	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
9135	CANTERBURY AVENUE	14682	432-242-04	F3	4	1585	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	1		No			Grind	
9177	CANTERBURY AVENUE	14691	432-241-42	F3	4	1585	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
9136	CANTERBURY AVENUE	14712	432-242-01	F3	4	1585	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9138	CANTERBURY AVENUE	14712	432-242-01	F3	4	1585	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
9137	CANTERBURY AVENUE	14712	432-242-01	F3	4	1585	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	8		No			Grind	
10660	CANTERBURY AVENUE	14762	432-272-03	F3	4	1585	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	3		Yes			Grind	
10659	CANTERBURY AVENUE	14782	432-272-05	F3	4	1585	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
10661	CANTERBURY AVENUE	14801	432-271-76	F3	4	1585	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
10662	CANTERBURY AVENUE	14801	432-271-76	F3	4	1585	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
10613	CANTERBURY AVENUE	14812	432-273-06	G3	4	1585	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
10663	CANTERBURY AVENUE	14821	432-271-74	G3	4	1585	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
10612	CANTERBURY AVENUE	14842	432-273-03	G3	4	1585	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10664	CANTERBURY AVENUE	14851	432-271-71	G3	4	1585	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
9184	CANTERBURY AVENUE	1962	432-241-31	F3	4	1585	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
10611	CANTERBURY AVENUE	2001	432-273-02	G3	4	1585	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
9035	CANTERBURY AVENUE	2002	432-243-05	F3	4	1585	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
9036	CANTERBURY AVENUE	2002	432-243-05	F3	4	1585	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9037	CANTERBURY AVENUE	2002	432-243-05	F3	4	1585	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
9046	CAPE COD AVENUE	14631	432-251-67	F3	4	1586	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
9099	CAPE COD AVENUE	14631	432-252-22	F3	4	1586	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
9100	CAPE COD AVENUE	14631	432-252-22	F3	4	1586	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9101	CAPE COD AVENUE	14631	432-252-22	F3	4	1586	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
9047	CAPE COD AVENUE	14631	432-251-67	F3	4	1586	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
9048	CAPE COD AVENUE	14631	432-251-67	F3	4	1586	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9049	CAPE COD AVENUE	14631	432-251-67	F3	4	1586	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9096	CAPE COD AVENUE	14632	432-252-01	F3	4	1586	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9097	CAPE COD AVENUE	14632	432-252-01	F3	4	1586	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
9098	CAPE COD AVENUE	14632	432-252-01	F3	4	1586	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
9093	CAPE COD AVENUE	14652	432-251-14	F3	4	1586	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	Prev grind
9095	CAPE COD AVENUE	14652	432-251-14	F3	4	1586	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	3		No			Grind	Prev grind
9092	CAPE COD AVENUE	14652	432-251-14	F3	4	1586	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
9094	CAPE COD AVENUE	14652	432-251-14	F3	4	1586	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
9127	CAPE COD AVENUE	14652	432-242-07	F3	4	1586	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
9687	CAPER TREE DRIVE	2181	432-267-02	G3	4	1587	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9688	CAPER TREE DRIVE	2182	432-266-02	G3	4	1587	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
9686	CAPER TREE DRIVE	2191	432-267-03	G3	4	1587	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
9685	CAPER TREE DRIVE	2211	432-267-05	G3	4	1587	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
9689	CAPER TREE DRIVE	2212	432-266-05	G3	4	1587	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
9684	CAPER TREE DRIVE	2221	432-267-06	G3	4	1587	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9690	CAPER TREE DRIVE	2222	432-266-06	G3	4	1587	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Prev grind
9691	CAPER TREE DRIVE	2222	432-266-06	G3	4	1587	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
9683			)	G4	4	1587	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
9692	CAPER TREE DRIVE	2262	432-463-04	G4	4	1587	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
9682	CAPER TREE DRIVE	2291	432-461-16	G4	4	1587	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
9693	CAPER TREE DRIVE	2292	432-463-07	G4	4	1587	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9694	CAPER TREE DRIVE	2302	432-463-08	G4	4	1587	Sidewalk	PCC	Faulting	1/2" to 1"	4		No			Ramp	
9624	CAPER TREE DRIVE	2331	432-462-26	G4	4	1588	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
9625	CAPER TREE DRIVE	2331	432-462-26	G4	4	1588	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
9619	CAPER TREE DRIVE	2332	432-462-35	G4	4	1588	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9620	CAPER TREE DRIVE	2332	432-462-35	G4	4	1588	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9621	CAPER TREE DRIVE	2332	432-462-35	G4	4	1588	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
9622	CAPER TREE DRIVE	2352	432-462-33	G4	4	1588	Sidewalk	PCC	Faulting	1/2" to 1"	4		No			Ramp	Between sidewalk and driveway
9623	CAPER TREE DRIVE	2371	432-462-30	G4	4	1588	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
2868	CARFAX AVENUE	14062	432-065-16	E3	4	1589	Driveway	PCC	Linear Cracking	1/4" to 1/2"	6		No			Patch	Also scaling
2866	CARFAX AVENUE	14072	432-065-15	E3	4	1589	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
2867	CARFAX AVENUE	14072	432-065-15	E3	4	1589	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
2870	CARFAX AVENUE	14081	432-063-15	E3	4	1589	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight displacement
2873	CARFAX AVENUE	14081	432-063-15	E3	4	1589	Sidewalk	PCC	Faulting	1" to 2"	5		No			Replace Slab	
2872	CARFAX AVENUE	14081	432-063-15	E3	4	1589	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
2871	CARFAX AVENUE	14081	432-063-15	E3	4	1589	Driveway	PCC	Sidewalk Curb Separation	1/2" to 1"	8		No			Replace Driveway	
2865	CARFAX AVENUE	14082	432-065-14	E3	4	1589	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight displacement
2875	CARFAX AVENUE	14091	432-063-16	E3	4	1589	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
2876	CARFAX AVENUE	14091	432-063-16	E3	4	1589	Driveway	PCC	Faulting	1" to 2"	3		Yes			Replace Driveway	
2874	CARFAX AVENUE	14091	432-063-16	E3	4	1589	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
2877	CARFAX AVENUE	14091	432-063-16	E3	4	1589	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	2		Yes			Grind	
2863	CARFAX AVENUE	14092	432-065-13	E3	4	1589	Sidewalk	PCC	Corner Break	1/4" to 1/2"	2		No			Grind	
2864	CARFAX AVENUE	14092	432-065-13	E3	4	1589	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
2878	CARFAX AVENUE	14101	432-063-17	E3	4	1589	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight displacement
2862	CARFAX AVENUE	14112	432-065-11	E3	4	1589	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
2861	CARFAX AVENUE	14112	432-065-11	E3	4	1589	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	
2860	CARFAX AVENUE	14112	432-065-11	E3	4	1589	Curb/Gutter	PCC	Spalling	1" to 2"	1		No			Patch	
2879	CARFAX AVENUE	14131	432-063-20	E3	4	1589	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
2882	CARFAX AVENUE	14141	432-063-21	E3	4	1589	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
2880	CARFAX AVENUE	14141	432-063-21	E3	4	1589	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight displacement
2881	CARFAX AVENUE	14141	432-063-21	E3	4	1589	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight displacement
2884	CARFAX AVENUE	14191	432-063-24	E3	4	1589	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight displacement
2883	CARFAX AVENUE	14191	432-063-24	E3	4	1589	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
2885	CARFAX AVENUE	14191	432-063-24	E3	4	1589	Driveway	PCC	Linear Cracking	No Displacement	6		No			Joint Seal	
2886	CARFAX AVENUE	14201	432-063-25	E3	4	1589	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight displacement
2859	CARFAX AVENUE	14232	432-065-02	E3	4	1589	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Prev grind
2858	CARFAX AVENUE	14232	432-065-02	E3	4	1589	Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	5		No			Replace Slab	
2857	CARFAX AVENUE	14232	432-065-02	E3	4	1589	Sidewalk	PCC	Spalling	1/4" to 1/2"	0.5		No			Grind	
4915	CARFAX DRIVE	1192	432-131-13	E3	4	1591	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Prev grind
4912	CARFAX DRIVE	1192	432-131-13	E3	4	1591	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
4913	CARFAX DRIVE	1192	432-131-13	E3	4	1591	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
4914	CARFAX DRIVE	1192	432-131-13	E3	4	1591	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
4916	CARFAX DRIVE	1192	432-131-13	E3	4	1591	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
2509	CARFAX DRIVE	1211	432-152-07	F3	4	1590	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	15		No			Grind	
2447	CARFAX DRIVE	1212	432-151-08	F3	4	1590	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
2510	CARFAX DRIVE	1212	432-152-06	F3	4	1590	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
2511	CARFAX DRIVE	1212	432-152-06	F3	4	1590	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
4881	CARFAX DRIVE	14521	432-132-07	E3	4	1591	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
4882	CARFAX DRIVE	14522	432-132-10	E3	4	1591	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	3		No			Grind	
4880	CARFAX DRIVE	14541	432-132-06	E3	4	1591	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		No			Ramp	
4879	CARFAX DRIVE	14541	432-132-06	E3	4	1591	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
4885	CARFAX DRIVE	14542	432-132-11	E3	4	1591	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Between sidewalk and driveway
4883	CARFAX DRIVE	14542	432-132-11	E3	4	1591	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
4884	CARFAX DRIVE	14542	432-132-11	E3	4	1591	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
4887	CARFAX DRIVE	14582	432-132-13	E3	4	1591	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Between sidewalk and driveway
4886	CARFAX DRIVE	14582	432-132-13	E3	4	1591	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
4890	CARFAX DRIVE	14602	432-132-14	E3	4	1591	Driveway	PCC	Sidewalk Curb Separation	1/4" to 1/2"	7		No			Grind	Between curb and driveway
4888	CARFAX DRIVE	14602	432-132-14	E3	4	1591	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
4889	CARFAX DRIVE	14602	432-132-14	E3	4	1591	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
4911	CARFAX DRIVE	14611	432-131-14	E3	4	1591	Driveway	PCC	Faulting	1/4" to 1/2"	5		No			Grind Driveway	Between the sidewalk and driveway
4910	CARFAX DRIVE	14611	432-131-14	E3	4	1591	Sidewalk	PCC	Faulting	1/2" to 1"	2		Yes			Ramp	Prev grind
4909				E3	4	1591	Sidewalk	PCC	Faulting	1/2" to 1"	1		Yes			Ramp	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
4908	CARFAX DRIVE	14611	432-131-14	E3	4	1591	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
4907	CARFAX DRIVE	14621	432-142-14	E3	4	1591	Driveway	PCC	Faulting	1/4" to 1/2"	4		No			Grind Driveway	Between driveway and sidewalk
4906	CARFAX DRIVE	14621	432-142-14	E3	4	1591	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
4891	CARFAX DRIVE	14622	432-143-01	E3	4	1591	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
4905	CARFAX DRIVE	14641	432-142-13	E3	4	1591	Sidewalk	PCC	Faulting	1/4" to 1/2"	7		No			Grind	Running parallel to sidewalk
4893	CARFAX DRIVE	14642	432-143-02	E3	4	1591	Driveway	PCC	Faulting	1/4" to 1/2"	5		No			Grind Driveway	Between driveway and sidewalk
4892	CARFAX DRIVE	14642	432-143-02	E3	4	1591	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
4894	CARFAX DRIVE	14642	432-143-02	E3	4	1591	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
4895	CARFAX DRIVE	14652	432-143-03	E3	4	1591	Driveway	PCC	Faulting	1/4" to 1/2"	3		No			Grind Driveway	Between sidewalk and driveway
4904	CARFAX DRIVE	14681	432-142-11	F3	4	1591	Driveway	PCC	Faulting	1/4" to 1/2"	4		No			Grind Driveway	Between driveway and sidewalk
4898	CARFAX DRIVE	14682	432-143-04	F3	4	1591	Sidewalk	PCC	Faulting	1/2" to 1"	3		No			Ramp	Between driveway and sidewalk
4897	CARFAX DRIVE	14682	432-143-04	F3	4	1591	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Between sidewalk and driveway
4896	CARFAX DRIVE	14682	432-143-04	E3	4	1591	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
4902	CARFAX DRIVE	14691	432-142-10	F3	4	1591	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
4903	CARFAX DRIVE	14691	432-142-10	F3	4	1591	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
4899	CARFAX DRIVE	14692	432-143-05	F3	4	1591	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	2		No			Grind	
4901	CARFAX DRIVE	14711	432-142-09	F3	4	1591	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
4900	CARFAX DRIVE	14712	432-143-06	F3	4	1591	Sidewalk	PCC	Faulting	1/2" to 1"	3		No			Ramp	
2512	CARFAX DRIVE	14742	432-153-01	F3	4	1590	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
2484	CARFAX DRIVE	14792	432-153-05	F3	4	1590	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
2485	CARFAX DRIVE	14792	432-153-05	F3	4	1590	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
2482	CARFAX DRIVE	14802	432-153-06	F3	4	1590	Driveway	PCC	Sidewalk Curb Separation	1/2" to 1"	10		No			Replace Driveway	Between gutter and driveway
2483	CARFAX DRIVE	14802	432-153-06	F3	4	1590	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
2479	CARFAX DRIVE	14842	432-153-09	F3	4	1590	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
2480	CARFAX DRIVE	14842	432-153-09	F3	4	1590	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
2481	CARFAX DRIVE	14842	432-153-09	F3	4	1590	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
2477	CARFAX DRIVE	14852	432-153-10	F3	4	1590	Driveway	PCC	Faulting	1/2" to 1"	3		No			Grind Driveway	Running parallel with sidewalk
2476	CARFAX DRIVE	14852	432-153-10	F3	4	1590	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No		Yes	Grind	
2478	CARFAX DRIVE	14852	432-153-10	F3	4	1590	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
2475	CARFAX DRIVE		432-541-53	F2	4	1590	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
10858	CASTLEGATE AVENUE	1861	432-271-04	F3	4	1597	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	6		No			Grind	Prev grind
12020	CASTLEGATE AVENUE	1861	432-271-04	F3	4	1597	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
12021	CASTLEGATE AVENUE	1861	432-271-04	F3	4	1597	Curb/Gutter	PCC	Linear Cracking	1/4" to 1/2"	6		No			Grind	
10857	CASTLEGATE AVENUE	1862	432-271-05	F3	4	1597	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	10		No			Grind	
10813	CASTLEGATE AVENUE	1881	432-271-62	F3	4	1597	Sidewalk	PCC	Faulting	1/4" to 1/2"		4	No			Grind	Prev grind
10814	CASTLEGATE AVENUE	1881	432-271-62	F3	4	1597	Sidewalk	PCC	Faulting	1/4" to 1/2"		4	No			Grind	Prev grind
12022	CASTLEGATE AVENUE	1881	432-271-62	F3	4	1597	Sidewalk	PCC	Faulting	1/4" to 1/2"		3	No			Grind	Prev grind
10815	CASTLEGATE AVENUE	1882	432-271-61	F3	4	1597	Sidewalk	PCC	Faulting	1/4" to 1/2"		2	No			Grind	
10816	CASTLEGATE AVENUE	1882	432-271-61	F3	4	1597	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	40		No			Grind	
7760	CASTLEWOOD AVENUE	1861	432-231-04	F3	4	1598	Sidewalk	PCC	Faulting	1/2" to 1"	2		Yes			Ramp	Prev grind
7763	CASTLEWOOD AVENUE	1861	432-231-04	F3	4	1598	Sidewalk	PCC	Faulting	1/2" to 1"	4		No			Ramp	Prev grind
7762	CASTLEWOOD AVENUE	1861	432-231-04	F3	4	1598	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	7		No			Replace Slab	Prev grind
7761	CASTLEWOOD AVENUE	1861	432-231-04	F3	4	1598	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
7812	CASTLEWOOD AVENUE	1881	432-232-01	F3	4	1598	Sidewalk	PCC	Faulting	1/2" to 1"	1		Yes			Ramp	Prev grind
7815	CASTLEWOOD AVENUE	1881	432-232-01	F3	4	1598	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		No			Ramp	
7813	CASTLEWOOD AVENUE	1881	432-232-01	F3	4	1598	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7814	CASTLEWOOD AVENUE	1881	432-232-01	F3	4	1598	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
4939	CEDAR LANE	14452	432-381-24	F4	4	1599	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	Prev grind
4937	CEDAR LANE	14461	432-381-26	F4	4	1599	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		No			Ramp	
4938	CEDAR LANE	14461	432-381-26	F4	4	1599	Sidewalk	PCC	Faulting	1/2" to 1"	2.5		No			Ramp	
4935	CEDAR LANE	14461	432-381-26	F4	4	1599	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
4936	CEDAR LANE	14461	432-381-26	F4	4	1599	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	20		No			Grind	
4960	CEDAR LANE	2182	432-381-06	F4	4	1599	Sidewalk	PCC	Faulting	1/2" to 1"	2.5		No			Ramp	Prev grind
4959	CEDAR LANE	2182	432-381-06	F4	4	1599	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
4961	CEDAR LANE	2182	432-381-06	F4	4	1599	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
4963	CEDAR LANE	2192	432-381-05	F4	4	1599	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
4962	CEDAR LANE	2192	432-381-05	F4	4	1599	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	4		No			Grind	
10642	CEDARCREST AVENUE	14812	432-274-01	G3	4	1600	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
10641	CEDARCREST AVENUE	14812	432-274-01	G3	4	1600	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
10643	CEDARCREST AVENUE	14812	432-274-01	G3	4	1600	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
2826	CHARLOMA DRIVE	14012	432-052-12	E3	4	1605	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	7		No			Grind	
2823	CHARLOMA DRIVE	14022	432-052-11	E3	4	1605	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight displacement
2824	CHARLOMA DRIVE	14022	432-052-11	E3	4	1605	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight displacement, Prev grind
2825				E3	4	1605	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
2827	CHARLOMA DRIVE	14031	432-051-31	E3	4	1605	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight displacement, Prev grind
2828	CHARLOMA DRIVE	14041	432-051-30	E3	4	1605	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
2829	CHARLOMA DRIVE	14051	432-051-29	E3	4	1605	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Prev grind
2830	CHARLOMA DRIVE	14061	432-051-28	E3	4	1605	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	
2831	CHARLOMA DRIVE	14061	432-051-28	E3	4	1605	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
2822	CHARLOMA DRIVE	14082	432-052-06	E3	4	1605	Driveway	PCC	Sidewalk Curb Separation	1/2" to 1"	5		No			Patch	
2821	CHARLOMA DRIVE	14102	432-052-05	E3	4	1605	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight displacement
2832	CHARLOMA DRIVE	14111	432-051-25	E3	4	1605	Sidewalk	PCC	Buckled Slab	1" to 2"	3		Yes			Replace Slab	
2820	CHARLOMA DRIVE	14112	432-052-04	E3	4	1605	Driveway	PCC	Faulting	1/4" to 1/2"	4		No			Grind Driveway	
2819	CHARLOMA DRIVE	14112	432-052-04	E3	4	1605	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
2833	CHARLOMA DRIVE	14121	432-051-24	E3	4	1605	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
2834	CHARLOMA DRIVE	14121	432-051-24	E3	4	1605	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
2818	CHARLOMA DRIVE	14122	432-052-03	E3	4	1605	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
2817	CHARLOMA DRIVE	14132	432-052-02	E3	4	1605	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
2835	CHARLOMA DRIVE	14141	432-051-22	E3	4	1605	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
2836	CHARLOMA DRIVE	14141	432-051-22	E3	4	1605	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
2837	CHARLOMA DRIVE	14151	432-051-21	E3	4	1605	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
2838	CHARLOMA DRIVE	14151	432-051-21	E3	4	1605	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
2816	CHARLOMA DRIVE	14152	432-052-01	E3	4	1605	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
2840	CHARLOMA DRIVE	14171	432-051-19	E3	4	1605	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
2839	CHARLOMA DRIVE	14171	432-051-19	E3	4	1605	Driveway	PCC	Faulting	1/2" to 1"	6		No			Grind Driveway	
2556	CHARLOMA DRIVE	14621	432-161-11	E3	4	1604	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Running parallel with sidewalk
2557	CHARLOMA DRIVE	14621	432-161-11	E3	4	1604	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	3		No			Grind	
2555	CHARLOMA DRIVE	14631	432-161-10	F3	4	1604	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	Prev grind
2559	CHARLOMA DRIVE	14632	432-161-13	F3	4	1604	Sidewalk	PCC	Faulting	1/2" to 1"	4		No			Ramp	Running parallel with sidewalk
2558	CHARLOMA DRIVE	14632	432-161-13	F3	4	1604	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
2553	CHARLOMA DRIVE	14641	432-161-09	F3	4	1604	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
2554	CHARLOMA DRIVE	14641	432-161-09	F3	4	1604	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
2560	CHARLOMA DRIVE	14642	432-161-14	F3	4	1604	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
2561	CHARLOMA DRIVE	14652	432-161-15	F3	4	1604	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
2552	CHARLOMA DRIVE	14681	432-161-06	F3	4	1604	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
2562	CHARLOMA DRIVE	14682	432-161-17	F3	4	1604	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
2549	CHARLOMA DRIVE	14691	432-161-05	F3	4	1604	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
2550	CHARLOMA DRIVE	14691	432-161-05	F3	4	1604	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
2551	CHARLOMA DRIVE	14691	432-161-05	F3	4	1604	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
2564	CHARLOMA DRIVE	14692	432-161-18	F3	4	1604	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
2563	CHARLOMA DRIVE	14692	432-161-18	F3	4	1604	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
2565	CHARLOMA DRIVE	14702	432-161-19	F3	4	1604	Sidewalk	PCC	Pothole	1/4" to 1/2"			No			Grind	
2547	CHARLOMA DRIVE	14721	432-161-03	F3	4	1604	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
2548	CHARLOMA DRIVE	14721	432-161-03	F3	4	1604	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
2566	CHARLOMA DRIVE	14722	432-161-20	F3	4	1604	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
2567	CHARLOMA DRIVE	14722	432-161-20	F3	4	1604	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
2302	CHARLOMA DRIVE	14731	432-161-02	F3	4	1604	Sidewalk	PCC	Faulting	1/2" to 1"	2		No			Ramp	
5046	CHERRYWOOD LANE	14201	432-382-23	F4	4	1615	Sidewalk	PCC	Faulting	1/2" to 1"	4.5		No			Ramp	
5048	CHERRYWOOD LANE	14201	432-382-23	F4	4	1615	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
5047	CHERRYWOOD LANE	14201	432-382-23	F4	4	1615	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	4		No		Yes	Grind	
5043	CHERRYWOOD LANE	14211	432-382-22	F4	4	1615	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Prev grind
5044	CHERRYWOOD LANE	14211	432-382-22	F4	4	1615	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
5045	CHERRYWOOD LANE	14211	432-382-22	F4	4	1615	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		Yes			Grind	Prev grind
5042	CHERRYWOOD LANE	14211	432-382-22	F4	4	1615	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
5037	CHERRYWOOD LANE	14221	432-382-21	F4	4	1615	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
5023	CHERRYWOOD LANE	14241	432-382-10	F4	4	1614	Sidewalk	PCC	Faulting	1/2" to 1"	1		Yes			Ramp	Prev grind
5024	CHERRYWOOD LANE	14241	432-382-10	F4	4	1614	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
5022	CHERRYWOOD LANE	14251	432-382-09	F4	4	1614	Sidewalk	PCC	Faulting	1" to 2"	1.5		Yes			Replace Slab	Prev grind
5021	CHERRYWOOD LANE	14251	432-382-09	F4	4	1614	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
5020	CHERRYWOOD LANE	14261	432-382-08	F4	4	1614	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	5		No			Grind	
5104	CHERRYWOOD LANE	14272	432-441-15	F4	4	1614	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No		Yes	Grind	
5105	CHERRYWOOD LANE	14272	432-441-15	F4	4	1614	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No		Yes	Grind	
5107	CHERRYWOOD LANE	14272	432-441-15	F4	4	1614	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No		Yes	Grind	
5106	CHERRYWOOD LANE	14272	432-441-15	F4	4	1614	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	10		No		Yes	Grind	
5019	CHERRYWOOD LANE	14281	432-382-06	F4	4	1614	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5108	CHERRYWOOD LANE	14302	432-441-18	F4	4	1614	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
4999	CHERRYWOOD LANE	14311	432-381-52	F4	4	1614	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5109			)	F4	4	1614	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
4998	CHERRYWOOD LANE	14331	432-381-50	F4	4	1614	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
5110	CHERRYWOOD LANE	14332	432-441-21	F4	4	1614	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
4997	CHERRYWOOD LANE	14341	432-381-49	F4	4	1614	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
4996	CHERRYWOOD LANE	14341	432-381-49	F4	4	1614	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	3		No			Grind	
5111	CHERRYWOOD LANE	14342	432-441-22	F4	4	1614	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
5112	CHERRYWOOD LANE	14352	432-441-23	F4	4	1614	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
4978	CHERRYWOOD LANE	14361	432-381-36	F4	4	1614	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	15		No			Grind	
4976	CHERRYWOOD LANE	14371	432-381-35	F4	4	1614	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
4977	CHERRYWOOD LANE	14371	432-381-35	F4	4	1614	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
4974	CHERRYWOOD LANE	14381	432-381-34	F4	4	1614	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
4975	CHERRYWOOD LANE	14381	432-381-34	F4	4	1614	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
5117	CHERRYWOOD LANE	14382	432-441-04	F4	4	1614	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
5116	CHERRYWOOD LANE	14382	432-441-04	F4	4	1614	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5118	CHERRYWOOD LANE	14392	432-441-05	F4	4	1614	Sidewalk	PCC	Faulting	1" to 2"	3		Yes			Replace Slab	
5120	CHERRYWOOD LANE	14392	432-441-05	F4	4	1614	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
5119	CHERRYWOOD LANE	14392	432-441-05	F4	4	1614	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	15		No			Grind	
4973	CHERRYWOOD LANE	14421	432-381-30	F4	4	1614	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	5		No			Grind	
5121	CHERRYWOOD LANE	14422	432-384-01	F4	4	1614	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
5122	CHERRYWOOD LANE	14422	432-384-01	F4	4	1614	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
5123	CHERRYWOOD LANE	14422	432-384-01	F4	4	1614	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	5		No			Grind	
4972	CHERRYWOOD LANE	14431	432-381-29	F4	4	1614	Sidewalk	PCC	Faulting	1/4" to 1/2"	4.5		No			Grind	
4968	CHERRYWOOD LANE	14441	432-381-28	F4	4	1614	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
4971	CHERRYWOOD LANE	14441	432-381-28	F4	4	1614	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	Prev grind
4969	CHERRYWOOD LANE	14441	432-381-28	F4	4	1614	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
4970	CHERRYWOOD LANE	14441	432-381-28	F4	4	1614	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
5247	CHERRYWOOD LANE	14442	432-383-07	F4	4	1614	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	5		No			Grind	
4967	CHERRYWOOD LANE	14451	432-381-27	F4	4	1614	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Prev grind
4965	CHERRYWOOD LANE	14451	432-381-27	F4	4	1614	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
4966	CHERRYWOOD LANE	14451	432-381-27	F4	4	1614	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
5248	CHERRYWOOD LANE	14452	432-383-06	F4	4	1614	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
5249	CHERRYWOOD LANE	14452	432-383-06	F4	4	1614	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
5250	CHERRYWOOD LANE	14452	432-383-06	F4	4	1614	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
4964	CHERRYWOOD LANE	14461	432-381-26	F4	4	1614	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5251	CHERRYWOOD LANE	14462	432-383-05	F4	4	1614	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
5252	CHERRYWOOD LANE	14462	432-383-05	F4	4	1614	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
5254	CHERRYWOOD LANE	14472	432-383-04	F4	4	1614	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
5253	CHERRYWOOD LANE	14472	432-383-04	F4	4	1614	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	15		No			Grind	
5255	CHERRYWOOD LANE	14482	432-383-03	F4	4	1614	Sidewalk	PCC	Faulting	1" to 2"	2.5		No			Replace Slab	
5256	CHERRYWOOD LANE	14492	432-383-02	F4	4	1614	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
9494	CHERRYWOOD LANE	14511	432-371-38	F4	4	1613	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
9495	CHERRYWOOD LANE	14511	432-371-38	F4	4	1613	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9493	CHERRYWOOD LANE	14521	432-371-37	F4	4	1613	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
9496	CHERRYWOOD LANE	14522	432-372-07	F4	4	1613	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
9498	CHERRYWOOD LANE	14522	432-372-07	F4	4	1613	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
9497	CHERRYWOOD LANE	14522	432-372-07	F4	4	1613	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	1		No			Grind	
9499	CHERRYWOOD LANE	14532	432-372-06	F4	4	1613	Sidewalk	PCC	Faulting	1" to 2"	4		No			Replace Slab	
9492	CHERRYWOOD LANE	14541	432-371-35	F4	4	1613	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
9500	CHERRYWOOD LANE	14542	432-372-05	F4	4	1613	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	Prev grind
9502	CHERRYWOOD LANE	14542	432-372-05	F4	4	1613	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
9501	CHERRYWOOD LANE	14542	432-372-05	F4	4	1613	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	2.5		Yes			Grind	
9489	CHERRYWOOD LANE	14551	432-371-34	F4	4	1613	Sidewalk	PCC	Faulting	1" to 2"	2		No			Replace Slab	
9490	CHERRYWOOD LANE	14551	432-371-34	F4	4	1613	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
9491	CHERRYWOOD LANE	14551	432-371-34	F4	4	1613	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
9488	CHERRYWOOD LANE	14561	432-371-33	F4	4	1613	Driveway	PCC	Sidewalk Curb Separation	1/2" to 1"	10		No			Replace Driveway	Between driveway and curb
9487	CHERRYWOOD LANE	14561	432-371-33	F4	4	1613	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
9505	CHERRYWOOD LANE	14572	432-372-02	F4	4	1613	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	15		No			Grind	Between curb and driveway
9503	CHERRYWOOD LANE	14572	432-372-02	F4	4	1613	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
9504	CHERRYWOOD LANE	14572	432-372-02	F4	4	1613	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
9506	CHERRYWOOD LANE	14572	432-372-02	F4	4	1613	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
9507	CHERRYWOOD LANE	14582	432-372-01	F4	4	1613	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
9158	CHERRYWOOD LANE	14661	432-461-37	G4	4	1612	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No		Yes	Grind	Prev grind
9159	CHERRYWOOD LANE	14661	432-461-37	G4	4	1612	Sidewalk	PCC	Faulting	1/2" to 1"	3.5		No		Yes	Ramp	
9155	CHERRYWOOD LANE	14671	432-461-36	G4	4	1612	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9156				G4	4	1612	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
9157	CHERRYWOOD LANE	14671	432-461-36	G4	4	1612	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
9154	CHERRYWOOD LANE	14681	432-461-35	G4	4	1612	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
9161	CHERRYWOOD LANE	14682	432-461-40	G4	4	1612	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
9151	CHERRYWOOD LANE	14691	432-461-34	G4	4	1612	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
9152	CHERRYWOOD LANE	14691	432-461-34	G4	4	1612	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9153	CHERRYWOOD LANE	14691	432-461-34	G4	4	1612	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
9162	CHERRYWOOD LANE	14692	432-461-41	G4	4	1612	Sidewalk	PCC	Faulting	1/2" to 1"	1		No			Ramp	
9163	CHERRYWOOD LANE	14702	432-461-42	G4	4	1612	Sidewalk	PCC	Faulting	1/2" to 1"	4		No			Ramp	Prev grind
9164	CHERRYWOOD LANE	14702	432-461-42	G4	4	1612	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
9148	CHERRYWOOD LANE	14711	432-461-32	G4	4	1612	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
9149	CHERRYWOOD LANE	14711	432-461-32	G4	4	1612	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
9150	CHERRYWOOD LANE	14711	432-461-32	G4	4	1612	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
9147	CHERRYWOOD LANE	14711	432-461-32	G4	4	1612	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	7		No			Grind	
9165	CHERRYWOOD LANE	14712	432-461-43	G4	4	1612	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
5061	CHERRYWOOD LANE		432-414-30	F4	4	1615	Sidewalk	PCC	Faulting	1/2" to 1"	4.5		No			Ramp	Prev grind
5258	CHERRYWOOD LANE		432-381-01	F4	4	1614	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
5262	CHERRYWOOD LANE		432-381-58	F4	4	1614	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	Prev grind
5099	CHERRYWOOD LANE		432-385-01	F4	4	1614	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No		Yes	Grind	Prev grind
5076	CHERRYWOOD LANE		432-415-13	F4	4	1615	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
5052	CHERRYWOOD LANE		432-411-39	F4	4	1615	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	Prev grind
5260	CHERRYWOOD LANE		432-381-58	F4	4	1614	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No			Grind	Running parallel to sidewalk
5097	CHERRYWOOD LANE		432-385-01	F4	4	1615	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	10		No		Yes	Grind	Running parallel to sidewalk, only 1.5 ft of vert
5267	CHERRYWOOD LANE		432-381-58	F4	4	1614	Curb/Gutter	PCC	Faulting	1/4" to 1/2"			No			Grind C&G	
5086	CHERRYWOOD LANE		432-412-27	F4	4	1615	Driveway	PCC	Faulting	1/4" to 1/2"	3		No			Grind Driveway	
8509	CHERRYWOOD LANE		432-381-01	F4	4	1614	Sidewalk	PCC	Faulting	1/2" to 1"	1		No			Ramp	
5098	CHERRYWOOD LANE		432-385-01	F4	4	1615	Sidewalk	PCC	Faulting	1/2" to 1"	1		Yes		Yes	Ramp	
5081	CHERRYWOOD LANE		432-412-27	F4	4	1615	Sidewalk	PCC	Faulting	1/2" to 1"	3		No			Ramp	
5082	CHERRYWOOD LANE		432-412-27	F4	4	1615	Sidewalk	PCC	Faulting	1/2" to 1"	3.5		Yes			Ramp	
5087	CHERRYWOOD LANE		432-412-27	F4	4	1615	Sidewalk	PCC	Faulting	1/2" to 1"	2		No			Ramp	
5090	CHERRYWOOD LANE		432-412-27	F4	4	1615	Sidewalk	PCC	Faulting	1/2" to 1"	2		Yes			Ramp	
5092	CHERRYWOOD LANE		432-412-27	F4	4	1615	Sidewalk	PCC	Faulting	1/2" to 1"	2.5		No			Ramp	
5257	CHERRYWOOD LANE		432-383-01	F4	4	1614	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5259	CHERRYWOOD LANE		432-381-01	F4	4	1614	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
5265	CHERRYWOOD LANE		432-381-58	F4	4	1614	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
5268	CHERRYWOOD LANE		432-381-58	F4	4	1614	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5114	CHERRYWOOD LANE		432-441-01	F4	4	1614	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
5115	CHERRYWOOD LANE		432-441-01	F4	4	1614	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5113	CHERRYWOOD LANE		432-441-24	F4	4	1614	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5101	CHERRYWOOD LANE		432-385-01	F4	4	1614	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No		Yes	Grind	
5103	CHERRYWOOD LANE		432-385-01	F4	4	1614	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No		Yes	Grind	
5038	CHERRYWOOD LANE		432-385-01	F4	4	1615	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No		Yes	Grind	
5039	CHERRYWOOD LANE		432-385-01	F4	4	1615	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No		Yes	Grind	
5041	CHERRYWOOD LANE		432-385-01	F4	4	1615	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No		Yes	Grind	
5094	CHERRYWOOD LANE		432-385-01	F4	4	1615	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No		Yes	Grind	
5096	CHERRYWOOD LANE		432-385-01	F4	4	1615	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes		Yes	Grind	
5078	CHERRYWOOD LANE		432-412-27	F4	4	1615	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
5079	CHERRYWOOD LANE		432-412-27	F4	4	1615	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
5080	CHERRYWOOD LANE		432-412-27	F4	4	1615	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
5084	CHERRYWOOD LANE		432-412-27	F4	4	1615	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
5088	CHERRYWOOD LANE		432-412-27	F4	4	1615	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
5089	CHERRYWOOD LANE		432-412-27	F4	4	1615	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
5091	CHERRYWOOD LANE		432-412-27	F4	4	1615	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
5077	CHERRYWOOD LANE		432-415-13	F4	4	1615	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5049	CHERRYWOOD LANE		432-411-39	F4	4	1615	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
5050	CHERRYWOOD LANE		432-411-39	F4	4	1615	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
5051	CHERRYWOOD LANE		432-411-39	F4	4	1615	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
5053	CHERRYWOOD LANE		432-411-39	F4	4	1615	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
5054	CHERRYWOOD LANE		432-411-39	F4	4	1615	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
5055	CHERRYWOOD LANE		432-411-39	F4	4	1615	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5074	CHERRYWOOD LANE		432-482-29	F4	4	1615	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
5056	CHERRYWOOD LANE		432-414-30	F4	4	1615	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
5057	CHERRYWOOD LANE		432-414-30	F4	4	1615	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		Yes			Grind	
5058	CHERRYWOOD LANE		432-414-30	F4	4	1615	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
5059			)	F4	4	1615	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
5062	CHERRYWOOD LANE		432-414-30	F4	4	1615	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
5063	CHERRYWOOD LANE		432-414-30	F4	4	1615	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
9160	CHERRYWOOD LANE		432-461-68	G4	4	1612	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No		Yes	Grind	
5093	CHERRYWOOD LANE		432-412-27	F4	4	1615	Sidewalk	PCC	Faulting	No Displacement	4	1.5"	No		Yes	Joint Seal	
5095	CHERRYWOOD LANE		432-385-01	F4	4	1615	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	2		No		Yes	Grind	
5102	CHERRYWOOD LANE		432-385-01	F4	4	1614	Curb/Gutter	PCC	Sidewalk Curb Separation	1" to 2"	10		No		Yes	Replace Curb	
5085	CHERRYWOOD LANE		432-412-27	F4	4	1615	Curb/Gutter	PCC	Sidewalk Curb Separation	1" to 2"	6		No			Replace Curb	
5060	CHERRYWOOD LANE		432-414-30	F4	4	1615	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	4		No			Replace Slab	
5083	CHERRYWOOD LANE		432-412-27	F4	4	1615	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	10		No			Grind	
5100	CHERRYWOOD LANE		432-385-01	F4	4	1614	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	10		No		Yes	Grind	
5040	CHERRYWOOD LANE		432-385-01	F4	4	1615	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	30		No		Yes	Grind	
5075	CHERRYWOOD LANE		432-482-29	F4	4	1615	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	5		No			Grind	
5264	CHERRYWOOD LANE		432-381-58	F4	4	1614	Curb/Gutter	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
7806	CHESHIRE PLACE	14622	432-241-21	F3	4	1616	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
7802	CHESHIRE PLACE	14671	432-241-06	F3	4	1616	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7805	CHESHIRE PLACE	14682	432-241-15	F3	4	1616	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
7803	CHESHIRE PLACE	14691	432-241-08	F3	4	1616	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
7804	CHESHIRE PLACE	14711	432-241-46	F3	4	1616	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7928	CLOVERBROOK AV	14261	432-342-18	F4	4	1618	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
7926	CLOVERBROOK AV	14262	432-342-19	F4	4	1618	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7927	CLOVERBROOK AV	14262	432-342-19	F4	4	1618	Driveway	PCC	Linear Cracking	1/4" to 1/2"	5		No			Grind	
11885	CLOVERBROOK AV	14272	432-342-20	F4	4	1618	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
7924	CLOVERBROOK AV	14282	432-342-21	F4	4	1618	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7925	CLOVERBROOK AV	14282	432-342-21	F4	4	1618	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
7931	CLOVERBROOK AV	14291	432-342-16	F4	4	1618	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	Prev grind
7929	CLOVERBROOK AV	14291	432-342-16	F4	4	1618	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
7930	CLOVERBROOK AV	14291	432-342-16	F4	4	1618	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
7932	CLOVERBROOK AV	14291	432-342-16	F4	4	1618	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
11886	CLOVERBROOK AV	14291	432-342-16	F4	4	1618	Curb/Gutter	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
7923	CLOVERBROOK AV	14292	432-342-22	F4	4	1618	Sidewalk	PCC	Corner Break	1/4" to 1/2"	1		No			Grind	
7921	CLOVERBROOK AV	14302	432-342-23	F4	4	1618	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		Yes			Grind	Prev grind
7922	CLOVERBROOK AV	14302	432-342-23	F4	4	1618	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	Prev grind
11884	CLOVERBROOK AV	14312	432-342-24	F4	4	1618	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
11883	CLOVERBROOK AV	14332	432-342-26	F4	4	1618	Sidewalk	PCC	Spalling	1/4" to 1/2"	0.5		No			Grind	
7944	CLOVERBROOK AV	14391	432-301-47	F3	4	1618	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
11875	CLOVERBROOK AV	14401	432-301-48	F3	4	1618	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
11874	CLOVERBROOK AV	14401	432-301-48	F3	4	1618	Driveway	PCC	Faulting	1/2" to 1"	6		No			Grind Driveway	Resident driveway
11881	CLOVERBROOK AV	14402	432-302-03	F4	4	1618	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
11882	CLOVERBROOK AV	14402	432-302-03	F4	4	1618	Sidewalk	PCC	Spalling	1/4" to 1/2"	0.5		No			Grind	
7945	CLOVERBROOK AV	14431	432-301-50	F3	4	1618	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7920	CLOVERBROOK AV	14452	432-302-07	F3	4	1618	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	Prev grind
7919	CLOVERBROOK AV	14452	432-302-07	F3	4	1618	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
11876	CLOVERBROOK AV	14471	432-301-53	F3	4	1618	Sidewalk	PCC	Spalling	1/4" to 1/2"	0.5		No			Grind	Corner
7946	CLOVERBROOK AV	14471	432-301-53	F3	4	1618	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
7916	CLOVERBROOK AV	14472	432-302-08	F3	4	1618	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		Yes			Grind	
7917	CLOVERBROOK AV	14472	432-302-08	F3	4	1618	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
7918	CLOVERBROOK AV	14472	432-302-08	F3	4	1618	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
11877	CLOVERBROOK AV	14491	432-301-54	F3	4	1618	Driveway	PCC	Faulting	1/2" to 1"	5		No			Grind Driveway	Resident driveway
11878	CLOVERBROOK AV	14491	432-301-54	F3	4	1618	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No			Grind	
7914	CLOVERBROOK AV	14492	432-302-09	F3	4	1618	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
7915	CLOVERBROOK AV	14492	432-302-09	F3	4	1618	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
11880	CLOVERBROOK AV	14492	432-302-09	F3	4	1618	Sidewalk	PCC	Faulting	1/4" to 1/2"	6		No			Grind	
11879	CLOVERBROOK AV	14492	432-302-09	F3	4	1618	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	4		No			Grind	
11873	CLOVERBROOK AV	1892	432-341-14	F4	4	1618	Sidewalk	PCC	Spalling	1/4" to 1/2"	0.5		No			Grind	Corner
9752	COCO PALM DRIVE	14872	432-265-01	G3	4	1619	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Repaired new slab
9753	COCO PALM DRIVE	14872	432-265-01	G3	4	1619	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	Repaired new slab
12035	COCO PALM DRIVE	14872	432-265-01	G3	4	1619	Driveway	PCC	Sidewalk Curb Separation	1/2" to 1"	10		No			Replace Driveway	
9789	COCO PALM DRIVE	14872	432-265-01	G3	4	1619	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	8		No			Grind	
9754	COCO PALM DRIVE	2181	432-264-02	G3	4	1619	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
9751	COCO PALM DRIVE	2191	432-265-12	G3	4	1619	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	Prev grind
9749	COCO PALM DRIVE	2201	432-265-11	G3	4	1619	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
9750	COCO PALM DRIVE	2201	432-265-11	G3	4	1619	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9756	COCO PALM DRIVE	2212	432-264-03	G3	4	1619	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	Prev grind
9755					G3	4	1619	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No		Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
9757	COCO PALM DRIVE	2212	432-264-03	G3	4	1619	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9758	COCO PALM DRIVE	2212	432-264-03	G3	4	1619	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
9760	COCO PALM DRIVE	2222	432-264-04	G3	4	1619	Sidewalk	PCC	Faulting	1/2" to 1"	4		No			Ramp	
9759	COCO PALM DRIVE	2222	432-264-04	G3	4	1619	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
9748	COCO PALM DRIVE	2231	432-422-18	G3	4	1619	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
9761	COCO PALM DRIVE	2232	432-423-01	G3	4	1619	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
9746	COCO PALM DRIVE	2261	432-422-15	G3	4	1619	Sidewalk	PCC	Faulting	1/2" to 1"	3.5		No			Ramp	Repaired new slab
9747	COCO PALM DRIVE	2261	432-422-15	G3	4	1619	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	Repaired new slab
9745	COCO PALM DRIVE	2271	432-422-14	G3	4	1619	Sidewalk	PCC	Faulting	1/2" to 1"	2		No			Ramp	Repaired new slab
9762	COCO PALM DRIVE	2272	432-423-05	G3	4	1619	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
9763	COCO PALM DRIVE	2282	432-423-06	G3	4	1619	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9744	COCO PALM DRIVE	2291	432-422-12	G3	4	1619	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
12034	COCO PALM DRIVE	2301	432-422-11	G3	4	1619	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
9742	COCO PALM DRIVE	2311	432-422-10	G4	4	1619	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	Prev grind
9743	COCO PALM DRIVE	2311	432-422-10	G3	4	1619	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
12033	COCO PALM DRIVE	2311	432-422-10	G4	4	1619	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	10		Yes			Grind	
9764	COCO PALM DRIVE	2312	432-423-09	G3	4	1619	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
9601	COCO PALM DRIVE	2331	432-424-12	G4	4	1619	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
9602	COCO PALM DRIVE	2331	432-424-12	G4	4	1619	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
9603	COCO PALM DRIVE	2331	432-424-12	G4	4	1619	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No			Grind	
9583	COCO PALM DRIVE	2332	432-424-24	G4	4	1619	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9599	COCO PALM DRIVE	2341	432-424-13	G4	4	1619	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Prev grind
9598	COCO PALM DRIVE	2341	432-424-13	G4	4	1619	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9600	COCO PALM DRIVE	2341	432-424-13	G4	4	1619	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
9586	COCO PALM DRIVE	2342	432-424-23	G4	4	1619	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	Prev grind
9584	COCO PALM DRIVE	2342	432-424-23	G4	4	1619	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		No			Ramp	
9585	COCO PALM DRIVE	2342	432-424-23	G4	4	1619	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
9597	COCO PALM DRIVE	2351	432-424-14	G4	4	1619	Sidewalk	PCC	Faulting	1/2" to 1"	3		No			Ramp	Prev grind
9587	COCO PALM DRIVE	2352	432-424-22	G4	4	1619	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
9588	COCO PALM DRIVE	2352	432-424-22	G4	4	1619	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
9596	COCO PALM DRIVE	2361	432-424-15	G4	4	1619	Sidewalk	PCC	Faulting	1/2" to 1"	2.5		No			Ramp	
9594	COCO PALM DRIVE	2361	432-424-15	G4	4	1619	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
9595	COCO PALM DRIVE	2361	432-424-15	G4	4	1619	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9589	COCO PALM DRIVE	2362	432-424-21	G4	4	1619	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
9593	COCO PALM DRIVE	2371	432-424-16	G4	4	1619	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	4		No			Grind	Between curb and driveway
9590	COCO PALM DRIVE	2372	432-424-20	G4	4	1619	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
9591	COCO PALM DRIVE	2381	432-424-17	G4	4	1619	Sidewalk	PCC	Faulting	1/2" to 1"	6		No			Ramp	Repaired new slab
9592	COCO PALM DRIVE	2381	432-424-17	G4	4	1619	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Repaired new slab
8219	COPPERFIELD DRIVE	14421	432-212-14	F3	4	1621	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
8217	COPPERFIELD DRIVE	1552	432-212-06	F3	4	1621	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
8269	COPPERFIELD DRIVE	1591	432-211-07	F3	4	1621	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		Yes			Grind	
8270	COPPERFIELD DRIVE	1591	432-211-07	F3	4	1621	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		Yes			Grind	
8218	COPPERFIELD DRIVE	1612	432-212-11	F3	4	1621	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Running between driveway and sidewalk
8268	COPPERFIELD DRIVE	1625	432-211-10	F3	4	1621	Sidewalk	PCC	Faulting	1/2" to 1"	2		No			Ramp	At utility grate
8267	COPPERFIELD DRIVE	1641	432-211-11	F3	4	1621	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
8265	COPPERFIELD DRIVE	1651	432-211-12	F3	4	1621	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
8266	COPPERFIELD DRIVE	1651	432-211-12	F3	4	1621	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
8264	COPPERFIELD DRIVE	1661	432-211-13	F3	4	1621	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
8263	COPPERFIELD DRIVE	1671	432-211-14	F3	4	1621	Driveway	PCC	Faulting	1/2" to 1"	8		No			Grind Driveway	Prev grinded, between sidewalk and driveway
7897	COPPERFIELD DRIVE	1791	432-301-56	F3	4	1622	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7896	COPPERFIELD DRIVE	1811	432-301-36	F3	4	1622	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
7895	COPPERFIELD DRIVE	1821	432-301-35	F3	4	1622	Driveway	PCC	Sidewalk Curb Separation	1/4" to 1/2"	15		No			Grind	Between driveway and curb
7894	COPPERFIELD DRIVE	1831	432-301-34	F3	4	1622	Driveway	PCC	Sidewalk Curb Separation	1/4" to 1/2"	12		No			Grind	Between driveway and curb
7678	DANBERRY CIRCLE	14632	432-192-39	F3	4	1631	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7660	DANBERRY CIRCLE	14641	432-192-22	F3	4	1631	Sidewalk	PCC	Corner Break	1/2" to 1"	1		No			Ramp	
7661	DANBERRY CIRCLE	14651	432-192-23	F3	4	1631	Sidewalk	PCC	Faulting	1/2" to 1"	1		No			Ramp	Prev grind
7662	DANBERRY CIRCLE	14651	432-192-23	F3	4	1631	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	Prev grind
7663	DANBERRY CIRCLE	14651	432-192-23	F3	4	1631	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		No			Ramp	
7664	DANBERRY CIRCLE	14661	432-192-24	F3	4	1631	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
7665	DANBERRY CIRCLE	14671	432-192-25	F3	4	1631	Sidewalk	PCC	Faulting	1/2" to 1"	2.5		No			Ramp	
7676	DANBERRY CIRCLE	14682	432-192-34	F3	4	1631	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
7677	DANBERRY CIRCLE	14682	432-192-34	F3	4	1631	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7666	DANBERRY CIRCLE	14691	432-192-27	F3	4	1631	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
7674				F3	4	1631	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
7675	DANBERRY CIRCLE	14692	432-192-33	F3	4	1631	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
7668	DANBERRY CIRCLE	14701	432-192-28	F3	4	1631	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		No			Ramp	
7667	DANBERRY CIRCLE	14701	432-192-28	F3	4	1631	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7669	DANBERRY CIRCLE	14701	432-192-28	F3	4	1631	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
7670	DANBERRY CIRCLE	14711	432-192-29	F3	4	1631	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
7673	DANBERRY CIRCLE	14712	432-192-31	F3	4	1631	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
7679	DANBERRY CIRCLE	1672	432-192-40	F3	4	1631	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
7671	DANBERRY CIRCLE		432-192-30	F3	4	1631	Sidewalk	PCC	Faulting	1/2" to 1"	1		No			Ramp	
7672	DANBERRY CIRCLE		432-192-30	F3	4	1631	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
9055	DANBOROUGH ROAD	14531	432-251-57	F4	4	1632	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	Prev grind
9054	DANBOROUGH ROAD	14531	432-251-57	F4	4	1632	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9056	DANBOROUGH ROAD	14531	432-251-57	F4	4	1632	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
9108	DANBOROUGH ROAD	14532	432-252-11	F4	4	1632	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
9109	DANBOROUGH ROAD	14532	432-252-11	F4	4	1632	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
9110	DANBOROUGH ROAD	14542	432-252-10	F4	4	1632	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
9111	DANBOROUGH ROAD	14542	432-252-10	F4	4	1632	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9053	DANBOROUGH ROAD	14581	432-251-62	F3	4	1632	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	Prev grind
9112	DANBOROUGH ROAD	14582	432-252-06	F3	4	1632	Curb/Gutter	PCC	Faulting	1/4" to 1/2"			No			Grind C&G	
9051	DANBOROUGH ROAD	14601	432-251-64	F3	4	1632	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
9052	DANBOROUGH ROAD	14601	432-251-64	F3	4	1632	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9113	DANBOROUGH ROAD	14602	432-252-04	F3	4	1632	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
9114	DANBOROUGH ROAD	14612	432-252-03	F3	4	1632	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
9050	DANBOROUGH ROAD	14621	432-251-66	F3	4	1632	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
9115	DANBOROUGH ROAD	14622	432-252-02	F3	4	1632	Sidewalk	PCC	Faulting	1/2" to 1"	1		No			Ramp	
9116	DANBOROUGH ROAD	14632	432-252-01	F3	4	1632	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9117	DANBOROUGH ROAD	14632	432-252-01	F3	4	1632	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
9118	DANBOROUGH ROAD	14652	432-251-14	F3	4	1632	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
9126	DANBOROUGH ROAD	14661	432-251-02	F3	4	1632	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
9119	DANBOROUGH ROAD	14672	432-251-12	F3	4	1632	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		Yes			Grind	
9121	DANBOROUGH ROAD	14682	432-251-11	F3	4	1632	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
9120	DANBOROUGH ROAD	14682	432-251-11	F3	4	1632	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
9125	DANBOROUGH ROAD	14691	432-251-05	F3	4	1632	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		Yes			Grind	
9122	DANBOROUGH ROAD	14692	432-251-10	F3	4	1632	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9124	DANBOROUGH ROAD	14701	432-251-06	F3	4	1632	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
9123	DANBOROUGH ROAD	14712	432-251-08	F3	4	1632	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
4189	DARSY CIRCLE	1601	432-193-09	F3	4	1633	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
4190	DARSY CIRCLE	1612	432-193-07	F3	4	1633	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
4191	DARSY CIRCLE	1612	432-193-07	F3	4	1633	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
4188	DARSY CIRCLE	1631	432-193-11	F3	4	1633	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
4192	DARSY CIRCLE	1632	432-193-05	F3	4	1633	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		Yes			Grind	
4193	DARSY CIRCLE	1632	432-193-05	F3	4	1633	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	6		No			Grind	
7697	DARTMOUTH CIRCLE	14622	432-201-21	F3	4	1634	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7696	DARTMOUTH CIRCLE	14632	432-201-20	F3	4	1634	Driveway	PCC	Linear Cracking	1/4" to 1/2"	3		No			Grind	
7680	DARTMOUTH CIRCLE	14641	432-201-03	F3	4	1634	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
7695	DARTMOUTH CIRCLE	14642	432-201-19	F3	4	1634	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7691	DARTMOUTH CIRCLE	14652	432-201-18	F3	4	1634	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
7692	DARTMOUTH CIRCLE	14652	432-201-18	F3	4	1634	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
7694	DARTMOUTH CIRCLE	14652	432-201-18	F3	4	1634	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
7693	DARTMOUTH CIRCLE	14652	432-201-18	F3	4	1634	Curb/Gutter	PCC	Sidewalk Curb Separation	Over 2"	4		Yes			Replace C&G	
7681	DARTMOUTH CIRCLE	14661	432-201-05	F3	4	1634	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
7682	DARTMOUTH CIRCLE	14661	432-201-05	F3	4	1634	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
7690	DARTMOUTH CIRCLE	14662	432-201-17	F3	4	1634	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		No			Ramp	
7689	DARTMOUTH CIRCLE	14662	432-201-17	F3	4	1634	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
7683	DARTMOUTH CIRCLE	14671	432-201-06	F3	4	1634	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
7684	DARTMOUTH CIRCLE	14681	432-201-07	F3	4	1634	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
7685	DARTMOUTH CIRCLE	14681	432-201-07	F3	4	1634	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7688	DARTMOUTH CIRCLE	14682	432-201-15	F3	4	1634	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7687	DARTMOUTH CIRCLE	14692	432-201-14	F3	4	1634	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
7686	DARTMOUTH CIRCLE	14712	432-201-50	F3	4	1634	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7898	DEERFIELD AVENUE	14411	432-301-60	F3	4	1638	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7885	DEERFIELD AVENUE	14422	432-303-07	F3	4	1638	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	15		No			Grind	
7899	DEERFIELD AVENUE	14431	432-301-62	F3	4	1638	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
7900	DEERFIELD AVENUE	14441	432-301-63	F3	4	1638	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7884				F3	4	1638	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
7901	DEERFIELD AVENUE	14491	432-301-67	F3	4	1638	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
7882	DEERFIELD AVENUE	14492	432-303-01	F3	4	1638	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	Prev grind
7883	DEERFIELD AVENUE	14492	432-303-01	F3	4	1638	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
7739	DEERFIELD AVENUE	14582	432-201-43	F3	4	1637	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7740	DEERFIELD AVENUE	14582	432-201-43	F3	4	1637	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
7741	DEERFIELD AVENUE	14582	432-201-43	F3	4	1637	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
7742	DEERFIELD AVENUE	14582	432-201-43	F3	4	1637	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
7743	DEERFIELD AVENUE	14582	432-201-43	F3	4	1637	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
7736	DEERFIELD AVENUE	14592	432-201-42	F3	4	1637	Sidewalk	PCC	Faulting	1/2" to 1"	1		Yes			Ramp	
7738	DEERFIELD AVENUE	14592	432-201-42	F3	4	1637	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		Yes			Ramp	
7737	DEERFIELD AVENUE	14592	432-201-42	F3	4	1637	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
7656	DEERFIELD AVENUE	1721	432-202-04	F3	4	1637	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		Yes			Grind	
7655	DEERFIELD AVENUE	1722	432-202-05	F3	4	1637	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	Prev grind
7654	DEERFIELD AVENUE	1722	432-202-05	F3	4	1637	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
2494	DEL AMO AVENUE	1151	432-152-12	F2	4	1640	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
2495	DEL AMO AVENUE	1151	432-152-12	F2	4	1640	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	9		No			Grind	
2492	DEL AMO AVENUE	1152	432-152-01	F2	4	1640	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
2493	DEL AMO AVENUE	1152	432-152-01	F2	4	1640	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
11485	DEL AMO AVENUE	14082	432-063-13	E3	4	1643	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
11475	DEL AMO AVENUE	14091	432-062-04	E3	4	1643	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
11474	DEL AMO AVENUE	14091	432-062-04	E3	4	1643	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
11476	DEL AMO AVENUE	14101	432-062-03	E3	4	1643	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
11477	DEL AMO AVENUE	14121	432-062-01	E3	4	1643	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
11478	DEL AMO AVENUE	14141	432-061-07	E3	4	1643	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
11479	DEL AMO AVENUE	14191	432-061-04	E3	4	1643	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
11484	DEL AMO AVENUE	14192	432-063-04	E3	4	1643	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
11480	DEL AMO AVENUE	14201	432-061-03	E3	4	1643	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
11481	DEL AMO AVENUE	14201	432-061-03	E3	4	1643	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
11482	DEL AMO AVENUE	14231	432-061-01	E3	4	1643	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
11483	DEL AMO AVENUE	14231	432-061-01	E3	4	1643	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
4924	DEL AMO AVENUE	14501	432-131-05	E3	4	1642	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
4926	DEL AMO AVENUE	14501	432-131-05	E3	4	1642	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
4925	DEL AMO AVENUE	14501	432-131-05	E3	4	1642	Driveway	PCC	Linear Cracking	1/4" to 1/2"	5		No			Grind	
4872	DEL AMO AVENUE	14502	432-132-01	E3	4	1642	Driveway	PCC	Sidewalk Curb Separation	1/4" to 1/2"	10		No			Grind	Between sidewalk and driveway
4871	DEL AMO AVENUE	14502	432-132-01	E3	4	1642	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
4921	DEL AMO AVENUE	14521	432-131-06	E3	4	1642	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
4922	DEL AMO AVENUE	14521	432-131-06	E3	4	1642	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
4923	DEL AMO AVENUE	14521	432-131-06	E3	4	1642	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
4920	DEL AMO AVENUE	14541	432-131-07	E3	4	1642	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
4919	DEL AMO AVENUE	14561	432-131-08	E3	4	1642	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
4873	DEL AMO AVENUE	14562	432-132-04	E3	4	1642	Driveway	PCC	Faulting	1/4" to 1/2"	3		No			Grind Driveway	Between sidewalk and driveway
4874	DEL AMO AVENUE	14562	432-132-04	E3	4	1642	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
2330	DEL AMO AVENUE	14611	432-131-16	E3	4	1641	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
2329	DEL AMO AVENUE	14611	432-131-16	E3	4	1641	Driveway	PCC	Linear Cracking	1/4" to 1/2"	7	1"	No			Grind	
2326	DEL AMO AVENUE	14612	432-131-15	E3	4	1641	Driveway	PCC	Sidewalk Curb Separation	1/4" to 1/2"	5		No			Grind	Between driveway and gutter
2328	DEL AMO AVENUE	14612	432-131-15	E3	4	1641	Sidewalk	PCC	Faulting	1/2" to 1"	3		No			Ramp	Running parallel with sidewalk
2325	DEL AMO AVENUE	14612	432-131-15	E3	4	1641	Driveway	PCC	Faulting	1/4" to 1/2"	3	1.5	No			Grind Driveway	
2327	DEL AMO AVENUE	14612	432-131-15	E3	4	1641	Driveway	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind Driveway	
2331	DEL AMO AVENUE	14621	432-141-02	E3	4	1641	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
2332	DEL AMO AVENUE	14641	432-141-03	E3	4	1641	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
2333	DEL AMO AVENUE	14641	432-141-03	E3	4	1641	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
2323	DEL AMO AVENUE	14642	432-142-02	E3	4	1641	Driveway	PCC	Sidewalk Curb Separation	1" to 2"	5		No			Replace Driveway	Between driveway and gutter
2324	DEL AMO AVENUE	14642	432-142-02	E3	4	1641	Sidewalk	PCC	Corner Break	1" to 2"	2		No			Replace Slab	
2321	DEL AMO AVENUE	14642	432-142-02	E3	4	1641	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
2322	DEL AMO AVENUE	14642	432-142-02	E3	4	1641	Driveway	PCC	Linear Cracking	1/4" to 1/2"	7		No			Grind	
2320	DEL AMO AVENUE	14682	432-142-04	E3	4	1641	Driveway	PCC	Sidewalk Curb Separation	1/2" to 1"	8		No			Replace Driveway	Between driveway and gutter
2319	DEL AMO AVENUE	14682	432-142-04	E3	4	1641	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	Prev grind
2334	DEL AMO AVENUE	14691	432-141-06	E3	4	1641	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
2317	DEL AMO AVENUE	14692	432-142-05	E3	4	1641	Driveway	PCC	Sidewalk Curb Separation	1/2" to 1"	8		No			Replace Driveway	Between driveway and gutter
2316	DEL AMO AVENUE	14692	432-142-05	E3	4	1641	Sidewalk	PCC	Faulting	1/2" to 1"	1		No			Ramp	
2315	DEL AMO AVENUE	14692	432-142-05	E3	4	1641	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
2318	DEL AMO AVENUE	14692	432-142-05	E3	4	1641	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
2336	DEL AMO AVENUE	14711	432-141-07	E3	4	1641	Driveway	PCC	Corner Break	1" to 2"	1		No			Replace Slab	
2335					E3	4	1641	Driveway	PCC	Corner Break	1/2" to 1"	1		No		Ramp	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
2314	DEL AMO AVENUE	14712	432-142-06	E3	4	1641	Driveway	PCC	Faulting	1/4" to 1/2"	15		No			Grind Driveway	Running parallel to sidewalk between sidewalk and driveway
2310	DEL AMO AVENUE	14732	432-142-07	F3	4	1641	Driveway	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind Driveway	
2312	DEL AMO AVENUE	14732	432-142-07	E3	4	1641	Sidewalk	PCC	Faulting	1" to 2"	2.5		Yes			Replace Slab	
2311	DEL AMO AVENUE	14732	432-142-07	F3	4	1641	Sidewalk	PCC	Faulting	1/2" to 1"	1		Yes			Ramp	
2313	DEL AMO AVENUE	14732	432-142-07	E3	4	1641	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
2457	DEL AMO AVENUE	14761	432-151-16	F2	4	1640	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
2458	DEL AMO AVENUE	14781	432-151-17	F2	4	1640	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
2459	DEL AMO AVENUE	14791	432-151-18	F2	4	1640	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
2460	DEL AMO AVENUE	14811	432-151-19	F2	4	1640	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
2461	DEL AMO AVENUE	14821	432-151-20	F2	4	1640	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
2462	DEL AMO AVENUE	14831	432-151-21	F2	4	1640	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
2463	DEL AMO AVENUE	14831	432-151-21	F2	4	1640	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
2464	DEL AMO AVENUE	14841	432-151-22	F2	4	1640	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
2465	DEL AMO AVENUE	14841	432-151-22	F2	4	1640	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
2152	DENBIGH LANE	14451	432-117-07	E3	4	1645	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
2153	DENBIGH LANE	14471	432-117-09	E3	4	1645	Sidewalk	PCC	Sidewalk Curb Separation	No Displacement	9	1"	No			Field Assess-Monitor	
2154	DENBIGH LANE	14481	432-117-10	E3	4	1645	Sidewalk	PCC	Sidewalk Curb Separation	No Displacement	6	1"	No			Field Assess-Monitor	
4130	DEVONSHIRE AVENUE	14582	432-192-10	F3	4	1646	Driveway	PCC	Faulting	1/4" to 1/2"	4		No			Grind Driveway	Between driveway and sidewalk
4131	DEVONSHIRE AVENUE	14582	432-192-10	F3	4	1646	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
4197	DEVONSHIRE AVENUE	14591	432-193-04	F3	4	1646	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	
4198	DEVONSHIRE AVENUE	14601	432-193-03	F3	4	1646	Driveway	PCC	Faulting	1/4" to 1/2"	4		No			Grind Driveway	Between sidewalk and driveway
4129	DEVONSHIRE AVENUE	14602	432-192-09	F3	4	1646	Driveway	PCC	Sidewalk Curb Separation	1/2" to 1"	20		No			Replace Driveway	Between curb and driveway
4128	DEVONSHIRE AVENUE	14602	432-192-09	F3	4	1646	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
4199	DEVONSHIRE AVENUE	14611	432-193-02	F3	4	1646	Driveway	PCC	Faulting	1/4" to 1/2"	6		No			Grind Driveway	Between driveway and sidewalk
4200	DEVONSHIRE AVENUE	14611	432-193-02	F3	4	1646	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
4201	DEVONSHIRE AVENUE	14611	432-193-02	F3	4	1646	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
4127	DEVONSHIRE AVENUE	14612	432-192-08	F3	4	1646	Driveway	PCC	Faulting	1/4" to 1/2"	3		No			Grind Driveway	Between driveway and sidewalk
4202	DEVONSHIRE AVENUE	14621	432-193-01	F3	4	1646	Driveway	PCC	Faulting	1/4" to 1/2"	12		No			Grind Driveway	Between sidewalk and driveway
4126	DEVONSHIRE AVENUE	14642	432-192-06	F3	4	1646	Driveway	PCC	Faulting	1/2" to 1"	4		No			Grind Driveway	Between driveway and sidewalk
4284	DEVONSHIRE AVENUE	14651	432-191-07	F3	4	1646	Driveway	PCC	Faulting	1/4" to 1/2"	10		No			Grind Driveway	Between in driveway and sidewalk
4282	DEVONSHIRE AVENUE	14651	432-191-07	F3	4	1646	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		Yes			Grind	Prev grind
4283	DEVONSHIRE AVENUE	14651	432-191-07	F3	4	1646	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
4285	DEVONSHIRE AVENUE	14661	432-191-06	F3	4	1646	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
4286	DEVONSHIRE AVENUE	14681	432-191-04	F3	4	1646	Sidewalk	PCC	Faulting	1/2" to 1"	3.5		No			Ramp	Prev grind
4287	DEVONSHIRE AVENUE	14681	432-191-04	F3	4	1646	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
4288	DEVONSHIRE AVENUE	14681	432-191-04	F3	4	1646	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
4289	DEVONSHIRE AVENUE	14681	432-191-04	F3	4	1646	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
4125	DEVONSHIRE AVENUE	14682	432-192-03	F3	4	1646	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
4291	DEVONSHIRE AVENUE	14691	432-191-03	F3	4	1646	Driveway	PCC	Sidewalk Curb Separation	1" to 2"	10		No			Replace Driveway	Between curb and driveway
4292	DEVONSHIRE AVENUE	14691	432-191-03	F3	4	1646	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	8		No			Grind	Between sidewalk and driveway
4290	DEVONSHIRE AVENUE	14691	432-191-03	F3	4	1646	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
4293	DEVONSHIRE AVENUE	14701	432-191-02	F3	4	1646	Driveway	PCC	Sidewalk Curb Separation	1/2" to 1"	5		No			Patch	Between curb and driveway
4294	DEVONSHIRE AVENUE	14701	432-191-02	F3	4	1646	Driveway	PCC	Sidewalk Curb Separation	1/4" to 1/2"	4		No			Grind	Between driveway and sidewalk
4295	DEVONSHIRE AVENUE	14701	432-191-02	F3	4	1646	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	Prev grind
4296	DEVONSHIRE AVENUE	14701	432-191-02	F3	4	1646	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
4123	DEVONSHIRE AVENUE	14702	432-192-01	F3	4	1646	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
4124	DEVONSHIRE AVENUE	14702	432-192-01	F3	4	1646	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		Yes			Grind	
3980	DEVONSHIRE AVENUE	14711	432-191-01	F3	4	1646	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
4297	DEVONSHIRE AVENUE	14711	432-191-01	F3	4	1646	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
3981	DEVONSHIRE AVENUE	14741	432-311-01	F3	4	1646	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
3982	DEVONSHIRE AVENUE	14741	432-311-01	F3	4	1646	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
4120	DEVONSHIRE AVENUE	14742	432-313-01	F3	4	1646	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
3984	DEVONSHIRE AVENUE	14751	432-311-02	F3	4	1646	Driveway	PCC	Faulting	1/4" to 1/2"	5		No			Grind Driveway	Between driveway and sidewalk
3983	DEVONSHIRE AVENUE	14751	432-311-02	F3	4	1646	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	1		Yes			Grind	
4118	DEVONSHIRE AVENUE	14752	432-313-02	F3	4	1646	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
4119	DEVONSHIRE AVENUE	14752	432-313-02	F3	4	1646	Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	1	2	No			Grind	
3985	DEVONSHIRE AVENUE	14761	432-311-03	F3	4	1646	Driveway	PCC	Faulting	1/4" to 1/2"	3		No			Grind Driveway	Between driveway and sidewalk
3986	DEVONSHIRE AVENUE	14771	432-311-04	F3	4	1646	Driveway	PCC	Faulting	1/4" to 1/2"	1		No			Grind Driveway	Between driveway and sidewalk
4117	DEVONSHIRE AVENUE	14772	432-313-04	F3	4	1646	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
4116	DEVONSHIRE AVENUE	14782	432-313-05	F3	4	1646	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
4115	DEVONSHIRE AVENUE	14792	432-313-06	F3	4	1646	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
4114	DEVONSHIRE AVENUE	14802	432-313-07	F3	4	1646	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
4112	DEVONSHIRE AVENUE	14812	432-313-08	F3	4	1646	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
4113				}	F3	4	1646	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No		Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
4094	DEVONSHIRE AVENUE	14821	432-312-02	F3	4	1646	Driveway	PCC	Faulting	1/4" to 1/2"	2		No			Grind Driveway	Between sidewalk and driveway
4111	DEVONSHIRE AVENUE	14822	432-313-09	F3	4	1646	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
4110	DEVONSHIRE AVENUE	14822	432-313-09	F3	4	1646	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	2		No			Grind	
4095	DEVONSHIRE AVENUE	14831	432-312-03	F3	4	1646	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
4096	DEVONSHIRE AVENUE	14831	432-312-03	F3	4	1646	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
4108	DEVONSHIRE AVENUE	14832	432-313-10	F3	4	1646	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	Prev grind
4109	DEVONSHIRE AVENUE	14832	432-313-10	F3	4	1646	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		Yes			Grind	
4097	DEVONSHIRE AVENUE	14841	432-312-04	F3	4	1646	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
4107	DEVONSHIRE AVENUE	14842	432-321-01	F3	4	1646	Driveway	PCC	Faulting	1/2" to 1"	15		No			Grind Driveway	Between sidewalk and driveway
4194	DEVONSHIRE AVENUE	1632	432-193-05	F3	4	1646	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
4195	DEVONSHIRE AVENUE	1632	432-193-05	F3	4	1646	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	Prev grind
4196	DEVONSHIRE AVENUE	1632	432-193-05	F3	4	1646	Sidewalk	PCC	Faulting	1" to 2"	4		No			Replace Slab	
4121	DEVONSHIRE AVENUE		432-313-71	F3	4	1646	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
4122	DEVONSHIRE AVENUE		432-313-71	F3	4	1646	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
7799	DORCHESTER AVENUE	14621	432-241-01	F3	4	1650	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		No			Ramp	
7800	DORCHESTER AVENUE	14621	432-241-01	F3	4	1650	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
7801	DORCHESTER AVENUE	14621	432-241-01	F3	4	1650	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
7783	DORCHESTER AVENUE	14621	432-231-25	F3	4	1650	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		Yes			Grind	
7784	DORCHESTER AVENUE	14621	432-231-25	F3	4	1650	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
7797	DORCHESTER AVENUE	14622	432-231-45	F3	4	1650	Sidewalk	PCC	Faulting	1/2" to 1"	2		Yes			Ramp	Prev grind
7782	DORCHESTER AVENUE	14622	432-231-24	F3	4	1650	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	Prev grind
7796	DORCHESTER AVENUE	14622	432-231-45	F3	4	1650	Sidewalk	PCC	Faulting	1/2" to 1"	1		No			Ramp	
7798	DORCHESTER AVENUE	14622	432-231-45	F3	4	1650	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
7781	DORCHESTER AVENUE	14622	432-231-24	F3	4	1650	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
7764	DORCHESTER AVENUE	1861	432-231-04	F3	4	1650	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
7765	DORCHESTER AVENUE	1861	432-231-04	F3	4	1650	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
7766	DORCHESTER AVENUE	1861	432-231-04	F3	4	1650	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
7811	DORCHESTER AVENUE	1881	432-232-01	F3	4	1650	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
7809	DORCHESTER AVENUE	1891	432-232-02	F3	4	1650	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		No			Ramp	
7810	DORCHESTER AVENUE	1891	432-232-02	F3	4	1650	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
7808	DORCHESTER AVENUE	1921	432-241-26	F3	4	1650	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7807	DORCHESTER AVENUE	1941	432-241-24	F3	4	1650	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
2466	DRAYTON AVENUE	1142	432-151-23	F2	4	1652	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
2497	DRAYTON AVENUE	1151	432-152-12	F2	4	1652	Sidewalk	PCC	Faulting	1/4" to 1/2"	8		No			Grind	Running along sidewalk
2496	DRAYTON AVENUE	1151	432-152-12	F2	4	1652	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	7		No			Grind	
2468	DRAYTON AVENUE	1152	432-151-24	F2	4	1652	Driveway	PCC	Sidewalk Curb Separation	1/2" to 1"	7		No			Replace Driveway	Between driveway and gutter
2467	DRAYTON AVENUE	1152	432-151-24	F2	4	1652	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	2		No			Grind	
2498	DRAYTON AVENUE	1161	432-152-11	F2	4	1652	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Running parallel with sidewalk
2499	DRAYTON AVENUE	1161	432-152-11	F2	4	1652	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
2500	DRAYTON AVENUE	1181	432-152-10	F2	4	1652	Sidewalk	PCC	Faulting	1/2" to 1"	1		Yes			Ramp	
2501	DRAYTON AVENUE	1181	432-152-10	F2	4	1652	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		Yes			Grind	
2502	DRAYTON AVENUE	1181	432-152-10	F2	4	1652	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
2469	DRAYTON AVENUE	1182	432-151-26	F2	4	1652	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
2503	DRAYTON AVENUE	1191	432-152-09	F2	4	1652	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
2470	DRAYTON AVENUE	1192	432-151-27	F2	4	1652	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
2504	DRAYTON AVENUE	1201	432-152-08	F2	4	1652	Sidewalk	PCC	Corner Break	1/4" to 1/2"	1.5		No			Grind	
2505	DRAYTON AVENUE	1201	432-152-08	F2	4	1652	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
2506	DRAYTON AVENUE	1201	432-152-08	F2	4	1652	Sidewalk	PCC	Faulting	1/4" to 1/2"	12		No			Grind	
2507	DRAYTON AVENUE	1201	432-152-08	F3	4	1652	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
2471	DRAYTON AVENUE	1202	432-151-28	F2	4	1652	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
2472	DRAYTON AVENUE	1202	432-151-28	F2	4	1652	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
2508	DRAYTON AVENUE	1211	432-152-07	F3	4	1652	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
2473	DRAYTON AVENUE	1212	432-151-29	F3	4	1652	Driveway	PCC	Faulting	1/4" to 1/2"	3		No			Grind Driveway	
2474	DRAYTON AVENUE	1212	432-151-29	F3	4	1652	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
3263	EDINGER AVENUE	1021	430-252-05	F2	4	1300	Sidewalk	PCC	Linear Cracking	No Displacement	35		No			Joint Seal	No displacement yet
3255	EDINGER AVENUE	1421	430-263-11	F3	4	1294	Ramp	PCC	Linear Cracking	No Displacement	17		No			Joint Seal	
3253	EDINGER AVENUE	1481	430-263-10	F3	4	1294	Sidewalk	PCC	Other - Leave Comment	Over 2"		6"	No	Yes		Replace Slab	Hole from prev hydrant
3251	EDINGER AVENUE	1481	430-263-10	F3	4	1294	Sidewalk	PCC	Divided Slab	No Displacement			No			Replace Slab	Low
3254	EDINGER AVENUE	1481	430-263-10	F3	4	1294	Sidewalk	PCC	Patch / Utility Cut	1/2" to 1"	2		No	Yes		Grind	
3252	EDINGER AVENUE	1481	430-263-10	F3	4	1294	Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	6		No			Grind	
3262	EDINGER AVENUE	15012	430-252-06	F2	4	1298	Sidewalk	PCC	Linear Cracking	No Displacement	40		No			Joint Seal	No displacement yet
11498	EDINGER AVENUE	1651	430-281-02	F3	4	1291	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
11499	EDINGER AVENUE	1651	430-281-02	F3	4	1291	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
11496				F3	4	1046	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
11497	EDINGER AVENUE	1651	430-281-02	F3	4	1046	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
3258	EDINGER AVENUE		430-263-08	F2	4	1296	Sidewalk	PCC	Spalling	1/2" to 1"	2		No			Replace C&G	Util cover
3257	EDINGER AVENUE		430-263-09	F2	4	1296	Sidewalk	PCC	Corner Break	1/4" to 1/2"	3		No			Grind	
3261	EDINGER AVENUE		430-252-14	F2	4	1298	Driveway	PCC	Faulting	1/2" to 1"	6		No			Grind Driveway	
3256	EDINGER AVENUE		430-263-09	F2	4	1296	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
3260	EDINGER AVENUE		430-263-08	F2	4	1296	Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	15		No			Replace Slab(s)	
3259	EDINGER AVENUE		430-263-08	F2	4	1296	Sidewalk	PCC	Spalling	1/4" to 1/2"	0.5		No			Grind	
1844	EDINGER AVENUE		999-000-07	G3	4	1291	Sidewalk	PCC	Spalling	No Displacement	0.5		No			Field Assess-Monitor	
9381	EL CAMINO REAL	1122	432-074-04	E3	4	1325	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
9394	EL CAMINO REAL	1450	500-142-06	E3	4	1323	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes		Yes	Grind	
9385	EL CAMINO REAL		432-064-05	E3	4	1324	Sidewalk	PCC	Faulting	1/4" to 1/2"	8		Yes		Yes	Grind	Prev grind
9393	EL CAMINO REAL		500-141-29	E3	4	1323	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
9368	EL CAMINO REAL		432-074-08	D3	4	1325	Driveway	PCC	Divided Slab	1" to 2"	8		No		Yes	Replace Slab(s)	
9386	EL CAMINO REAL		432-064-05	E3	4	1324	Sidewalk	PCC	Faulting	1/2" to 1"	8		No	Yes	Yes	Ramp	
9389	EL CAMINO REAL		500-141-26	E3	4	1324	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
9390	EL CAMINO REAL		500-141-26	E3	4	1324	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
9387	EL CAMINO REAL		500-141-24	E3	4	1324	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
9391	EL CAMINO REAL		500-141-21	E3	4	1323	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
9374	EL CAMINO REAL		432-074-09	E3	4	1325	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No		Yes	Grind	
9376	EL CAMINO REAL		432-074-09	E3	4	1325	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes		Yes	Grind	
9378	EL CAMINO REAL		432-074-09	E3	4	1325	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No		Yes	Grind	
9379	EL CAMINO REAL		432-074-09	E3	4	1325	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes		Yes	Grind	
9370	EL CAMINO REAL		432-074-08	D3	4	1325	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes		Yes	Grind	
9369	EL CAMINO REAL		432-074-08	D3	4	1325	Driveway	PCC	Linear Cracking	1/2" to 1"	8		No		Yes	Grind	
9382	EL CAMINO REAL		432-064-05	E3	4	1324	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	5		No		Yes	Grind	
9373	EL CAMINO REAL		432-074-09	E3	4	1325	Driveway	PCC	Punchout	1" to 2"	6		No		Yes	Replace Slab	
9372	EL CAMINO REAL		432-074-08	E3	4	1325	Sidewalk	PCC	Punchout	1" to 2"	12		Yes		Yes	Replace Slab(s)	
9380	EL CAMINO REAL		432-074-09	E3	4	1325	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	6		Yes		Yes	Replace Slab	
9377	EL CAMINO REAL		432-074-09	E3	4	1325	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	12	1"	Yes		Yes	Grind	
9371	EL CAMINO REAL		432-074-08	D3	4	1325	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	16		Yes		Yes	Grind	
9388	EL CAMINO REAL		500-141-24	E3	4	1324	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	8		Yes			Grind	
9392	EL CAMINO REAL		500-141-29	E3	4	1323	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	10		No			Grind	
9375	EL CAMINO REAL		432-074-09	E3	4	1325	Sidewalk	PCC	Spalling	1" to 2"	1		Yes		Yes	Patch	
9383	EL CAMINO REAL		432-064-05	E3	4	1324	Driveway	PCC	Spalling	1/2" to 1"	1		No		Yes	Replace C&G	
9384	EL CAMINO REAL		432-064-05	E3	4	1324	Sidewalk	PCC	Spalling	1/2" to 1"	1		No		Yes	Replace C&G	
5189	ELDER LANE	14311	432-445-10	F4	4	1657	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
5191	ELDER LANE	14311	432-445-10	F4	4	1657	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
5198	ELDER LANE	14321	432-442-17	F4	4	1657	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	8		No			Grind	
5187	ELDER LANE	14322	432-445-08	F4	4	1657	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	10		No			Grind	
5201	ELDER LANE	14342	432-442-01	F4	4	1657	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5204	ELDER LANE	14342	432-442-01	F4	4	1657	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	15		No			Grind	
4208	EMERYWOOD ROAD	14502	432-181-76	F3	4	1660	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
4209	EMERYWOOD ROAD	14511	432-181-74	F3	4	1660	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
4210	EMERYWOOD ROAD	14511	432-181-74	F3	4	1660	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
4211	EMERYWOOD ROAD	14521	432-181-73	F3	4	1660	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Prev grind
4212	EMERYWOOD ROAD	14521	432-181-73	F3	4	1660	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
4213	EMERYWOOD ROAD	14521	432-181-73	F3	4	1660	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
4214	EMERYWOOD ROAD	14531	432-181-72	F3	4	1660	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
4207	EMERYWOOD ROAD	14552	432-181-82	F3	4	1660	Driveway	PCC	Faulting	1/4" to 1/2"	5		No			Grind Driveway	Between driveway and sidewalk
4215	EMERYWOOD ROAD	14561	432-181-69	F3	4	1660	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
4206	EMERYWOOD ROAD	14562	432-181-83	F3	4	1660	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
4205	EMERYWOOD ROAD	14612	432-181-88	F3	4	1660	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
4216	EMERYWOOD ROAD	14621	432-181-63	F3	4	1660	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
4204	EMERYWOOD ROAD	14622	432-181-89	F3	4	1660	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
4203	EMERYWOOD ROAD	14632	432-181-90	F3	4	1660	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
4274	EMERYWOOD ROAD	14672	432-181-03	F3	4	1660	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
4273	EMERYWOOD ROAD	14672	432-181-03	F3	4	1660	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
4272	EMERYWOOD ROAD	14682	432-181-04	F3	4	1660	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
4271	EMERYWOOD ROAD	14692	432-181-05	F3	4	1660	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
4269	EMERYWOOD ROAD	14702	432-181-06	F3	4	1660	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
4270	EMERYWOOD ROAD	14702	432-181-06	F3	4	1660	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
4265	EMERYWOOD ROAD	14711	432-181-09	F3	4	1660	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
4268	EMERYWOOD ROAD	14712	432-181-07	F3	4	1660	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
4266				}	F3	4	1660	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No		Grind	



3548 Seagate Way, Suite 230
Oceanside, CA 92056
T: (760) 216-6529
www.bucknam-inc.com

Bucknam understands that the City will make all final decisions on sidewalk improvement types and repair locations

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
4267	EMERYWOOD ROAD		432-181-08	F3	4	1660	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
10648	FALLEN LEAF PLACE	14921	432-261-01	G3	4	1669	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10647	FALLEN LEAF PLACE	14921	432-261-01	G3	4	1669	Sidewalk	PCC	Spalling	1" to 2"	1		No			Patch	
10625	FALLEN LEAF PLACE	14922	432-262-12	G3	4	1669	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
10624	FALLEN LEAF PLACE	14922	432-262-12	G3	4	1669	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10626	FALLEN LEAF PLACE	14922	432-262-12	G3	4	1669	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
10627	FALLEN LEAF PLACE	14922	432-262-12	G3	4	1669	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10650	FALLEN LEAF PLACE	14922	432-282-05	G3	4	1669	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
10649	FALLEN LEAF PLACE	14922	432-282-05	G3	4	1669	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	3		Yes			Grind	
10628	FALLEN LEAF PLACE	14922	432-262-12	G3	4	1669	Curb/Gutter	PCC	Sidewalk Curb Separation	Over 2"	25		Yes			Replace C&G	
10651	FALLEN LEAF PLACE	14922	432-282-05	G3	4	1669	Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	20		Yes			Replace Slab(s)	
10617	FALLEN LEAF PLACE	2001	432-281-61	G3	4	1669	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
10616	FALLEN LEAF PLACE	2001	432-281-61	G3	4	1669	Sidewalk	PCC	Linear Cracking	1/2" to 1"	4		Yes			Grind	
10618	FALLEN LEAF PLACE	2042	432-281-66	G3	4	1669	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
10619	FALLEN LEAF PLACE	2132	432-262-07	G3	4	1669	Sidewalk	PCC	Faulting	1/2" to 1"	3		No			Ramp	
10622	FALLEN LEAF PLACE	2141	432-262-39	G3	4	1669	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
10623	FALLEN LEAF PLACE	2141	432-262-39	G3	4	1669	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
10620	FALLEN LEAF PLACE	2142	432-262-08	G3	4	1669	Sidewalk	PCC	Faulting	1" to 2"	5		No			Replace Slab	
10621	FALLEN LEAF PLACE	2152	432-262-38	G3	4	1669	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
10658	FEATHERHILL ROAD	14742	432-272-11	F3	4	1678	Sidewalk	PCC	Faulting	1/2" to 1"	1		Yes			Ramp	
10657	FEATHERHILL ROAD	14742	432-272-11	F3	4	1678	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
10656	FEATHERHILL ROAD	14752	432-272-12	F3	4	1678	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
10655	FEATHERHILL ROAD	14812	432-274-01	G3	4	1678	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
10654	FEATHERHILL ROAD	14822	432-274-02	G3	4	1678	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
10614	FEATHERHILL ROAD	14861	432-273-12	G3	4	1678	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
10653	FEATHERHILL ROAD	14872	432-274-07	G3	4	1678	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
10652	FEATHERHILL ROAD	14892	432-282-02	G3	4	1678	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10615	FEATHERHILL ROAD	14911	432-281-58	G3	4	1678	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
7225	FERNBROOK DRIVE	14262	432-291-19	F4	4	1679	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
7226	FERNBROOK DRIVE	14262	432-291-19	F4	4	1679	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7223	FERNBROOK DRIVE	14272	432-291-18	F4	4	1679	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7224	FERNBROOK DRIVE	14272	432-291-18	F4	4	1679	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
7227	FERNBROOK DRIVE	14291	432-291-23	F4	4	1679	Driveway	PCC	Sidewalk Curb Separation	1/4" to 1/2"	4		No			Grind	Between driveway and curb
7228	FERNBROOK DRIVE	14301	432-291-24	F4	4	1679	Driveway	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind Driveway	Between sidewalk and driveway
7229	FERNBROOK DRIVE	14311	432-291-25	F4	4	1679	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
7230	FERNBROOK DRIVE	14321	432-291-26	F4	4	1679	Driveway	PCC	Faulting	1/4" to 1/2"	4		No			Grind Driveway	Between sidewalk and driveway
7222	FERNBROOK DRIVE	14322	432-291-13	F4	4	1679	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
9434	FIG TREE DRIVE	14581	432-451-13	G4	4	1682	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
9435	FIG TREE DRIVE	14581	432-451-13	G4	4	1682	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	Prev grind
9436	FIG TREE DRIVE	14581	432-451-13	G4	4	1682	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
9433	FIG TREE DRIVE	14581	432-451-13	G4	4	1682	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9437	FIG TREE DRIVE	14581	432-451-13	G4	4	1682	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
9510	FIG TREE DRIVE	14581	432-451-01	F4	4	1682	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
9511	FIG TREE DRIVE	14581	432-451-01	F4	4	1682	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
9512	FIG TREE DRIVE	14581	432-451-01	F4	4	1682	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
9485	FIG TREE DRIVE	14581	432-371-31	F4	4	1682	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9486	FIG TREE DRIVE	14581	432-371-31	F4	4	1682	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
9508	FIG TREE DRIVE	14582	432-372-01	F4	4	1682	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
9448	FIG TREE DRIVE	14582	432-453-04	G4	4	1683	Sidewalk	PCC	Faulting	1/2" to 1"	2		No			Ramp	
9431	FIG TREE DRIVE	14582	432-451-12	G4	4	1682	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
9509	FIG TREE DRIVE	14582	432-372-01	F4	4	1682	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
9483	FIG TREE DRIVE	14582	432-371-30	F4	4	1682	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
9484	FIG TREE DRIVE	14582	432-371-30	F4	4	1682	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9446	FIG TREE DRIVE	14582	432-453-04	G4	4	1683	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9447	FIG TREE DRIVE	14582	432-453-04	G4	4	1683	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
9432	FIG TREE DRIVE	14582	432-451-12	G4	4	1682	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	1		Yes			Grind	
9449	FIG TREE DRIVE	2331	432-453-07	G4	4	1683	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
9452	FIG TREE DRIVE	2352	432-453-12	G4	4	1683	Sidewalk	PCC	Corner Break	No Displacement	4		No			Patch	
9450	FIG TREE DRIVE	2361	432-453-10	G4	4	1683	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9451	FIG TREE DRIVE	2362	432-453-11	G4	4	1683	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
9453	FIG TREE DRIVE		432-452-01	G4	4	1682	Sidewalk	PCC	Corner Break	1/4" to 1/2"	5		No		Yes	Grind	Prev grind
9456	FIG TREE DRIVE		432-452-01	F4	4	1682	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No		Yes	Grind	Prev grind
9871	FIG TREE DRIVE		432-452-01	F4	4	1682	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	5		No		Yes	Grind	Running parallel with sidewalk
9868				F4	4	1682	Sidewalk	PCC	Corner Break	1/4" to 1/2"	1.5		No		Yes	Grind	



3548 Seagate Way, Suite 230
Oceanside, CA 92056
T: (760) 216-6529
www.bucknam-inc.com

Bucknam understands that the City will make all final decisions on sidewalk improvement types and repair locations

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
9454	FIG TREE DRIVE		432-452-01	F4	4	1682	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No		Yes	Grind	
9457	FIG TREE DRIVE		432-452-01	F4	4	1682	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No		Yes	Grind	
9455	FIG TREE DRIVE		432-452-01	F4	4	1682	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	5		No		Yes	Grind	
9458	FIG TREE DRIVE		432-452-01	F4	4	1682	Ramp	PCC	Sidewalk Curb Separation	1/4" to 1/2"	6		No		Yes	Grind	
2155	FORESTERRA LANE	1352	432-117-11	E3	4	1686	Curb/Gutter	PCC	Spalling	1" to 2"	1		No			Patch	
2158	FORESTERRA LANE	1362	432-117-12	E3	4	1686	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Util cover
2157	FORESTERRA LANE	1362	432-117-12	E3	4	1686	Sidewalk	PCC	Linear Cracking	No Displacement	5		No			Joint Seal	
2156	FORESTERRA LANE	1362	432-117-12	E3	4	1686	Curb/Gutter	PCC	Spalling	1" to 2"	0.5		No			Patch	
2159	FORESTERRA LANE	1382	432-117-14	E3	4	1686	Driveway	PCC	Sidewalk Curb Separation	1/4" to 1/2"	4		No			Grind	Prev grind
2045	FORESTERRA LANE	1402	432-116-05	E3	4	1686	Sidewalk	PCC	Buckled Slab	1/2" to 1"			No			Replace Slab	Cracked in middle
2047	FORESTERRA LANE	1402	432-116-05	E3	4	1686	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
2046	FORESTERRA LANE	1402	432-116-05	E3	4	1686	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
2048	FORESTERRA LANE	14462	432-116-01	E3	4	1686	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	2		Yes			Grind	
10636	FOXCROFT ROAD	14741	432-262-31	G3	4	1687	Sidewalk	PCC	Faulting	1" to 2"	7		No			Replace Slab	
10637	FOXCROFT ROAD	14751	432-262-32	G3	4	1687	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10635	FOXCROFT ROAD	14752	432-262-54	G3	4	1687	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
10638	FOXCROFT ROAD	14761	432-262-33	G3	4	1687	Sidewalk	PCC	Faulting	1/2" to 1"	3		No			Ramp	
10634	FOXCROFT ROAD	14762	432-262-53	G3	4	1687	Sidewalk	PCC	Corner Break	1" to 2"	2		No			Replace Slab	
10640	FOXCROFT ROAD	14771	432-262-34	G3	4	1687	Sidewalk	PCC	Faulting	1/2" to 1"	4		No			Ramp	
10639	FOXCROFT ROAD	14771	432-262-34	G3	4	1687	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	5		No			Grind	
10633	FOXCROFT ROAD	14772	432-262-52	G3	4	1687	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	3		Yes			Grind	
10632	FOXCROFT ROAD	14802	432-262-49	G3	4	1687	Sidewalk	PCC	Faulting	1/2" to 1"	5		No			Ramp	
10630	FOXCROFT ROAD	14822	432-262-47	G3	4	1687	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
10631	FOXCROFT ROAD	14822	432-262-47	G3	4	1687	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10644	FOXCROFT ROAD	14861	432-261-07	G3	4	1687	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	
10645	FOXCROFT ROAD	14881	432-261-05	G3	4	1687	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
10629	FOXCROFT ROAD	14902	432-262-14	G3	4	1687	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
10646	FOXCROFT ROAD	14921	432-261-01	G3	4	1687	Sidewalk	PCC	Faulting	1/2" to 1"	3		No			Ramp	
10897	GLENARBOR AVENUE	1721	432-321-10	F3	4	1695	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
10860	GLENARBOR AVENUE	1752	432-313-70	F3	4	1695	Sidewalk	PCC	Faulting	1/2" to 1"	4		No			Ramp	
4100	GRANDOAKS CIRCLE	1601	432-323-03	F3	4	1696	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
4101	GRANDOAKS CIRCLE	1602	432-323-04	F3	4	1696	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
4099	GRANDOAKS CIRCLE	1621	432-323-01	F3	4	1696	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
4098	GRANDOAKS CIRCLE	1621	432-323-01	F3	4	1696	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
4102	GRANDOAKS CIRCLE	1622	432-323-05	F3	4	1696	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
4103	GRANDOAKS CIRCLE	1632	432-323-06	F3	4	1696	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
2052	GRASSMERE LANE	1402	432-116-05	E3	4	1697	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
2053	GRASSMERE LANE	1402	432-116-05	E3	4	1697	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	
2077	GRASSMERE LANE	1411	432-115-11	E3	4	1697	Ramp	PCC	Faulting	1" to 2"	6		Yes			Replace Ramp	Prev grind
2073	GRASSMERE LANE	1411	432-115-11	E3	4	1697	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
2075	GRASSMERE LANE	1411	432-115-11	E3	4	1697	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
2076	GRASSMERE LANE	1411	432-115-11	E3	4	1697	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
2074	GRASSMERE LANE	1411	432-115-11	E3	4	1697	Sidewalk	PCC	Spalling	1" to 2"	1		No			Patch	
2072	GRASSMERE LANE	1412	432-115-10	E3	4	1697	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	5		No			Grind	
2060	GRASSMERE LANE	14402	432-111-29	E3	4	1697	Driveway	PCC	Sidewalk Curb Separation	1/2" to 1"	6		No			Patch	
2059	GRASSMERE LANE	14422	432-111-31	E3	4	1697	Curb/Gutter	PCC	Spalling	1/4" to 1/2"	0.5		No			Grind	
2058	GRASSMERE LANE	14442	432-111-33	E3	4	1697	Sidewalk	PCC	Patch / Utility Cut	1/2" to 1"	2		No			Grind	
2056	GRASSMERE LANE	14462	432-111-35	E3	4	1697	Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	1		No			Grind	Util cut for drainage
2057	GRASSMERE LANE	14462	432-111-35	E3	4	1697	Curb/Gutter	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
10544	GREEN MEADOW AVENUE	1602	432-323-24	F3	4	1698	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
10542	GREEN MEADOW AVENUE	1631	432-323-19	F3	4	1698	Sidewalk	PCC	Spalling	1" to 2"	1		Yes			Patch	
10545	GREEN MEADOW AVENUE	1642	432-323-28	F3	4	1698	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10546	GREEN MEADOW AVENUE	1642	432-323-28	F3	4	1698	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		Yes			Grind	
10547	GREEN MEADOW AVENUE	1642	432-323-28	F3	4	1698	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
10548	GREEN MEADOW AVENUE	1642	432-323-28	F3	4	1698	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
10549	GREEN MEADOW AVENUE	1652	432-323-29	F3	4	1698	Sidewalk	PCC	Spalling	Over 2"	3		Yes			Patch	
10541	GREEN MEADOW AVENUE	1691	432-323-13	F3	4	1698	Sidewalk	PCC	Spalling	1" to 2"	1		No			Patch	
10550	GREEN MEADOW AVENUE	1692	432-323-33	F3	4	1698	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
10551	GREEN MEADOW AVENUE	1702	432-323-34	F3	4	1698	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
10552	GREEN MEADOW AVENUE	1712	432-323-35	F3	4	1698	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
10553	GREEN MEADOW AVENUE	1752	432-323-39	F3	4	1698	Curb/Gutter	PCC	Sidewalk Curb Separation	1" to 2"	5		No			Replace Curb	
10558	GREEN MEADOW AVENUE	1761	432-323-46	F3	4	1698	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	3		No			Grind	
10554	GREEN MEADOW AVENUE	1762	432-323-40	F3	4	1698	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
10557				F3	4	1698	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
10555	GREEN MEADOW AVENUE	1772	432-323-41	F3	4	1698	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
10556	GREEN MEADOW AVENUE	1781	432-323-44	F3	4	1698	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
10543	GREEN MEADOW AVENUE		432-323-23	F3	4	1698	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No			Grind	
2175	GREEN VALLEY AVENUE	14241	432-091-03	E3	4	1699	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
2174	GREEN VALLEY AVENUE	14241	432-091-03	E3	4	1699	Cross Gutter	PCC	Linear Cracking	1/4" to 1/2"	5		No			Grind	
2179	GREEN VALLEY AVENUE	14242	432-091-40	E3	4	1699	Curb/Gutter	PCC	Spalling	1" to 2"	1		No			Patch	
2180	GREEN VALLEY AVENUE	14252	432-091-41	E3	4	1699	Cross Gutter	PCC	Divided Slab	No Displacement			No			Replace Slab	
2181	GREEN VALLEY AVENUE	14252	432-091-41	E3	4	1699	Cross Gutter	PCC	Linear Cracking	1/4" to 1/2"	5		No			Grind	
2178	GREEN VALLEY AVENUE	14312	432-091-15	E3	4	1699	Driveway	PCC	Corner Break	1/4" to 1/2"	3		No			Grind	
2177	GREEN VALLEY AVENUE	14322	432-091-14	E3	4	1699	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	6		Yes			Grind	
2176	GREEN VALLEY AVENUE	14331	432-091-08	E3	4	1699	Curb/Gutter	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
2121	HAMLET LANE	14291	432-093-04	E3	4	1705	Sidewalk	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
2120	HAMLET LANE	14291	432-093-04	E3	4	1705	Curb/Gutter	PCC	Spalling	Over 2"	1		No			Replace C&G	
2122	HAMLET LANE	14301	432-093-05	E3	4	1705	Curb/Gutter	PCC	Spalling	1/2" to 1"	0.5		No			Replace C&G	
2131	HAMLET LANE	14302	432-092-02	E3	4	1705	Curb/Gutter	PCC	Spalling	1/2" to 1"	0.5		No			Replace C&G	
2123	HAMLET LANE	14311	432-093-06	E3	4	1705	Curb/Gutter	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
2130	HAMLET LANE	14322	432-092-04	E3	4	1705	Curb/Gutter	PCC	Spalling	1/2" to 1"	0.5		No			Replace C&G	
2125	HAMLET LANE	14361	432-093-11	E3	4	1705	Driveway	PCC	Sidewalk Curb Separation	1/4" to 1/2"	5		No			Grind	
2126	HAMLET LANE	14361	432-093-11	E3	4	1705	Sidewalk	PCC	Sidewalk Curb Separation	No Displacement	5	1"	No			Field Assess-Monitor	
2124	HAMLET LANE	14361	432-093-11	E3	4	1705	Curb/Gutter	PCC	Spalling	1" to 2"	0.5		No			Patch	
4217	HAMPDEN AVENUE	14631	432-181-62	F3	4	1706	Sidewalk	PCC	Corner Break	1/4" to 1/2"	1		No			Grind	
4218	HAMPDEN AVENUE	14631	432-181-62	F3	4	1706	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
4219	HAMPDEN AVENUE	14632	432-181-61	F3	4	1706	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
4220	HAMPDEN AVENUE	14632	432-181-61	F3	4	1706	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
4221	HAMPDEN AVENUE	14632	432-181-61	F3	4	1706	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
4222	HAMPDEN AVENUE	14632	432-181-61	F3	4	1706	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
4279	HAMPDEN AVENUE	14651	432-191-07	F3	4	1706	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
4277	HAMPDEN AVENUE	14651	432-191-07	F3	4	1706	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
4278	HAMPDEN AVENUE	14651	432-191-07	F3	4	1706	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
4280	HAMPDEN AVENUE	14651	432-191-07	F3	4	1706	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No			Grind	
4264	HAMPDEN AVENUE	14651	432-181-15	F3	4	1706	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
4281	HAMPDEN AVENUE	14651	432-191-07	F3	4	1706	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	5		No			Grind	
4276	HAMPDEN AVENUE	14652	432-181-01	F3	4	1706	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	Prev grind
4261	HAMPDEN AVENUE	14652	432-181-16	F3	4	1706	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	Prev grind
4275	HAMPDEN AVENUE	14652	432-181-01	F3	4	1706	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
4262	HAMPDEN AVENUE	14652	432-181-16	F3	4	1706	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
4263	HAMPDEN AVENUE	14652	432-181-16	F3	4	1706	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		Yes			Grind	
7853	HAMPSHIRE ROAD	1831	432-233-16	F3	4	1707	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
7855	HAMPSHIRE ROAD	1832	432-233-14	F3	4	1707	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
7854	HAMPSHIRE ROAD	1832	432-233-14	F3	4	1707	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7856	HAMPSHIRE ROAD	1842	432-233-13	F3	4	1707	Sidewalk	PCC	Faulting	1/2" to 1"	10		No			Ramp	Between sidewalk and driveway
7852	HAMPSHIRE ROAD	1861	432-233-19	F3	4	1707	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	Prev grind
7857	HAMPSHIRE ROAD	1872	432-233-10	F3	4	1707	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
7851	HAMPSHIRE ROAD	1881	432-233-21	F3	4	1707	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
7849	HAMPSHIRE ROAD	1891	432-233-22	F3	4	1707	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
7850	HAMPSHIRE ROAD	1891	432-233-22	F3	4	1707	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		No			Ramp	
7858	HAMPSHIRE ROAD	1892	432-233-08	F3	4	1707	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	6		No			Grind	
7847	HAMPSHIRE ROAD	1901	432-233-23	F3	4	1707	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
7848	HAMPSHIRE ROAD	1901	432-233-23	F3	4	1707	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
7846	HAMPSHIRE ROAD	1931	432-243-32	F3	4	1707	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
7845	HAMPSHIRE ROAD	1941	432-243-31	F3	4	1707	Sidewalk	PCC	Faulting	1/2" to 1"	2		Yes			Ramp	
7842	HAMPSHIRE ROAD	1972	432-243-23	F3	4	1707	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7844	HAMPSHIRE ROAD	1991	432-243-26	F3	4	1707	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
7843	HAMPSHIRE ROAD	1992	432-243-25	F3	4	1707	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
7734	HEATHER AVENUE	14592	432-201-42	F3	4	1708	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7735	HEATHER AVENUE	14592	432-201-42	F3	4	1708	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	15		No			Grind	
7699	HEATHER AVENUE	14622	432-201-21	F3	4	1708	Sidewalk	PCC	Faulting	1/4" to 1/2"	6		Yes			Grind	Running parallel to sidewalk
7700	HEATHER AVENUE	14622	432-201-21	F3	4	1708	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
7698	HEATHER AVENUE	14622	432-201-21	F3	4	1708	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	5		Yes			Replace Slab	
7659	HEATHER AVENUE	1671	432-192-16	F3	4	1708	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
7658	HEATHER AVENUE	1691	432-202-01	F3	4	1708	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
7657	HEATHER AVENUE	1721	432-202-04	F3	4	1708	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7703	HEATHER AVENUE	1742	432-201-22	F3	4	1708	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	Prev grind
7701				F3	4	1708	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
7702	HEATHER AVENUE	1742	432-201-22	F3	4	1708	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
7937	HEATHERFIELD DRIVE	14261	432-341-01	F4	4	1709	Driveway	PCC	Sidewalk Curb Separation	1/4" to 1/2"	4		No			Grind	Between curb and driveway
7936	HEATHERFIELD DRIVE	14262	432-342-06	F4	4	1709	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
7162	HEATHERFIELD DRIVE	14281	432-341-02	F4	4	1709	Sidewalk	PCC	Faulting	1/2" to 1"	2.5		No			Ramp	
7938	HEATHERFIELD DRIVE	14281	432-341-02	F4	4	1709	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
7940	HEATHERFIELD DRIVE	14301	432-341-04	F4	4	1709	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	Prev grind
7939	HEATHERFIELD DRIVE	14301	432-341-04	F4	4	1709	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7935	HEATHERFIELD DRIVE	14302	432-342-09	F4	4	1709	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		Yes			Grind	
11888	HEATHERFIELD DRIVE	14302	432-342-09	F4	4	1709	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		Yes			Grind	
11887	HEATHERFIELD DRIVE	14312	432-342-10	F4	4	1709	Sidewalk	PCC	Faulting	1/4" to 1/2"	6		No			Grind	
11871	HEATHERFIELD DRIVE	14341	432-341-08	F3	4	1709	Curb/Gutter	PCC	Linear Cracking	1/2" to 1"	1.5		No			Grind	
10574	HIDDEN HILL AVENUE	1891	432-281-09	G3	4	1714	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	
10573	HIDDEN HILL AVENUE	1892	432-281-08	G3	4	1714	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
10596	HIDDEN HILL AVENUE	1921	432-281-44	G3	4	1714	Sidewalk	PCC	Faulting	1/2" to 1"	2		Yes			Ramp	
10598	HIDDEN HILL AVENUE	1922	432-281-45	G3	4	1714	Sidewalk	PCC	Faulting	1/2" to 1"	3		No			Ramp	
10597	HIDDEN HILL AVENUE	1922	432-281-45	G3	4	1714	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
12014	HILLSBORO PLACE	14771	432-271-14	F3	4	1715	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
12015	HILLSBORO PLACE	14781	432-271-13	F3	4	1715	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
10852	HILLSBORO PLACE	14782	432-271-16	F3	4	1715	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
10851	HILLSBORO PLACE	14792	432-271-17	F3	4	1715	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
10848	HILLSBORO PLACE	14802	432-271-18	F3	4	1715	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
10849	HILLSBORO PLACE	14802	432-271-18	F3	4	1715	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
10850	HILLSBORO PLACE	14802	432-271-18	F3	4	1715	Sidewalk	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
12016	HILLSBORO PLACE	14821	432-271-09	F3	4	1715	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
10853	HILLSBORO PLACE	14821	432-271-09	F3	4	1715	Sidewalk	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
12013	HILLSBORO PLACE	14822	432-271-20	F3	4	1715	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	18		No			Grind	
10854	HILLSBORO PLACE	14831	432-271-08	F3	4	1715	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
12017	HILLSBORO PLACE	1842	432-271-07	F3	4	1715	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Prev grind
12018	HILLSBORO PLACE	1842	432-271-07	F3	4	1715	Sidewalk	PCC	Faulting	1/4" to 1/2"	6		No			Grind	
10540	HOLLYHOCK AVENUE	1692	432-323-12	F3	4	1716	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
10559	HOLLYHOCK AVENUE	1711	432-323-51	F3	4	1716	Sidewalk	PCC	Faulting	1/2" to 1"	4		No			Ramp	
10560	HOLLYHOCK AVENUE	1711	432-323-51	F3	4	1716	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	
10561	HOLLYHOCK AVENUE	1711	432-323-51	F3	4	1716	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
9069	HYANNIS PORT ROAD	14522	432-251-41	F4	4	1717	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
9106	HYANNIS PORT ROAD	14531	432-252-12	F4	4	1717	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	6		No			Grind	
9070	HYANNIS PORT ROAD	14542	432-251-39	F4	4	1717	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
9071	HYANNIS PORT ROAD	14542	432-251-39	F4	4	1717	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
9105	HYANNIS PORT ROAD	14561	432-252-15	F4	4	1717	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
9104	HYANNIS PORT ROAD	14581	432-252-17	F4	4	1717	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
9103	HYANNIS PORT ROAD	14591	432-252-18	F4	4	1717	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
9072	HYANNIS PORT ROAD	14592	432-251-34	F4	4	1717	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9073	HYANNIS PORT ROAD	14592	432-251-34	F4	4	1717	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
9075	HYANNIS PORT ROAD	14602	432-251-33	F4	4	1717	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	Prev grind
9074	HYANNIS PORT ROAD	14602	432-251-33	F4	4	1717	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9076	HYANNIS PORT ROAD	14622	432-251-31	F3	4	1717	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
9102	HYANNIS PORT ROAD	14631	432-252-22	F3	4	1717	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	10		No			Grind	
9077	HYANNIS PORT ROAD	14632	432-251-30	F3	4	1717	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
9078	HYANNIS PORT ROAD	14642	432-251-29	F3	4	1717	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
9079	HYANNIS PORT ROAD	14642	432-251-29	F3	4	1717	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	Prev grind
9090	HYANNIS PORT ROAD	14651	432-251-15	F3	4	1717	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
9091	HYANNIS PORT ROAD	14651	432-251-15	F3	4	1717	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
9089	HYANNIS PORT ROAD	14661	432-251-16	F3	4	1717	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
9088	HYANNIS PORT ROAD	14671	432-251-17	F3	4	1717	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
9080	HYANNIS PORT ROAD	14672	432-251-26	F3	4	1717	Sidewalk	PCC	Faulting	1/2" to 1"	1		No			Ramp	
9087	HYANNIS PORT ROAD	14681	432-251-18	F3	4	1717	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	Prev grind
9081	HYANNIS PORT ROAD	14682	432-251-25	F3	4	1717	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
9082	HYANNIS PORT ROAD	14692	432-251-24	F3	4	1717	Sidewalk	PCC	Faulting	1/2" to 1"	5		No			Ramp	Between driveway and sidewalk
9086	HYANNIS PORT ROAD	14711	432-251-21	F3	4	1717	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
9083	HYANNIS PORT ROAD	14712	432-251-22	F3	4	1717	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	Prev grind
9084	HYANNIS PORT ROAD	14712	432-251-22	F3	4	1717	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
9085	HYANNIS PORT ROAD	14712	432-251-22	F3	4	1717	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	3.5		No			Grind	
7732	KIMBERLY CIRCLE	14602	432-201-49	F3	4	1728	Driveway	PCC	Faulting	1/4" to 1/2"	2		No			Grind Driveway	Between driveway and sidewalk
7733	KIMBERLY CIRCLE	14602	432-201-49	F3	4	1728	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
7731				F3	4	1728	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	Prev grind

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP	Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
7730	KIMBERLY CIRCLE	14612	432-201-39	F3	4	1728		Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	1.5		No			Grind	
7728	KIMBERLY CIRCLE	14622	432-201-38	F3	4	1728		Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7729	KIMBERLY CIRCLE	14622	432-201-38	F3	4	1728		Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
7727	KIMBERLY CIRCLE	14632	432-201-37	F3	4	1728		Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		Yes			Grind	
7704	KIMBERLY CIRCLE	14641	432-201-24	F3	4	1728		Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
7725	KIMBERLY CIRCLE	14642	432-201-36	F3	4	1728		Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		Yes			Grind	Prev grind
7726	KIMBERLY CIRCLE	14642	432-201-36	F3	4	1728		Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7705	KIMBERLY CIRCLE	14651	432-201-25	F3	4	1728		Sidewalk	PCC	Faulting	1" to 2"	10		Yes	Yes		Replace Slab	Running parallel with sidewalk
7722	KIMBERLY CIRCLE	14652	432-201-35	F3	4	1728		Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
7724	KIMBERLY CIRCLE	14652	432-201-35	F3	4	1728		Driveway	PCC	Faulting	1/4" to 1/2"	3		No			Grind Driveway	
7723	KIMBERLY CIRCLE	14652	432-201-35	F3	4	1728		Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	15		No			Grind	
7706	KIMBERLY CIRCLE	14661	432-201-26	F3	4	1728		Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
7708	KIMBERLY CIRCLE	14661	432-201-26	F3	4	1728		Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7707	KIMBERLY CIRCLE	14661	432-201-26	F3	4	1728		Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	2		Yes			Grind	
7721	KIMBERLY CIRCLE	14662	432-201-34	F3	4	1728		Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	Prev grind
7720	KIMBERLY CIRCLE	14662	432-201-34	F3	4	1728		Driveway	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
7709	KIMBERLY CIRCLE	14671	432-201-27	F3	4	1728		Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
7716	KIMBERLY CIRCLE	14672	432-201-33	F3	4	1728		Sidewalk	PCC	Faulting	1/2" to 1"	1		Yes			Ramp	Prev grind
7717	KIMBERLY CIRCLE	14672	432-201-33	F3	4	1728		Sidewalk	PCC	Faulting	1/2" to 1"	2		Yes			Ramp	Prev grind
7718	KIMBERLY CIRCLE	14672	432-201-33	F3	4	1728		Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	Prev grind
7719	KIMBERLY CIRCLE	14672	432-201-33	F3	4	1728		Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	15		No			Grind	
7710	KIMBERLY CIRCLE	14681	432-201-28	F3	4	1728		Driveway	PCC	Sidewalk Curb Separation	1" to 2"	5		Yes			Replace Driveway	Between curb and driveway
7711	KIMBERLY CIRCLE	14681	432-201-28	F3	4	1728		Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
7714	KIMBERLY CIRCLE	14682	432-201-32	F3	4	1728		Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
7715	KIMBERLY CIRCLE	14682	432-201-32	F3	4	1728		Driveway	PCC	Linear Cracking	1/4" to 1/2"	1.5		No			Grind	
7712	KIMBERLY CIRCLE	14691	432-201-29	F3	4	1728		Driveway	PCC	Faulting	1/4" to 1/2"	4		No			Grind Driveway	Between driveway and sidewalk
7713	KIMBERLY CIRCLE		432-201-30	F3	4	1728		Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
7826	KINGSBORO CIRCLE	1981	432-243-11	F3	4	1729		Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
7827	KINGSBORO CIRCLE	1981	432-243-11	F3	4	1729		Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
7825	KINGSBORO CIRCLE	2002	432-243-05	F3	4	1729		Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
4173	KINGSTON AVENUE	1691	432-193-16	F3	4	1730		Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
4170	KINGSTON AVENUE	1691	432-193-16	F3	4	1730		Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
4171	KINGSTON AVENUE	1691	432-193-16	F3	4	1730		Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
4172	KINGSTON AVENUE	1691	432-193-16	F3	4	1730		Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
4168	KINGSTON AVENUE	1692	432-193-17	F3	4	1730		Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
4169	KINGSTON AVENUE	1692	432-193-17	F3	4	1730		Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
4147	KINGSTON AVENUE	1711	432-203-07	F3	4	1730		Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
4149	KINGSTON AVENUE	1712	432-203-08	F3	4	1730		Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
4150	KINGSTON AVENUE	1712	432-203-08	F3	4	1730		Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	Prev grind
4148	KINGSTON AVENUE	1712	432-203-08	F3	4	1730		Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
2108	KIPLING LANE	14272	432-091-37	E3	4	1732		Driveway	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
2107	KIPLING LANE	14282	432-091-36	E3	4	1732		Curb/Gutter	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
2134	KIPLING LANE	14291	432-092-11	E3	4	1732		Sidewalk	PCC	Corner Break	1/2" to 1"	3		Yes			Ramp	
2133	KIPLING LANE	14291	432-092-11	E3	4	1732		Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	4		No			Grind	
2106	KIPLING LANE	14292	432-091-24	E3	4	1732		Curb/Gutter	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
2136	KIPLING LANE	14301	432-092-10	E3	4	1732		Curb/Gutter	PCC	Spalling	1" to 2"	1		No			Patch	
2135	KIPLING LANE	14301	432-092-10	E3	4	1732		Curb/Gutter	PCC	Spalling	Over 2"	1		No			Replace C&G	
2137	KIPLING LANE	14311	432-092-09	E3	4	1732		Curb/Gutter	PCC	Spalling	1" to 2"	0.5		No			Patch	
2138	KIPLING LANE	14311	432-092-09	E3	4	1732		Curb/Gutter	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
2105	KIPLING LANE	14312	432-091-26	E3	4	1732		Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	4		No			Grind	
2139	KIPLING LANE	14321	432-092-08	E3	4	1732		Curb/Gutter	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
2104	KIPLING LANE	14322	432-091-27	E3	4	1732		Curb/Gutter	PCC	Spalling	1/2" to 1"	0.5		No			Replace C&G	
2140	KIPLING LANE	14331	432-092-07	E3	4	1732		Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
2103	KIPLING LANE	14342	432-091-29	E3	4	1732		Curb/Gutter	PCC	Spalling	Over 2"	1		No			Replace C&G	
2101	KIPLING LANE	14352	432-091-30	E3	4	1732		Sidewalk	PCC	Linear Cracking	No Displacement	2		No			Joint Seal	
2102	KIPLING LANE	14352	432-091-30	E3	4	1732		Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	8	1"	No			Grind	
2100	KIPLING LANE	14362	432-091-31	E3	4	1732		Driveway	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight displacement
2147	LANGDALE LANE	1312	432-117-02	E3	4	1740		Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
2092	LANGDALE LANE	14461	432-112-07	E3	4	1740		Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
5035	MAPLE COURT	14221	432-382-21	F4	4	1762		Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
5036	MAPLE COURT	14221	432-382-21	F4	4	1762		Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	8		No			Grind	
5025	MAPLE COURT	14241	432-382-10	F4	4	1762		Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	15		No			Grind	
5029	MAPLE COURT	2152	432-382-14	F4	4	1762		Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
5030				F4	4	1762		Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
5032	MAPLE COURT	2161	432-382-17	F4	4	1762	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
5031	MAPLE COURT	2161	432-382-17	F4	4	1762	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	4		No			Grind	
5027	MAPLE COURT	2162	432-382-13	F4	4	1762	Sidewalk	PCC	Faulting	1" to 2"	3		Yes			Replace Slab	
5028	MAPLE COURT	2162	432-382-13	F4	4	1762	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
5033	MAPLE COURT	2171	432-382-18	F4	4	1762	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	6		No			Grind	
5026	MAPLE COURT	2172	432-382-12	F4	4	1762	Sidewalk	PCC	Faulting	Over 2"	1		Yes			Replace Slab	
5034	MAPLE COURT	2181	432-382-19	F4	4	1762	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
2456	MEAR LANE	1151	432-151-14	F3	4	1768	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
2490	MEAR LANE	1152	432-152-01	F2	4	1768	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
2491	MEAR LANE	1152	432-152-01	F2	4	1768	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
2455	MEAR LANE	1181	432-151-12	F3	4	1768	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	2		No			Grind	
2489	MEAR LANE	1182	432-152-03	F3	4	1768	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
2454	MEAR LANE	1191	432-151-11	F3	4	1768	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
2488	MEAR LANE	1192	432-152-04	F3	4	1768	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
2487	MEAR LANE	1192	432-152-04	F3	4	1768	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
2453	MEAR LANE	1201	432-151-10	F3	4	1768	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
2451	MEAR LANE	1201	432-151-10	F3	4	1768	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
2452	MEAR LANE	1201	432-151-10	F3	4	1768	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
2448	MEAR LANE	1211	432-151-09	F3	4	1768	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
2449	MEAR LANE	1211	432-151-09	F3	4	1768	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
2450	MEAR LANE	1211	432-151-09	F3	4	1768	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
2486	MEAR LANE	1212	432-152-06	F3	4	1768	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
2245	MITCHELL AVENUE	1192	432-081-10	E3	4	1783	Driveway	PCC	Divided Slab	1/4" to 1/2"			No			Replace Slab(s)	Med, scaling
2247	MITCHELL AVENUE	1192	432-081-10	E3	4	1783	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
2248	MITCHELL AVENUE	1192	432-081-10	E3	4	1783	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
2246	MITCHELL AVENUE	1192	432-081-10	E3	4	1783	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Prev grind
2249	MITCHELL AVENUE	1192	432-081-10	E3	4	1783	Sidewalk	PCC	Linear Cracking	No Displacement	4		Yes			Joint Seal	Prev grind
2253	MITCHELL AVENUE	1192	432-081-10	E3	4	1783	Driveway	PCC	Corner Break	1/4" to 1/2"	3		No			Grind	
2251	MITCHELL AVENUE	1192	432-081-10	E3	4	1783	Driveway	PCC	Linear Cracking	1/4" to 1/2"	8		No			Grind	
2252	MITCHELL AVENUE	1192	432-081-10	E3	4	1783	Driveway	PCC	Linear Cracking	1/4" to 1/2"	8		No			Grind	
2254	MITCHELL AVENUE	1192	432-081-10	E3	4	1783	Driveway	PCC	Linear Cracking	1/4" to 1/2"	8		No			Grind	
2255	MITCHELL AVENUE	1192	432-081-10	E3	4	1783	Driveway	PCC	Linear Cracking	1/4" to 1/2"	8		No			Grind	
2250	MITCHELL AVENUE	1192	432-081-10	E3	4	1783	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
2256	MITCHELL AVENUE	1192	432-081-10	E3	4	1783	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
2257	MITCHELL AVENUE	1251	432-093-02	E3	4	1783	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
2258	MITCHELL AVENUE	1261	432-093-01	E3	4	1783	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	Prev grind
2260	MITCHELL AVENUE	1261	432-093-01	E3	4	1783	Sidewalk	PCC	Faulting	1/2" to 1"	3		No			Ramp	Prev grind
2112	MITCHELL AVENUE	1261	432-093-01	E3	4	1783	Cross Gutter	PCC	Divided Slab	1/4" to 1/2"			No			Replace Slab	
2259	MITCHELL AVENUE	1261	432-093-01	E3	4	1783	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	4		No			Grind	
2208	MITCHELL AVENUE	1291	432-051-04	E3	4	1783	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	
2205	MITCHELL AVENUE	1311	432-051-05	E3	4	1783	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
2206	MITCHELL AVENUE	1311	432-051-05	E3	4	1783	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
2207	MITCHELL AVENUE	1311	432-051-05	E3	4	1783	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
2204	MITCHELL AVENUE	1331	432-051-07	E3	4	1783	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
2203	MITCHELL AVENUE	1351	432-051-09	E3	4	1783	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
2166	MITCHELL AVENUE	1362	432-091-02	E3	4	1783	Cross Gutter	PCC	Divided Slab	1/4" to 1/2"			No		Yes	Replace Slab(s)	Med
2161	MITCHELL AVENUE	1362	432-091-02	E3	4	1783	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No		Yes	Grind	Prev grind
2162	MITCHELL AVENUE	1362	432-091-02	E3	4	1783	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No		Yes	Grind	
2163	MITCHELL AVENUE	1362	432-091-02	E3	4	1783	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No		Yes	Grind	
2164	MITCHELL AVENUE	1362	432-091-02	E3	4	1783	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No		Yes	Grind	
2170	MITCHELL AVENUE	1362	432-091-02	E3	4	1783	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No		Yes	Grind	
2171	MITCHELL AVENUE	1362	432-091-02	E3	4	1783	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No		Yes	Grind	
2169	MITCHELL AVENUE	1362	432-091-02	E3	4	1783	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No		Yes	Grind	
2167	MITCHELL AVENUE	1362	432-091-02	E3	4	1783	Sidewalk	PCC	Linear Cracking	No Displacement	4		No		Yes	Joint Seal	
2168	MITCHELL AVENUE	1362	432-091-02	E3	4	1783	Sidewalk	PCC	Linear Cracking	No Displacement	4		No		Yes	Joint Seal	
2165	MITCHELL AVENUE	1362	432-091-02	E3	4	1783	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No		Yes	Grind	
2198	MITCHELL AVENUE	1411	432-041-22	E3	4	1783	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	5		No		Yes	Grind	Hole
2199	MITCHELL AVENUE	1411	432-041-22	E3	4	1783	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	5		No		Yes	Grind	Hole
2200	MITCHELL AVENUE	1411	432-041-22	E3	4	1783	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	10		No		Yes	Grind	Hole
2202	MITCHELL AVENUE	1411	432-041-22	E3	4	1783	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	10		No		Yes	Grind	Hole
2197	MITCHELL AVENUE	1411	432-041-22	E3	4	1783	Curb/Gutter	PCC	Spalling	1/2" to 1"	1		No		Yes	Replace C&G	Hole
2196	MITCHELL AVENUE	1411	432-041-22	E3	4	1783	Sidewalk	PCC	Spalling	1/2" to 1"	1		No		Yes	Replace C&G	Hole
2201	MITCHELL AVENUE	1411	432-041-22	E3	4	1783	Sidewalk	PCC	Linear Cracking	No Displacement	7		No		Yes	Joint Seal	Slight displacement
2194				E3	4	1783	Sidewalk	PCC	Patch / Utility Cut	1" to 2"	4		No		Yes	Ramp	Cut for down guy anchor

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
2195	MITCHELL AVENUE	14213	432-041-21	E3	4	1783	Sidewalk	PCC	Other - Leave Comment	Over 2"			No		Yes	Replace Slab	Hole
2193	MITCHELL AVENUE	14213	432-041-21	E3	4	1783	Curb/Gutter	PCC	Spalling	1/2" to 1"	0.5		No		Yes	Replace C&G	
2185	MITCHELL AVENUE	14231	432-041-14	E3	4	1783	Driveway	PCC	Divided Slab	1/4" to 1/2"			No		Yes	Replace Slab(s)	Med
2190	MITCHELL AVENUE	14231	432-041-14	E3	4	1783	Driveway	PCC	Divided Slab	1/4" to 1/2"			No		Yes	Replace Slab(s)	Med
2212	MITCHELL AVENUE	14231	432-063-27	E3	4	1783	Sidewalk	PCC	Divided Slab	No Displacement			No			Replace Slab	Med
2211	MITCHELL AVENUE	14231	432-063-27	E3	4	1783	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
2218	MITCHELL AVENUE	14231	432-072-14	E3	4	1783	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
7141	MITCHELL AVENUE	14231	432-031-15	E3	4	1784	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
2189	MITCHELL AVENUE	14231	432-041-14	E3	4	1783	Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	3		No		Yes	Grind	
2184	MITCHELL AVENUE	14231	432-041-14	E3	4	1783	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	6		No		Yes	Grind	
2186	MITCHELL AVENUE	14231	432-041-14	E3	4	1783	Curb/Gutter	PCC	Spalling	1/2" to 1"	0.5		No		Yes	Replace C&G	
2187	MITCHELL AVENUE	14231	432-041-14	E3	4	1783	Curb/Gutter	PCC	Spalling	1/2" to 1"	0.5		No		Yes	Replace C&G	
2191	MITCHELL AVENUE	14231	432-041-14	E3	4	1783	Curb/Gutter	PCC	Spalling	1/2" to 1"	0.5		No		Yes	Replace C&G	
2192	MITCHELL AVENUE	14231	432-041-14	E3	4	1783	Curb/Gutter	PCC	Spalling	1/2" to 1"	0.5		No		Yes	Replace C&G	
2188	MITCHELL AVENUE	14231	432-041-14	E3	4	1783	Curb/Gutter	PCC	Spalling	Over 2"	0.5		No		Yes	Replace C&G	
2220	MITCHELL AVENUE	14232	432-073-01	E3	4	1783	Sidewalk	PCC	Other - Leave Comment	No Displacement	6		No			Field Assess-Monitor	Light cracks/scaling
2214	MITCHELL AVENUE	14232	432-063-01	E3	4	1783	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
2216	MITCHELL AVENUE	14232	432-063-01	E3	4	1783	Sidewalk	PCC	Corner Break	1/4" to 1/2"	1		No			Grind	Small
11908	MITCHELL AVENUE	14232	432-031-01	E3	4	1784	Sidewalk	PCC	Corner Break	1/4" to 1/2"	1.5		No			Grind	
2217	MITCHELL AVENUE	14232	432-063-01	E3	4	1783	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	
2210	MITCHELL AVENUE	14232	432-065-02	E3	4	1783	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
2213	MITCHELL AVENUE	14232	432-063-01	E3	4	1783	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
2215	MITCHELL AVENUE	14232	432-063-01	E3	4	1783	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
2219	MITCHELL AVENUE	14232	432-072-01	E3	4	1783	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
7117	MITCHELL AVENUE	14232	432-031-01	E3	4	1784	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
7143	MITCHELL AVENUE	14232	432-031-27	E3	4	1784	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7144	MITCHELL AVENUE	14232	432-031-27	E3	4	1784	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7145	MITCHELL AVENUE	14232	432-031-27	E3	4	1784	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
7142	MITCHELL AVENUE	14232	432-031-27	E3	4	1784	Driveway	PCC	Linear Cracking	1/4" to 1/2"	5		No			Grind	
11909	MITCHELL AVENUE	14232	432-031-27	E3	4	1784	Driveway	PCC	Linear Cracking	1/4" to 1/2"	8		No			Grind	
11910	MITCHELL AVENUE	14232	432-031-27	E3	4	1784	Ramp	PCC	Sidewalk Curb Separation	1/4" to 1/2"	6		No			Grind	
11907	MITCHELL AVENUE	14232	432-031-01	E3	4	1784	Sidewalk	PCC	Temporary Ramp	1/4" to 1/2"	4		No			Replace Slab	
2172	MITCHELL AVENUE	14241	432-091-03	E3	4	1783	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
2173	MITCHELL AVENUE	14241	432-091-03	E3	4	1783	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
2224	MITCHELL AVENUE	14244	432-081-01	E3	4	1783	Sidewalk	PCC	Divided Slab	1/4" to 1/2"			No			Replace Slab	Low, scaling
2221	MITCHELL AVENUE	14244	432-081-01	E3	4	1783	Driveway	PCC	Divided Slab	1/4" to 1/2"			No			Replace Slab	Low, scaling
2223	MITCHELL AVENUE	14244	432-081-01	E3	4	1783	Sidewalk	PCC	Corner Break	No Displacement	3		No			Patch	
2222	MITCHELL AVENUE	14244	432-081-01	E3	4	1783	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	12		No			Grind	
2225	MITCHELL AVENUE	14244	432-081-01	E3	4	1783	Driveway	PCC	Sidewalk Curb Separation	1" to 2"	3		No			Patch	
2226	MITCHELL AVENUE	14244	432-081-01	E3	4	1783	Sidewalk	PCC	Spalling	1/2" to 1"	3		No			Replace C&G	
2182	MITCHELL AVENUE	14252	432-091-41	E3	4	1783	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
7161	MITCHELL AVENUE	14261	432-341-01	F4	4	1784	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
11925	MITCHELL AVENUE	14261	432-341-01	F4	4	1784	Curb/Gutter	PCC	Linear Cracking	1/4" to 1/2"	3		No			Grind	
2229	MITCHELL AVENUE	14262	432-081-02	E3	4	1783	Driveway	PCC	Divided Slab	1/4" to 1/2"			No			Replace Slab	Low
2231	MITCHELL AVENUE	14262	432-081-02	E3	4	1783	Sidewalk	PCC	Divided Slab	1/4" to 1/2"			No			Replace Slab(s)	Med
2227	MITCHELL AVENUE	14262	432-081-02	E3	4	1783	Sidewalk	PCC	Corner Break	1/4" to 1/2"	6		No			Grind	
7163	MITCHELL AVENUE	14262	432-342-06	F4	4	1784	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7164	MITCHELL AVENUE	14262	432-342-06	F4	4	1784	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
2232	MITCHELL AVENUE	14262	432-081-02	E3	4	1783	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	8		No			Grind	
2228	MITCHELL AVENUE	14262	432-081-02	E3	4	1783	Curb/Gutter	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
11889	MITCHELL AVENUE	14262	432-342-06	F4	4	1784	Sidewalk	PCC	Spalling	1/4" to 1/2"	1.5		No			Grind	
11904	MITCHELL AVENUE	1731	432-031-29	F3	4	1784	Curb/Gutter	PCC	Linear Cracking	1/4" to 1/2"	2		No			Grind	8 cracks
7113	MITCHELL AVENUE	1731	432-031-29	E3	4	1784	Driveway	PCC	Sidewalk Curb Separation	1/2" to 1"	13		No			Replace Driveway	Between curb and driveway
7114	MITCHELL AVENUE	1731	432-031-29	E3	4	1784	Sidewalk	PCC	Faulting	1/2" to 1"	4		No			Ramp	Between sidewalk and driveway
7112	MITCHELL AVENUE	1731	432-031-29	E3	4	1784	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
7111	MITCHELL AVENUE	1731	432-031-29	F3	4	1784	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7115	MITCHELL AVENUE	1731	432-031-29	E3	4	1784	Driveway	PCC	Linear Cracking	1/4" to 1/2"	5		No			Grind	
11905	MITCHELL AVENUE	1731	432-031-29	E3	4	1784	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
7165	MITCHELL AVENUE	1872	432-342-05	F4	4	1784	Driveway	PCC	Sidewalk Curb Separation	1/2" to 1"	12		No			Replace Driveway	Between driveway and curb
11890	MITCHELL AVENUE	1872	432-342-05	F4	4	1784	Sidewalk	PCC	Faulting	1/2" to 1"	8		No			Ramp	Resident driveway
7166	MITCHELL AVENUE	1882	432-342-04	F4	4	1784	Driveway	PCC	Sidewalk Curb Separation	1" to 2"	15		No			Replace Driveway	Between driveway and curb
11891	MITCHELL AVENUE	1882	432-342-04	F4	4	1784	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
11892	MITCHELL AVENUE	1882	432-342-04	F4	4	1784	Sidewalk	PCC	Buckled Slab	1/4" to 1/2"	16		Yes			Replace Slab(s)	Tented, cracked, no displacement yet
7167				F4	4	1784	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
7168	MITCHELL AVENUE	1902	432-342-03	F4	4	1784	Driveway	PCC	Sidewalk Curb Separation	1/2" to 1"	10		No			Replace Driveway	Between driveway and curb
7169	MITCHELL AVENUE	1902	432-342-03	F4	4	1784	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Between driveway and sidewalk
7170	MITCHELL AVENUE	1912	432-342-02	F4	4	1784	Driveway	PCC	Sidewalk Curb Separation	1" to 2"	3		No			Patch	Between curb and driveway
7171	MITCHELL AVENUE	1912	432-342-02	F4	4	1784	Driveway	PCC	Faulting	1/4" to 1/2"	15		No			Grind Driveway	Between sidewalk and driveway
7172	MITCHELL AVENUE	1912	432-342-02	F4	4	1784	Driveway	PCC	Linear Cracking	1/4" to 1/2"	3		No			Grind	
7174	MITCHELL AVENUE	1932	432-342-01	F4	4	1784	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
7173	MITCHELL AVENUE	1932	432-342-01	F4	4	1784	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	5		No			Grind	
7099	MITCHELL AVENUE	1951	432-221-01	F4	4	1784	Driveway	PCC	Faulting	1/4" to 1/2"	14		No			Grind Driveway	Between driveway and sidewalk, prev grinded
7100	MITCHELL AVENUE	1951	432-221-01	F4	4	1784	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
11898	MITCHELL AVENUE	1951	432-221-01	F4	4	1784	Driveway	PCC	Sidewalk Curb Separation	1/2" to 1"	8		No			Replace Driveway	
7098	MITCHELL AVENUE	1961	432-221-02	F4	4	1784	Driveway	PCC	Faulting	1/4" to 1/2"	6		No			Grind Driveway	Between sidewalk and driveway
7097	MITCHELL AVENUE	1971	432-221-03	F4	4	1784	Driveway	PCC	Faulting	1/2" to 1"	6		No			Grind Driveway	Running parallel to sidewalk
7096	MITCHELL AVENUE	1971	432-221-03	F4	4	1784	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
11895	MITCHELL AVENUE	1972	432-342-30	F4	4	1784	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
11896	MITCHELL AVENUE	1972	432-342-30	F4	4	1784	Driveway	PCC	Faulting	1" to 2"	2		Yes			Replace Driveway	
7175	MITCHELL AVENUE	1972	432-342-30	F4	4	1784	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
11893	MITCHELL AVENUE	1972	432-342-30	F4	4	1784	Curb/Gutter	PCC	Linear Cracking	1/2" to 1"	2		No			Grind	
11894	MITCHELL AVENUE	1972	432-342-30	F4	4	1784	Curb/Gutter	PCC	Linear Cracking	1/2" to 1"	2		No			Grind	
7176	MITCHELL AVENUE	1972	432-342-30	F4	4	1784	Driveway	PCC	Spalling	1/4" to 1/2"	2		No			Grind	
7094	MITCHELL AVENUE	1981	432-221-04	F4	4	1784	Driveway	PCC	Faulting	1/2" to 1"	12		No			Grind Driveway	Between sidewalk and driveway
7095	MITCHELL AVENUE	1981	432-221-04	F4	4	1784	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	Prev grind
11897	MITCHELL AVENUE	1981	432-221-04	F4	4	1784	Curb/Gutter	PCC	Linear Cracking	1/2" to 1"	2		No			Grind	
11921	MITCHELL AVENUE		999-000-18	E3	4	1784	Curb/Gutter	PCC	Linear Cracking	1/2" to 1"	2		No			Grind	6 cracks
11901	MITCHELL AVENUE		432-221-23	F4	4	1784	Curb/Gutter	PCC	Linear Cracking	1/2" to 1"	2		No			Grind	7 cracks
7116	MITCHELL AVENUE		432-031-32	E3	4	1784	Driveway	PCC	Sidewalk Curb Separation	1" to 2"	12		No			Replace Driveway	Between driveway and curb
11899	MITCHELL AVENUE		432-221-23	F4	4	1784	Sidewalk	PCC	Other - Leave Comment	1/4" to 1/2"	4	1"	No			Grind	Joint separated
2244	MITCHELL AVENUE		999-000-22	E3	4	1783	Sidewalk	PCC	Divided Slab	1/4" to 1/2"	4		No			Replace Slab	Low
2230	MITCHELL AVENUE		999-000-22	E3	4	1783	Driveway	PCC	Divided Slab	1/4" to 1/2"			No			Replace Slab(s)	Med
11919	MITCHELL AVENUE		999-000-20	E3	4	1784	Sidewalk	PCC	Other - Leave Comment	1/2" to 1"		2"	No			Grind	Old pole hole
2236	MITCHELL AVENUE		999-000-22	E3	4	1783	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Prev grind
11924	MITCHELL AVENUE		999-000-18	F4	4	1784	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
11902	MITCHELL AVENUE		999-000-19	F4	4	1784	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Prev grind
11903	MITCHELL AVENUE		999-000-19	F4	4	1784	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Prev grind
11900	MITCHELL AVENUE		432-221-23	F4	4	1784	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	Prev grind
2209	MITCHELL AVENUE		432-065-01	E3	4	1783	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
2240	MITCHELL AVENUE		999-000-22	E3	4	1783	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
2241	MITCHELL AVENUE		999-000-22	E3	4	1783	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	2		No			Grind	Prev grind
7101	MITCHELL AVENUE		432-221-23	F4	4	1784	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
7105	MITCHELL AVENUE		432-221-23	F4	4	1784	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	Prev grind
7152	MITCHELL AVENUE		999-000-18	E3	4	1784	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	Prev grind
7108	MITCHELL AVENUE		432-221-23	F4	4	1784	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	Prev grind
11923	MITCHELL AVENUE		999-000-18	F4	4	1784	Driveway	PCC	Linear Cracking	1/4" to 1/2"	10		No			Grind	Sealed
7102	MITCHELL AVENUE		432-221-23	F4	4	1784	Driveway	PCC	Divided Slab	1" to 2"	12		No			Replace Slab(s)	
11911	MITCHELL AVENUE		999-000-20	E3	4	1784	Driveway	PCC	Divided Slab	1/4" to 1/2"	15		No			Replace Slab	
2234	MITCHELL AVENUE		999-000-22	E3	4	1783	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
2235	MITCHELL AVENUE		999-000-22	E3	4	1783	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
7107	MITCHELL AVENUE		432-221-23	F4	4	1784	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
7153	MITCHELL AVENUE		999-000-18	E3	4	1784	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		Yes			Grind	
7154	MITCHELL AVENUE		999-000-18	E3	4	1784	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
7155	MITCHELL AVENUE		999-000-18	E3	4	1784	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
7156	MITCHELL AVENUE		999-000-18	E3	4	1784	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
7157	MITCHELL AVENUE		999-000-18	E3	4	1784	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
7158	MITCHELL AVENUE		999-000-18	F3	4	1784	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7159	MITCHELL AVENUE		999-000-18	F3	4	1784	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
7110	MITCHELL AVENUE		999-000-19	F4	4	1784	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7146	MITCHELL AVENUE		999-000-20	E3	4	1784	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
7147	MITCHELL AVENUE		999-000-20	E3	4	1784	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
7151	MITCHELL AVENUE		999-000-20	E3	4	1784	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
11915	MITCHELL AVENUE		999-000-20	E3	4	1784	Curb/Gutter	PCC	Linear Cracking	1/2" to 1"	2		No			Grind	
11922	MITCHELL AVENUE		999-000-18	F4	4	1784	Driveway	PCC	Linear Cracking	1/4" to 1/2"	10		No			Grind	
2233	MITCHELL AVENUE		999-000-22	E3	4	1783	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
2242	MITCHELL AVENUE		999-000-22	E3	4	1783	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
2243	MITCHELL AVENUE		999-000-22	E3	4	1783	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
7103				F4	4	1784	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	2.5		No			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
7104	MITCHELL AVENUE		432-221-23	F4	4	1784	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	2		No			Grind	
7106	MITCHELL AVENUE		432-221-23	F4	4	1784	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	2.5		No			Grind	
11917	MITCHELL AVENUE		999-000-20	E3	4	1784	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	5		No			Grind	
11920	MITCHELL AVENUE		999-000-20	E3	4	1784	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	6		No			Grind	
11906	MITCHELL AVENUE		432-031-32	E3	4	1784	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
2237	MITCHELL AVENUE		999-000-22	E3	4	1783	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	
2238	MITCHELL AVENUE		999-000-22	E3	4	1783	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	
2239	MITCHELL AVENUE		999-000-22	E3	4	1783	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	
7109	MITCHELL AVENUE		432-221-23	F4	4	1784	Driveway	PCC	Punchout	1/4" to 1/2"			No			Replace Slab	
11914	MITCHELL AVENUE		999-000-20	E3	4	1784	Driveway	PCC	Sidewalk Curb Separation	1/2" to 1"	4		No			Patch	
7149	MITCHELL AVENUE		999-000-20	E3	4	1784	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	4		No			Grind	
7148	MITCHELL AVENUE		999-000-20	E3	4	1784	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	7		No			Grind	
7150	MITCHELL AVENUE		999-000-20	E3	4	1784	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	10		No			Grind	
11912	MITCHELL AVENUE		999-000-20	E3	4	1784	Curb/Gutter	PCC	Spalling	1/4" to 1/2"	0.5		No			Grind	
11918	MITCHELL AVENUE		999-000-20	E3	4	1784	Curb/Gutter	PCC	Spalling	1/4" to 1/2"	0.5		No			Grind	
7160	MITCHELL AVENUE		999-000-18	F3	4	1784	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
11913	MITCHELL AVENUE		999-000-20	E3	4	1784	Sidewalk	PCC	Spalling	1/4" to 1/2"	2		No			Grind	
11916	MITCHELL AVENUE		999-000-20	E3	4	1784	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
5392	MOREL ROAD	14411	432-434-03	F4	4	1786	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5394	MOREL ROAD	14411	432-434-03	F4	4	1786	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5397	MOREL ROAD	14412	432-434-01	F4	4	1786	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	Prev grind
5399	MOREL ROAD	14412	432-434-01	F4	4	1786	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Prev grind
5272	MOREL ROAD	14421	432-435-17	F4	4	1786	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
5270	MOREL ROAD	14421	432-435-17	F4	4	1786	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5274	MOREL ROAD	14421	432-435-17	F4	4	1786	Ramp	PCC	Sidewalk Curb Separation	1/4" to 1/2"	5		No			Grind	
5269	MOREL ROAD	14432	432-435-01	F4	4	1786	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
5163	MORNING GLORY ROAD	14252	432-445-01	F4	4	1788	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No		Yes	Grind	
5164	MORNING GLORY ROAD	14252	432-445-01	F4	4	1788	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No		Yes	Grind	
5166	MORNING GLORY ROAD	14252	432-445-01	F4	4	1788	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
5168	MORNING GLORY ROAD	14262	432-445-02	F4	4	1788	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5170	MORNING GLORY ROAD	14272	432-445-03	F4	4	1788	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
5156	MORNING GLORY ROAD	14281	432-441-33	F4	4	1788	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
5158	MORNING GLORY ROAD	14281	432-441-33	F4	4	1788	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
5175	MORNING GLORY ROAD	14282	432-445-04	F4	4	1788	Sidewalk	PCC	Faulting	1/2" to 1"	4.5		No			Ramp	
5172	MORNING GLORY ROAD	14282	432-445-04	F4	4	1788	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	15		No			Grind	
5153	MORNING GLORY ROAD	14291	432-441-32	F4	4	1788	Sidewalk	PCC	Faulting	1/2" to 1"	2		No			Ramp	
5155	MORNING GLORY ROAD	14291	432-441-32	F4	4	1788	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		No			Ramp	
5177	MORNING GLORY ROAD	14292	432-445-05	F4	4	1788	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
5179	MORNING GLORY ROAD	14292	432-445-05	F4	4	1788	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
5150	MORNING GLORY ROAD	14301	432-441-31	F4	4	1788	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
5151	MORNING GLORY ROAD	14301	432-441-31	F4	4	1788	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	10		No			Grind	
5181	MORNING GLORY ROAD	14302	432-445-06	F4	4	1788	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5182	MORNING GLORY ROAD	14302	432-445-06	F4	4	1788	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
5149	MORNING GLORY ROAD	14311	432-441-30	F4	4	1788	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
5184	MORNING GLORY ROAD	14312	432-445-07	F4	4	1788	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
5147	MORNING GLORY ROAD	14341	432-441-27	F4	4	1788	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
5148	MORNING GLORY ROAD	14341	432-441-27	F4	4	1788	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
5205	MORNING GLORY ROAD	14342	432-442-01	F4	4	1788	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
5143	MORNING GLORY ROAD	14351	432-441-14	F4	4	1788	Sidewalk	PCC	Faulting	1/2" to 1"	2		No			Ramp	Prev grind
5142	MORNING GLORY ROAD	14351	432-441-14	F4	4	1788	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	Prev grind
5141	MORNING GLORY ROAD	14351	432-441-14	F4	4	1788	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
5207	MORNING GLORY ROAD	14352	432-442-02	F4	4	1788	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
5140	MORNING GLORY ROAD	14361	432-441-13	F4	4	1788	Sidewalk	PCC	Faulting	1/2" to 1"	2.5		No			Ramp	
5209	MORNING GLORY ROAD	14362	432-442-03	F4	4	1788	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
5139	MORNING GLORY ROAD	14371	432-441-12	F4	4	1788	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
5212	MORNING GLORY ROAD	14372	432-442-04	F4	4	1788	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	15		No			Grind	
5135	MORNING GLORY ROAD	14381	432-441-11	F4	4	1788	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	Prev grind
5137	MORNING GLORY ROAD	14381	432-441-11	F4	4	1788	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	Prev grind
5136	MORNING GLORY ROAD	14381	432-441-11	F4	4	1788	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
5138	MORNING GLORY ROAD	14381	432-441-11	F4	4	1788	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5214	MORNING GLORY ROAD	14382	432-442-05	F4	4	1788	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
5133	MORNING GLORY ROAD	14391	432-441-10	F4	4	1788	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5134	MORNING GLORY ROAD	14391	432-441-10	F4	4	1788	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	6		No			Grind	
5130				F4	4	1788	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		No			Ramp	Prev grind

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
5129	MORNING GLORY ROAD	14401	432-441-09	F4	4	1788	Sidewalk	PCC	Faulting	1/4" to 1/2"	4.5		Yes			Grind	
5131	MORNING GLORY ROAD	14401	432-441-09	F4	4	1788	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
5132	MORNING GLORY ROAD	14401	432-441-09	F4	4	1788	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
5215	MORNING GLORY ROAD	14402	432-442-07	F4	4	1788	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5127	MORNING GLORY ROAD	14411	432-441-08	F4	4	1788	Sidewalk	PCC	Faulting	1/2" to 1"	4.5		Yes			Ramp	Prev grind
5128	MORNING GLORY ROAD	14411	432-441-08	F4	4	1788	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	Prev grind
5126	MORNING GLORY ROAD	14411	432-441-08	F4	4	1788	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
5125	MORNING GLORY ROAD	14411	432-441-08	F4	4	1788	Curb/Gutter	PCC	Faulting	1/4" to 1/2"			No			Grind C&G	
5216	MORNING GLORY ROAD	14422	432-433-02	F4	4	1788	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5235	MORNING GLORY ROAD	14431	432-432-01	F4	4	1788	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
5236	MORNING GLORY ROAD	14431	432-432-01	F4	4	1788	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
5217	MORNING GLORY ROAD	14432	432-433-03	F4	4	1788	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	20		No			Grind	
5233	MORNING GLORY ROAD	14441	432-432-02	F4	4	1788	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
5234	MORNING GLORY ROAD	14441	432-432-02	F4	4	1788	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
5230	MORNING GLORY ROAD	14451	432-432-03	F4	4	1788	Sidewalk	PCC	Faulting	1/2" to 1"	3		No			Ramp	Prev grind
5229	MORNING GLORY ROAD	14451	432-432-03	F4	4	1788	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
5231	MORNING GLORY ROAD	14451	432-432-03	F4	4	1788	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
5232	MORNING GLORY ROAD	14451	432-432-03	F4	4	1788	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	10		No			Grind	
5228	MORNING GLORY ROAD	14461	432-432-04	F4	4	1788	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		Yes			Grind	Prev grind
5227	MORNING GLORY ROAD	14461	432-432-04	F4	4	1788	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
5219	MORNING GLORY ROAD	14462	432-433-06	F4	4	1788	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
5218	MORNING GLORY ROAD	14462	432-433-06	F4	4	1788	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	12		No			Grind	
5220	MORNING GLORY ROAD	14472	432-433-07	F4	4	1788	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
5224	MORNING GLORY ROAD	14491	432-432-07	F4	4	1788	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	Prev grind
5225	MORNING GLORY ROAD	14491	432-432-07	F4	4	1788	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
5226	MORNING GLORY ROAD	14491	432-432-07	F4	4	1788	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
5223	MORNING GLORY ROAD	14491	432-432-07	F4	4	1788	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	8		No			Grind	
5222	MORNING GLORY ROAD	14492	432-433-09	F4	4	1788	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
5221	MORNING GLORY ROAD	14492	432-433-09	F4	4	1788	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	20		No			Grind	
5146	MORNING GLORY ROAD		432-441-26	F4	4	1788	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
5144	MORNING GLORY ROAD		432-441-26	F4	4	1788	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
5145	MORNING GLORY ROAD		432-441-26	F4	4	1788	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
5159	MORNING GLORY ROAD		432-385-01	F4	4	1788	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No		Yes	Grind	
5161	MORNING GLORY ROAD		432-385-01	F4	4	1788	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	20		No		Yes	Grind	
10606	MUNTON CIRCLE	1982	432-281-51	G3	4	1791	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
10609	MUNTON CIRCLE	2001	432-273-02	G3	4	1791	Sidewalk	PCC	Faulting	1" to 2"	3		No			Replace Slab	
10610	MUNTON CIRCLE	2001	432-273-02	G3	4	1791	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
10607	MUNTON CIRCLE	2002	432-281-53	G3	4	1791	Sidewalk	PCC	Linear Cracking	1" to 2"	4		No			Replace Slab	
10608	MUNTON CIRCLE	2012	432-281-54	G3	4	1791	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	3		No			Grind	
9107	NANTUCKET PLACE	14531	432-252-12	F4	4	1802	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
9057	NANTUCKET PLACE	14531	432-251-57	F4	4	1802	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	Prev grind
9058	NANTUCKET PLACE	14531	432-251-57	F3	4	1802	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
9060	NANTUCKET PLACE	2002	432-251-55	F3	4	1802	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
9061	NANTUCKET PLACE	2011	432-251-52	F3	4	1802	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		Yes			Grind	Prev grind
9062	NANTUCKET PLACE	2011	432-251-52	F3	4	1802	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
9063	NANTUCKET PLACE	2011	432-251-52	F4	4	1802	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Prev grind
9059	NANTUCKET PLACE	2012	432-251-56	F3	4	1802	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9064	NANTUCKET PLACE	2041	432-251-49	F4	4	1802	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9065	NANTUCKET PLACE	2051	432-251-48	F4	4	1802	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9066	NANTUCKET PLACE	2051	432-251-48	F4	4	1802	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
9067	NANTUCKET PLACE	2071	432-251-46	F4	4	1802	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	Prev grind
9068	NANTUCKET PLACE	2091	432-251-44	F4	4	1802	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	3		No			Grind	
11437	NEWPORT AVENUE	1044	432-131-03	E3	4	1166	Driveway	PCC	Linear Cracking	1/4" to 1/2"	6		No			Grind	
9364	NEWPORT AVENUE	14042	432-074-07	E3	4	1169	Driveway	PCC	Divided Slab	1" to 2"	10		No		Yes	Replace Slab(s)	
9367	NEWPORT AVENUE	14042	432-074-07	E3	4	1170	Sidewalk	PCC	Faulting	1/2" to 1"	3		No		Yes	Ramp	
9365	NEWPORT AVENUE	14042	432-074-07	E3	4	1169	Driveway	PCC	Linear Cracking	1/2" to 1"	8		No		Yes	Grind	
9366	NEWPORT AVENUE	14042	432-074-07	E3	4	1169	Driveway	PCC	Spalling	1/2" to 1"	4		No		Yes	Replace C&G	
9363	NEWPORT AVENUE	14152	432-073-24	E3	4	1168	Driveway	PCC	Divided Slab	1" to 2"	16		No		Yes	Replace Slab(s)	
9361	NEWPORT AVENUE	14152	432-073-24	E3	4	1168	Sidewalk	PCC	Spalling	1/2" to 1"	4		No		Yes	Replace C&G	
9362	NEWPORT AVENUE	14152	432-073-24	E3	4	1168	Curb/Gutter	PCC	Spalling	Over 2"	2		No		Yes	Replace C&G	
9358	NEWPORT AVENUE	14172	432-073-25	E3	4	1168	Driveway	PCC	Divided Slab	1/2" to 1"	15		No		Yes	Replace Slab(s)	
9359	NEWPORT AVENUE	14172	432-073-25	E3	4	1168	Sidewalk	PCC	Spalling	1/2" to 1"	4		No		Yes	Replace C&G	
9360	NEWPORT AVENUE	14172	432-073-25	E3	4	1168	Sidewalk	PCC	Spalling	1/2" to 1"	4		No		Yes	Replace C&G	
9356				E3	4	1168	Driveway	PCC	Corner Break	1/4" to 1/2"	5		No			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
9357	NEWPORT AVENUE	14232	432-073-01	E3	4	1168	Driveway	PCC	Divided Slab	Over 2"	15		No		Yes	Replace Slab(s)	
9355	NEWPORT AVENUE	14232	432-073-01	E3	4	1168	Sidewalk	PCC	Spalling	1/4" to 1/2"	3		No	Yes		Grind	
11432	NEWPORT AVENUE	14242	432-121-02	E3	4	1168	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
11433	NEWPORT AVENUE	14242	432-121-02	E3	4	1167	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No		Yes	Grind	
11429	NEWPORT AVENUE	14244	432-081-01	E3	4	1168	Driveway	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind Driveway	
11430	NEWPORT AVENUE	14262	432-081-02	E3	4	1168	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
11431	NEWPORT AVENUE	14300	432-081-04	E3	4	1168	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
11435	NEWPORT AVENUE	14430	432-121-09	E3	4	1167	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No		Yes	Grind	Prev grind
11434	NEWPORT AVENUE	14430	432-121-09	E3	4	1167	Driveway	PCC	Divided Slab	1/4" to 1/2"			No		Yes	Replace Slab	
11436	NEWPORT AVENUE	14430	432-121-09	E3	4	1167	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No		Yes	Grind	
11440	NEWPORT AVENUE	14642	432-141-14	E2	4	1166	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No		Yes	Grind	
11438	NEWPORT AVENUE	14662	432-141-15	E3	4	1166	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No		Yes	Grind	
11439	NEWPORT AVENUE	14662	432-141-15	E3	4	1166	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No		Yes	Grind	
11441	NEWPORT AVENUE	14702	432-141-11	E2	4	1166	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No		Yes	Grind	
11442	NEWPORT AVENUE	14702	432-141-11	E2	4	1166	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	8		No		Yes	Grind	
2352	NEWPORT AVENUE	14722	432-141-12	E2	4	1166	Sidewalk	PCC		1/4" to 1/2"	2		No		Yes	Grind	
11443	NEWPORT AVENUE	14722	432-141-12	E2	4	1166	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No		Yes	Grind	
2358	NEWPORT AVENUE	14742	432-151-01	E2	4	1165	Curb/Gutter	PCC	Faulting	1/2" to 1"	1		No			Replace C&G	
2355	NEWPORT AVENUE	14742	432-151-01	E2	4	1165	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		Yes			Grind	
2357	NEWPORT AVENUE	14742	432-151-01	E2	4	1165	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
2356	NEWPORT AVENUE	14742	432-151-01	E2	4	1165	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	12		No			Grind	
2362	NEWPORT AVENUE	14802	432-151-34	E2	4	1165	Sidewalk	PCC		1/4" to 1/2"	1		No			Grind	Prev grind
2363	NEWPORT AVENUE	14802	432-151-34	F2	4	1165	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
2359	NEWPORT AVENUE	14802	432-151-34	E2	4	1165	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
2360	NEWPORT AVENUE	14802	432-151-34	E2	4	1165	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
2361	NEWPORT AVENUE	14802	432-151-34	E2	4	1165	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
2367	NEWPORT AVENUE		432-521-26	F2	4	1165	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		No			Ramp	
2370	NEWPORT AVENUE		999-000-14	F2	4	1165	Sidewalk	PCC	Faulting	1/2" to 1"	3		No			Ramp	
2368	NEWPORT AVENUE		432-521-26	F2	4	1165	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
2369	NEWPORT AVENUE		999-000-14	F2	4	1165	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
2371	NEWPORT AVENUE		999-000-14	F2	4	1165	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
2372	NEWPORT AVENUE		999-000-14	F2	4	1165	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
2373	NEWPORT AVENUE		999-000-14	F2	4	1165	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
2374	NEWPORT AVENUE		999-000-14	F2	4	1165	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
2375	NEWPORT AVENUE		999-000-14	F2	4	1165	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
2376	NEWPORT AVENUE		999-000-14	F2	4	1165	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
2377	NEWPORT AVENUE		999-000-14	F2	4	1165	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
2365	NEWPORT AVENUE		999-000-16	F2	4	1165	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
2366	NEWPORT AVENUE		999-000-16	F2	4	1165	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
2364	NEWPORT AVENUE		999-000-16	F2	4	1165	Driveway	PCC	Spalling	1" to 2"	0.5		No			Patch	
11473	NISSON RD	120	432-073-06	E3	4	1804	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No			Grind	
11462	NISSON RD	130	432-073-07	E3	4	1804	Driveway	PCC	Faulting	1/4" to 1/2"	2		No			Grind Driveway	
11463	NISSON RD	130	432-073-07	E3	4	1804	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No				
11468	NISSON RD	1362	432-041-12	E3	4	1804	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
2775	NISSON RD	14011	432-053-13	E3	4	1804	Curb/Gutter	PCC	Linear Cracking	1/2" to 1"	2		No			Grind	
11467	NISSON RD	14012	432-052-12	E3	4	1804	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
11466	NISSON RD	14012	432-052-12	E3	4	1804	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	8		Yes			Grind	
7074	NISSON RD	14031	432-221-35	E4	4	1805	Sidewalk	PCC		1/4" to 1/2"	4		No			Grind	
7073	NISSON RD	14031	432-221-35	E4	4	1805	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	6		Yes			Grind	
7076	NISSON RD	14031	432-221-35	E4	4	1805	Sidewalk	PCC		1/2" to 1"	3.5		Yes			Grind	
7075	NISSON RD	14031	432-221-35	E4	4	1805	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	3		Yes			Grind	
7264	NISSON RD	14042	432-402-08	E3	4	1805	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
2869	NISSON RD	14062	432-065-16	E3	4	1804	Ramp	PCC	Sidewalk Curb Separation	1/2" to 1"	9		No			Replace Ramp	
11471	NISSON RD	14081	432-041-04	E3	4	1804	Sidewalk	PCC		1/4" to 1/2"	1.5		No		Yes	Grind	
11470	NISSON RD	14081	432-041-04	E3	4	1804	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	5		No		Yes	Grind	
11465	NISSON RD	14082	432-063-13	E3	4	1804	Sidewalk	PCC		1/4" to 1/2"	10		No			Grind	
11469	NISSON RD	1412	432-041-13	E3	4	1804	Driveway	PCC	Divided Slab	No Displacement			No			Replace Slab	
11461	NISSON RD	14122	432-073-05	E3	4	1804	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No		Yes	Grind	
11472	NISSON RD	1451	432-042-02	E3	4	1804	Driveway	PCC	Divided Slab	1/4" to 1/2"	15		No		Yes	Replace Slab	
11464	NISSON RD	150	432-073-27	E3	4	1804	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Prev grind
7259	NISSON RD	1501	432-402-06	E3	4	1805	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7260	NISSON RD	1501	432-402-06	E3	4	1805	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
7261	NISSON RD	1501	432-402-06	E3	4	1805	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
7262				i	E3	4	1805	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No		Grind	



3548 Seagate Way, Suite 230
Oceanside, CA 92056
T: (760) 216-6529
www.bucknam-inc.com

Bucknam understands that the City will make all final decisions on sidewalk improvement types and repair locations

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
7263	NISSON RD	1501	432-402-06	E3	4	1805	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
7043	NISSON RD	1602	432-401-16	E3	4	1805	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No		Yes	Grind	
7044	NISSON RD	1602	432-401-16	E3	4	1805	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No		Yes	Grind	
7045	NISSON RD	1602	432-401-16	E3	4	1805	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No		Yes	Grind	
7046	NISSON RD	1602	432-401-16	E3	4	1805	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
7051	NISSON RD	1602	432-401-16	E4	4	1805	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
7052	NISSON RD	1602	432-401-16	E4	4	1805	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
7054	NISSON RD	1602	432-401-16	E4	4	1805	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7047	NISSON RD	1602	432-401-16	E4	4	1805	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	6		No			Grind	
7048	NISSON RD	1602	432-401-16	E4	4	1805	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	3		Yes			Grind	
7050	NISSON RD	1602	432-401-16	E4	4	1805	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	5		Yes			Grind	
7053	NISSON RD	1602	432-401-16	E4	4	1805	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	1		Yes			Grind	
7049	NISSON RD	1602	432-401-16	E4	4	1805	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	5		Yes			Grind	
7055	NISSON RD	1602	432-401-16	E4	4	1805	Driveway	PCC	Spalling	1/4" to 1/2"	3.5		No			Grind	
7060	NISSON RD	1702	432-401-14	E4	4	1805	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
7059	NISSON RD	1702	432-401-14	E4	4	1805	Driveway	PCC	Spalling	1/4" to 1/2"	4.5		No			Grind	
7061	NISSON RD	1712	432-401-05	E4	4	1805	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7072	NISSON RD	1782	432-021-07	E4	4	1805	Sidewalk	PCC	Faulting	1/2" to 1"	2		No			Ramp	
7064	NISSON RD	1782	432-021-07	E4	4	1805	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
7065	NISSON RD	1782	432-021-07	E4	4	1805	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
7068	NISSON RD	1782	432-021-07	E4	4	1805	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		Yes			Grind	
7069	NISSON RD	1782	432-021-07	E4	4	1805	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
7066	NISSON RD	1782	432-021-07	E4	4	1805	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	8		Yes			Grind	
7070	NISSON RD	1782	432-021-07	E4	4	1805	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	3		Yes			Grind	
7063	NISSON RD	1782	432-021-07	E4	4	1805	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	5		Yes			Grind	
7062	NISSON RD	1782	432-021-07	E4	4	1805	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	5		Yes			Grind	
7067	NISSON RD	1782	432-021-07	E4	4	1805	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	4		Yes			Grind	
7071	NISSON RD	1782	432-021-07	E4	4	1805	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	2.5		Yes			Grind	
7057	NISSON RD		432-401-13	E4	4	1805	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
7258	NISSON RD		432-401-16	E4	4	1805	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
7058	NISSON RD		432-401-13	E4	4	1805	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	3.5		Yes			Grind	
7056	NISSON RD		432-401-13	E4	4	1805	Curb/Gutter	PCC	Spalling	1/2" to 1"	0.5		No			Replace C&G	
7887	OXFORD AVENUE	14421	432-303-10	F3	4	1817	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
7886	OXFORD AVENUE	14421	432-303-10	F3	4	1817	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	3		No			Grind	
7888	OXFORD AVENUE	14431	432-303-11	F3	4	1817	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7889	OXFORD AVENUE	14431	432-303-11	F3	4	1817	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
7890	OXFORD AVENUE	14481	432-303-15	F3	4	1817	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
7893	OXFORD AVENUE	14482	432-301-25	F3	4	1817	Driveway	PCC	Faulting	1/4" to 1/2"	4		No			Grind Driveway	
7891	OXFORD AVENUE	14491	432-303-16	F3	4	1817	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7892	OXFORD AVENUE	14492	432-301-24	F3	4	1817	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
7636	OXFORD AVENUE	1771	432-203-16	F3	4	1816	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	1.5		No			Grind	Prev grind
7641	OXFORD AVENUE	1771	432-203-01	F3	4	1816	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7642	OXFORD AVENUE	1771	432-203-01	F3	4	1816	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
7634	OXFORD AVENUE	1771	432-203-16	F3	4	1816	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
7635	OXFORD AVENUE	1771	432-203-16	F3	4	1816	Sidewalk	PCC	Linear Cracking	1/2" to 1"	1		Yes			Grind	
7639	OXFORD AVENUE	1772	432-203-14	F3	4	1816	Sidewalk	PCC	Other - Leave Comment	1" to 2"			Yes			Replace Slab	Slabs has broken off. Big chunks
7638	OXFORD AVENUE	1772	432-203-14	F3	4	1816	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
7640	OXFORD AVENUE	1772	432-203-14	F3	4	1816	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	3		No			Grind	
7880	OXFORD AVENUE	1831	432-233-16	F3	4	1816	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
7879	OXFORD AVENUE	1832	432-233-14	F3	4	1816	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7637	OXFORD AVENUE		432-203-15	F3	4	1816	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Prev grind
10831	PENNINGTON AVENUE	14821	432-271-37	F3	4	1836	Sidewalk	PCC	Buckled Slab	No Displacement	8		Yes			Replace Slab(s)	Cracked, no displacement
10832	PENNINGTON AVENUE	14821	432-271-37	F3	4	1836	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
10845	PENNINGTON AVENUE	14821	432-271-21	F3	4	1836	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
10846	PENNINGTON AVENUE	14821	432-271-21	F3	4	1836	Sidewalk	PCC	Buckled Slab	Over 2"	8		Yes			Replace Slab(s)	Raised
10829	PENNINGTON AVENUE	14821	432-271-37	F3	4	1836	Sidewalk	PCC	Divided Slab	1/2" to 1"	5		No			Replace Slab	
10830	PENNINGTON AVENUE	14821	432-271-37	F3	4	1836	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
10844	PENNINGTON AVENUE	14821	432-271-21	F3	4	1836	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
10847	PENNINGTON AVENUE	14821	432-271-21	F3	4	1836	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
10834	PENNINGTON AVENUE	14822	432-271-36	F3	4	1836	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
10835	PENNINGTON AVENUE	14822	432-271-36	F3	4	1836	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	6		No			Grind	
10833	PENNINGTON AVENUE	14822	432-271-36	F3	4	1836	Sidewalk	PCC	Spalling	1" to 2"	1		No			Patch	
12019	PENNINGTON AVENUE	1852	432-271-06	F3	4	1836	Driveway	PCC	Spalling	1/4" to 1/2"	3		No			Grind	
10855				F3	4	1836	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
10856	PENNINGTON AVENUE	1862	432-271-05	F3	4	1836	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	4		No			Grind	
11999	PENNINGTON AVENUE	1902	432-271-59	F3	4	1836	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
12000	PENNINGTON AVENUE	1902	432-271-59	F3	4	1836	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No			Grind	
12003	PENNINGTON AVENUE	1912	432-271-58	F3	4	1836	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
12001	PENNINGTON AVENUE	1912	432-271-58	F3	4	1836	Sidewalk	PCC	Faulting	1/4" to 1/2"	8		No			Grind	
12002	PENNINGTON AVENUE	1912	432-271-58	F3	4	1836	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
10817	PENNINGTON AVENUE	1922	432-271-57	F3	4	1836	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
12004	PENNINGTON AVENUE	1952	432-271-54	F3	4	1836	Sidewalk	PCC	Faulting	1/4" to 1/2"	7		No			Grind	
2084	PENRITH LANE	1321	432-115-20	E3	4	1837	Ramp	PCC	Faulting	1/4" to 1/2"	4		No			Grind Ramp	
2083	PENRITH LANE	1341	432-115-18	E3	4	1837	Curb/Gutter	PCC	Spalling	1" to 2"	1		No			Patch	
2081	PENRITH LANE	1351	432-115-17	E3	4	1837	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Patch	Also spall
2082	PENRITH LANE	1351	432-115-17	E3	4	1837	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	5		No			Grind	
2080	PENRITH LANE	1361	432-115-16	E3	4	1837	Curb/Gutter	PCC	Spalling	1" to 2"	1		No			Patch	
2049	PENRITH LANE	1372	432-116-03	E3	4	1837	Driveway	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	
2079	PENRITH LANE	1381	432-115-14	E3	4	1837	Curb/Gutter	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
2050	PENRITH LANE	1402	432-116-05	E3	4	1837	Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	4		No			Grind	
2051	PENRITH LANE	1402	432-116-05	E3	4	1837	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	5		Yes			Grind	
2078	PENRITH LANE	1411	432-115-11	E3	4	1837	Ramp	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind Ramp	
9427	PEPPER TREE CIRCLE	14541	432-451-05	F4	4	1839	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9428	PEPPER TREE CIRCLE	14552	432-451-09	F4	4	1839	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
9429	PEPPER TREE CIRCLE	14552	432-451-09	F4	4	1839	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9426	PEPPER TREE CIRCLE	14571	432-451-02	F4	4	1839	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
9430	PEPPER TREE CIRCLE	14582	432-451-12	G4	4	1839	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
9829	PEPPER TREE CIRCLE	14651	432-461-50	G4	4	1838	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9827	PEPPER TREE CIRCLE	14652	432-461-52	G4	4	1838	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
9825	PEPPER TREE CIRCLE	14652	432-461-52	G4	4	1838	Sidewalk	PCC	Faulting	1/2" to 1"	3		No			Ramp	
9821	PEPPER TREE CIRCLE	14662	432-461-53	G4	4	1838	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9823	PEPPER TREE CIRCLE	14662	432-461-53	G4	4	1838	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
9832	PEPPER TREE CIRCLE	14671	432-461-48	G4	4	1838	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
9835	PEPPER TREE CIRCLE	14691	432-461-46	G4	4	1838	Sidewalk	PCC	Faulting	1/4" to 1/2"	8		No			Grind	Between driveway and sidewalk
9837	PEPPER TREE CIRCLE	14691	432-461-46	G4	4	1838	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	Prev grind
9816	PEPPER TREE CIRCLE	14692	432-461-56	G4	4	1838	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9818	PEPPER TREE CIRCLE	14692	432-461-56	G4	4	1838	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
9838	PEPPER TREE CIRCLE	14711	432-461-44	G4	4	1838	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
9840	PEPPER TREE CIRCLE	14711	432-461-44	G4	4	1838	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9813	PEPPER TREE CIRCLE	14722	432-461-59	G4	4	1838	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
7077	PINEBROOK DRIVE	14031	432-221-35	E4	4	1843	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
7078	PINEBROOK DRIVE	14031	432-221-35	E4	4	1843	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
7079	PINEBROOK DRIVE	14051	432-221-26	F4	4	1843	Sidewalk	PCC	Faulting	1/2" to 1"	3.5		No			Ramp	
7080	PINEBROOK DRIVE	14052	432-221-29	F4	4	1843	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
7183	PINEBROOK DRIVE	14385	432-302-11	F4	4	1842	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7196	PINEBROOK DRIVE	14412	432-302-29	F4	4	1842	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7195	PINEBROOK DRIVE	14412	432-302-29	F4	4	1842	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	10		No			Grind	
7184	PINEBROOK DRIVE	14431	432-302-17	F4	4	1842	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
7185	PINEBROOK DRIVE	14441	432-302-18	F4	4	1842	Sidewalk	PCC	Faulting	1/2" to 1"	3		No			Ramp	
7194	PINEBROOK DRIVE	14442	432-302-26	F4	4	1842	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
7187	PINEBROOK DRIVE	14451	432-302-19	F4	4	1842	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	4		No			Grind	
7192	PINEBROOK DRIVE	14452	432-302-25	F4	4	1842	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7193	PINEBROOK DRIVE	14452	432-302-25	F4	4	1842	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
7186	PINEBROOK DRIVE	14461	432-302-20	F4	4	1842	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7190	PINEBROOK DRIVE	14466	432-302-24	F4	4	1842	Sidewalk	PCC	Faulting	1/2" to 1"	1		No			Ramp	At CATV grate
7191	PINEBROOK DRIVE	14466	432-302-24	F4	4	1842	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7188	PINEBROOK DRIVE	14481	432-302-22	F3	4	1842	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	At CATV grate
7189	PINEBROOK DRIVE	14482	432-302-23	F3	4	1842	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
5355	PINEWOOD ROAD	14232	432-444-12	F4	4	1844	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
5354	PINEWOOD ROAD	14242	432-444-13	F4	4	1844	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		No			Ramp	
5352	PINEWOOD ROAD	14242	432-444-13	F4	4	1844	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
5353	PINEWOOD ROAD	14242	432-444-13	F4	4	1844	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No			Grind	
5362	PINEWOOD ROAD	14251	432-443-37	F4	4	1844	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
5358	PINEWOOD ROAD	14251	432-443-37	F4	4	1844	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
5360	PINEWOOD ROAD	14251	432-443-37	F4	4	1844	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
5361	PINEWOOD ROAD	14251	432-443-37	F4	4	1844	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	4		No			Grind	
5350	PINEWOOD ROAD	14252	432-444-14	F4	4	1844	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		Yes			Grind	
5351				F4	4	1844	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
5349	PINEWOOD ROAD	14262	432-444-15	F4	4	1844	Curb/Gutter	PCC	Faulting	1/2" to 1"			No			Replace C&G	
5347	PINEWOOD ROAD	14262	432-444-15	F4	4	1844	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
5348	PINEWOOD ROAD	14262	432-444-15	F4	4	1844	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
5346	PINEWOOD ROAD	14262	432-444-15	F4	4	1844	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	20		No			Grind	
5365	PINEWOOD ROAD	14271	432-443-35	F4	4	1844	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	2		No			Grind	
5345	PINEWOOD ROAD	14272	432-444-16	F4	4	1844	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	Prev grind
5344	PINEWOOD ROAD	14272	432-444-16	F4	4	1844	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	1.5		No			Grind	
5367	PINEWOOD ROAD	14281	432-443-34	F4	4	1844	Sidewalk	PCC	Faulting	1/2" to 1"	1		No			Ramp	
5369	PINEWOOD ROAD	14281	432-443-34	F4	4	1844	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	8		No			Grind	
5341	PINEWOOD ROAD	14282	432-444-17	F4	4	1844	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5342	PINEWOOD ROAD	14282	432-444-17	F4	4	1844	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	3		No			Grind	
5343	PINEWOOD ROAD	14282	432-444-17	F4	4	1844	Curb/Gutter	PCC	Spalling	1/4" to 1/2"	1.5		No			Grind	
5337	PINEWOOD ROAD	14292	432-444-01	F4	4	1844	Sidewalk	PCC	Faulting	1/4" to 1/2"	4.5		No			Grind	Prev grind
5336	PINEWOOD ROAD	14292	432-444-01	F4	4	1844	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
5338	PINEWOOD ROAD	14292	432-444-01	F4	4	1844	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
5339	PINEWOOD ROAD	14292	432-444-01	F4	4	1844	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
5371	PINEWOOD ROAD	14301	432-443-32	F4	4	1844	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	10		No			Grind	
5333	PINEWOOD ROAD	14302	432-444-02	F4	4	1844	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5334	PINEWOOD ROAD	14302	432-444-02	F4	4	1844	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
5335	PINEWOOD ROAD	14302	432-444-02	F4	4	1844	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	10		No			Grind	
5375	PINEWOOD ROAD	14321	432-443-20	F4	4	1844	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
5330	PINEWOOD ROAD	14322	432-444-04	F4	4	1844	Sidewalk	PCC	Faulting	1" to 2"	4		No			Replace Slab	
5331	PINEWOOD ROAD	14322	432-444-04	F4	4	1844	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
5377	PINEWOOD ROAD	14331	432-443-19	F4	4	1844	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
5378	PINEWOOD ROAD	14331	432-443-19	F4	4	1844	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
5327	PINEWOOD ROAD	14352	432-444-07	F4	4	1844	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
5379	PINEWOOD ROAD	14361	432-443-16	F4	4	1844	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	8		No			Grind	
5383	PINEWOOD ROAD	14371	432-443-15	F4	4	1844	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5381	PINEWOOD ROAD	14371	432-443-15	F4	4	1844	Curb/Gutter	PCC	Spalling	1/2" to 1"	0.5		No			Replace C&G	
5324	PINEWOOD ROAD	14372	432-444-09	F4	4	1844	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
5385	PINEWOOD ROAD	14391	432-443-13	F4	4	1844	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
5387	PINEWOOD ROAD	14401	432-443-12	F4	4	1844	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
5321	PINEWOOD ROAD	14402	432-436-02	F4	4	1844	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
5319	PINEWOOD ROAD	14402	432-436-02	F4	4	1844	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	3		No			Grind	
5390	PINEWOOD ROAD	14411	432-434-03	F4	4	1844	Curb/Gutter	PCC	Faulting	1/4" to 1/2"	1		No			Grind C&G	
5388	PINEWOOD ROAD	14411	432-434-03	F4	4	1844	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
5317	PINEWOOD ROAD	14412	432-436-03	F4	4	1844	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
5276	PINEWOOD ROAD	14421	432-435-17	F4	4	1844	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		No			Ramp	
5278	PINEWOOD ROAD	14421	432-435-17	F4	4	1844	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
5315	PINEWOOD ROAD	14422	432-436-04	F4	4	1844	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5312	PINEWOOD ROAD	14442	432-436-06	G4	4	1844	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
5280	PINEWOOD ROAD	14451	432-435-14	G4	4	1844	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5307	PINEWOOD ROAD	14452	432-436-07	G4	4	1844	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		No			Ramp	
5308	PINEWOOD ROAD	14452	432-436-07	G4	4	1844	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		No			Ramp	
5310	PINEWOOD ROAD	14452	432-436-07	G4	4	1844	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
5282	PINEWOOD ROAD	14461	432-435-13	G4	4	1844	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
5283	PINEWOOD ROAD	14461	432-435-13	G4	4	1844	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
5305	PINEWOOD ROAD	14462	432-436-08	G4	4	1844	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
5284	PINEWOOD ROAD	14471	432-435-12	G4	4	1844	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
5299	PINEWOOD ROAD	14472	432-436-09	G4	4	1844	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5301	PINEWOOD ROAD	14472	432-436-09	G4	4	1844	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
5303	PINEWOOD ROAD	14472	432-436-09	G4	4	1844	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
5287	PINEWOOD ROAD	14481	432-435-11	G4	4	1844	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		Yes			Ramp	
5288	PINEWOOD ROAD	14481	432-435-11	G4	4	1844	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5298	PINEWOOD ROAD	14482	432-436-10	G4	4	1844	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	3		No			Grind	
5293	PINEWOOD ROAD	14492	432-436-11	G4	4	1844	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
5294	PINEWOOD ROAD	14492	432-436-11	G4	4	1844	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
5297	PINEWOOD ROAD	14492	432-436-11	G4	4	1844	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
5295	PINEWOOD ROAD	14492	432-436-11	G4	4	1844	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	10		No			Grind	
5340	PINEWOOD ROAD		432-444-18	F4	4	1844	Sidewalk	PCC	Faulting	1/2" to 1"	3.5		No			Ramp	
5373	PINEWOOD ROAD		432-443-31	F4	4	1844	Sidewalk	PCC	Faulting	1/4" to 1/2"	4.5		No			Grind	
5291	PINEWOOD ROAD		432-436-12	G4	4	1844	Driveway	PCC	Pothole	1/4" to 1/2"			No			Grind	
5124	POMEGRANATE ROAD	14422	432-384-01	F4	4	1854	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
5238				F4	4	1854	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
5240	POMEGRANATE ROAD	14431	432-432-01	F4	4	1854	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
5242	POMEGRANATE ROAD	14442	432-383-07	F4	4	1854	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
5245	POMEGRANATE ROAD	14442	432-383-07	F4	4	1854	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5246	POMEGRANATE ROAD	14442	432-383-07	F4	4	1854	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5244	POMEGRANATE ROAD	14442	432-383-07	F4	4	1854	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	15		No			Grind	
4950	POPLAR DRIVE	14391	432-381-17	F4	4	1855	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
4952	POPLAR DRIVE	14391	432-381-17	F4	4	1855	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
4951	POPLAR DRIVE	14391	432-381-17	F4	4	1855	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	3		No			Grind	
4947	POPLAR DRIVE	14392	432-381-18	F4	4	1855	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	2.5		No			Grind	
4948	POPLAR DRIVE	14392	432-381-18	F4	4	1855	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	3		No			Grind	
4946	POPLAR DRIVE	14402	432-381-19	F4	4	1855	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
4953	POPLAR DRIVE	14411	432-381-15	F4	4	1855	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	12		No			Grind	
4944	POPLAR DRIVE	14412	432-381-20	F4	4	1855	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
4945	POPLAR DRIVE	14412	432-381-20	F4	4	1855	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	15		No			Grind	
4943	POPLAR DRIVE	14422	432-381-21	F4	4	1855	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
4954	POPLAR DRIVE	14431	432-381-13	F4	4	1855	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
4955	POPLAR DRIVE	14441	432-381-12	F4	4	1855	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
4941	POPLAR DRIVE	14442	432-381-23	F4	4	1855	Sidewalk	PCC	Corner Break	1/4" to 1/2"	4		No			Grind	
4942	POPLAR DRIVE	14442	432-381-23	F4	4	1855	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
4940	POPLAR DRIVE	14452	432-381-24	F4	4	1855	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
4958	POPLAR DRIVE	14461	432-381-10	F4	4	1855	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		Yes			Grind	Prev grind
4956	POPLAR DRIVE	14461	432-381-10	F4	4	1855	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	3		No			Grind	
4957	POPLAR DRIVE	14461	432-381-10	F4	4	1855	Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	4		No			Replace Slab	
4949	POPLAR DRIVE		432-381-04	F4	4	1855	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7134	QUENT DRIVE	14191	432-031-12	E3	4	1858	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
7135	QUENT DRIVE	14191	432-031-12	E3	4	1858	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
7136	QUENT DRIVE	14191	432-031-12	E3	4	1858	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7133	QUENT DRIVE	14192	432-031-11	E3	4	1858	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
7137	QUENT DRIVE	14211	432-031-13	E3	4	1858	Driveway	PCC	Faulting	1/4" to 1/2"	5		No			Grind Driveway	Between driveway and sidewalk
7132	QUENT DRIVE	14212	432-031-10	E3	4	1858	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
7138	QUENT DRIVE	14221	432-031-14	E3	4	1858	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
7131	QUENT DRIVE	14222	432-031-09	E3	4	1858	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
7140	QUENT DRIVE	14231	432-031-15	E3	4	1858	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
7139	QUENT DRIVE	14231	432-031-15	E3	4	1858	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	1.5		No			Grind	
7129	QUENT DRIVE	14232	432-031-08	E3	4	1858	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
7130	QUENT DRIVE	14232	432-031-08	E3	4	1858	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
5709	RAINTREE LANE	14241	432-445-17	F4	4	1861	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No		Yes	Grind	
5710	RAINTREE LANE	14241	432-445-17	F4	4	1861	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		Yes		Yes	Grind	
5711	RAINTREE LANE	14241	432-445-17	F4	4	1861	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No		Yes	Grind	
5643	RAINTREE LANE	14242	432-443-22	F4	4	1861	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	At water meter
5645	RAINTREE LANE	14242	432-443-22	F4	4	1861	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
5644	RAINTREE LANE	14242	432-443-22	F4	4	1861	Curb/Gutter	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
5712	RAINTREE LANE	14251	432-445-16	F4	4	1861	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
5713	RAINTREE LANE	14251	432-445-16	F4	4	1861	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	20		No			Grind	
5642	RAINTREE LANE	14252	432-443-23	F4	4	1861	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
5640	RAINTREE LANE	14252	432-443-23	F4	4	1861	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	3		Yes			Grind	
5641	RAINTREE LANE	14252	432-443-23	F4	4	1861	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	8		No			Grind	
5714	RAINTREE LANE	14261	432-445-15	F4	4	1861	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5639	RAINTREE LANE	14262	432-443-24	F4	4	1861	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		Yes			Grind	
5716	RAINTREE LANE	14271	432-445-14	F4	4	1861	Sidewalk	PCC	Faulting	1" to 2"	3.5		No			Replace Slab	Prev grind
5715	RAINTREE LANE	14271	432-445-14	F4	4	1861	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
5637	RAINTREE LANE	14272	432-443-25	F4	4	1861	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	At water meter
5635	RAINTREE LANE	14272	432-443-25	F4	4	1861	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5636	RAINTREE LANE	14272	432-443-25	F4	4	1861	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	7		No			Replace Slab	
5638	RAINTREE LANE	14272	432-443-25	F4	4	1861	Curb/Gutter	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
5717	RAINTREE LANE	14281	432-445-13	F4	4	1861	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
5718	RAINTREE LANE	14281	432-445-13	F4	4	1861	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
5634	RAINTREE LANE	14282	432-443-26	F4	4	1861	Sidewalk	PCC	Faulting	1/2" to 1"	2		No			Ramp	
5633	RAINTREE LANE	14282	432-443-26	F4	4	1861	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
5719	RAINTREE LANE	14291	432-445-12	F4	4	1861	Sidewalk	PCC	Faulting	1/2" to 1"	2.5		No			Ramp	
5632	RAINTREE LANE	14292	432-443-27	F4	4	1861	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
5720	RAINTREE LANE	14301	432-445-11	F4	4	1861	Sidewalk	PCC	Faulting	1/2" to 1"	3.5		No			Ramp	
5721	RAINTREE LANE	14301	432-445-11	F4	4	1861	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
5722			)	F4	4	1861	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
5751	RAINTREE LANE	14322	432-443-02	F4	4	1861	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5752	RAINTREE LANE	14322	432-443-02	F4	4	1861	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
5723	RAINTREE LANE	14331	432-442-16	F4	4	1861	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
5724	RAINTREE LANE	14331	432-442-16	F4	4	1861	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	18		No			Grind	
5725	RAINTREE LANE	14341	432-442-15	F4	4	1861	Sidewalk	PCC		1/4" to 1/2"	0.5		No			Grind	
5750	RAINTREE LANE	14362	432-443-06	F4	4	1861	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
5726	RAINTREE LANE	14371	432-442-12	F4	4	1861	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
5749	RAINTREE LANE	14372	432-443-07	F4	4	1861	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5748	RAINTREE LANE	14382	432-443-08	F4	4	1861	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
5727	RAINTREE LANE	14401	432-442-09	F4	4	1861	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
5746	RAINTREE LANE	14402	432-443-10	F4	4	1861	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	Prev grind
5747	RAINTREE LANE	14402	432-443-10	F4	4	1861	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
5744	RAINTREE LANE	14412	432-434-01	F4	4	1861	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
5745	RAINTREE LANE	14412	432-434-01	F4	4	1861	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
5743	RAINTREE LANE	14432	432-435-01	F4	4	1861	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
5728	RAINTREE LANE	14441	432-433-17	F4	4	1861	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	10		No			Grind	
5741	RAINTREE LANE	14442	432-435-02	F4	4	1861	Sidewalk	PCC		1/4" to 1/2"	1		No			Grind	Prev grinded, at meter
5742	RAINTREE LANE	14442	432-435-02	F4	4	1861	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	3		No			Grind	
5729	RAINTREE LANE	14451	432-433-16	F4	4	1861	Sidewalk	PCC		1/4" to 1/2"	1		No			Grind	Prev grind
5730	RAINTREE LANE	14461	432-433-15	F4	4	1861	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
5739	RAINTREE LANE	14462	432-435-04	F4	4	1861	Sidewalk	PCC	Faulting	1/2" to 1"	2		Yes			Ramp	Prev grind
5740	RAINTREE LANE	14462	432-435-04	F4	4	1861	Sidewalk	PCC	Faulting	1/2" to 1"	1		No			Ramp	
5731	RAINTREE LANE	14481	432-433-13	F4	4	1861	Sidewalk	PCC	Faulting	1/2" to 1"	4		No			Ramp	
5732	RAINTREE LANE	14481	432-433-13	F4	4	1861	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	2		Yes			Grind	
5733	RAINTREE LANE	14491	432-433-12	F4	4	1861	Sidewalk	PCC		1/4" to 1/2"	3.5		No			Grind	Prev grind
5734	RAINTREE LANE	14491	432-433-12	F4	4	1861	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
5735	RAINTREE LANE	14491	432-433-12	F4	4	1861	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
5737	RAINTREE LANE	14492	432-435-07	F4	4	1861	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
5738	RAINTREE LANE	14492	432-435-07	F4	4	1861	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9442	RAINTREE LANE	14541	432-451-17	F4	4	1860	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
9443	RAINTREE LANE	14552	432-453-01	G4	4	1860	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9440	RAINTREE LANE	14561	432-451-15	G4	4	1860	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
9441	RAINTREE LANE	14561	432-451-15	G4	4	1860	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
9439	RAINTREE LANE	14571	432-451-14	G4	4	1860	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Running parallel with sidewalk
9444	RAINTREE LANE	14572	432-453-03	G4	4	1860	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
9438	RAINTREE LANE	14581	432-451-13	G4	4	1860	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
9445	RAINTREE LANE	14582	432-453-04	G4	4	1860	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9673	RAINTREE LANE	14641	432-461-01	G4	4	1860	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No		Yes	Grind	
9672	RAINTREE LANE	14641	432-461-01	G4	4	1860	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	2		No		Yes	Grind	
9674	RAINTREE LANE	14661	432-461-03	G4	4	1860	Sidewalk	PCC		1/4" to 1/2"	2		No			Grind	
9675	RAINTREE LANE	14701	432-461-07	G4	4	1860	Sidewalk	PCC	Faulting	1/2" to 1"	2.5		No			Ramp	Prev grind
9676	RAINTREE LANE	14711	432-461-08	G4	4	1860	Sidewalk	PCC	Faulting	1/2" to 1"	2		Yes			Ramp	Prev grind
9677	RAINTREE LANE	14711	432-461-08	G4	4	1860	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
9639	RAINTREE LANE	2301	432-462-15	G4	4	1860	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
9649	RAINTREE LANE	2301	432-462-01	G4	4	1860	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9650	RAINTREE LANE	2301	432-462-01	G4	4	1860	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
9665	RAINTREE LANE	2301	432-453-18	G4	4	1860	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
9666	RAINTREE LANE	2301	432-453-18	G4	4	1860	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
9667	RAINTREE LANE	2301	432-453-18	G4	4	1860	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
9640	RAINTREE LANE	2302	432-462-14	G4	4	1860	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	Prev grind
9669	RAINTREE LANE	2302	432-453-17	G4	4	1860	Sidewalk	PCC	Faulting	1/2" to 1"	2		Yes			Ramp	
9641	RAINTREE LANE	2302	432-462-14	G4	4	1860	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
9642	RAINTREE LANE	2302	432-462-14	G4	4	1860	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9651	RAINTREE LANE	2302	432-453-31	G4	4	1860	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
9668	RAINTREE LANE	2302	432-453-17	G4	4	1860	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
9670	RAINTREE LANE	2302	432-453-17	G4	4	1860	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
9767	RAINTREE LANE	2311	432-423-10	G3	4	1859	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
9741	RAINTREE LANE	2311	432-422-10	G4	4	1859	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
9698	RAINTREE LANE	2311	432-421-09	G4	4	1859	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No			Grind	
9699	RAINTREE LANE	2311	432-421-09	G4	4	1859	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
9700	RAINTREE LANE	2311	432-421-09	G4	4	1859	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		Yes			Grind	
9701	RAINTREE LANE	2311	432-421-09	G4	4	1859	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
12032	RAINTREE LANE	2311	432-422-10	G4	4	1859	Curb/Gutter	PCC	Linear Cracking	1/2" to 1"	2		No			Grind	
9697				G4	4	1859	Sidewalk	PCC		1/4" to 1/2"	1		No			Grind	Prev grind

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
9680	RAINTREE LANE	2312	432-461-13	G4	4	1859	Sidewalk	PCC	Faulting	1/4" to 1/2"	6		No			Grind	Prev grind
9681	RAINTREE LANE	2312	432-461-13	G4	4	1859	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No			Grind	Prev grind
9765	RAINTREE LANE	2312	432-423-09	G3	4	1859	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	
9766	RAINTREE LANE	2312	432-423-09	G3	4	1859	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
9739	RAINTREE LANE	2312	432-422-09	G4	4	1859	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
9740	RAINTREE LANE	2312	432-422-09	G4	4	1859	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
9695	RAINTREE LANE	2312	432-463-09	G4	4	1859	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9696	RAINTREE LANE	2312	432-463-09	G4	4	1859	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
9679	RAINTREE LANE	2312	432-461-13	G4	4	1859	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
9615	RAINTREE LANE	2331	432-424-01	G4	4	1859	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
9616	RAINTREE LANE	2331	432-424-01	G4	4	1859	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	Prev grind
9604	RAINTREE LANE	2331	432-424-12	G4	4	1859	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	
9605	RAINTREE LANE	2331	432-424-12	G4	4	1859	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
9617	RAINTREE LANE	2331	432-424-01	G4	4	1859	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9626	RAINTREE LANE	2331	432-462-26	G4	4	1859	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
9582	RAINTREE LANE	2332	432-424-24	G4	4	1859	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	Prev grind
9627	RAINTREE LANE	2332	432-462-25	G4	4	1859	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
9580	RAINTREE LANE	2332	432-424-24	G3	4	1859	Sidewalk	PCC	Faulting	1/2" to 1"	4		No			Ramp	
9581	RAINTREE LANE	2332	432-424-24	G4	4	1859	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
9606	RAINTREE LANE	2332	432-424-11	G4	4	1859	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9618	RAINTREE LANE	2332	432-462-35	G4	4	1859	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
5755	RAINTREE LANE		432-443-01	F4	4	1861	Sidewalk	PCC	Faulting	1/2" to 1"	3.5		No			Ramp	Prev grind
5667	RAINTREE LANE		432-483-27	F4	4	1862	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		Yes			Grind	Prev grind
5700	RAINTREE LANE		432-385-01	F4	4	1862	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No		Yes	Grind	Prev grind
5703	RAINTREE LANE		432-385-01	F4	4	1862	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes		Yes	Grind	Prev grind
5690	RAINTREE LANE		432-481-32	F4	4	1862	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		Yes			Grind	Prev grind
5679	RAINTREE LANE		432-482-30	F4	4	1862	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	Prev grind
9671	RAINTREE LANE		432-452-01	G4	4	1860	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No		Yes	Grind	Prev grind
5648	RAINTREE LANE		432-486-27	F4	4	1861	Curb/Gutter	PCC	Faulting	1/4" to 1/2"	1		No		Yes	Grind C&G	
5660	RAINTREE LANE		432-486-27	F4	4	1862	Sidewalk	PCC	Faulting	1/2" to 1"	1		No			Ramp	
5665	RAINTREE LANE		432-483-27	F4	4	1862	Sidewalk	PCC	Faulting	1/2" to 1"	1		Yes			Ramp	
5693	RAINTREE LANE		432-484-27	F4	4	1862	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		No			Ramp	
5695	RAINTREE LANE		432-484-27	F4	4	1862	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		No		Yes	Ramp	
5696	RAINTREE LANE		432-484-27	F4	4	1862	Sidewalk	PCC	Faulting	1/2" to 1"	3.5		Yes		Yes	Ramp	
5064	RAINTREE LANE		432-414-30	F4	4	1862	Sidewalk	PCC	Faulting	1/2" to 1"	1		No			Ramp	
5653	RAINTREE LANE		432-486-27	F4	4	1861	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		Yes			Ramp	
5657	RAINTREE LANE		432-486-27	F4	4	1862	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No		Yes	Grind	
5658	RAINTREE LANE		432-486-27	F4	4	1862	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
5659	RAINTREE LANE		432-486-27	F4	4	1862	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
5661	RAINTREE LANE		432-486-27	F4	4	1862	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
5662	RAINTREE LANE		432-486-27	F4	4	1862	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
5663	RAINTREE LANE		432-486-27	F4	4	1862	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
5666	RAINTREE LANE		432-483-27	F4	4	1862	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
5668	RAINTREE LANE		432-483-27	F4	4	1862	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
5669	RAINTREE LANE		432-483-27	F4	4	1862	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
5670	RAINTREE LANE		432-483-27	F4	4	1862	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
5672	RAINTREE LANE		432-483-27	F4	4	1862	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
5673	RAINTREE LANE		432-483-27	F4	4	1862	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
5674	RAINTREE LANE		432-483-27	F4	4	1862	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
5675	RAINTREE LANE		432-483-27	F4	4	1862	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
5676	RAINTREE LANE		432-483-27	F4	4	1862	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
5692	RAINTREE LANE		432-484-27	F4	4	1862	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
5694	RAINTREE LANE		432-484-27	F4	4	1862	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
5698	RAINTREE LANE		432-385-01	F4	4	1862	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No		Yes	Grind	
5699	RAINTREE LANE		432-385-01	F4	4	1862	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No		Yes	Grind	
5683	RAINTREE LANE		432-481-32	F4	4	1862	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
5684	RAINTREE LANE		432-481-32	F4	4	1862	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
5685	RAINTREE LANE		432-481-32	F4	4	1862	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
5687	RAINTREE LANE		432-481-32	F4	4	1862	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
5688	RAINTREE LANE		432-481-32	F4	4	1862	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5689	RAINTREE LANE		432-481-32	F4	4	1862	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
5067	RAINTREE LANE		432-482-29	F4	4	1862	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
5068	RAINTREE LANE		432-482-29	F4	4	1862	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5069				F4	4	1862	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
5070	RAINTREE LANE		432-482-29	F4	4	1862	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
5072	RAINTREE LANE		432-482-29	F4	4	1862	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
5073	RAINTREE LANE		432-482-29	F4	4	1862	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
5682	RAINTREE LANE		432-482-29	F4	4	1862	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		Yes			Grind	
5677	RAINTREE LANE		432-482-30	F4	4	1862	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
5678	RAINTREE LANE		432-482-30	F4	4	1862	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5680	RAINTREE LANE		432-482-30	F4	4	1862	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5681	RAINTREE LANE		432-482-30	F4	4	1862	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
5753	RAINTREE LANE		432-443-01	F4	4	1861	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5754	RAINTREE LANE		432-443-01	F4	4	1861	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
5649	RAINTREE LANE		432-486-27	F4	4	1861	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No		Yes	Grind	
5650	RAINTREE LANE		432-486-27	F4	4	1861	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5651	RAINTREE LANE		432-486-27	F4	4	1861	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5652	RAINTREE LANE		432-486-27	F4	4	1861	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
5655	RAINTREE LANE		432-486-27	F4	4	1861	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5706	RAINTREE LANE		432-385-01	F4	4	1861	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No		Yes	Grind	
5707	RAINTREE LANE		432-385-01	F4	4	1861	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No		Yes	Grind	
5708	RAINTREE LANE		432-385-01	F4	4	1861	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No		Yes	Grind	
5686	RAINTREE LANE		432-481-32	F4	4	1862	Driveway	PCC	Linear Cracking	1/4" to 1/2"	2		No			Grind	
5671	RAINTREE LANE		432-483-27	F4	4	1862	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	1.5		Yes			Grind	
5701	RAINTREE LANE		432-385-01	F4	4	1862	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	1.5		No		Yes	Grind	
5702	RAINTREE LANE		432-385-01	F4	4	1862	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	3		No		Yes	Grind	
5705	RAINTREE LANE		432-385-01	F4	4	1861	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	1		No		Yes	Grind	
5647	RAINTREE LANE		432-486-27	F4	4	1861	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	8		No			Grind	
5664	RAINTREE LANE		432-486-27	F4	4	1862	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	4		No			Grind	
5656	RAINTREE LANE		432-486-27	F4	4	1862	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	5		No		Yes	Grind	
5691	RAINTREE LANE		432-484-27	F4	4	1862	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	4		No			Grind	
5697	RAINTREE LANE		432-484-27	F4	4	1862	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	7		No		Yes	Grind	
5071	RAINTREE LANE		432-482-29	F4	4	1862	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	10		No			Grind	
5646	RAINTREE LANE		432-486-27	F4	4	1861	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	15		No			Grind	
5654	RAINTREE LANE		432-486-27	F4	4	1861	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	10		No		Yes	Grind	
5704	RAINTREE LANE		432-385-01	F4	4	1861	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	12		No		Yes	Grind	
5065	RAINTREE LANE		432-414-30	F4	4	1862	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	9		No			Grind	
5066	RAINTREE LANE		432-414-30	F4	4	1862	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	4		No			Grind	
5736	RAINTREE LANE		432-435-08	F4	4	1861	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	8		No			Grind	
2532	RED HILL AVENUE	1402	432-011-12	F3	4	1189	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes		Yes	Grind	Prev grind
2533	RED HILL AVENUE	1402	432-011-12	F3	4	1189	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes		Yes	Grind	Prev grind
2534	RED HILL AVENUE	1402	432-011-12	F3	4	1189	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No		Yes	Grind	Prev grind
2538	RED HILL AVENUE	1402	432-011-12	F3	4	1189	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No		Yes	Grind	Prev grind
2531	RED HILL AVENUE	1402	432-011-12	F3	4	1189	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No		Yes	Grind	
2535	RED HILL AVENUE	1402	432-011-12	F3	4	1189	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No		Yes	Grind	
2536	RED HILL AVENUE	1402	432-011-12	F3	4	1189	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No		Yes	Grind	
2537	RED HILL AVENUE	1402	432-011-12	F3	4	1189	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No		Yes	Grind	
2539	RED HILL AVENUE	1402	432-011-12	F3	4	1189	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No		Yes	Grind	
2540	RED HILL AVENUE	1402	432-011-12	F3	4	1189	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No		Yes	Grind	
7272	RED HILL AVENUE	14042	432-402-08	E3	4	1195	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
7274	RED HILL AVENUE	14042	432-402-08	E3	4	1195	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
8311	RED HILL AVENUE	14081	432-041-04	E3	4	1193	Sidewalk	PCC	Faulting	1/4" to 1/2"	4.5		No		Yes	Grind	
8312	RED HILL AVENUE	14081	432-041-04	E3	4	1193	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No		Yes	Grind	
8310	RED HILL AVENUE	14092	432-401-09	E3	4	1194	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No		Yes	Grind	
8309	RED HILL AVENUE	14122	432-031-21	E3	4	1194	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No		Yes	Grind	
8308	RED HILL AVENUE	14122	432-031-21	E3	4	1194	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	4		Yes		Yes	Grind	
8301	RED HILL AVENUE	14160	432-031-20	E3	4	1194	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
8302	RED HILL AVENUE	14160	432-031-20	E3	4	1194	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
8303	RED HILL AVENUE	14160	432-031-20	E3	4	1194	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
8304	RED HILL AVENUE	14160	432-031-20	E3	4	1194	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
8305	RED HILL AVENUE	14160	432-031-20	E3	4	1194	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
8300	RED HILL AVENUE	14160	432-031-20	E3	4	1194	Driveway	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
8307	RED HILL AVENUE	14160	432-031-20	E3	4	1194	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	1	6"	No			Grind	
8306	RED HILL AVENUE	14160	432-031-20	E3	4	1194	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	5		No			Grind	
8314	RED HILL AVENUE	14171	432-041-20	E3	4	1193	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No		Yes	Grind	Prev grind
8316	RED HILL AVENUE	14171	432-041-20	E3	4	1193	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No		Yes	Grind	Prev grind
8319	RED HILL AVENUE	14171	432-041-20	E3	4	1193	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		No		Yes	Ramp	
8313			)	E3	4	1193	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No		Yes	Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
8315	RED HILL AVENUE	14171	432-041-20	E3	4	1193	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		Yes		Yes	Grind	
8317	RED HILL AVENUE	14171	432-041-20	E3	4	1193	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No		Yes	Grind	
8318	RED HILL AVENUE	14171	432-041-20	E3	4	1193	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No		Yes	Grind	
8299	RED HILL AVENUE	14192	432-031-19	E3	4	1194	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
8298	RED HILL AVENUE	14212	432-031-18	E3	4	1194	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	Prev grind
8322	RED HILL AVENUE	14213	432-041-21	E3	4	1193	Sidewalk	PCC	Faulting	1/4" to 1/2"	6		No		Yes	Grind	Prev grind
8320	RED HILL AVENUE	14213	432-041-21	E3	4	1193	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No		Yes	Grind	
8323	RED HILL AVENUE	14213	432-041-21	E3	4	1193	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No		Yes	Grind	
8324	RED HILL AVENUE	14213	432-041-21	E3	4	1193	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No		Yes	Grind	
8321	RED HILL AVENUE	14213	432-041-21	E3	4	1193	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No		Yes	Grind	
8297	RED HILL AVENUE	14222	432-031-17	E3	4	1194	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
8326	RED HILL AVENUE	14231	432-041-14	E3	4	1193	Sidewalk	PCC	Corner Break	1/2" to 1"	2		No		Yes	Ramp	
8325	RED HILL AVENUE	14231	432-041-14	E3	4	1193	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No		Yes	Grind	
8328	RED HILL AVENUE	14231	432-041-14	E3	4	1193	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No		Yes	Grind	
8327	RED HILL AVENUE	14231	432-041-14	E3	4	1193	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4	7"	No		Yes	Grind	
8296	RED HILL AVENUE	14232	432-031-27	E3	4	1194	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	Prev grind
8295	RED HILL AVENUE	14232	432-031-27	E3	4	1194	Curb/Gutter	PCC	Faulting	1/4" to 1/2"			No			Grind C&G	
2183	RED HILL AVENUE	14252	432-091-41	E3	4	1187	Ramp	PCC	Sidewalk Curb Separation	1/4" to 1/2"	6		No			Grind	
8273	RED HILL AVENUE	14304	432-101-01	E3	4	1192	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
8285	RED HILL AVENUE	14304	432-101-01	E3	4	1192	Sidewalk	PCC	Faulting	1/2" to 1"	1		Yes			Ramp	
8271	RED HILL AVENUE	14304	432-101-01	E3	4	1192	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
8272	RED HILL AVENUE	14304	432-101-01	E3	4	1192	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
8275	RED HILL AVENUE	14304	432-101-01	E3	4	1192	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
8276	RED HILL AVENUE	14304	432-101-01	E3	4	1192	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
8277	RED HILL AVENUE	14304	432-101-01	E3	4	1192	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
8279	RED HILL AVENUE	14304	432-101-01	E3	4	1192	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
8280	RED HILL AVENUE	14304	432-101-01	E3	4	1192	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
8282	RED HILL AVENUE	14304	432-101-01	E3	4	1192	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
8283	RED HILL AVENUE	14304	432-101-01	E3	4	1192	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
8284	RED HILL AVENUE	14304	432-101-01	E3	4	1192	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
8286	RED HILL AVENUE	14304	432-101-01	E3	4	1192	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
8288	RED HILL AVENUE	14304	432-101-01	E3	4	1192	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
8274	RED HILL AVENUE	14304	432-101-01	E3	4	1192	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	6		Yes			Replace Slab	
8278	RED HILL AVENUE	14304	432-101-01	E3	4	1192	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	3		Yes			Grind	
8281	RED HILL AVENUE	14304	432-101-01	E3	4	1192	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	6		Yes			Grind	
8287	RED HILL AVENUE	14304	432-101-01	E3	4	1192	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	4		No			Grind	
8331	RED HILL AVENUE	14421	432-111-03	E3	4	1187	Driveway	PCC	Faulting	1/2" to 1"	5		No			Grind Driveway	
8330	RED HILL AVENUE	14421	432-111-03	E3	4	1187	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
8332	RED HILL AVENUE	14421	432-111-03	E3	4	1187	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
8333	RED HILL AVENUE	14421	432-111-03	E3	4	1187	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
8334	RED HILL AVENUE	14421	432-111-03	E3	4	1187	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
8335	RED HILL AVENUE	14421	432-111-03	E3	4	1187	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
8208	RED HILL AVENUE	14462	432-212-30	F3	4	1192	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
8214	RED HILL AVENUE	14462	432-212-30	F3	4	1192	Sidewalk	PCC	Faulting	1/2" to 1"	1		Yes			Ramp	Running parallel to sidewalk
8209	RED HILL AVENUE	14462	432-212-30	F3	4	1192	Sidewalk	PCC	Corner Break	1/2" to 1"	2.5		No			Ramp	
8211	RED HILL AVENUE	14462	432-212-30	F3	4	1192	Sidewalk	PCC	Faulting	1" to 2"	2.5		Yes			Replace Slab	
8212	RED HILL AVENUE	14462	432-212-30	F3	4	1192	Sidewalk	PCC	Faulting	1/2" to 1"	2.5		Yes			Ramp	
8210	RED HILL AVENUE	14462	432-212-30	F3	4	1192	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
8213	RED HILL AVENUE	14462	432-212-30	F3	4	1192	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
2637	RED HILL AVENUE	14501	432-171-07	F3	4	1190	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No		Yes	Grind	
2640	RED HILL AVENUE	14501	432-171-07	F3	4	1190	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	10		Yes		Yes	Replace Slab(s)	
2639	RED HILL AVENUE	14501	432-171-07	F3	4	1190	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	20		No		Yes	Grind	
3934	RED HILL AVENUE	14511	432-181-44	F3	4	1191	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	Prev grind
3933	RED HILL AVENUE	14511	432-181-44	F3	4	1191	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	1.5		Yes			Replace Slab	
3935	RED HILL AVENUE	14511	432-181-44	F3	4	1191	Sidewalk	PCC	Spalling	1/4" to 1/2"	0.5		No			Grind	
2629	RED HILL AVENUE	14521	432-171-12	F3	4	1190	Sidewalk	PCC	Faulting	1/2" to 1"	4		No		Yes	Ramp	Prev grind
2616	RED HILL AVENUE	14521	432-171-12	F3	4	1190	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No		Yes	Grind	Prev grind
2635	RED HILL AVENUE	14521	432-171-12	F3	4	1190	Driveway	PCC	Corner Break	1" to 2"	4		No		Yes	Replace Slab	
2614	RED HILL AVENUE	14521	432-171-12	F3	4	1190	Sidewalk	PCC	Divided Slab	1" to 2"			No		Yes	Replace Slab(s)	
2632	RED HILL AVENUE	14521	432-171-12	F3	4	1190	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes		Yes	Ramp	
3937	RED HILL AVENUE	14521	432-181-43	F3	4	1191	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
2610	RED HILL AVENUE	14521	432-171-12	F3	4	1190	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No		Yes	Grind	
2630	RED HILL AVENUE	14521	432-171-12	F3	4	1190	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes		Yes	Grind	
2634				F3	4	1190	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No		Yes	Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
2612	RED HILL AVENUE	14521	432-171-12	F3	4	1190	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	8		Yes		Yes	Replace Slab	
2621	RED HILL AVENUE	14521	432-171-12	F3	4	1190	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	3		Yes		Yes	Replace Slab	
3938	RED HILL AVENUE	14521	432-181-43	F3	4	1191	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	10		No			Grind	
2608	RED HILL AVENUE	14521	432-171-12	F3	4	1190	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	10		Yes		Yes	Grind	
2622	RED HILL AVENUE	14521	432-171-12	F3	4	1190	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	8		No		Yes	Grind	
2626	RED HILL AVENUE	14521	432-171-12	F3	4	1190	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	10		No		Yes	Grind	
2633	RED HILL AVENUE	14521	432-171-12	F3	4	1190	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	5		Yes		Yes	Grind	
3936	RED HILL AVENUE	14521	432-181-43	F3	4	1191	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	12		No			Grind	
2627	RED HILL AVENUE	14521	432-171-12	F3	4	1190	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	15		No		Yes	Grind	
2624	RED HILL AVENUE	14521	432-171-12	F3	4	1190	Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	3		Yes		Yes	Replace Slab	
2619	RED HILL AVENUE	14521	432-171-12	F3	4	1190	Curb/Gutter	PCC	Spalling	1" to 2"	1		No		Yes	Patch	
2268	RED HILL AVENUE	14521	432-171-12	F3	4	1190	Ramp	PCC	Spalling	1/4" to 1/2"	1		No		Yes	Grind	
3939	RED HILL AVENUE	14531	432-181-42	F3	4	1191	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	2.5		No			Grind	
3940	RED HILL AVENUE	14571	432-181-38	F3	4	1191	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	2		No			Grind	
3941	RED HILL AVENUE	14591	432-181-36	F3	4	1191	Curb/Gutter	PCC	Spalling	1/4" to 1/2"			No			Grind	
2263	RED HILL AVENUE	14601	432-171-10	F3	4	1190	Sidewalk	PCC	Faulting	1/2" to 1"	4.5		Yes		Yes	Ramp	Prev grind
2261	RED HILL AVENUE	14601	432-171-10	F3	4	1190	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No		Yes	Grind	
2265	RED HILL AVENUE	14601	432-171-10	F3	4	1190	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes		Yes	Grind	
2266	RED HILL AVENUE	14601	432-171-10	F3	4	1190	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No		Yes	Grind	
2264	RED HILL AVENUE	14601	432-171-10	F3	4	1190	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	13		Yes		Yes	Replace Slab	
2262	RED HILL AVENUE	14601	432-171-10	F3	4	1190	Curb/Gutter	PCC	Spalling	1" to 2"			No		Yes	Patch	
2267	RED HILL AVENUE	14601	432-171-10	F3	4	1190	Curb/Gutter	PCC	Spalling	1" to 2"	1	5"	No		Yes	Patch	
3942	RED HILL AVENUE	14611	432-181-34	F3	4	1191	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
3943	RED HILL AVENUE	14621	432-181-33	F3	4	1191	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	2		Yes			Grind	
3945	RED HILL AVENUE	14631	432-181-32	F3	4	1191	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		Yes			Ramp	
3944	RED HILL AVENUE	14631	432-181-32	F3	4	1191	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
3946	RED HILL AVENUE	14631	432-181-32	F3	4	1191	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	4		Yes			Replace Slab	
3947	RED HILL AVENUE	14641	432-181-31	F3	4	1191	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	2.5		Yes			Grind	
3948	RED HILL AVENUE	14651	432-181-30	F3	4	1191	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		Yes			Grind	
3949	RED HILL AVENUE	14661	432-181-29	F3	4	1191	Curb/Gutter	PCC	Faulting	1/4" to 1/2"			No			Grind C&G	
3950	RED HILL AVENUE	14691	432-181-26	F3	4	1191	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
3951	RED HILL AVENUE	14691	432-181-26	F3	4	1191	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	2		No			Grind	
3952	RED HILL AVENUE	14711	432-181-91	F3	4	1191	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
3953	RED HILL AVENUE	14711	432-181-91	F3	4	1191	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
4302	RED HILL AVENUE	14741	432-331-65	F3	4	1188	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
4303	RED HILL AVENUE	14751	432-331-64	F3	4	1188	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
4304	RED HILL AVENUE	14751	432-331-64	F3	4	1188	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	4		No			Grind	
4305	RED HILL AVENUE	14761	432-331-63	F3	4	1188	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
4306	RED HILL AVENUE	14771	432-331-62	F3	4	1188	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
4307	RED HILL AVENUE	14771	432-331-62	F3	4	1188	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
4308	RED HILL AVENUE	14791	432-331-60	F3	4	1188	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
4310	RED HILL AVENUE	14801	432-331-59	F3	4	1188	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	Prev grind
4309	RED HILL AVENUE	14801	432-331-59	F3	4	1188	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	8		Yes			Grind	
4334	RED HILL AVENUE	1481	430-263-10	F3	4	5047	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
4335	RED HILL AVENUE	1481	430-263-10	F3	4	5047	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
4333	RED HILL AVENUE	1481	430-263-10	F3	4	5047	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	10		No			Grind	
4311	RED HILL AVENUE	14811	432-331-58	F3	4	1188	Sidewalk	PCC	Faulting	1/2" to 1"	3		No			Ramp	Prev grind
4312	RED HILL AVENUE	14811	432-331-58	F3	4	1188	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
4313	RED HILL AVENUE	14821	432-331-57	F3	4	1188	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
4314	RED HILL AVENUE	14821	432-331-57	F3	4	1188	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
4315	RED HILL AVENUE	14821	432-331-57	F3	4	1188	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
4316	RED HILL AVENUE	14831	432-331-56	F3	4	1188	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	20		No			Grind	
4317	RED HILL AVENUE	14841	432-331-55	F3	4	1188	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
4318	RED HILL AVENUE	14871	432-331-52	F3	4	5048	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		Yes			Grind	
4320	RED HILL AVENUE	14871	432-331-52	F3	4	5048	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
4319	RED HILL AVENUE	14871	432-331-52	F3	4	5048	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	4		Yes			Grind	
4321	RED HILL AVENUE	14881	432-331-51	F3	4	5048	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
4323	RED HILL AVENUE	14881	432-331-51	F3	4	5048	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
4322	RED HILL AVENUE	14881	432-331-51	F3	4	5048	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	4		No			Grind	
4324	RED HILL AVENUE	14891	432-331-50	F3	4	5048	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
4325	RED HILL AVENUE	14891	432-331-50	F3	4	5048	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
4326	RED HILL AVENUE	14891	432-331-50	F3	4	5048	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	3		No			Grind	
4327	RED HILL AVENUE	14901	432-331-49	F3	4	5048	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
4328				F3	4	5048	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
4329	RED HILL AVENUE	14921	432-331-47	F3	4	5048	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		Yes			Grind	
4330	RED HILL AVENUE	14931	432-331-46	F3	4	5048	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
4331	RED HILL AVENUE	14931	432-331-46	F3	4	5048	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
4332	RED HILL AVENUE	14931	432-331-46	F3	4	5048	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
8215	RED HILL AVENUE	1522	432-212-03	E3	4	1192	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
8216	RED HILL AVENUE	1522	432-212-03	E3	4	1192	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
11500	RED HILL AVENUE	1651	430-281-02	F3	4	5048	Sidewalk	PCC	Other - Leave Comment	1/4" to 1/2"			No			Grind	Removed pole. Holes in ground
2273	RED HILL AVENUE		432-173-49	F3	4	1190	Driveway	PCC	Other - Leave Comment	1/2" to 1"			No			Grind	Curb has some large cracks through driveway
8291	RED HILL AVENUE		999-000-20	E3	4	1192	Sidewalk	PCC	Buckled Slab	1/2" to 1"	3		No			Replace Slab	On the side of grate
4339	RED HILL AVENUE		432-011-24	F3	4	5047	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No		Yes	Grind	Prev grind
4340	RED HILL AVENUE		432-011-24	F3	4	5047	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No		Yes	Grind	Prev grind
2277	RED HILL AVENUE		432-173-49	F3	4	1190	Sidewalk	PCC	Faulting	1/4" to 1/2"	30		No			Grind	Running parallel to sidewalk
2270	RED HILL AVENUE		432-172-49	F3	4	1190	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	15		No			Grind	Some spalling
4338	RED HILL AVENUE		432-011-24	F3	4	5047	Curb/Gutter	PCC	Faulting	1/4" to 1/2"			No		Yes	Grind C&G	
2276	RED HILL AVENUE		432-173-49	F3	4	1190	Sidewalk	PCC	Faulting	1/2" to 1"	2.5		No			Ramp	
4343	RED HILL AVENUE		432-011-24	F3	4	5047	Sidewalk	PCC	Faulting	1/2" to 1"	3		No		Yes	Ramp	
8292	RED HILL AVENUE		999-000-20	E3	4	1192	Sidewalk	PCC	Faulting	1/2" to 1"	1		No			Ramp	
8293	RED HILL AVENUE		999-000-20	E3	4	1192	Sidewalk	PCC	Faulting	1/2" to 1"	1		No			Ramp	
7276	RED HILL AVENUE		432-402-08	E3	4	1195	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
2274	RED HILL AVENUE		432-173-49	F3	4	1190	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
2280	RED HILL AVENUE		432-173-49	F3	4	1190	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
2281	RED HILL AVENUE		432-173-49	F3	4	1190	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
2269	RED HILL AVENUE		432-172-49	F3	4	1190	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
4341	RED HILL AVENUE		432-011-24	F3	4	5047	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes		Yes	Grind	
4342	RED HILL AVENUE		432-011-24	F3	4	5047	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No		Yes	Grind	
4344	RED HILL AVENUE		432-011-24	F3	4	5047	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No		Yes	Grind	
4336	RED HILL AVENUE		999-000-09	F3	4	5047	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
8289	RED HILL AVENUE		999-000-20	E3	4	1192	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
8290	RED HILL AVENUE		999-000-20	E3	4	1192	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
8294	RED HILL AVENUE		999-000-20	E3	4	1192	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
8329	RED HILL AVENUE		432-091-42	E3	4	1187	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
2279	RED HILL AVENUE		432-173-49	F3	4	1190	Curb/Gutter	PCC	Sidewalk Curb Separation	1" to 2"	4		No			Replace Curb	
2275	RED HILL AVENUE		432-173-49	F3	4	1190	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	8		Yes			Replace Slab	
2271	RED HILL AVENUE		432-172-49	F3	4	1190	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	4		No			Grind	
4337	RED HILL AVENUE		432-011-24	F3	4	5047	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	4		No		Yes	Grind	
7290	RED HILL AVENUE		432-042-06	E3	4	1196	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	25		No			Grind	
2272	RED HILL AVENUE		432-172-49	F3	4	1190	Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	10		Yes			Replace Slab(s)	
2278	RED HILL AVENUE		432-173-49	F3	4	1190	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
7091	REN CIRCLE	1981	432-221-12	F4	4	1868	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
7092	REN CIRCLE		432-221-32	F4	4	1868	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
7093	REN CIRCLE		432-221-32	F4	4	1868	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
10841	RIDGEBORO PLACE	14771	432-271-26	F3	4	1869	Curb/Gutter	PCC	Linear Cracking	1/2" to 1"	2		No			Grind	Multiple cracks in gutter
10840	RIDGEBORO PLACE	14771	432-271-26	F3	4	1869	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
10838	RIDGEBORO PLACE	14782	432-271-32	F3	4	1869	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	12		Yes			Replace Slab	Slabs around tree
12009	RIDGEBORO PLACE	14782	432-271-32	F3	4	1869	Sidewalk	PCC	Spalling	1/4" to 1/2"	0.5		No			Grind	
10842	RIDGEBORO PLACE	14791	432-271-24	F3	4	1869	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
10837	RIDGEBORO PLACE	14802	432-271-34	F3	4	1869	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	6		No			Grind	
10843	RIDGEBORO PLACE	14811	432-271-22	F3	4	1869	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
12012	RIDGEBORO PLACE	14811	432-271-22	F3	4	1869	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
10836	RIDGEBORO PLACE	14822	432-271-36	F3	4	1869	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	6		No			Grind	
10839	RIDGEBORO PLACE		432-271-82	F3	4	1869	Sidewalk	PCC	Faulting	1/4" to 1/2"	6		No			Grind	
12010	RIDGEBORO PLACE		432-271-82	F3	4	1869	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
12011	RIDGEBORO PLACE		432-271-82	F3	4	1869	Curb/Gutter	PCC	Linear Cracking	1/2" to 1"	1.5		No			Grind	
7747	ROANOKE AVENUE	14582	432-201-43	F3	4	1872	Driveway	PCC	Faulting	1/4" to 1/2"	8		No			Grind Driveway	Between sidewalk and driveway
7746	ROANOKE AVENUE	14582	432-201-43	F3	4	1872	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Prev grind
7748	ROANOKE AVENUE	14582	432-201-43	F3	4	1872	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	Prev grind
7745	ROANOKE AVENUE	14582	432-201-43	F3	4	1872	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		No			Ramp	
7744	ROANOKE AVENUE	14582	432-201-43	F3	4	1872	Ramp	PCC	Sidewalk Curb Separation	1/4" to 1/2"	3		No			Grind	
4132	ROANOKE AVENUE	1622	432-192-11	F3	4	1872	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
4133	ROANOKE AVENUE	1622	432-192-11	F3	4	1872	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
4134	ROANOKE AVENUE	1622	432-192-11	F3	4	1872	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
4185	ROANOKE AVENUE	1631	432-193-11	F3	4	1872	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
4186	ROANOKE AVENUE	1631	432-193-11	F3	4	1872	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
4187				F3	4	1872	Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	10		No			Replace Slab(s)	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
4184	ROANOKE AVENUE	1641	432-193-12	F3	4	1872	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
4135	ROANOKE AVENUE	1642	432-192-12	F3	4	1872	Driveway	PCC	Faulting	1/4" to 1/2"	4		No			Grind Driveway	Between sidewalk and driveway
4181	ROANOKE AVENUE	1651	432-193-13	F3	4	1872	Driveway	PCC	Faulting	1/2" to 1"	8		No			Grind Driveway	Between driveway and sidewalk
4182	ROANOKE AVENUE	1651	432-193-13	F3	4	1872	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
4183	ROANOKE AVENUE	1651	432-193-13	F3	4	1872	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
4136	ROANOKE AVENUE	1652	432-192-13	F3	4	1872	Driveway	PCC	Faulting	1/2" to 1"	10		No			Grind Driveway	Between driveway and sidewalk
4137	ROANOKE AVENUE	1652	432-192-13	F3	4	1872	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	Prev grind
4180	ROANOKE AVENUE	1661	432-193-14	F3	4	1872	Sidewalk	PCC	Faulting	1/2" to 1"	2		No			Ramp	
4139	ROANOKE AVENUE	1662	432-192-14	F3	4	1872	Driveway	PCC	Faulting	1/4" to 1/2"	6		No			Grind Driveway	Between driveway and sidewalk
4138	ROANOKE AVENUE	1662	432-192-14	F3	4	1872	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	1		Yes			Grind	
4179	ROANOKE AVENUE	1671	432-193-15	F3	4	1872	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	Prev grind
4178	ROANOKE AVENUE	1671	432-193-15	F3	4	1872	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
4176	ROANOKE AVENUE	1691	432-193-16	F3	4	1872	Driveway	PCC	Faulting	1/4" to 1/2"	5		No			Grind Driveway	Between driveway and sidewalk
4175	ROANOKE AVENUE	1691	432-193-16	F3	4	1872	Sidewalk	PCC	Faulting	1/2" to 1"	2		No			Ramp	
4174	ROANOKE AVENUE	1691	432-193-16	F3	4	1872	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
4177	ROANOKE AVENUE	1691	432-193-16	F3	4	1872	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	2.5		No			Grind	
4140	ROANOKE AVENUE	1702	432-202-07	F3	4	1872	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No			Grind	Prev grinded, between sidewalk and driveway
4141	ROANOKE AVENUE	1711	432-203-07	F3	4	1872	Driveway	PCC	Faulting	1/2" to 1"	4		No			Grind Driveway	Between driveway and sidewalk
4142	ROANOKE AVENUE	1711	432-203-07	F3	4	1872	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	Prev grind
4143	ROANOKE AVENUE	1711	432-203-07	F3	4	1872	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	Prev grind
4144	ROANOKE AVENUE	1711	432-203-07	F3	4	1872	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
4146	ROANOKE AVENUE	1711	432-203-07	F3	4	1872	Ramp	PCC	Linear Cracking	1/4" to 1/2"	6		No			Replace Ramp	
4145	ROANOKE AVENUE	1711	432-203-07	F3	4	1872	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	9		No			Replace Slab	
7650	ROANOKE AVENUE	1712	432-202-06	F3	4	1872	Driveway	PCC	Sidewalk Curb Separation	1/2" to 1"	3		No			Patch	Between curb and driveway
7649	ROANOKE AVENUE	1721	432-203-06	F3	4	1872	Driveway	PCC	Faulting	1/4" to 1/2"	6		No			Grind Driveway	Between driveway and sidewalk
7647	ROANOKE AVENUE	1721	432-203-06	F3	4	1872	Sidewalk	PCC	Faulting	1/2" to 1"	1		Yes			Ramp	
7646	ROANOKE AVENUE	1721	432-203-06	F3	4	1872	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
7648	ROANOKE AVENUE	1721	432-203-06	F3	4	1872	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
7651	ROANOKE AVENUE	1722	432-202-05	F3	4	1872	Driveway	PCC	Sidewalk Curb Separation	1/2" to 1"	9		No			Replace Driveway	Between driveway and curb
7652	ROANOKE AVENUE	1722	432-202-05	F3	4	1872	Driveway	PCC	Sidewalk Curb Separation	1/4" to 1/2"	9		No			Grind	Between driveway and sidewalk
7653	ROANOKE AVENUE	1722	432-202-05	F3	4	1872	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
7645	ROANOKE AVENUE	1731	432-203-05	F3	4	1872	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7644	ROANOKE AVENUE	1751	432-203-03	F3	4	1872	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Between driveway and sidewalk
7749	ROANOKE AVENUE	1762	432-201-45	F3	4	1872	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
7643	ROANOKE AVENUE	1771	432-203-01	F3	4	1872	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
7876	ROANOKE AVENUE	1831	432-233-01	F3	4	1872	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	Prev grind
7877	ROANOKE AVENUE	1831	432-233-01	F3	4	1872	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
7878	ROANOKE AVENUE	1831	432-233-01	F3	4	1872	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7874	ROANOKE AVENUE	1841	432-233-02	F3	4	1872	Driveway	PCC	Sidewalk Curb Separation	1/4" to 1/2"	15		No			Grind	Between driveway and curb
7873	ROANOKE AVENUE	1841	432-233-02	F3	4	1872	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		No			Ramp	Prev grind
7875	ROANOKE AVENUE	1841	432-233-02	F3	4	1872	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
7754	ROANOKE AVENUE	1842	432-231-01	F3	4	1872	Driveway	PCC	Faulting	1/2" to 1"	15		No			Grind Driveway	Between sidewalk and driveway
7755	ROANOKE AVENUE	1842	432-231-01	F3	4	1872	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	Prev grind
7872	ROANOKE AVENUE	1851	432-233-03	F3	4	1872	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		Yes			Grind	Prev grind
7871	ROANOKE AVENUE	1851	432-233-03	F3	4	1872	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		Yes			Grind	
7756	ROANOKE AVENUE	1852	432-231-02	F3	4	1872	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
7757	ROANOKE AVENUE	1852	432-231-02	F3	4	1872	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
7868	ROANOKE AVENUE	1861	432-233-04	F3	4	1872	Driveway	PCC	Faulting	1/2" to 1"	4		No			Grind Driveway	Between driveway and sidewalk
7867	ROANOKE AVENUE	1861	432-233-04	F3	4	1872	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
7870	ROANOKE AVENUE	1861	432-233-04	F3	4	1872	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	Prev grind
7869	ROANOKE AVENUE	1861	432-233-04	F3	4	1872	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
7758	ROANOKE AVENUE	1862	432-231-03	F3	4	1872	Driveway	PCC	Faulting	1/2" to 1"	6		No			Grind Driveway	Between driveway and sidewalk
7759	ROANOKE AVENUE	1862	432-231-03	F3	4	1872	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
7866	ROANOKE AVENUE	1871	432-233-05	F3	4	1872	Sidewalk	PCC	Faulting	1/2" to 1"	1		No			Ramp	
7865	ROANOKE AVENUE	1871	432-233-05	F3	4	1872	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
7864	ROANOKE AVENUE	1881	432-233-06	F3	4	1872	Driveway	PCC	Sidewalk Curb Separation	1/2" to 1"	15		No			Replace Driveway	Between driveway and curb
7817	ROANOKE AVENUE	1882	432-232-08	F3	4	1872	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	Prev grind
7816	ROANOKE AVENUE	1882	432-232-08	F3	4	1872	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		No			Ramp	
7863	ROANOKE AVENUE	1891	432-233-07	F3	4	1872	Driveway	PCC	Sidewalk Curb Separation	1/2" to 1"	15		No			Replace Driveway	Between curb and driveway
7862	ROANOKE AVENUE	1891	432-233-07	F3	4	1872	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Prev grind
7861	ROANOKE AVENUE	1891	432-233-07	F3	4	1872	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
7860	ROANOKE AVENUE	1891	432-233-07	F3	4	1872	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	5		No			Grind	
7818	ROANOKE AVENUE	1892	432-232-07	F3	4	1872	Driveway	PCC	Faulting	1/2" to 1"	2		No			Grind Driveway	Between sidewalk and driveway
7834					F3	4	1872	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No		Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
7835	ROANOKE AVENUE	1921	432-243-17	F3	4	1872	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	10		No			Grind	
7819	ROANOKE AVENUE	1922	432-241-27	F3	4	1872	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
7832	ROANOKE AVENUE	1931	432-243-16	F3	4	1872	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7833	ROANOKE AVENUE	1931	432-243-16	F3	4	1872	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7820	ROANOKE AVENUE	1942	432-241-29	F3	4	1872	Driveway	PCC	Sidewalk Curb Separation	1/2" to 1"	7		No			Replace Driveway	Between curb and driveway
7821	ROANOKE AVENUE	1942	432-241-29	F3	4	1872	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	Prev grind
7822	ROANOKE AVENUE	1942	432-241-29	F3	4	1872	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
7823	ROANOKE AVENUE	1942	432-241-29	F3	4	1872	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
7831	ROANOKE AVENUE	1951	432-243-14	F3	4	1872	Driveway	PCC	Faulting	1/2" to 1"	2		No			Grind Driveway	Between sidewalk and driveway
7830	ROANOKE AVENUE	1961	432-243-13	F3	4	1872	Driveway	PCC	Faulting	1" to 2"	17		No			Replace Driveway	Between driveway and sidewalk
7829	ROANOKE AVENUE	1961	432-243-13	F3	4	1872	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7824	ROANOKE AVENUE	1962	432-241-31	F3	4	1872	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
7828	ROANOKE AVENUE	1981	432-243-11	F3	4	1872	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
7753	ROANOKE AVENUE		432-231-46	F3	4	1872	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	Prev grind
7750	ROANOKE AVENUE		432-231-46	F3	4	1872	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
7751	ROANOKE AVENUE		432-231-46	F3	4	1872	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
7752	ROANOKE AVENUE		432-231-46	F3	4	1872	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7122	ROSALIE PLACE	14192	432-031-04	E3	4	1876	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
7123	ROSALIE PLACE	14192	432-031-04	E3	4	1876	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	2.5		No			Grind	
7121	ROSALIE PLACE	14212	432-031-03	E3	4	1876	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
7125	ROSALIE PLACE	14221	432-031-06	E3	4	1876	Driveway	PCC	Faulting	1/4" to 1/2"	3		No			Grind Driveway	Between driveway and sidewalk
7124	ROSALIE PLACE	14221	432-031-06	E3	4	1876	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
7126	ROSALIE PLACE	14221	432-031-06	E3	4	1876	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	2		No			Grind	
7119	ROSALIE PLACE	14222	432-031-02	E3	4	1876	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
7120	ROSALIE PLACE	14222	432-031-02	E3	4	1876	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
7127	ROSALIE PLACE	14231	432-031-07	E3	4	1876	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
7128	ROSALIE PLACE	14231	432-031-07	E3	4	1876	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	2		No			Grind	
7118	ROSALIE PLACE	14232	432-031-01	E3	4	1876	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	Prev grind
10580	ROYAL OAK PL	1821	432-281-16	F3	4	1881	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10583	ROYAL OAK PL	1832	432-281-19	F3	4	1881	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
10579	ROYAL OAK PL	1841	432-281-14	F3	4	1881	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	
10585	ROYAL OAK PL	1842	432-281-20	G3	4	1881	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	
10584	ROYAL OAK PL	1842	432-281-20	G3	4	1881	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
10578	ROYAL OAK PL	1861	432-281-12	G3	4	1881	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
10577	ROYAL OAK PL	1871	432-281-11	G3	4	1881	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
10576	ROYAL OAK PL	1881	432-281-10	G3	4	1881	Sidewalk	PCC	Corner Break	1/2" to 1"	2		Yes			Ramp	
10575	ROYAL OAK PL	1891	432-281-09	G3	4	1881	Sidewalk	PCC	Faulting	1/2" to 1"	5		Yes			Ramp	
10586	ROYAL OAK PL	1892	432-281-25	G3	4	1881	Sidewalk	PCC	Faulting	1/2" to 1"	3		No			Ramp	
10587	ROYAL OAK PL	1912	432-281-27	G3	4	1881	Sidewalk	PCC	Faulting	1/2" to 1"	2		Yes			Ramp	
10588	ROYAL OAK PL	1912	432-281-27	G3	4	1881	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10595	ROYAL OAK PL	1921	432-281-44	G3	4	1881	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
10589	ROYAL OAK PL	1942	432-281-30	G3	4	1881	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10594	ROYAL OAK PL	1951	432-281-41	G3	4	1881	Sidewalk	PCC	Corner Break	1/2" to 1"	3		No			Ramp	
10593	ROYAL OAK PL	1961	432-281-40	G3	4	1881	Sidewalk	PCC	Faulting	1/2" to 1"	3		No			Ramp	
10592	ROYAL OAK PL	1981	432-281-38	G3	4	1881	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10590	ROYAL OAK PL	1992	432-281-35	G3	4	1881	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
10591	ROYAL OAK PL	1992	432-281-35	G3	4	1881	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
10582	ROYAL OAK PL		432-281-17	F3	4	1881	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
10581	ROYAL OAK PL		432-281-17	F3	4	1881	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
9648	SABLE TREE CIRCLE	2301	432-462-01	G4	4	1882	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
9647	SABLE TREE CIRCLE	2311	432-462-02	G4	4	1882	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
9643	SABLE TREE CIRCLE	2312	432-462-13	G4	4	1882	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
9644	SABLE TREE CIRCLE	2322	432-462-12	G4	4	1882	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
9645	SABLE TREE CIRCLE	2332	432-462-11	G4	4	1882	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
9646	SABLE TREE CIRCLE	2342	432-462-10	G4	4	1882	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
8261	SANDBROOK DRIVE	14436	432-211-18	F3	4	1889	Driveway	PCC	Sidewalk Curb Separation	1/2" to 1"	1.5		No			Patch	Between curb and driveway
8220	SANDBROOK DRIVE	14441	432-212-16	F3	4	1889	Driveway	PCC	Sidewalk Curb Separation	1/4" to 1/2"	8		No			Grind	Between driveway and curb
8260	SANDBROOK DRIVE	14452	432-211-19	F3	4	1889	Driveway	PCC	Faulting	1/4" to 1/2"	4		No			Grind Driveway	Between driveway and sidewalk
8221	SANDBROOK DRIVE	14455	432-212-17	F3	4	1889	Driveway	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind Driveway	Between driveway and sidewalk
8222	SANDBROOK DRIVE	14455	432-212-17	F3	4	1889	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
8258	SANDBROOK DRIVE	14462	432-211-20	F3	4	1889	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
8259	SANDBROOK DRIVE	14462	432-211-20	F3	4	1889	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
8262	SANDBROOK DRIVE	1671	432-211-14	F3	4	1889	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7245				F4	4	1890	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
7231	SANDFIELD PLACE	14331	432-291-27	F4	4	1890	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7246	SANDFIELD PLACE	14331	432-291-43	F4	4	1890	Sidewalk	PCC	Faulting	1/4" to 1/2"	4.5		No			Grind	
7232	SANDFIELD PLACE	14332	432-291-28	F4	4	1890	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
7233	SANDFIELD PLACE	14332	432-291-28	F4	4	1890	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7234	SANDFIELD PLACE	14332	432-291-28	F4	4	1890	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
7235	SANDFIELD PLACE	14332	432-291-28	F4	4	1890	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
7214	SANDFIELD PLACE	2012	432-291-02	F4	4	1890	Sidewalk	PCC	Faulting	1/2" to 1"	1		No			Ramp	
7215	SANDFIELD PLACE	2012	432-291-02	F4	4	1890	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		Yes			Ramp	
7216	SANDFIELD PLACE	2022	432-291-03	F4	4	1890	Driveway	PCC	Faulting	1/4" to 1/2"	6		No			Grind Driveway	Between driveway and sidewalk
7217	SANDFIELD PLACE	2022	432-291-03	F4	4	1890	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7218	SANDFIELD PLACE	2052	432-291-05	F4	4	1890	Driveway	PCC	Faulting	1/4" to 1/2"	7		No			Grind Driveway	Between driveway and sidewalk
7219	SANDFIELD PLACE	2052	432-291-05	F4	4	1890	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
7220	SANDFIELD PLACE	2062	432-291-06	F4	4	1890	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
7221	SANDFIELD PLACE	2062	432-291-06	F4	4	1890	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		Yes			Grind	
7934	SANDWOOD PLACE	14332	432-342-12	F3	4	1891	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
11872	SANDWOOD PLACE	1852	432-341-10	F3	4	1891	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7941	SANDWOOD PLACE	1872	432-341-12	F4	4	1891	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Between driveway and sidewalk
7942	SANDWOOD PLACE	1872	432-341-12	F4	4	1891	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7933	SANDWOOD PLACE	1891	432-342-15	F4	4	1891	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	Prev grind
7943	SANDWOOD PLACE	1892	432-341-14	F4	4	1891	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
4918	SCHERER PLACE	1162	432-131-11	E3	4	1896	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
4917	SCHERER PLACE	1182	432-131-12	E3	4	1896	Sidewalk	PCC	Spalling	1/4" to 1/2"	1.5		No			Grind	
4875	SCHERER PLACE	14561	432-132-05	E3	4	1896	Sidewalk	PCC	Faulting	1/4" to 1/2"	4.5		No			Grind	
4876	SCHERER PLACE	14561	432-132-05	E3	4	1896	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		Yes			Grind	
4877	SCHERER PLACE	14561	432-132-05	E3	4	1896	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
4878	SCHERER PLACE	14561	432-132-05	E3	4	1896	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
2546	SCHOOL LANE	1402	432-011-07	F3	4	1897	Sidewalk	PCC	Faulting	1/2" to 1"	1		No		Yes	Ramp	
2543	SERVICE ROAD	1402	432-011-22	F3	4	1903	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No		Yes	Grind	Running parallel with sidewalk
2541	SERVICE ROAD	1402	432-011-12	F3	4	1903	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No		Yes	Grind	
2544	SERVICE ROAD	1402	432-011-22	F3	4	1903	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No		Yes	Grind	
2545	SERVICE ROAD	1402	432-011-22	F2	4	1903	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No		Yes	Grind	
2542	SERVICE ROAD	1402	432-011-22	F3	4	1903	Driveway	PCC	Linear Cracking	No Displacement	8	1.5"	No		Yes	Joint Seal	
7237	SHADYBROOK DRIVE	14262	432-291-35	F4	4	1907	Sidewalk	PCC	Faulting	1/2" to 1"	1		No			Ramp	
7238	SHADYBROOK DRIVE	14262	432-291-35	F4	4	1907	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		No			Ramp	
7239	SHADYBROOK DRIVE	14262	432-291-35	F4	4	1907	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7240	SHADYBROOK DRIVE	14271	432-291-37	F4	4	1907	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
7241	SHADYBROOK DRIVE	14285	432-291-38	F4	4	1907	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
7242	SHADYBROOK DRIVE	14301	432-291-40	F4	4	1907	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
7243	SHADYBROOK DRIVE	14301	432-291-40	F4	4	1907	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7244	SHADYBROOK DRIVE	14311	432-291-41	F4	4	1907	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
7236	SHADYBROOK DRIVE	14332	432-291-28	F4	4	1907	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9725	SILK TREE DRIVE	14832	432-265-04	G3	4	1911	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9726	SILK TREE DRIVE	14832	432-265-04	G3	4	1911	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9724	SILK TREE DRIVE	14832	432-265-04	G3	4	1911	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	12		No			Grind	
9723	SILK TREE DRIVE	2171	432-266-12	G3	4	1911	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9721	SILK TREE DRIVE	2181	432-266-11	G3	4	1911	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	
9722	SILK TREE DRIVE	2181	432-266-11	G3	4	1911	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
9719	SILK TREE DRIVE	2191	432-266-10	G3	4	1911	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
9720	SILK TREE DRIVE	2191	432-266-10	G3	4	1911	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
9728	SILK TREE DRIVE	2192	432-265-05	G3	4	1911	Sidewalk	PCC	Faulting	1/2" to 1"	4		No			Ramp	Prev grind
9727	SILK TREE DRIVE	2192	432-265-05	G3	4	1911	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
9714	SILK TREE DRIVE	2201	432-266-09	G3	4	1911	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
9715	SILK TREE DRIVE	2201	432-266-09	G3	4	1911	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
9716	SILK TREE DRIVE	2201	432-266-09	G3	4	1911	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	Prev grind
9717	SILK TREE DRIVE	2201	432-266-09	G3	4	1911	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
9718	SILK TREE DRIVE	2201	432-266-09	G3	4	1911	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
9729	SILK TREE DRIVE	2212	432-265-07	G3	4	1911	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9730	SILK TREE DRIVE	2212	432-265-07	G3	4	1911	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
9712	SILK TREE DRIVE	2221	432-266-07	G3	4	1911	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Prev grind
9713	SILK TREE DRIVE	2221	432-266-07	G3	4	1911	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
9731	SILK TREE DRIVE	2222	432-265-08	G3	4	1911	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
9732	SILK TREE DRIVE	2222	432-265-08	G3	4	1911	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
9711	SILK TREE DRIVE	2231	432-421-01	G3	4	1911	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Prev grind
9710				G3	4	1911	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
9733	SILK TREE DRIVE	2242	432-422-02	G3	4	1911	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
9734	SILK TREE DRIVE	2242	432-422-02	G3	4	1911	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
9709	SILK TREE DRIVE	2251	432-421-03	G3	4	1911	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
9708	SILK TREE DRIVE	2251	432-421-03	G3	4	1911	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9735	SILK TREE DRIVE	2252	432-422-03	G3	4	1911	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
9707	SILK TREE DRIVE	2261	432-421-04	G3	4	1911	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
9736	SILK TREE DRIVE	2262	432-422-04	G3	4	1911	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
9706	SILK TREE DRIVE	2281	432-421-06	G4	4	1911	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
9737	SILK TREE DRIVE	2282	432-422-06	G3	4	1911	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
9738	SILK TREE DRIVE	2292	432-422-07	G4	4	1911	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9704	SILK TREE DRIVE	2301	432-421-08	G4	4	1911	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		No			Ramp	Prev grind
9703	SILK TREE DRIVE	2301	432-421-08	G4	4	1911	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
9705	SILK TREE DRIVE	2301	432-421-08	G4	4	1911	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
9702	SILK TREE DRIVE	2311	432-421-09	G4	4	1911	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
9614	SILK TREE DRIVE	2331	432-424-01	G4	4	1911	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
9607	SILK TREE DRIVE	2332	432-424-11	G4	4	1911	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
9613	SILK TREE DRIVE	2341	432-424-02	G4	4	1911	Sidewalk	PCC	Faulting	1/2" to 1"	2		No			Ramp	
9612	SILK TREE DRIVE	2351	432-424-03	G4	4	1911	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
9608	SILK TREE DRIVE	2352	432-424-09	G4	4	1911	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9611	SILK TREE DRIVE	2361	432-424-51	G4	4	1911	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9609	SILK TREE DRIVE	2362	432-424-08	G4	4	1911	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
9610	SILK TREE DRIVE	2362	432-424-08	G4	4	1911	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
8246	SILVERBROOK DRIVE	14391	432-211-27	F3	4	1914	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
8245	SILVERBROOK DRIVE	14392	432-211-28	F3	4	1914	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
8247	SILVERBROOK DRIVE	14411	432-211-25	F3	4	1914	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	At CATV grate
8244	SILVERBROOK DRIVE	14412	432-211-30	F3	4	1914	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
8248	SILVERBROOK DRIVE	14425	432-211-24	F3	4	1914	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
8243	SILVERBROOK DRIVE	14426	432-211-31	F3	4	1914	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
8249	SILVERBROOK DRIVE	14441	432-211-23	F3	4	1914	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
8250	SILVERBROOK DRIVE	14451	432-211-22	F3	4	1914	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	At CATV grate
8251	SILVERBROOK DRIVE	14451	432-211-22	F3	4	1914	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
8252	SILVERBROOK DRIVE	14461	432-211-21	F3	4	1914	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
8253	SILVERBROOK DRIVE	14461	432-211-21	F3	4	1914	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	5		No			Grind	
8242	SILVERBROOK DRIVE	14482	432-211-35	F3	4	1914	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
8240	SILVERBROOK DRIVE	14482	432-211-35	F3	4	1913	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
8241	SILVERBROOK DRIVE	14482	432-211-35	F3	4	1913	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	8		No			Grind	
8238	SILVERBROOK DRIVE	14492	432-211-36	F3	4	1913	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
8239	SILVERBROOK DRIVE	14492	432-211-36	F3	4	1913	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
5018	SNOWBERRY ROAD	14281	432-382-06	F4	4	1919	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
5000	SNOWBERRY ROAD	14301	432-381-53	F4	4	1919	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5008	SNOWBERRY ROAD	2151	432-382-01	F4	4	1919	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
5009	SNOWBERRY ROAD	2151	432-382-01	F4	4	1919	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5010	SNOWBERRY ROAD	2151	432-382-01	F4	4	1919	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5003	SNOWBERRY ROAD	2152	432-381-57	F4	4	1919	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5004	SNOWBERRY ROAD	2152	432-381-57	F4	4	1919	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	2		No			Grind	
5011	SNOWBERRY ROAD	2161	432-382-02	F4	4	1919	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	Prev grind
5013	SNOWBERRY ROAD	2161	432-382-02	F4	4	1919	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
5012	SNOWBERRY ROAD	2161	432-382-02	F4	4	1919	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	10		No			Grind	
5014	SNOWBERRY ROAD	2161	432-382-02	F4	4	1919	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	12		No			Grind	
5015	SNOWBERRY ROAD	2171	432-382-03	F4	4	1919	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
5002	SNOWBERRY ROAD	2172	432-381-55	F4	4	1919	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	Prev grind
5001	SNOWBERRY ROAD	2172	432-381-55	F4	4	1919	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
5016	SNOWBERRY ROAD	2181	432-382-04	F4	4	1919	Sidewalk	PCC	Faulting	1/2" to 1"	4.5		No			Ramp	
5017	SNOWBERRY ROAD	2181	432-382-04	F4	4	1919	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
5007	SNOWBERRY ROAD		432-382-05	F4	4	1919	Sidewalk	PCC	Faulting	1/2" to 1"	3		No			Ramp	
5005	SNOWBERRY ROAD		432-291-45	F4	4	1919	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5006	SNOWBERRY ROAD		432-291-45	F4	4	1919	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	4		No			Grind	
10880	SUMMERVILLE AVENUE	14821	432-313-37	F3	4	1923	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
10879	SUMMERVILLE AVENUE	14821	432-313-37	F3	4	1923	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	6		No			Grind	
10893	SUMMERVILLE AVENUE	1652	432-313-18	F3	4	1923	Curb/Gutter	PCC	Spalling	1/2" to 1"	2		No			Replace C&G	
10894	SUMMERVILLE AVENUE	1662	432-313-17	F3	4	1923	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
10895	SUMMERVILLE AVENUE	1672	432-313-16	F3	4	1923	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
10896	SUMMERVILLE AVENUE	1722	432-313-11	F3	4	1923	Curb/Gutter	PCC	Buckled Slab	Over 2"	12		No			Replace Slab(s)	Cracked and sunked
10861				F3	4	1923	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
10862	SUMMERVILLE AVENUE	1772	432-313-68	F3	4	1923	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
10863	SUMMERVILLE AVENUE	1772	432-313-68	F3	4	1923	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
4995	SWEETBRIAR ROAD	14341	432-381-49	F4	4	1924	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	12		No			Grind	
4987	SWEETBRIAR ROAD	2141	432-381-43	F4	4	1924	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
4986	SWEETBRIAR ROAD	2141	432-381-43	F4	4	1924	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	8		No			Grind	
4988	SWEETBRIAR ROAD	2151	432-381-44	F4	4	1924	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
4989	SWEETBRIAR ROAD	2151	432-381-44	F4	4	1924	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
4985	SWEETBRIAR ROAD	2152	432-381-41	F4	4	1924	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	10		No			Grind	
4991	SWEETBRIAR ROAD	2161	432-381-45	F4	4	1924	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
4990	SWEETBRIAR ROAD	2161	432-381-45	F4	4	1924	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	3		No			Grind	
4992	SWEETBRIAR ROAD	2171	432-381-46	F4	4	1924	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
4983	SWEETBRIAR ROAD	2172	432-381-39	F4	4	1924	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
4984	SWEETBRIAR ROAD	2172	432-381-39	F4	4	1924	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
4993	SWEETBRIAR ROAD	2181	432-381-47	F4	4	1924	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
4994	SWEETBRIAR ROAD	2181	432-381-47	F4	4	1924	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	2		No			Grind	
4982	SWEETBRIAR ROAD	2182	432-381-38	F4	4	1924	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	7		No			Grind	
4979	SWEETBRIAR ROAD	2192	432-381-37	F4	4	1924	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
4980	SWEETBRIAR ROAD	2192	432-381-37	F4	4	1924	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
4981	SWEETBRIAR ROAD	2192	432-381-37	F4	4	1924	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
2339	SYCAMORE AVENUE	1101	432-141-09	E2	4	1220	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		Yes		Yes	Grind	
2340	SYCAMORE AVENUE	1101	432-141-09	E2	4	1220	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No		Yes	Grind	
2341	SYCAMORE AVENUE	1101	432-141-09	E2	4	1220	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No		Yes	Grind	
2445	SYCAMORE AVENUE	1182	432-151-38	F3	4	1220	Sidewalk	PCC	Patch / Utility Cut	1/2" to 1"			No			Grind	At manhole fault
2443	SYCAMORE AVENUE	1182	432-151-38	F3	4	1220	Sidewalk	PCC	Faulting	1/2" to 1"	1		No			Ramp	
2442	SYCAMORE AVENUE	1182	432-151-38	F3	4	1220	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
2444	SYCAMORE AVENUE	1182	432-151-38	F3	4	1220	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
2446	SYCAMORE AVENUE	1202	432-151-07	F3	4	1220	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	3		No			Grind	
2304	SYCAMORE AVENUE	1241	432-161-01	F3	4	1221	Sidewalk	PCC	Faulting	1/2" to 1"	3		No			Ramp	
2299	SYCAMORE AVENUE	1301	432-161-22	F3	4	1221	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No		Yes	Grind	Running parallel sidewalk
2300	SYCAMORE AVENUE	1301	432-161-22	F3	4	1221	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	7		No		Yes	Grind	
2295	SYCAMORE AVENUE	1311	432-161-23	F3	4	1221	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No		Yes	Grind	
2296	SYCAMORE AVENUE	1311	432-161-23	F3	4	1221	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No		Yes	Grind	
2297	SYCAMORE AVENUE	1311	432-161-23	F3	4	1221	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No		Yes	Grind	
2298	SYCAMORE AVENUE	1311	432-161-23	F3	4	1221	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No		Yes	Grind	
2527	SYCAMORE AVENUE	1402	432-011-12	F3	4	1221	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No		Yes	Grind	Prev grind
2522	SYCAMORE AVENUE	1402	432-011-07	F3	4	1221	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No		Yes	Grind	Prev grind
2525	SYCAMORE AVENUE	1402	432-011-12	F3	4	1221	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No		Yes	Grind	
2526	SYCAMORE AVENUE	1402	432-011-12	F3	4	1221	Sidewalk	PCC	Faulting	1/4" to 1/2"	6		No		Yes	Grind	
2528	SYCAMORE AVENUE	1402	432-011-12	F3	4	1221	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No		Yes	Grind	
2529	SYCAMORE AVENUE	1402	432-011-12	F3	4	1221	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No		Yes	Grind	
2530	SYCAMORE AVENUE	1402	432-011-12	F3	4	1221	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No		Yes	Grind	
2513	SYCAMORE AVENUE	1402	432-011-07	F3	4	1221	Sidewalk	PCC	Faulting	1/4" to 1/2"	7		No		Yes	Grind	
2514	SYCAMORE AVENUE	1402	432-011-07	F3	4	1221	Sidewalk	PCC	Faulting	1/4" to 1/2"	6		No		Yes	Grind	
2515	SYCAMORE AVENUE	1402	432-011-07	F3	4	1221	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No		Yes	Grind	
2516	SYCAMORE AVENUE	1402	432-011-07	F3	4	1221	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No		Yes	Grind	
2517	SYCAMORE AVENUE	1402	432-011-07	F3	4	1221	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No		Yes	Grind	
2519	SYCAMORE AVENUE	1402	432-011-07	F3	4	1221	Sidewalk	PCC	Faulting	1/4" to 1/2"	7		No		Yes	Grind	
2520	SYCAMORE AVENUE	1402	432-011-07	F3	4	1221	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No		Yes	Grind	
2521	SYCAMORE AVENUE	1402	432-011-07	F3	4	1221	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No		Yes	Grind	
2523	SYCAMORE AVENUE	1402	432-011-07	F3	4	1221	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No		Yes	Grind	
2524	SYCAMORE AVENUE	1402	432-011-07	F3	4	1221	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No		Yes	Grind	
2518	SYCAMORE AVENUE	1402	432-011-07	F3	4	1221	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	3		No		Yes	Grind	
2344	SYCAMORE AVENUE	14642	432-141-14	E2	4	1220	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes		Yes	Grind	Prev grind
2346	SYCAMORE AVENUE	14642	432-141-14	E2	4	1220	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes		Yes	Grind	Prev grind
2345	SYCAMORE AVENUE	14642	432-141-14	E2	4	1220	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes		Yes	Grind	
2342	SYCAMORE AVENUE	14662	432-141-15	E2	4	1220	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No		Yes	Grind	
2343	SYCAMORE AVENUE	14662	432-141-15	E2	4	1220	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No		Yes	Grind	
3965	SYCAMORE AVENUE	14711	432-181-09	F3	4	1222	Sidewalk	AC	Patch / Utility Cut	No Displacement	4	3	No			AC Patch	Patch alittle rough. With some cracks.
9145	SYCAMORE AVENUE	14711	432-371-01	G3	4	1224	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	Prev grind
3956	SYCAMORE AVENUE	14711	432-181-91	F3	4	1222	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Running parallel to sidewalk
3954	SYCAMORE AVENUE	14711	432-181-91	F3	4	1222	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No			Grind	Running parallel with sidewalk
3957	SYCAMORE AVENUE	14711	432-181-91	F3	4	1222	Sidewalk	PCC	Faulting	1/4" to 1/2"	25		No			Grind	Running parallel with sidewalk
9142	SYCAMORE AVENUE	14711	432-251-07	F3	4	1223	Sidewalk	PCC	Corner Break	No Displacement	3		No			Patch	
3955				F3	4	1222	Sidewalk	PCC	Faulting	1/2" to 1"	3		No			Ramp	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
3978	SYCAMORE AVENUE	14711	432-191-01	F3	4	1222	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
3979	SYCAMORE AVENUE	14711	432-191-01	F3	4	1222	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
3967	SYCAMORE AVENUE	14711	432-181-09	F3	4	1222	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
3969	SYCAMORE AVENUE	14711	432-181-09	F3	4	1222	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
3970	SYCAMORE AVENUE	14711	432-181-09	F3	4	1222	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
3968	SYCAMORE AVENUE	14711	432-181-09	F3	4	1222	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	10		Yes			Grind	
3966	SYCAMORE AVENUE	14711	432-181-09	F3	4	1222	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	4		Yes			Grind	
9843	SYCAMORE AVENUE	14712	432-461-43	G4	4	1225	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		Yes			Ramp	Prev grind
9845	SYCAMORE AVENUE	14712	432-461-43	G4	4	1225	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
3973	SYCAMORE AVENUE	14712	432-181-07	F3	4	1222	Sidewalk	PCC	Faulting	1/2" to 1"	10		Yes			Ramp	Running parallel with sidewalk
3975	SYCAMORE AVENUE	14712	432-181-07	F3	4	1222	Sidewalk	PCC	Faulting	1/2" to 1"	6		No			Ramp	Running parallel with sidewalk
3959	SYCAMORE AVENUE	14712	432-181-22	F3	4	1222	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Running parallel with sidewalk
3961	SYCAMORE AVENUE	14712	432-181-22	F3	4	1222	Sidewalk	PCC	Faulting	1/2" to 1"	9		Yes			Ramp	
3962	SYCAMORE AVENUE	14712	432-181-22	F3	4	1222	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	
3972	SYCAMORE AVENUE	14712	432-181-07	F3	4	1222	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		Yes			Grind	
3974	SYCAMORE AVENUE	14712	432-181-07	F3	4	1222	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
3976	SYCAMORE AVENUE	14712	432-181-07	F3	4	1222	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
3977	SYCAMORE AVENUE	14712	432-181-07	F3	4	1222	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
3958	SYCAMORE AVENUE	14712	432-181-22	F3	4	1222	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
3960	SYCAMORE AVENUE	14712	432-181-22	F3	4	1222	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
3963	SYCAMORE AVENUE	14712	432-181-22	F3	4	1222	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
3964	SYCAMORE AVENUE	14712	432-181-22	F3	4	1222	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9848	SYCAMORE AVENUE	14712	432-461-43	G4	4	1225	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
9146	SYCAMORE AVENUE	14712	432-461-31	G3	4	1225	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9139	SYCAMORE AVENUE	14712	432-242-01	F3	4	1223	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9140	SYCAMORE AVENUE	14712	432-242-01	F3	4	1223	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
9141	SYCAMORE AVENUE	14712	432-242-01	F3	4	1223	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
2348	SYCAMORE AVENUE	14722	432-141-12	E2	4	1220	Driveway	PCC	Sidewalk Curb Separation	1" to 2"	8		No		Yes	Replace Driveway	Between driveway and gutter
2347	SYCAMORE AVENUE	14722	432-141-12	E2	4	1220	Sidewalk	PCC	Faulting	1/4" to 1/2"	7		No		Yes	Grind	Running parallel to sidewalk
2350	SYCAMORE AVENUE	14722	432-141-12	E2	4	1220	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No		Yes	Grind	
2351	SYCAMORE AVENUE	14722	432-141-12	E2	4	1220	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No		Yes	Grind	
2349	SYCAMORE AVENUE	14722	432-141-12	E2	4	1220	Driveway	PCC	Linear Cracking	1/4" to 1/2"	6		No		Yes	Grind	
2306	SYCAMORE AVENUE	14731	432-142-08	F3	4	1220	Sidewalk	PCC	Linear Cracking	No Displacement	7		No			Joint Seal	Running parallel to sidewalk
2337	SYCAMORE AVENUE	14731	432-141-08	E3	4	1220	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
2338	SYCAMORE AVENUE	14731	432-141-08	E3	4	1220	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
2303	SYCAMORE AVENUE	14731	432-161-02	F3	4	1221	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"		2"	No			Grind	
2305	SYCAMORE AVENUE	14732	432-143-07	F3	4	1220	Sidewalk	PCC	Faulting	1/2" to 1"	1		No			Ramp	
2307	SYCAMORE AVENUE	14732	432-142-07	F3	4	1220	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
2308	SYCAMORE AVENUE	14732	432-142-07	F3	4	1220	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
2301	SYCAMORE AVENUE	14732	432-161-21	F3	4	1221	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		Yes		Yes	Grind	
2309	SYCAMORE AVENUE	14732	432-142-07	F3	4	1220	Sidewalk	PCC	Spalling	No Displacement			No			Field Assess-Monitor	
4298	SYCAMORE AVENUE	14741	432-311-01	F3	4	1222	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	Prev grind
9170	SYCAMORE AVENUE	14741	432-263-20	G3	4	1224	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	Prev grind
9171	SYCAMORE AVENUE	14741	432-263-20	G3	4	1224	Sidewalk	PCC	Faulting	1/2" to 1"	2		No			Ramp	
4300	SYCAMORE AVENUE	14741	432-331-76	F3	4	1222	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
9175	SYCAMORE AVENUE	14741	432-272-10	F3	4	1223	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	1		Yes			Grind	
9172	SYCAMORE AVENUE	14742	432-262-55	G3	4	1223	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
2427	SYCAMORE AVENUE	14742	432-151-01	E2	4	1220	Driveway	PCC	Faulting	1/4" to 1/2"	2		No			Grind Driveway	
4299	SYCAMORE AVENUE	14742	432-331-77	F3	4	1222	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
2353	SYCAMORE AVENUE	14742	432-151-01	E2	4	1220	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
2425	SYCAMORE AVENUE	14742	432-151-01	E2	4	1220	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
2426	SYCAMORE AVENUE	14742	432-151-01	E2	4	1220	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
2428	SYCAMORE AVENUE	14742	432-151-01	E2	4	1220	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
2429	SYCAMORE AVENUE	14742	432-151-01	E2	4	1220	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
9173	SYCAMORE AVENUE	14742	432-262-55	G3	4	1223	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9174	SYCAMORE AVENUE	14742	432-262-55	G3	4	1223	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
9176	SYCAMORE AVENUE	14742	432-272-01	F3	4	1223	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
2354	SYCAMORE AVENUE	14742	432-151-01	E2	4	1220	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	2		No			Grind	
2431	SYCAMORE AVENUE	14802	432-151-34	E2	4	1220	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
2432	SYCAMORE AVENUE	14802	432-151-34	E2	4	1220	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
2433	SYCAMORE AVENUE	14802	432-151-34	E2	4	1220	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
2434	SYCAMORE AVENUE	14802	432-151-34	E2	4	1220	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
2435	SYCAMORE AVENUE	14802	432-151-34	E2	4	1220	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
2436				E2	4	1220	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
2437	SYCAMORE AVENUE	14802	432-151-34	E2	4	1220	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
2430	SYCAMORE AVENUE	14802	432-151-34	E2	4	1220	Driveway	PCC	Linear Cracking	1/4" to 1/2"	8		No			Grind	
9167	SYCAMORE AVENUE	2172	432-461-67	G3	4	1225	Sidewalk	PCC	Faulting	1/2" to 1"	4.5		No			Ramp	
9806	SYCAMORE AVENUE	2172	432-461-67	G3	4	1225	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
9168	SYCAMORE AVENUE	2172	432-461-67	G3	4	1225	Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	8		No			Replace Slab(s)	
9166	SYCAMORE AVENUE	2192	432-461-65	G3	4	1225	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	2.5		No			Grind	
9807	SYCAMORE AVENUE	2212	432-461-63	G4	4	1225	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9808	SYCAMORE AVENUE	2212	432-461-63	G4	4	1225	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
9809	SYCAMORE AVENUE	2222	432-461-62	G4	4	1225	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		Yes			Grind	
9810	SYCAMORE AVENUE	2232	432-461-61	G4	4	1225	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
9812	SYCAMORE AVENUE	2242	432-461-60	G4	4	1225	Sidewalk	PCC	Faulting	1/2" to 1"	2		No			Ramp	
2441	SYCAMORE AVENUE		432-151-33	F3	4	1220	Driveway	PCC	Sidewalk Curb Separation	1/4" to 1/2"	5		No			Grind	Between gutter and driveway
2294	SYCAMORE AVENUE		432-173-49	F3	4	1221	Driveway	PCC	Divided Slab	1/4" to 1/2"			No		Yes	Replace Slab	Lots of med cracks throughout driveway
2439	SYCAMORE AVENUE		432-151-36	E3	4	1220	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
2290	SYCAMORE AVENUE		432-173-49	F3	4	1221	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
2291	SYCAMORE AVENUE		432-173-49	F3	4	1221	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
2283	SYCAMORE AVENUE		432-173-49	F3	4	1221	Sidewalk	PCC	Faulting	1/4" to 1/2"	10		No			Grind	Running parallel to sidewalk
4301	SYCAMORE AVENUE		432-331-66	F3	4	1222	Sidewalk	PCC	Faulting	1/2" to 1"	15		No			Ramp	Running parallel with sidewalk
2285	SYCAMORE AVENUE		432-173-49	F3	4	1221	Driveway	PCC	Linear Cracking	1/4" to 1/2"			No			Grind	Some cracks on curb and driveway
2288	SYCAMORE AVENUE		432-173-49	F3	4	1221	Driveway	PCC	Pothole	1/4" to 1/2"			No			Grind	Spalling turned to hole
2438	SYCAMORE AVENUE		432-151-36	E3	4	1220	Driveway	PCC	Corner Break	1/4" to 1/2"	3		No			Grind	
2289	SYCAMORE AVENUE		432-173-49	F3	4	1221	Sidewalk	PCC	Faulting	1/2" to 1"	2		No			Ramp	
2292	SYCAMORE AVENUE		432-173-49	F3	4	1221	Sidewalk	PCC	Faulting	1/2" to 1"	2		No			Ramp	
2293	SYCAMORE AVENUE		432-173-49	F3	4	1221	Sidewalk	PCC	Faulting	1/2" to 1"	2		Yes			Ramp	
3971	SYCAMORE AVENUE		432-181-08	F3	4	1222	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
2440	SYCAMORE AVENUE		432-151-33	F3	4	1220	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
2282	SYCAMORE AVENUE		432-173-49	F3	4	1221	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
2284	SYCAMORE AVENUE		432-173-49	F3	4	1221	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
2286	SYCAMORE AVENUE		432-173-49	F3	4	1221	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
2287	SYCAMORE AVENUE		432-173-49	F3	4	1221	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
9143	SYCAMORE AVENUE		432-251-43	G3	4	1223	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
9144	SYCAMORE AVENUE		432-371-44	G3	4	1224	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
2160	TENBY LANE	1382	432-117-14	E3	4	1925	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
2054	TENBY LANE	1412	432-111-39	E3	4	1925	Sidewalk	PCC	Faulting	1/2" to 1"	4		No			Ramp	
2055	TENBY LANE	1412	432-111-39	E3	4	1925	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	4		No			Grind	
2115	TUPELO LANE	1261	432-093-01	E3	4	1937	Sidewalk	PCC	Faulting	1/2" to 1"	4		No			Ramp	Prev grind
2114	TUPELO LANE	1261	432-093-01	E3	4	1937	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
2116	TUPELO LANE	1261	432-093-01	E3	4	1937	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
2117	TUPELO LANE	1261	432-093-01	E3	4	1937	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
2118	TUPELO LANE	1261	432-093-01	E3	4	1937	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	9		No			Grind	
2113	TUPELO LANE	1261	432-093-01	E3	4	1937	Ramp	PCC	Sidewalk Curb Separation	1/4" to 1/2"	4		No			Grind	
2109	TUPELO LANE	1281	432-091-20	E3	4	1937	Curb/Gutter	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
2110	TUPELO LANE		432-094-01	E3	4	1937	Cross Gutter	PCC	Linear Cracking	1/4" to 1/2"	6		No			Grind	
2111	TUPELO LANE		432-094-01	E3	4	1937	Cross Gutter	PCC	Linear Cracking	1/4" to 1/2"	6		No			Grind	
8387	TUSTIN RANCH ROAD	2351	432-453-09	G4	4	5003	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
2856	UTT DRIVE	1351	432-051-09	E3	4	1942	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No		Yes	Grind	
2855	UTT DRIVE	1351	432-051-09	E3	4	1942	Driveway	PCC	Sidewalk Curb Separation	1/2" to 1"	4		No		Yes	Patch	
2851	UTT DRIVE	1352	432-051-10	E3	4	1942	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
2852	UTT DRIVE	1352	432-051-10	E3	4	1942	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	5		No		Yes	Grind	
2853	UTT DRIVE	1352	432-051-10	E3	4	1942	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	3		No		Yes	Grind	
2790	UTT DRIVE	1352	432-051-10	E3	4	1942	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	6		No		Yes	Grind	
2854	UTT DRIVE	1352	432-051-10	E3	4	1942	Sidewalk	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
2773	UTT DRIVE	1362	432-041-12	E3	4	1942	Driveway	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
2774	UTT DRIVE	1362	432-041-12	E3	4	1942	Curb/Gutter	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
2776	UTT DRIVE	14011	432-053-13	E3	4	1942	Curb/Gutter	PCC	Linear Cracking	1/2" to 1"	2		Yes			Grind	
2777	UTT DRIVE	14011	432-053-13	E3	4	1942	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
2778	UTT DRIVE	14021	432-053-14	E3	4	1942	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
2779	UTT DRIVE	14021	432-053-14	E3	4	1942	Driveway	PCC	Spalling	1/4" to 1/2"	2		No			Grind	
2780	UTT DRIVE	14061	432-053-18	E3	4	1942	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight displacement
2781	UTT DRIVE	14081	432-053-19	E3	4	1942	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	Slight displacement, Prev grind
2782	UTT DRIVE	14091	432-053-20	E3	4	1942	Driveway	PCC	Linear Cracking	No Displacement	5		No		Yes	Joint Seal	Slight displacement
2772	UTT DRIVE	14092	432-041-09	E3	4	1942	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
2783	UTT DRIVE	14101	432-053-21	E3	4	1942	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No		Yes	Grind	Prev grind
2770				}	4	1942	Sidewalk	PCC	Faulting	1" to 2"	6		No			Replace Slab	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
2771	UTT DRIVE	14102	432-041-08	E3	4	1942	Curb/Gutter	PCC	Sidewalk Curb Separation	1" to 2"	6		No			Replace Curb	
2765	UTT DRIVE	1411	432-041-22	E3	4	1942	Sidewalk	PCC	Divided Slab	No Displacement			No		Yes	Replace Slab	Low
2764	UTT DRIVE	1411	432-041-22	E3	4	1942	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No		Yes	Grind	Prev grind
2767	UTT DRIVE	1411	432-041-22	E3	4	1942	Sidewalk	PCC	Corner Break	1/4" to 1/2"	2		No		Yes	Grind	
2761	UTT DRIVE	1411	432-041-22	E3	4	1942	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No		Yes	Grind	
2762	UTT DRIVE	1411	432-041-22	E3	4	1942	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No		Yes	Grind	
2768	UTT DRIVE	1411	432-041-22	E3	4	1942	Driveway	PCC	Linear Cracking	1/4" to 1/2"	6		No		Yes	Grind	
2766	UTT DRIVE	1411	432-041-22	E3	4	1942	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	1		No		Yes	Grind	
2763	UTT DRIVE	1411	432-041-22	E3	4	1942	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No		Yes	Grind	
2784	UTT DRIVE	14111	432-053-22	E3	4	1942	Sidewalk	PCC	Linear Cracking	No Displacement	4		Yes		Yes	Joint Seal	Slight displacement
2769	UTT DRIVE	14112	432-041-07	E3	4	1942	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
2785	UTT DRIVE	14121	432-053-23	E3	4	1942	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes		Yes	Grind	
2787	UTT DRIVE	14131	432-053-24	E3	4	1942	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No		Yes	Grind	Slight displacement
2786	UTT DRIVE	14131	432-053-24	E3	4	1942	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No		Yes	Grind	
2788	UTT DRIVE	14151	432-053-25	E3	4	1942	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes		Yes	Grind	
2841	VEEH DRIVE	1272	432-051-17	E3	4	1948	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
2842	VEEH DRIVE	1272	432-051-17	E3	4	1948	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
2843	VEEH DRIVE	1282	432-051-16	E3	4	1948	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
2844	VEEH DRIVE	1292	432-051-15	E3	4	1948	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
2845	VEEH DRIVE	1322	432-051-13	E3	4	1949	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
2846	VEEH DRIVE	1322	432-051-13	E3	4	1949	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
2847	VEEH DRIVE	1322	432-051-13	E3	4	1949	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
2793	VEEH DRIVE	1341	432-053-26	E3	4	1949	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
2794	VEEH DRIVE	1341	432-053-26	E3	4	1949	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
2849	VEEH DRIVE	1352	432-051-10	E3	4	1949	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
2850	VEEH DRIVE	1352	432-051-10	E3	4	1949	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
2848	VEEH DRIVE	1352	432-051-10	E3	4	1949	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
2789	VEEH DRIVE	1352	432-051-10	E3	4	1949	Cross Gutter	PCC	Linear Cracking	1/4" to 1/2"	7		No		Yes	Grind	
2815	VEEH DRIVE	14151	432-052-25	E3	4	1948	Sidewalk	PCC	Linear Cracking	No Displacement	4		Yes			Joint Seal	Slight displacement
2791	VEEH DRIVE	14151	432-053-25	E3	4	1949	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
2792	VEEH DRIVE	14151	432-053-25	E3	4	1949	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
2795	VEEH DRIVE	14152	432-053-01	E3	4	1949	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
2796	VEEH DRIVE	14152	432-053-01	E3	4	1949	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
2797	VEEH DRIVE	14152	432-053-01	E3	4	1949	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	10		No			Grind	
2119	WALDEN LANE	1251	432-093-02	E3	4	1953	Curb/Gutter	PCC	Spalling	Over 2"	1		No			Replace C&G	
2132	WALDEN LANE	14292	432-092-01	E3	4	1953	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	10		No			Grind	
4932	WALNUT AVENUE	1044	432-131-03	E3	4	1259	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Prev grind
4826	WALNUT AVENUE	1044	432-131-03	E3	4	1259	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
4933	WALNUT AVENUE	1044	432-131-03	E3	4	1259	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
4934	WALNUT AVENUE	1044	432-131-03	E3	4	1259	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	13		No			Grind	
4840	WALNUT AVENUE	1071	432-121-08	E3	4	1259	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
4842	WALNUT AVENUE	1071	432-121-08	E3	4	1259	Sidewalk	PCC	Faulting	1/2" to 1"	2		No			Ramp	
4834	WALNUT AVENUE	1071	432-121-08	E3	4	1259	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No		Yes	Grind	
4835	WALNUT AVENUE	1071	432-121-08	E3	4	1259	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No		Yes	Grind	
4837	WALNUT AVENUE	1071	432-121-08	E3	4	1259	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
4838	WALNUT AVENUE	1071	432-121-08	E3	4	1259	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
4841	WALNUT AVENUE	1071	432-121-08	E3	4	1259	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
4836	WALNUT AVENUE	1071	432-121-08	E3	4	1259	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	5		No			Grind	
4839	WALNUT AVENUE	1071	432-121-08	E3	4	1259	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	12		No			Grind	
4843	WALNUT AVENUE	1071	432-121-08	E3	4	1259	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	9		Yes			Grind	
4845	WALNUT AVENUE	1071	432-121-08	E3	4	1259	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	12		No			Grind	
4844	WALNUT AVENUE	1071	432-121-08	E3	4	1259	Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	4		Yes			Replace Slab	
4846	WALNUT AVENUE	1071	432-121-08	E3	4	1259	Curb/Gutter	PCC	Spalling	1" to 2"	2		No			Patch	
4931	WALNUT AVENUE	1112	432-131-04	E3	4	1259	Driveway	PCC	Linear Cracking	No Displacement			No			Joint Seal	3 separate cracks on driveway
4927	WALNUT AVENUE	1112	432-131-04	E3	4	1259	Driveway	PCC	Divided Slab	No Displacement			No			Replace Slab	Some of slab is divided, prev grinded
4929	WALNUT AVENUE	1112	432-131-04	E3	4	1259	Sidewalk	PCC	Faulting	1/2" to 1"	2		No			Ramp	
4928	WALNUT AVENUE	1112	432-131-04	E3	4	1259	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
4930	WALNUT AVENUE	1112	432-131-04	E3	4	1259	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	7		No			Grind	
4847	WALNUT AVENUE	1151	432-121-07	E3	4	1259	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	Prev grind
4851	WALNUT AVENUE	1151	432-121-07	E3	4	1259	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
4855	WALNUT AVENUE	1151	432-121-07	E3	4	1259	Curb/Gutter	PCC	Spalling	1/2" to 1"	15		No			Replace C&G	Prev grind
4849	WALNUT AVENUE	1151	432-121-07	E3	4	1259	Sidewalk	PCC	Faulting	1/2" to 1"	2		No			Ramp	
4850	WALNUT AVENUE	1151	432-121-07	E3	4	1259	Sidewalk	PCC	Faulting	1/2" to 1"	1		No			Ramp	
4853				E3	4	1259	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
4852	WALNUT AVENUE	1151	432-121-07	E3	4	1259	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	4		No			Replace Slab	
4854	WALNUT AVENUE	1151	432-121-07	E3	4	1259	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	8		Yes			Grind	
4848	WALNUT AVENUE	1151	432-121-07	E3	4	1259	Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	9		No			Replace Slab(s)	
4861	WALNUT AVENUE	1201	432-121-06	E3	4	1259	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
4858	WALNUT AVENUE	1201	432-121-06	E3	4	1259	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
4859	WALNUT AVENUE	1201	432-121-06	E3	4	1259	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
4860	WALNUT AVENUE	1201	432-121-06	E3	4	1259	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
4856	WALNUT AVENUE	1201	432-121-06	E3	4	1259	Driveway	PCC	Pothole	1/4" to 1/2"	1		No			Grind	
4857	WALNUT AVENUE	1201	432-121-06	E3	4	1259	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	2		No			Grind	
4862	WALNUT AVENUE	1262	432-113-12	E3	4	1259	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
4863	WALNUT AVENUE	1272	432-113-13	E3	4	1259	Sidewalk	PCC	Faulting	1/2" to 1"	5		Yes			Ramp	Running parallel to sidewalk
4864	WALNUT AVENUE	1272	432-113-13	E3	4	1259	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
2683	WALNUT AVENUE	1280	432-161-26	E3	4	1260	Driveway	PCC	Corner Break	1/4" to 1/2"	6		No			Grind	
2685	WALNUT AVENUE	1280	432-161-26	E3	4	1260	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
4865	WALNUT AVENUE	1280	432-161-26	E3	4	1259	Sidewalk	PCC	Spalling	1/4" to 1/2"	0.5		No			Grind	
2677	WALNUT AVENUE	1302	432-117-01	E3	4	1260	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
2678	WALNUT AVENUE	1302	432-117-01	E3	4	1260	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
2671	WALNUT AVENUE	1312	432-117-02	E3	4	1260	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
2676	WALNUT AVENUE	1312	432-117-02	E3	4	1260	Sidewalk	PCC	Faulting	1/2" to 1"	4		No			Ramp	
2673	WALNUT AVENUE	1312	432-117-02	E3	4	1260	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
2672	WALNUT AVENUE	1312	432-117-02	E3	4	1260	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	5		No			Grind	
2701	WALNUT AVENUE	1322	432-161-28	E3	4	1260	Sidewalk	PCC	Faulting	1/2" to 1"	4		No			Ramp	
2702	WALNUT AVENUE	1322	432-161-28	E3	4	1260	Sidewalk	PCC	Faulting	1/2" to 1"	4		No			Ramp	
2688	WALNUT AVENUE	1322	432-161-28	E3	4	1260	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
2690	WALNUT AVENUE	1322	432-161-28	E3	4	1260	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
2694	WALNUT AVENUE	1322	432-161-28	E3	4	1260	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
2697	WALNUT AVENUE	1322	432-161-28	E3	4	1260	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
2699	WALNUT AVENUE	1322	432-161-28	E3	4	1260	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
2664	WALNUT AVENUE	1352	432-117-11	E3	4	1260	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		No			Ramp	
2666	WALNUT AVENUE	1352	432-117-11	E3	4	1260	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
2667	WALNUT AVENUE	1352	432-117-11	E3	4	1260	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
2668	WALNUT AVENUE	1352	432-117-11	E3	4	1260	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
2663	WALNUT AVENUE	1362	432-117-12	E3	4	1260	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
2659	WALNUT AVENUE	1372	432-117-13	E3	4	1260	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
2660	WALNUT AVENUE	1372	432-117-13	E3	4	1260	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
2654	WALNUT AVENUE	1422	432-111-38	E3	4	1260	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Sunken CATV patch
2656	WALNUT AVENUE	1422	432-111-38	E3	4	1260	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	4		No			Grind	
8528	WALNUT AVENUE	14392	432-291-01	F4	4	1304	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No		Yes	Grind	Prev grind
8530	WALNUT AVENUE	14392	432-291-01	F4	4	1304	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No		Yes	Grind	Prev grind
8532	WALNUT AVENUE	14392	432-291-01	F4	4	1304	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No		Yes	Grind	
8534	WALNUT AVENUE	14392	432-291-01	F4	4	1304	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No		Yes	Grind	
8537	WALNUT AVENUE	14392	432-291-01	F4	4	1304	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No		Yes	Grind	
8539	WALNUT AVENUE	14392	432-291-01	F4	4	1304	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No		Yes	Grind	
8542	WALNUT AVENUE	14392	432-291-01	F4	4	1304	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No		Yes	Grind	
4832	WALNUT AVENUE	14430	432-121-09	E3	4	1259	Driveway	PCC	Sidewalk Curb Separation	1/2" to 1"	8		No		Yes	Replace Driveway	Between driveway and curb
4833	WALNUT AVENUE	14430	432-121-09	E3	4	1259	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		No		Yes	Ramp	
2646	WALNUT AVENUE	14441	432-111-04	F3	4	1260	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
2649	WALNUT AVENUE	14441	432-111-04	F3	4	1260	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
2651	WALNUT AVENUE	14441	432-111-04	F3	4	1260	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
2645	WALNUT AVENUE	14441	432-111-04	F3	4	1260	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	60		No			Grind	
2647	WALNUT AVENUE	14441	432-111-04	F3	4	1260	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	30		No			Grind	
2652	WALNUT AVENUE	14441	432-111-04	F3	4	1260	Curb/Gutter	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
7911	WALNUT AVENUE	14462	432-212-30	F3	4	1302	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
7912	WALNUT AVENUE	14462	432-212-30	F3	4	1302	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	Prev grind
7913	WALNUT AVENUE	14462	432-212-30	F3	4	1302	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
7910	WALNUT AVENUE	14462	432-212-30	F3	4	1302	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
8551	WALNUT AVENUE	14471	432-302-21	F3	4	1303	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
2669	WALNUT AVENUE	14481	432-117-10	E3	4	1260	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
8545	WALNUT AVENUE	14482	432-302-23	F4	4	1303	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
2670	WALNUT AVENUE	14482	432-117-03	E3	4	1260	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
7947	WALNUT AVENUE	14491	432-301-54	F3	4	1303	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
7903	WALNUT AVENUE	14491	432-301-67	F3	4	1302	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
7904	WALNUT AVENUE	14491	432-301-67	F3	4	1302	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7948				F3	4	1303	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
7902	WALNUT AVENUE	14491	432-303-16	F3	4	1303	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
7950	WALNUT AVENUE	14492	432-301-24	F3	4	1303	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	At CATV patch
7881	WALNUT AVENUE	14492	432-303-01	F3	4	1302	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
7949	WALNUT AVENUE	14492	432-301-24	F3	4	1303	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		Yes			Grind	
2709	WALNUT AVENUE	14501	432-171-07	F3	4	1260	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	5		No		Yes	Grind	Between gutter and driveway
2707	WALNUT AVENUE	14501	432-171-07	F3	4	1260	Driveway	PCC	Divided Slab	1/4" to 1/2"			No		Yes	Replace Slab	Prev grind
7618	WALNUT AVENUE	14501	432-181-75	F3	4	1302	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
2708	WALNUT AVENUE	14501	432-171-07	F3	4	1260	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No		Yes	Grind	
8368	WALNUT AVENUE	14502	432-371-22	F4	4	1304	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
7619	WALNUT AVENUE	14502	432-181-76	F3	4	1302	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	Prev grind
8370	WALNUT AVENUE	14502	432-371-22	F4	4	1304	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7620	WALNUT AVENUE	14502	432-181-76	F3	4	1302	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
7621	WALNUT AVENUE	14502	432-181-76	F3	4	1302	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
8369	WALNUT AVENUE	14502	432-371-22	F4	4	1304	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	5		No			Grind	
4870	WALNUT AVENUE	14502	432-132-01	E3	4	1259	Curb/Gutter	PCC	Spalling	1/4" to 1/2"	1.5		No			Grind	
4829	WALNUT AVENUE	14510	432-131-02	E3	4	1259	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
4830	WALNUT AVENUE	14510	432-131-02	E3	4	1259	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
4831	WALNUT AVENUE	14510	432-131-02	E3	4	1259	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
4828	WALNUT AVENUE	14510	432-131-02	E3	4	1259	Curb/Gutter	PCC	Spalling	1/4" to 1/2"	2		No			Grind	
4827	WALNUT AVENUE	14510	432-131-02	E3	4	1259	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
8367	WALNUT AVENUE	14511	432-371-41	F4	4	1304	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	15		No			Grind	
8363	WALNUT AVENUE	14512	432-251-42	F4	4	1304	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	Prev grind
8365	WALNUT AVENUE	14512	432-251-42	F4	4	1304	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	Prev grind
8364	WALNUT AVENUE	14512	432-251-42	F4	4	1304	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
4868	WALNUT AVENUE	14512	432-132-09	E3	4	1259	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No	Yes		Grind	
4869	WALNUT AVENUE	14512	432-132-09	E3	4	1259	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	10		No			Grind	
2704	WALNUT AVENUE	14521	432-171-12	E3	4	1260	Sidewalk	PCC	Corner Break	1/4" to 1/2"	3		No		Yes	Grind	
2705	WALNUT AVENUE	14521	432-171-12	F3	4	1260	Driveway	PCC	Faulting	1/2" to 1"	5		No		Yes	Grind Driveway	
2706	WALNUT AVENUE	14521	432-171-12	F3	4	1260	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No		Yes	Grind	
2703	WALNUT AVENUE	14521	432-171-12	E3	4	1260	Driveway	PCC	Linear Cracking	1/4" to 1/2"	6	2"	No		Yes	Grind	
8371	WALNUT AVENUE	14522	432-372-07	F4	4	1305	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
8375	WALNUT AVENUE	14531	432-451-06	F4	4	1305	Sidewalk	PCC	Faulting	1/2" to 1"	1		No			Ramp	
8372	WALNUT AVENUE	14531	432-451-06	F4	4	1305	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
8373	WALNUT AVENUE	14531	432-451-06	F4	4	1305	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
8374	WALNUT AVENUE	14531	432-451-06	F4	4	1305	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	2		No			Grind	
8376	WALNUT AVENUE	14532	432-451-07	F4	4	1305	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
8379	WALNUT AVENUE	14541	432-451-17	F4	4	1305	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
8377	WALNUT AVENUE	14541	432-451-17	F4	4	1305	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
8380	WALNUT AVENUE	14541	432-451-17	F4	4	1305	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
8381	WALNUT AVENUE	14541	432-451-17	F4	4	1305	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
8378	WALNUT AVENUE	14541	432-451-17	F4	4	1305	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	5		No			Replace Slab	
7622	WALNUT AVENUE	1611	432-194-02	F3	4	1302	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		No			Ramp	
7623	WALNUT AVENUE	1611	432-194-02	F3	4	1302	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	6		No			Grind	
7624	WALNUT AVENUE	1631	432-194-04	F3	4	1302	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
7625	WALNUT AVENUE	1671	432-194-08	F3	4	1302	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
7626	WALNUT AVENUE	1681	432-194-09	F3	4	1302	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
7627	WALNUT AVENUE	1681	432-194-09	F3	4	1302	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
7906	WALNUT AVENUE	1686	432-212-27	F3	4	1302	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
7905	WALNUT AVENUE	1712	432-212-29	F3	4	1302	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7631	WALNUT AVENUE	1721	432-203-21	F3	4	1302	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		No			Ramp	Prev grind
7628	WALNUT AVENUE	1721	432-203-21	F3	4	1302	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
7629	WALNUT AVENUE	1721	432-203-21	F3	4	1302	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7630	WALNUT AVENUE	1731	432-203-20	F3	4	1302	Curb/Gutter	PCC	Sidewalk Curb Separation	Over 2"	4		Yes			Replace C&G	
7632	WALNUT AVENUE	1751	432-203-18	F3	4	1302	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
7633	WALNUT AVENUE	1761	432-203-17	F3	4	1302	Sidewalk	PCC	Faulting	1/2" to 1"	0.5		No			Ramp	
7951	WALNUT AVENUE	1841	432-233-17	F3	4	1303	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
7952	WALNUT AVENUE	1841	432-233-17	F3	4	1303	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
7953	WALNUT AVENUE	1851	432-233-18	F3	4	1303	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	13		No			Grind	
7954	WALNUT AVENUE	1861	432-233-19	F3	4	1303	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
7955	WALNUT AVENUE	1871	432-233-20	F3	4	1303	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	4		No			Grind	
7957	WALNUT AVENUE	1881	432-233-21	F3	4	1303	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
7956	WALNUT AVENUE	1881	432-233-21	F3	4	1303	Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	5		No			Replace Slab(s)	
7958	WALNUT AVENUE	1891	432-233-22	F3	4	1303	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
7959				F3	4	1303	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
8336	WALNUT AVENUE	1901	432-233-23	F3	4	1303	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
8552	WALNUT AVENUE	1901	432-302-10	F3	4	1303	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
8337	WALNUT AVENUE	1911	432-233-24	F3	4	1303	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
8338	WALNUT AVENUE	1941	432-243-31	F3	4	1303	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
8339	WALNUT AVENUE	1941	432-243-31	F3	4	1303	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
8340	WALNUT AVENUE	1971	432-243-28	F3	4	1303	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
8341	WALNUT AVENUE	1981	432-243-27	F3	4	1303	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		Yes			Grind	
8342	WALNUT AVENUE	1991	432-243-26	F3	4	1303	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
8343	WALNUT AVENUE	1991	432-243-26	F3	4	1303	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
8344	WALNUT AVENUE	1991	432-243-26	F3	4	1303	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
8346	WALNUT AVENUE	2001	432-251-53	F4	4	1304	Sidewalk	PCC	Corner Break	1/4" to 1/2"	1		No			Grind	
8345	WALNUT AVENUE	2001	432-251-53	F4	4	1304	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
8347	WALNUT AVENUE	2011	432-251-52	F4	4	1304	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
8348	WALNUT AVENUE	2031	432-251-50	F4	4	1304	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
8349	WALNUT AVENUE	2041	432-251-49	F4	4	1304	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
8350	WALNUT AVENUE	2041	432-251-49	F4	4	1304	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
8352	WALNUT AVENUE	2041	432-251-49	F4	4	1304	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
8351	WALNUT AVENUE	2041	432-251-49	F4	4	1304	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	3		Yes			Grind	
8353	WALNUT AVENUE	2051	432-251-48	F4	4	1304	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
8354	WALNUT AVENUE	2061	432-251-47	F4	4	1304	Sidewalk	PCC	Faulting	1/2" to 1"	1		No			Ramp	
8357	WALNUT AVENUE	2061	432-251-47	F4	4	1304	Sidewalk	PCC	Faulting	1/2" to 1"	1		No			Ramp	
8355	WALNUT AVENUE	2061	432-251-47	F4	4	1304	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
8356	WALNUT AVENUE	2061	432-251-47	F4	4	1304	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
8359	WALNUT AVENUE	2071	432-251-46	F4	4	1304	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
8358	WALNUT AVENUE	2071	432-251-46	F4	4	1304	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	1.5		No			Grind	
8360	WALNUT AVENUE	2081	432-251-45	F4	4	1304	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
8362	WALNUT AVENUE	2081	432-251-45	F4	4	1304	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
8361	WALNUT AVENUE	2081	432-251-45	F4	4	1304	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	10		No			Grind	
8382	WALNUT AVENUE	2321	432-453-06	G4	4	1305	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
8383	WALNUT AVENUE	2321	432-453-06	G4	4	1305	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
8384	WALNUT AVENUE	2331	432-453-07	G4	4	1305	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
8385	WALNUT AVENUE	2351	432-453-09	G4	4	1305	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
8386	WALNUT AVENUE	2351	432-453-09	G4	4	1305	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
4866	WALNUT AVENUE		432-161-27	E3	4	1259	Driveway	PCC	Divided Slab	1/4" to 1/2"			No			Replace Slab(s)	Half of driveway has divided slab
8499	WALNUT AVENUE		432-432-08	F4	4	1306	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
8481	WALNUT AVENUE		432-433-11	F4	4	1306	Curb/Gutter	PCC	Faulting	1" to 2"			No			Replace C&G	
7908	WALNUT AVENUE		432-212-31	F3	4	1302	Curb/Gutter	PCC	Faulting	1/2" to 1"			No			Replace C&G	
8366	WALNUT AVENUE		432-371-44	F4	4	1304	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
8512	WALNUT AVENUE		432-381-04	F4	4	1304	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
8514	WALNUT AVENUE		432-381-04	F4	4	1304	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
8516	WALNUT AVENUE		432-381-04	F4	4	1304	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
8517	WALNUT AVENUE		432-381-04	F4	4	1304	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
8518	WALNUT AVENUE		432-381-04	F4	4	1304	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
8520	WALNUT AVENUE		432-381-04	F4	4	1304	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
8524	WALNUT AVENUE		432-381-04	F4	4	1304	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
8526	WALNUT AVENUE		432-381-04	F4	4	1304	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
4867	WALNUT AVENUE		432-161-27	E3	4	1259	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
8469	WALNUT AVENUE		432-436-12	G4	4	1306	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
8470	WALNUT AVENUE		432-436-12	G4	4	1306	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
8472	WALNUT AVENUE		432-435-09	G4	4	1306	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
8474	WALNUT AVENUE		432-435-09	G4	4	1306	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
8476	WALNUT AVENUE		432-435-09	G4	4	1306	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
8477	WALNUT AVENUE		432-435-09	G4	4	1306	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
8486	WALNUT AVENUE		432-433-10	F4	4	1306	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
8488	WALNUT AVENUE		432-433-10	F4	4	1306	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
8490	WALNUT AVENUE		432-433-10	F4	4	1306	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
8504	WALNUT AVENUE		432-383-01	F4	4	1306	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
8501	WALNUT AVENUE		432-432-08	F4	4	1306	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
7909	WALNUT AVENUE		432-212-31	F3	4	1302	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
8522	WALNUT AVENUE		432-381-04	F4	4	1304	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	2.5		No			Replace Slab	
8484	WALNUT AVENUE		432-433-10	F4	4	1306	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	4		No			Grind	
8497	WALNUT AVENUE		432-432-08	F4	4	1306	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	1.5		No			Grind	
8466	WALNUT AVENUE		432-436-12	G4	4	1306	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	15		No			Grind	
8494				F4	4	1306	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	4		No			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
8511	WALNUT AVENUE		432-381-04	F4	4	1304	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	6		No			Grind	
8503	WALNUT AVENUE		432-432-08	F4	4	1306	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	4		No			Grind	
7617	WALNUT AVENUE		432-181-45	F3	4	1302	Curb/Gutter	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
7907	WALNUT AVENUE		432-212-31	F3	4	1302	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
4236	WESTFALL ROAD	14501	432-181-46	F3	4	1962	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
4234	WESTFALL ROAD	14502	432-181-47	F3	4	1962	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
4235	WESTFALL ROAD	14502	432-181-47	F3	4	1962	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
4237	WESTFALL ROAD	14511	432-181-44	F3	4	1962	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
4238	WESTFALL ROAD	14521	432-181-43	F3	4	1962	Sidewalk	PCC	Faulting	1/2" to 1"	1		No			Ramp	
4233	WESTFALL ROAD	14522	432-181-50	F3	4	1962	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
4239	WESTFALL ROAD	14531	432-181-42	F3	4	1962	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
4231	WESTFALL ROAD	14532	432-181-51	F3	4	1962	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	3		No			Grind	Running parallel with sidewalk
4240	WESTFALL ROAD	14541	432-181-41	F3	4	1962	Sidewalk	PCC	Faulting	1/2" to 1"	2.5		No			Ramp	
4241	WESTFALL ROAD	14551	432-181-40	F3	4	1962	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
4228	WESTFALL ROAD	14562	432-181-54	F3	4	1962	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
4229	WESTFALL ROAD	14562	432-181-54	F3	4	1962	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
4230	WESTFALL ROAD	14562	432-181-54	F3	4	1962	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
4242	WESTFALL ROAD	14601	432-181-35	F3	4	1962	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
4226	WESTFALL ROAD	14602	432-181-58	F3	4	1962	Driveway	PCC	Sidewalk Curb Separation	Over 2"	10		No			Replace Driveway	Between curb and driveway
4225	WESTFALL ROAD	14602	432-181-58	F3	4	1962	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
4227	WESTFALL ROAD	14602	432-181-58	F3	4	1962	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
4243	WESTFALL ROAD	14621	432-181-33	F3	4	1962	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
4244	WESTFALL ROAD	14631	432-181-32	F3	4	1962	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
4245	WESTFALL ROAD	14631	432-181-32	F3	4	1962	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
4223	WESTFALL ROAD	14632	432-181-61	F3	4	1962	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	Prev grind
4224	WESTFALL ROAD	14632	432-181-61	F3	4	1962	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
4246	WESTFALL ROAD	14651	432-181-30	F3	4	1962	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
4247	WESTFALL ROAD	14661	432-181-29	F3	4	1962	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
4260	WESTFALL ROAD	14662	432-181-17	F3	4	1962	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
4248	WESTFALL ROAD	14671	432-181-28	F3	4	1962	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
4259	WESTFALL ROAD	14672	432-181-18	F3	4	1962	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
4258	WESTFALL ROAD	14682	432-181-19	F3	4	1962	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
4249	WESTFALL ROAD	14691	432-181-26	F3	4	1962	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
4250	WESTFALL ROAD	14691	432-181-26	F3	4	1962	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
4257	WESTFALL ROAD	14692	432-181-20	F3	4	1962	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
4251	WESTFALL ROAD	14701	432-181-25	F3	4	1962	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
4256	WESTFALL ROAD	14702	432-181-21	F3	4	1962	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
4252	WESTFALL ROAD	14711	432-181-91	F3	4	1962	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
4254	WESTFALL ROAD	14712	432-181-22	F3	4	1962	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
4255	WESTFALL ROAD	14712	432-181-22	F3	4	1962	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
4253	WESTFALL ROAD		432-181-23	F3	4	1962	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
4232	WESTFALL ROAD		432-181-49	F3	4	1962	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
2096	WILDEVE LANE	1281	432-111-05	E3	4	1967	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
2098	WILDEVE LANE	1282	432-091-33	E3	4	1967	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	5		No			Grind	
2097	WILDEVE LANE	1282	432-091-33	E3	4	1967	Sidewalk	PCC	Spalling	1/4" to 1/2"	0.5		No			Grind	
2142	WILDEVE LANE	14401	432-113-03	E3	4	1967	Curb/Gutter	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
2141	WILDEVE LANE	14401	432-113-03	E3	4	1967	Curb/Gutter	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
2094	WILDEVE LANE	14412	432-112-01	E3	4	1967	Curb/Gutter	PCC	Spalling	1/2" to 1"	0.5		No			Replace C&G	
2093	WILDEVE LANE	14422	432-112-02	E3	4	1967	Curb/Gutter	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
2143	WILDEVE LANE	14461	432-113-09	E3	4	1967	Curb/Gutter	PCC	Spalling	1" to 2"	1.5		No			Patch	
2087	WINDERMERE LANE	1281	432-111-05	E3	4	1969	Ramp	PCC	Faulting	1/4" to 1/2"	1		No			Grind Ramp	
2095	WINDERMERE LANE	1281	432-111-05	E3	4	1969	Cross Gutter	PCC	Linear Cracking	1/4" to 1/2"	7		No			Grind	
2086	WINDERMERE LANE	1281	432-111-05	E3	4	1969	Curb/Gutter	PCC	Spalling	1/2" to 1"	0.5		No			Replace C&G	
2065	WINDERMERE LANE	1321	432-111-09	E3	4	1969	Sidewalk	PCC	Spalling	1/2" to 1"	0.5		No			Replace C&G	
2064	WINDERMERE LANE	1331	432-111-18	E3	4	1969	Curb/Gutter	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
2066	WINDERMERE LANE	1332	432-115-02	E3	4	1969	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
2063	WINDERMERE LANE	1351	432-111-20	E3	4	1969	Curb/Gutter	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
2067	WINDERMERE LANE	1362	432-115-05	E3	4	1969	Curb/Gutter	PCC	Spalling	Over 2"	1		No			Replace C&G	
2068	WINDERMERE LANE	1402	432-115-09	E3	4	1969	Curb/Gutter	PCC	Spalling	1/4" to 1/2"	2		No			Grind	
2062	WINDERMERE LANE	1411	432-111-26	E3	4	1969	Sidewalk	PCC	Divided Slab	No Displacement			No			Replace Slab	Low
2070	WINDERMERE LANE	1412	432-115-10	E3	4	1969	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
2071	WINDERMERE LANE	1412	432-115-10	E3	4	1969	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
2069	WINDERMERE LANE	1412	432-115-10	E3	4	1969	Driveway	PCC	Sidewalk Curb Separation	1" to 2"	3		No			Patch	
2061				;	E3	4	1969	Curb/Gutter	PCC	Spalling	1/2" to 1"	1		No		Replace C&G	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
2089	WINDERMERE LANE	14412	432-112-01	E3	4	1969	Curb/Gutter	PCC	Spalling	1" to 2"	2		No			Patch	
2088	WINDERMERE LANE	14412	432-112-01	E3	4	1969	Curb/Gutter	PCC	Spalling	Over 2"	0.5		No			Replace C&G	
2804	WOODLAWN AVENUE	14021	432-052-14	E3	4	1974	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
2802	WOODLAWN AVENUE	14022	432-053-11	E3	4	1974	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
2803	WOODLAWN AVENUE	14022	432-053-11	E3	4	1974	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	2		No			Grind	
2805	WOODLAWN AVENUE	14051	432-052-17	E3	4	1974	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
2806	WOODLAWN AVENUE	14061	432-052-18	E3	4	1974	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
2801	WOODLAWN AVENUE	14082	432-053-06	E3	4	1974	Driveway	PCC	Linear Cracking	1/4" to 1/2"	6		No			Grind	
2807	WOODLAWN AVENUE	14091	432-052-20	E3	4	1974	Driveway	PCC	Sidewalk Curb Separation	1/2" to 1"	6		No			Patch	
2800	WOODLAWN AVENUE	14102	432-053-04	E3	4	1974	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
2809	WOODLAWN AVENUE	14111	432-052-22	E3	4	1974	Sidewalk	PCC	Divided Slab	No Displacement			No			Replace Slab	Low
2811	WOODLAWN AVENUE	14111	432-052-22	E3	4	1974	Sidewalk	PCC	Divided Slab	1/4" to 1/2"	7		No			Replace Slab(s)	
2808	WOODLAWN AVENUE	14111	432-052-22	E3	4	1974	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
2799	WOODLAWN AVENUE	14112	432-053-03	E3	4	1974	Driveway	PCC	Sidewalk Curb Separation	1/2" to 1"	15		No			Replace Driveway	
2810	WOODLAWN AVENUE	14121	432-052-23	E3	4	1974	Sidewalk	PCC	Divided Slab	1/4" to 1/2"			No			Replace Slab	
2812	WOODLAWN AVENUE	14131	432-052-24	E3	4	1974	Sidewalk	PCC	Linear Cracking	No Displacement	4		Yes			Joint Seal	Slight displacement
2813	WOODLAWN AVENUE	14151	432-052-25	E3	4	1974	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
2814	WOODLAWN AVENUE	14151	432-052-25	E3	4	1974	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	7		No			Grind	
2798	WOODLAWN AVENUE	14152	432-053-01	E3	4	1974	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
7087	YOLANDA WAY	1952	432-221-16	F4	4	1976	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
7086	YOLANDA WAY	1961	432-221-18	F4	4	1976	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
7088	YOLANDA WAY	1962	432-221-15	F4	4	1976	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	Prev grind
7089	YOLANDA WAY	1972	432-221-14	F4	4	1976	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	Prev grind

Zone 5

11781	ADAMS DRIVE	12712	501-109-72	D5	5	1505	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
11770	ADAMS DRIVE		501-109-71	D5	5	1505	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	Prev grind
11783	ADAMS DRIVE		501-108-69	D5	5	1505	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	Prev grind
11769	ADAMS DRIVE		501-109-71	D5	5	1505	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
11774	ADAMS DRIVE		501-109-71	D5	5	1505	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
11778	ADAMS DRIVE		501-109-71	D5	5	1505	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
11758	ADAMS DRIVE		501-109-84	D5	5	1505	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
11786	ADAMS DRIVE		501-108-69	D5	5	1505	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
11767	ADAMS DRIVE		501-109-81	D5	5	1505	Curb/Gutter	PCC	Sidewalk Curb Separation	1" to 2"	6		No			Replace Curb	Temp ramp
11764	ADAMS DRIVE		501-109-84	D5	5	1505	Ramp	PCC	Faulting	1/4" to 1/2"	8		Yes			Grind Ramp	
11789	ADAMS DRIVE		501-108-69	D5	5	1505	Sidewalk	PCC	Faulting	1" to 2"	4		Yes			Replace Slab	
11771	ADAMS DRIVE		501-109-71	D5	5	1505	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
11779	ADAMS DRIVE		501-109-71	D5	5	1505	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
11780	ADAMS DRIVE		501-109-71	D5	5	1505	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	
11790	ADAMS DRIVE		501-108-70	D5	5	1505	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
11791	ADAMS DRIVE		501-108-70	D5	5	1505	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
11792	ADAMS DRIVE		501-108-70	D5	5	1505	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
11793	ADAMS DRIVE		501-108-70	D5	5	1505	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes	Yes		Grind	
11794	ADAMS DRIVE		501-108-70	D5	5	1505	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
11772	ADAMS DRIVE		501-109-71	D5	5	1505	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
11773	ADAMS DRIVE		501-109-71	D5	5	1505	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
11775	ADAMS DRIVE		501-109-71	D5	5	1505	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
11776	ADAMS DRIVE		501-109-71	D5	5	1505	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
11777	ADAMS DRIVE		501-109-71	D5	5	1505	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
11757	ADAMS DRIVE		501-109-84	D5	5	1505	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
11759	ADAMS DRIVE		501-109-84	D5	5	1505	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
11760	ADAMS DRIVE		501-109-84	D5	5	1505	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
11763	ADAMS DRIVE		501-109-84	D5	5	1505	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes	Yes		Grind	
11755	ADAMS DRIVE		501-109-79	D5	5	1505	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
11756	ADAMS DRIVE		501-109-79	D5	5	1505	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
11782	ADAMS DRIVE		501-108-69	D5	5	1505	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
11784	ADAMS DRIVE		501-108-69	D5	5	1505	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
11785	ADAMS DRIVE		501-108-69	D5	5	1505	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
11787	ADAMS DRIVE		501-108-69	D5	5	1505	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
11788	ADAMS DRIVE		501-108-69	D5	5	1505	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
11762	ADAMS DRIVE		501-109-84	D5	5	1505	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		Yes			Grind	
11768	ADAMS DRIVE		501-109-71	D5	5	1505	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	6		No			Grind	
11765	ADAMS DRIVE		501-109-81	D5	5	1505	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	9		Yes			Grind	
11761				D5	5	1505	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	9		Yes			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
11766	ADAMS DRIVE		501-109-84	D5	5	1505	Curb/Gutter	PCC	Spalling	1" to 2"	1		No			Patch	
499	AUTO CENTER DRIVE	1	500-183-01	F4	5	1534	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
500	AUTO CENTER DRIVE	1	500-183-01	F4	5	1534	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
497	AUTO CENTER DRIVE	1	500-183-01	F4	5	1534	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	4 ft running along sidewalk
498	AUTO CENTER DRIVE	1	500-183-01	F4	5	1534	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	4 ft running along sidewalk
496	AUTO CENTER DRIVE	1	500-183-01	F4	5	1532	Sidewalk	PCC	Spalling	1/4" to 1/2"			No			Grind	
501	AUTO CENTER DRIVE	1	500-183-01	F4	5	1534	Driveway	PCC	Spalling	No Displacement			No			Field Assess-Monitor	
395	AUTO CENTER DRIVE	16	500-184-03	F5	5	1533	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
393	AUTO CENTER DRIVE	16	500-184-03	F5	5	1533	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide
396	AUTO CENTER DRIVE	16	500-184-03	F5	5	1533	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide
397	AUTO CENTER DRIVE	16	500-184-03	F5	5	1533	Sidewalk	PCC	Spalling	1/2" to 1"			No			Replace C&G	1 ft wide.
394	AUTO CENTER DRIVE	16	500-184-03	F5	5	1533	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	At cable tv patch
453	AUTO CENTER DRIVE	2	500-182-06	F4	5	1532	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.25	No			Grind	.25 ft wide
432	AUTO CENTER DRIVE	2	500-182-06	F5	5	1533	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.25	No			Grind	.25 ft wide
449	AUTO CENTER DRIVE	2	500-182-06	F4	5	1532	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
455	AUTO CENTER DRIVE	2	500-182-06	F4	5	1532	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
460	AUTO CENTER DRIVE	2	500-182-06	F5	5	1532	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
443	AUTO CENTER DRIVE	2	500-182-06	F5	5	1534	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
447	AUTO CENTER DRIVE	2	500-182-06	F5	5	1534	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
448	AUTO CENTER DRIVE	2	500-182-06	F4	5	1534	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
430	AUTO CENTER DRIVE	2	500-182-06	F5	5	1533	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
433	AUTO CENTER DRIVE	2	500-182-06	F5	5	1533	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
434	AUTO CENTER DRIVE	2	500-182-06	F5	5	1533	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
435	AUTO CENTER DRIVE	2	500-182-06	F5	5	1533	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
437	AUTO CENTER DRIVE	2	500-182-06	F5	5	1533	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
428	AUTO CENTER DRIVE	2	500-182-06	F5	5	1533	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide, on curb as well
458	AUTO CENTER DRIVE	2	500-182-06	F5	5	1532	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 wide ft
451	AUTO CENTER DRIVE	2	500-182-06	F4	5	1532	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide
452	AUTO CENTER DRIVE	2	500-182-06	F4	5	1532	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide
454	AUTO CENTER DRIVE	2	500-182-06	F4	5	1532	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide
429	AUTO CENTER DRIVE	2	500-182-06	F5	5	1533	Sidewalk	PCC	Spalling	1/4" to 1/2"			Yes			Grind	1 ft wide
457	AUTO CENTER DRIVE	2	500-182-06	F4	5	1532	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1.5 ft wide
444	AUTO CENTER DRIVE	2	500-182-06	F5	5	1534	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1.5 ft wide
446	AUTO CENTER DRIVE	2	500-182-06	F5	5	1534	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1.5 ft wide
439	AUTO CENTER DRIVE	2	500-182-06	F5	5	1533	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1.5 ft wide
445	AUTO CENTER DRIVE	2	500-182-06	F5	5	1534	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"			No			Grind	2 length
450	AUTO CENTER DRIVE	2	500-182-06	F4	5	1532	Sidewalk	PCC	Faulting	1/2" to 1"			No			Ramp	2.5 ft wide
442	AUTO CENTER DRIVE	2	500-182-06	F5	5	1534	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"			No			Grind	2.5 ft wide
456	AUTO CENTER DRIVE	2	500-182-06	F4	5	1532	Driveway	PCC	Spalling	1/4" to 1/2"			No			Grind	3 ft length
441	AUTO CENTER DRIVE	2	500-182-06	F5	5	1534	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"			No			Grind	4 ft length
459	AUTO CENTER DRIVE	2	500-182-06	F5	5	1532	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"			No			Grind	5 ft in length
438	AUTO CENTER DRIVE	2	500-182-06	F5	5	1533	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"			No			Grind	5 ft wide
440	AUTO CENTER DRIVE	2	500-182-06	F5	5	1534	Sidewalk	PCC	Buckled Slab	No Displacement			No			Replace Slab	
436	AUTO CENTER DRIVE	2	500-182-06	F5	5	1533	Sidewalk	PCC	Spalling	1/2" to 1"			No			Replace C&G	
431	AUTO CENTER DRIVE	2	500-182-06	F5	5	1533	Sidewalk	PCC	Spalling	1/4" to 1/2"			No			Grind	
474	AUTO CENTER DRIVE	28	500-181-13	F4	5	1532	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
477	AUTO CENTER DRIVE	28	500-181-13	F4	5	1532	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide
473	AUTO CENTER DRIVE	28	500-181-13	F4	5	1532	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1.5 ft wide
475	AUTO CENTER DRIVE	28	500-181-13	F4	5	1532	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1.5 ft wide
479	AUTO CENTER DRIVE	28	500-181-13	F4	5	1532	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"			No			Grind	15 ft length
478	AUTO CENTER DRIVE	28	500-181-13	F4	5	1532	Sidewalk	PCC	Corner Break	1/4" to 1/2"			No			Grind	2 ft length
472	AUTO CENTER DRIVE	28	500-181-13	F4	5	1532	Driveway	PCC	Spalling	No Displacement			No			Field Assess-Monitor	4 ft length.
476	AUTO CENTER DRIVE	28	500-181-13	F4	5	1532	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	At edison patch
480	AUTO CENTER DRIVE	28	500-181-13	F4	5	1532	Sidewalk	PCC	Faulting	1/2" to 1"			No			Ramp	At edison patch. 1 ft wide
403	AUTO CENTER DRIVE	30	500-184-01	F5	5	1533	Sidewalk	PCC	Spalling	1/4" to 1/2"		0.25	No			Grind	.25 ft wide
413	AUTO CENTER DRIVE	30	500-184-01	F5	5	1532	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
398	AUTO CENTER DRIVE	30	500-184-01	F5	5	1533	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
399	AUTO CENTER DRIVE	30	500-184-01	F5	5	1533	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
401	AUTO CENTER DRIVE	30	500-184-01	F5	5	1533	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
408	AUTO CENTER DRIVE	30	500-184-01	F5	5	1533	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
410	AUTO CENTER DRIVE	30	500-184-01	F5	5	1533	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
414	AUTO CENTER DRIVE	30	500-184-01	F5	5	1532	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide, prev grinded
406	AUTO CENTER DRIVE	30	500-184-01	F5	5	1533	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide
409				F5	5	1533	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
412	AUTO CENTER DRIVE	30	500-184-01	F5	5	1533	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide
411	AUTO CENTER DRIVE	30	500-184-01	F5	5	1533	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide, prev grinded. At manhole
407	AUTO CENTER DRIVE	30	500-184-01	F5	5	1533	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1.5 ft wide with some spladding as well
405	AUTO CENTER DRIVE	30	500-184-01	F5	5	1533	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	2.5 ft wide
404	AUTO CENTER DRIVE	30	500-184-01	F5	5	1533	Sidewalk	PCC	Faulting	1/2" to 1"			No			Ramp	3.5 ft wide
415	AUTO CENTER DRIVE	30	500-184-01	F5	5	1532	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"			No			Grind	4 ft length
400	AUTO CENTER DRIVE	30	500-184-01	F5	5	1533	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"			No			Grind	5 ft in length
402	AUTO CENTER DRIVE	30	500-184-01	F5	5	1533	Curb/Gutter	PCC	Spalling	1/4" to 1/2"			No			Grind	
471	AUTO CENTER DRIVE	36	500-181-14	F4	5	1532	Sidewalk	PCC	Faulting	1/4" to 1/2"			No	Yes		Grind	1 ft wide. At edison patch
468	AUTO CENTER DRIVE	40	500-181-02	F4	5	1532	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
464	AUTO CENTER DRIVE	40	500-181-02	F4	5	1532	Sidewalk	PCC	Faulting	1/2" to 1"			No			Ramp	1 ft wide
467	AUTO CENTER DRIVE	40	500-181-02	F4	5	1532	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide
461	AUTO CENTER DRIVE	40	500-181-02	F4	5	1532	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1.5 ft wide. Prev grinded
469	AUTO CENTER DRIVE	40	500-181-02	F4	5	1532	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"			No			Grind	2 ft length
465	AUTO CENTER DRIVE	40	500-181-02	F4	5	1532	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"			No			Replace Slab	3 ft length
462	AUTO CENTER DRIVE	40	500-181-02	F4	5	1532	Sidewalk	PCC	Faulting	1/2" to 1"			No			Ramp	3 ft wide. At edison patch
470	AUTO CENTER DRIVE	40	500-181-02	F4	5	1532	Sidewalk	PCC	Faulting	1/2" to 1"			No			Ramp	4 ft running along sidewalk
463	AUTO CENTER DRIVE	40	500-181-02	F4	5	1532	Curb/Gutter	PCC	Sidewalk Curb Separation	1" to 2"			No			Replace Curb	6.5 ft length
466	AUTO CENTER DRIVE	40	500-181-02	F4	5	1532	Sidewalk	PCC	Spalling	1/4" to 1/2"			No			Grind	
419	AUTO CENTER DRIVE	44	500-181-03	F5	5	1532	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
421	AUTO CENTER DRIVE	44	500-181-03	F5	5	1532	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
424	AUTO CENTER DRIVE	44	500-181-03	F5	5	1532	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
427	AUTO CENTER DRIVE	44	500-181-03	F5	5	1532	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	Yes			Grind	.5 ft wide
420	AUTO CENTER DRIVE	44	500-181-03	F5	5	1532	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide
422	AUTO CENTER DRIVE	44	500-181-03	F5	5	1532	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide
426	AUTO CENTER DRIVE	44	500-181-03	F5	5	1532	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide
425	AUTO CENTER DRIVE	44	500-181-03	F5	5	1532	Sidewalk	PCC	Faulting	1/2" to 1"			No			Ramp	1.5 ft wide
418	AUTO CENTER DRIVE	44	500-181-03	F5	5	1532	Sidewalk	PCC	Divided Slab	1/4" to 1/2"			No			Replace Slab	Some spladding as well.
423	AUTO CENTER DRIVE	44	500-181-03	F5	5	1532	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	Some spladding as well.
503	AUTO CENTER DRIVE	5	500-183-02	F5	5	1534	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide
502	AUTO CENTER DRIVE	5	500-183-02	F5	5	1534	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	2 ft wide
416	AUTO CENTER DRIVE	50	500-301-01	F5	5	1532	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
417	AUTO CENTER DRIVE	50	500-301-01	F5	5	1532	Curb/Gutter	PCC	Spalling	1/4" to 1/2"			No			Grind	On curb
504	AUTO CENTER DRIVE	9	500-183-03	F5	5	1534	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide
505	AUTO CENTER DRIVE	9	500-183-03	F5	5	1534	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide
506	AUTO CENTER DRIVE	9	500-183-03	F5	5	1534	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide
508	AUTO CENTER DRIVE	9	500-183-03	F5	5	1533	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1.5 ft wide
507	AUTO CENTER DRIVE	9	500-183-03	F5	5	1534	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1.5 ft wide. At edison patch
509	AUTO CENTER DRIVE	9	500-183-03	F5	5	1533	Driveway	PCC	Spalling	No Displacement			No			Field Assess-Monitor	
481	AUTO CENTER DRIVE		500-181-04	F4	5	1532	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
510	AUTO CENTER DRIVE		500-183-04	F5	5	1533	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1.5 ft wide
392	AUTO CENTER DRIVE		500-184-04	F5	5	1533	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	At traffic signal patch
1563	BELLEFORD ROAD	13121	500-013-02	D5	5	1545	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
1547	BELLEFORD ROAD	13121	500-013-23	D5	5	1545	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	8		No			Grind	
1562	BELLEFORD ROAD	13121	500-013-02	D5	5	1545	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	7		No			Grind	
1546	BELLEFORD ROAD	13121	500-013-23	D5	5	1545	Curb/Gutter	PCC	Spalling	1/2" to 1"	0.5		No			Replace C&G	
1561	BELLEFORD ROAD	13121	500-013-02	D5	5	1545	Curb/Gutter	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
1548	BELLEFORD ROAD	13122	500-013-22	D5	5	1545	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
1502	BELLEFORD ROAD	13141	500-011-02	D5	5	1545	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
1520	BELLEFORD ROAD	13141	500-011-23	E5	5	1545	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	15		No			Grind	
1517	BELLEFORD ROAD	13142	500-011-22	D5	5	1545	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
1519	BELLEFORD ROAD	13142	500-011-22	D5	5	1545	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
1518	BELLEFORD ROAD	13142	500-011-22	D5	5	1545	Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	20		No			Replace Slab(s)	
1516	BELLEFORD ROAD	13142	500-011-22	D5	5	1545	Curb/Gutter	PCC	Spalling	1/2" to 1"	0.5		No			Replace C&G	
1500	BELLEFORD ROAD		999-000-28	D5	5	1545	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	3		No			Grind	
1501	BELLEFORD ROAD		999-000-28	D5	5	1545	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	16		No			Grind	
731	BRAZOS LANE	13232	500-331-33	E5	5	1563	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	4 ft wide
730	BRAZOS LANE	13240	500-331-34	E5	5	1563	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	1.5 ft wide
748	BRAZOS LANE	2540	500-332-12	E5	5	1563	Sidewalk	PCC	Faulting	1/2" to 1"			Yes			Ramp	2.5 ft wide
750	BRAZOS LANE	2545	500-332-13	E5	5	1563	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1.5 ft wide
749	BRAZOS LANE	2545	500-332-13	E5	5	1563	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	2 ft wide
751	BRAZOS LANE	2545	500-332-13	E5	5	1563	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	2 ft wide
733	BRAZOS LANE	2553	500-331-31	E5	5	1563	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	2.5 ft wide
729				i	E5	5	1563	Sidewalk	PCC	Faulting			No			Grind	1 ft wide

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
732	BRAZOS LANE	2561	500-331-32	E5	5	1563	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	1.5 ft wide
1034	BRISTOW LANE		999-000-65	B7	5	1567	Curb/Gutter	PCC	Spalling	1/4" to 1/2"	0.5		No			Grind	
1039	BRISTOW LANE		999-000-65	B7	5	1567	Curb/Gutter	PCC	Spalling	1/4" to 1/2"	0.5		No			Grind	
1040	BRISTOW LANE		999-000-65	B7	5	1567	Curb/Gutter	PCC	Spalling	1/4" to 1/2"	0.5		No			Grind	
1575	BROWNING AVENUE	13031	500-013-10	D5	5	1005	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	5		No			Grind	
1573	BROWNING AVENUE	13041	500-013-09	D5	5	1005	Sidewalk	PCC	Faulting	1/2" to 1"	5		No			Ramp	Prev grind
1574	BROWNING AVENUE	13041	500-013-09	D5	5	1005	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	18		No			Grind	
1572	BROWNING AVENUE	13051	500-013-08	D5	5	1005	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
1571	BROWNING AVENUE	13061	500-013-07	D5	5	1005	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	2		Yes			Grind	
1570	BROWNING AVENUE	13075	500-013-06	D5	5	1005	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
1566	BROWNING AVENUE	13111	500-013-03	D5	5	1005	Sidewalk	PCC	Divided Slab	No Displacement			No			Replace Slab	Low
1567	BROWNING AVENUE	13111	500-013-03	D5	5	1005	Sidewalk	PCC	Divided Slab	No Displacement			No			Replace Slab	Low
1568	BROWNING AVENUE	13111	500-013-03	D5	5	1005	Sidewalk	PCC	Divided Slab	No Displacement			No			Replace Slab	Low
1569	BROWNING AVENUE	13111	500-013-03	D5	5	1005	Sidewalk	PCC	Divided Slab	No Displacement			No			Replace Slab	Low
1499	BROWNING AVENUE	13141	500-011-02	D5	5	1005	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
1498	BROWNING AVENUE	13165	500-011-04	D5	5	1005	Sidewalk	PCC	Divided Slab	No Displacement			No			Replace Slab	Low
1497	BROWNING AVENUE	13181	500-011-05	D5	5	1005	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
1496	BROWNING AVENUE	13191	500-011-06	D5	5	1005	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	20		No			Grind	
1494	BROWNING AVENUE	13201	500-011-07	E5	5	1005	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	15		No			Grind	
1495	BROWNING AVENUE	13201	500-011-07	E5	5	1005	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
1493	BROWNING AVENUE	13211	500-011-08	E5	5	1005	Sidewalk	PCC	Linear Cracking	No Displacement	6		No			Joint Seal	
1492	BROWNING AVENUE	13221	500-011-09	E5	5	1004	Sidewalk	PCC	Spalling	1/4" to 1/2"	0.5		No			Grind	
1490	BROWNING AVENUE	13231	500-011-10	E4	5	1004	Sidewalk	PCC	Corner Break	1/4" to 1/2"	4		No			Grind	2 breaks
1491	BROWNING AVENUE	13231	500-011-10	E5	5	1004	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	20		No			Grind	
1287	BROWNING AVENUE		500-201-03	E4	5	1328	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	At edison patch
1484	BROWNING AVENUE		500-281-30	E4	5	1004	Sidewalk	PCC	Faulting	1/2" to 1"	2		No			Ramp	Base of pole cement cracked
1476	BROWNING AVENUE		500-281-30	E4	5	1004	Sidewalk	PCC	Divided Slab	No Displacement			Yes			Replace Slab	Low
1279	BROWNING AVENUE		500-207-49	E4	5	1329	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	250		No			Grind	Most of curb has 1/4 separation. Until new slabs south
1461	BROWNING AVENUE		500-282-29	E4	5	1004	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
1474	BROWNING AVENUE		500-281-30	E4	5	1004	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
1487	BROWNING AVENUE		500-281-30	E4	5	1004	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
1488	BROWNING AVENUE		500-281-30	E4	5	1004	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
1457	BROWNING AVENUE		500-282-29	E4	5	1004	Sidewalk	PCC	Corner Break	1/4" to 1/2"	4		Yes			Grind	
1284	BROWNING AVENUE		500-201-03	E4	5	1328	Sidewalk	PCC	Corner Break	1/4" to 1/2"	3		No			Grind	
1325	BROWNING AVENUE		500-205-78	E4	5	1330	Sidewalk	PCC	Corner Break	1/4" to 1/2"	3		No			Grind	
1328	BROWNING AVENUE		500-205-78	E4	5	1330	Sidewalk	PCC	Corner Break	1/4" to 1/2"	2.5		No			Grind	
1283	BROWNING AVENUE		500-201-03	E4	5	1328	Sidewalk	PCC	Corner Break	No Displacement	4		No			Patch	
1285	BROWNING AVENUE		500-201-03	E4	5	1328	Sidewalk	PCC	Corner Break	No Displacement	4.5		No			Patch	
1326	BROWNING AVENUE		500-205-78	E4	5	1330	Sidewalk	PCC	Corner Break	No Displacement	4		No			Patch	
1469	BROWNING AVENUE		500-211-05	E4	5	1004	Sidewalk	PCC	Divided Slab	1/4" to 1/2"			Yes			Replace Slab	
1480	BROWNING AVENUE		500-281-30	E4	5	1004	Sidewalk	PCC	Divided Slab	1/4" to 1/2"			Yes			Replace Slab	
1456	BROWNING AVENUE		500-282-29	E4	5	1004	Sidewalk	PCC	Faulting	1/2" to 1"	5		Yes			Ramp	
1281	BROWNING AVENUE		500-201-03	E4	5	1329	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
1330	BROWNING AVENUE		500-207-49	E4	5	1329	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
1464	BROWNING AVENUE		500-211-05	E4	5	1004	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
1470	BROWNING AVENUE		500-211-05	E4	5	1004	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
1478	BROWNING AVENUE		500-281-30	E4	5	1004	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
1481	BROWNING AVENUE		500-281-30	E4	5	1004	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
1482	BROWNING AVENUE		500-281-30	E4	5	1004	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
1565	BROWNING AVENUE		999-000-30	D5	5	1005	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
1327	BROWNING AVENUE		500-205-78	E4	5	1330	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
1329	BROWNING AVENUE		500-205-78	E4	5	1330	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
1462	BROWNING AVENUE		500-282-29	E4	5	1004	Sidewalk	PCC	Linear Cracking	1/2" to 1"	5		No			Grind	
1459	BROWNING AVENUE		500-282-29	E4	5	1004	Sidewalk	PCC	Linear Cracking	No Displacement	6		Yes			Joint Seal	
1463	BROWNING AVENUE		500-282-29	E4	5	1004	Curb/Gutter	PCC	Sidewalk Curb Separation	1" to 2"	6		No			Replace Curb	
1280	BROWNING AVENUE		500-201-03	E4	5	1329	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	3		No			Grind	
1475	BROWNING AVENUE		500-281-30	E4	5	1004	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	15		No			Grind	
1458	BROWNING AVENUE		500-282-29	E4	5	1004	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	10		Yes			Grind	
1460	BROWNING AVENUE		500-282-29	E4	5	1004	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	12		Yes			Grind	
1278	BROWNING AVENUE		500-207-49	E4	5	1329	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	2.5		No			Grind	
1477	BROWNING AVENUE		500-281-30	E4	5	1004	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	4		Yes			Grind	
1324	BROWNING AVENUE		500-205-78	E4	5	1330	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	6		No			Grind	
1479	BROWNING AVENUE		500-281-30	E4	5	1004	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	3		Yes			Grind	
1485				E4	5	1004	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	8		No			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
1486	BROWNING AVENUE		500-281-30	E4	5	1004	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	8		No			Grind	
1282	BROWNING AVENUE		500-201-03	E4	5	1328	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	20		No			Grind	
1286	BROWNING AVENUE		500-201-03	E4	5	1328	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	20		No			Grind	
1564	BROWNING AVENUE		999-000-30	D5	5	1005	Curb/Gutter	PCC	Spalling	1" to 2"	1		No			Patch	
1465	BROWNING AVENUE		500-211-05	E4	5	1004	Curb/Gutter	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
1466	BROWNING AVENUE		500-211-05	E4	5	1004	Curb/Gutter	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
1467	BROWNING AVENUE		500-211-05	E4	5	1004	Curb/Gutter	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
1483	BROWNING AVENUE		500-281-30	E4	5	1004	Curb/Gutter	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
1468	BROWNING AVENUE		500-211-05	E4	5	1004	Sidewalk	PCC	Spalling	1/4" to 1/2"	3		No			Grind	
1489	BROWNING AVENUE		500-281-30	E4	5	1004	Sidewalk	PCC	Spalling	1/4" to 1/2"	0.5		Yes			Grind	
175	BRYAN AVENUE	13402	500-244-08	F5	5	1015	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	At manhole, 2 ft wide
176	BRYAN AVENUE	13402	500-244-10	F5	5	1015	Sidewalk	PCC	Divided Slab	1/4" to 1/2"			No			Replace Slab	vert only .5 ft of crack
329	BRYAN AVENUE	2452	500-185-01	E5	5	1012	Sidewalk	PCC	Faulting	1/2" to 1"			Yes			Ramp	1 ft wide
330	BRYAN AVENUE	2452	500-185-01	E5	5	1012	Sidewalk	PCC	Faulting	1" to 2"			Yes			Replace Slab	1.5 ft wide
328	BRYAN AVENUE	2452	500-185-01	E5	5	1012	Sidewalk	PCC	Faulting	1/2" to 1"			No			Ramp	1.5 ft wide
332	BRYAN AVENUE	2452	500-185-01	E5	5	1012	Sidewalk	PCC	Faulting	1/2" to 1"			Yes			Ramp	1.5 ft wide
331	BRYAN AVENUE	2452	500-185-01	E5	5	1012	Sidewalk	PCC	Faulting	1" to 2"			Yes			Replace Slab	2 ft wide
327	BRYAN AVENUE	2452	500-185-01	E5	5	1012	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"			No			Grind	4 ft along curb
333	BRYAN AVENUE	2505	500-185-06	E5	5	1012	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	4 ft wide
335	BRYAN AVENUE	2530	500-185-02	E5	5	1012	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
334	BRYAN AVENUE	2530	500-185-02	E5	5	1012	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1.5 ft wide
336	BRYAN AVENUE	2560	500-185-03	E5	5	1012	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide
337	BRYAN AVENUE	2560	500-185-03	E5	5	1012	Sidewalk	PCC	Faulting	1/2" to 1"			Yes			Ramp	4.5 ft wide
338	BRYAN AVENUE	2655	500-185-04	E5	5	1012	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
341	BRYAN AVENUE	2655	500-185-04	F5	5	1012	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	Yes			Grind	.5 ft wide
340	BRYAN AVENUE	2655	500-185-04	F5	5	1012	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 wide
339	BRYAN AVENUE	2655	500-185-04	E5	5	1012	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	2.5 ft wide
263	BRYAN AVENUE	2740	500-312-01	F5	5	1014	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide
261	BRYAN AVENUE	2740	500-312-01	F5	5	1014	Sidewalk	PCC	Faulting	1/2" to 1"	4		No			Ramp	
258	BRYAN AVENUE	2740	500-312-01	F5	5	1014	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
259	BRYAN AVENUE	2740	500-312-01	F5	5	1014	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
260	BRYAN AVENUE	2740	500-312-01	F5	5	1014	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
262	BRYAN AVENUE	2740	500-312-01	F5	5	1014	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
12090	BRYAN AVENUE	2740	500-312-01	F5	5	1014	Curb/Gutter	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
12091	BRYAN AVENUE	2740	500-312-01	F5	5	1014	Curb/Gutter	PCC	Spalling	1/4" to 1/2"	2		No			Grind	
246	BRYAN AVENUE	2821	500-312-05	F5	5	1014	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
256	BRYAN AVENUE	2821	500-312-05	F5	5	1014	Sidewalk	PCC	Faulting	1/2" to 1"	4		No			Ramp	CATV util cover
12083	BRYAN AVENUE	2821	500-312-05	F5	5	1014	Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	2		No			Grind	Hydrant base
253	BRYAN AVENUE	2821	500-312-05	F5	5	1014	Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	2		No			Grind	Pole base
12087	BRYAN AVENUE	2821	500-312-05	F5	5	1014	Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	2		No			Grind	Pole base
249	BRYAN AVENUE	2821	500-312-05	F5	5	1014	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No			Grind	
250	BRYAN AVENUE	2821	500-312-05	F5	5	1014	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
251	BRYAN AVENUE	2821	500-312-05	F5	5	1014	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No	Yes		Grind	
252	BRYAN AVENUE	2821	500-312-05	F5	5	1014	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No	Yes		Grind	
254	BRYAN AVENUE	2821	500-312-05	F5	5	1014	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
255	BRYAN AVENUE	2821	500-312-05	F5	5	1014	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
257	BRYAN AVENUE	2821	500-312-05	F5	5	1014	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
12086	BRYAN AVENUE	2821	500-312-05	F5	5	1014	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
12089	BRYAN AVENUE	2821	500-312-05	F5	5	1014	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
12088	BRYAN AVENUE	2821	500-312-05	F5	5	1014	Sidewalk	PCC	Linear Cracking	No Displacement	8		No			Joint Seal	
248	BRYAN AVENUE	2821	500-312-05	F5	5	1014	Curb/Gutter	PCC	Sidewalk Curb Separation	1" to 2"	20		No			Replace Curb	
247	BRYAN AVENUE	2821	500-312-05	F5	5	1014	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	4		No			Grind	
12084	BRYAN AVENUE	2821	500-312-05	F5	5	1014	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	10		No			Grind	
12085	BRYAN AVENUE	2821	500-312-05	F5	5	1014	Sidewalk	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
12082	BRYAN AVENUE	2821	500-312-05	F5	5	1014	Sidewalk	PCC	Spalling	1/4" to 1/2"	1.5		No			Grind	
307	BRYAN AVENUE		500-271-79	E5	5	1011	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	Yes			Grind	.5 ft wide
309	BRYAN AVENUE		500-271-79	E5	5	1011	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	Yes			Grind	.5 ft wide
310	BRYAN AVENUE		500-271-79	E5	5	1011	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	Yes			Grind	.5 ft wide
312	BRYAN AVENUE		500-271-79	E5	5	1011	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
282	BRYAN AVENUE		500-233-04	E5	5	1013	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
283	BRYAN AVENUE		500-233-04	E5	5	1013	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
284	BRYAN AVENUE		500-233-04	E5	5	1013	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
288	BRYAN AVENUE		500-233-04	E5	5	1013	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	Yes			Grind	.5 ft wide
290				E5	5	1013	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
292	BRYAN AVENUE		500-233-04	E5	5	1013	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	Yes			Grind	.5 ft wide
293	BRYAN AVENUE		500-233-04	E5	5	1013	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	Yes			Grind	.5 ft wide
294	BRYAN AVENUE		500-233-04	E5	5	1013	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	Yes			Grind	.5 ft wide
300	BRYAN AVENUE		500-233-04	E5	5	1013	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No	Yes		Grind	.5 ft wide
301	BRYAN AVENUE		500-233-04	E5	5	1013	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	Yes			Grind	.5 ft wide
303	BRYAN AVENUE		500-233-04	E5	5	1013	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	Yes			Grind	.5 ft wide
178	BRYAN AVENUE		500-244-12	F5	5	1015	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
183	BRYAN AVENUE		500-244-12	F5	5	1015	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	Yes			Grind	.5 ft wide
274	BRYAN AVENUE		500-243-10	F5	5	1015	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
172	BRYAN AVENUE		500-244-07	F5	5	1015	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	Yes			Grind	.5 ft wide
268	BRYAN AVENUE		500-243-16	F5	5	1015	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
271	BRYAN AVENUE		500-243-16	F5	5	1015	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
323	BRYAN AVENUE		500-192-20	E5	5	1010	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	Yes			Grind	.5 ft wide
342	BRYAN AVENUE		500-311-02	F5	5	1012	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
266	BRYAN AVENUE		500-243-16	F5	5	1015	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide, prev grinded
315	BRYAN AVENUE		500-271-79	E5	5	1011	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	Yes			Grind	.5 wide ft
286	BRYAN AVENUE		500-233-04	E5	5	1013	Sidewalk	PCC	Faulting	1" to 2"			Yes			Replace Slab	1 ft wide
324	BRYAN AVENUE		500-192-20	E5	5	1010	Sidewalk	PCC	Faulting	1" to 2"			Yes			Replace Slab	1 ft wide
319	BRYAN AVENUE		500-271-79	E4	5	1011	Sidewalk	PCC	Faulting	1/2" to 1"			Yes			Ramp	1 ft wide
289	BRYAN AVENUE		500-233-04	E5	5	1013	Sidewalk	PCC	Faulting	1/2" to 1"			Yes			Ramp	1 ft wide
273	BRYAN AVENUE		500-243-10	F5	5	1015	Sidewalk	PCC	Faulting	1/2" to 1"			Yes			Ramp	1 ft wide
269	BRYAN AVENUE		500-243-16	F5	5	1015	Sidewalk	PCC	Faulting	1/2" to 1"			No			Ramp	1 ft wide
313	BRYAN AVENUE		500-271-79	E5	5	1011	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	1 ft wide
314	BRYAN AVENUE		500-271-79	E5	5	1011	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	1 ft wide
316	BRYAN AVENUE		500-271-79	E5	5	1011	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	1 ft wide
317	BRYAN AVENUE		500-271-79	E5	5	1011	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide
318	BRYAN AVENUE		500-271-79	E4	5	1011	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	1 ft wide
277	BRYAN AVENUE		500-321-55	F5	5	1013	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide
280	BRYAN AVENUE		500-233-04	F5	5	1013	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	1 ft wide
287	BRYAN AVENUE		500-233-04	E5	5	1013	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide
306	BRYAN AVENUE		500-233-04	E5	5	1013	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide
275	BRYAN AVENUE		500-243-10	F5	5	1015	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide
174	BRYAN AVENUE		500-244-07	F5	5	1015	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide
267	BRYAN AVENUE		500-243-16	F5	5	1015	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	1 ft wide
272	BRYAN AVENUE		500-243-16	F5	5	1015	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	1 ft wide
173	BRYAN AVENUE		500-244-07	F5	5	1015	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	1 ft wide, prev grinded
270	BRYAN AVENUE		500-243-16	F5	5	1015	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	1 ft wide, prev grinded
179	BRYAN AVENUE		500-244-12	F5	5	1015	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	1 ft wide. Prev grinded
305	BRYAN AVENUE		500-233-04	E5	5	1013	Sidewalk	PCC	Faulting	1/2" to 1"			No			Ramp	1.5 ft wide
308	BRYAN AVENUE		500-271-79	E5	5	1011	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1.5 ft wide
297	BRYAN AVENUE		500-233-04	E5	5	1013	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	1.5 ft wide
299	BRYAN AVENUE		500-233-04	E5	5	1013	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1.5 ft wide
180	BRYAN AVENUE		500-244-12	F5	5	1015	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	1.5 ft wide
265	BRYAN AVENUE		500-243-16	F5	5	1015	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1.5 ft wide
322	BRYAN AVENUE		500-192-20	E5	5	1010	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"			No			Grind	12 ft along curb
184	BRYAN AVENUE		500-244-12	F5	5	1015	Sidewalk	PCC	Faulting	1/2" to 1"			Yes			Ramp	2 ft wide
302	BRYAN AVENUE		500-233-04	E5	5	1013	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	2 ft wide
278	BRYAN AVENUE		500-233-05	F5	5	1013	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	2 ft wide
177	BRYAN AVENUE		500-244-12	F5	5	1015	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	2 ft wide
181	BRYAN AVENUE		500-244-12	F5	5	1015	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	2 ft wide
171	BRYAN AVENUE		500-244-07	F5	5	1015	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	2 ft wide
285	BRYAN AVENUE		500-233-04	E5	5	1013	Sidewalk	PCC	Faulting	Over 2"			Yes			Replace Slab	2 ft wide
279	BRYAN AVENUE		500-233-05	F5	5	1013	Sidewalk	PCC	Faulting	1" to 2"			No			Replace Slab	2 ft wide. At bridge
296	BRYAN AVENUE		500-233-04	E5	5	1013	Sidewalk	PCC	Faulting	1/2" to 1"			Yes			Ramp	2.5 ft wide
291	BRYAN AVENUE		500-233-04	E5	5	1013	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	2.5 ft wide
182	BRYAN AVENUE		500-244-12	F5	5	1015	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	3 ft wide
298	BRYAN AVENUE		500-233-04	E5	5	1013	Sidewalk	PCC	Faulting	1/2" to 1"			Yes			Ramp	4.5 ft wide
169	BRYAN AVENUE		500-244-07	F5	5	1015	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"			No			Grind	6 ft long. Vert only on 1 ft of crack
304	BRYAN AVENUE		500-233-04	E5	5	1013	Sidewalk	PCC	Linear Cracking	No Displacement			No			Joint Seal	7 ft crack
325	BRYAN AVENUE		500-192-20	E5	5	1010	Sidewalk	PCC	Spalling	No Displacement			No			Field Assess-Monitor	All along opposite side of curb.
344	BRYAN AVENUE		500-311-01	F5	5	1012	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	At edison patch
321	BRYAN AVENUE		500-192-20	E4	5	1010	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	At man holes
831	BRYAN AVENUE		500-211-06	E4	5	1011	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	At traffic signal patch
343				F5	5	1012	Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"			No			Grind	Edison patch broken

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
825	BRYAN AVENUE		500-211-05	E4	5	1011	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
827	BRYAN AVENUE		500-211-05	E4	5	1011	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	Prev grind
281	BRYAN AVENUE		500-233-04	E5	5	1013	Sidewalk	PCC	Pothole	1/4" to 1/2"			No			Grind	Prev grinded with hole now
295	BRYAN AVENUE		500-233-04	E5	5	1013	Sidewalk	PCC	Faulting	1" to 2"			Yes			Replace Slab	Prev grinded, 1.5 wide
311	BRYAN AVENUE		500-271-79	E5	5	1011	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	Previously grinded. 1 ft wide
821	BRYAN AVENUE		500-211-15	E4	5	1011	Driveway	PCC	Faulting	1/4" to 1/2"	5		No			Grind Driveway	Some spalling as well
170	BRYAN AVENUE		500-244-07	F5	5	1015	Sidewalk	PCC	Divided Slab	1/4" to 1/2"			No			Replace Slab	Vert on .5 ft of crack.
276	BRYAN AVENUE		500-321-55	F5	5	1013	Sidewalk	PCC	Divided Slab	No Displacement			No			Replace Slab	
822	BRYAN AVENUE		500-211-15	E4	5	1011	Driveway	PCC	Faulting	1/4" to 1/2"	4		No			Grind Driveway	
832	BRYAN AVENUE		500-205-78	E4	5	1010	Sidewalk	PCC	Faulting	1/2" to 1"	1		No			Ramp	
817	BRYAN AVENUE		500-211-14	E4	5	1011	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
818	BRYAN AVENUE		500-211-14	E4	5	1011	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
819	BRYAN AVENUE		500-211-14	E4	5	1011	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
820	BRYAN AVENUE		500-211-14	E4	5	1011	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
823	BRYAN AVENUE		500-211-15	E4	5	1011	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
828	BRYAN AVENUE		500-211-06	E4	5	1011	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
829	BRYAN AVENUE		500-211-06	E4	5	1011	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
830	BRYAN AVENUE		500-211-06	E4	5	1011	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
824	BRYAN AVENUE		500-211-05	E4	5	1011	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
833	BRYAN AVENUE		500-205-78	E4	5	1010	Sidewalk	PCC	Faulting	1/4" to 1/2"	4.5		No			Grind	
834	BRYAN AVENUE		500-205-78	E4	5	1010	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
835	BRYAN AVENUE		500-205-78	E4	5	1010	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
836	BRYAN AVENUE		500-205-78	E4	5	1010	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	3		No			Grind	
837	BRYAN AVENUE		500-205-78	E4	5	1010	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	25		No			Grind	
826	BRYAN AVENUE		500-211-05	E4	5	1011	Curb/Gutter	PCC	Sidewalk Curb Separation	No Displacement	15	1"	No			Field Assess-Monitor	
168	BRYAN AVENUE		500-244-07	F5	5	1015	Curb/Gutter	PCC	Spalling	1/4" to 1/2"			No			Grind	
320	BRYAN AVENUE		500-192-20	E4	5	1010	Curb/Gutter	PCC	Spalling	1/4" to 1/2"			No			Grind	
326	BRYAN AVENUE		500-192-20	E5	5	1010	Sidewalk	PCC	Spalling	No Displacement			No			Field Assess-Monitor	
121	BURNT MILL ROAD	13381	500-281-29	E4	5	1574	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	3', prev grind
1653	BURNT MILL ROAD	13381	500-284-13	E4	5	1574	Sidewalk	PCC	Spalling	1/4" to 1/2"			No			Grind	Corner
1652	BURNT MILL ROAD	13381	500-284-13	E4	5	1574	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	Prev grind
1664	BURNT MILL ROAD	2002	500-282-01	E4	5	1574	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
1663	BURNT MILL ROAD	2062	500-282-07	E4	5	1574	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
1661	BURNT MILL ROAD	2072	500-282-08	E4	5	1574	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
1662	BURNT MILL ROAD	2082	500-282-09	E4	5	1574	Curb/Gutter	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
1660	BURNT MILL ROAD	2092	500-282-10	E4	5	1574	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
1472	BURNT MILL ROAD		500-281-30	E4	5	1574	Ramp	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind Ramp	Prev grind
1473	BURNT MILL ROAD		500-281-30	E4	5	1574	Ramp	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind Ramp	Prev grind
1471	BURNT MILL ROAD		500-281-30	E4	5	1574	Ramp	PCC	Divided Slab	1/4" to 1/2"			Yes			Replace Slab	
1455	BURNT MILL ROAD		500-282-29	E4	5	1574	Sidewalk	PCC	Faulting	1" to 2"	5		Yes			Replace Slab	
1454	BURNT MILL ROAD		500-282-29	E4	5	1574	Ramp	PCC	Linear Cracking	No Displacement	10		No			Joint Seal	
1036	BURRIER LANE		999-000-65	B7	5	1575	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
1037	BURRIER LANE		999-000-65	B7	5	1575	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
1038	BURRIER LANE		999-000-65	B7	5	1575	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
1655	CALAVERA CIRCLE	2091	500-283-04	E5	5	1582	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
1656	CALAVERA CIRCLE	2091	500-283-04	E5	5	1582	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
1657	CALAVERA CIRCLE	2111	500-283-06	E5	5	1582	Driveway	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	
787	CARRERA	2171	500-252-09	E5	5	1593	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	
783	CARRERA	2172	500-251-14	E5	5	1593	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide
788	CARRERA	2181	500-252-08	E5	5	1593	Sidewalk	PCC	Faulting	1/4" to 1/2"		2.5	No			Grind	
798	CONTESSA	2152	500-261-01	E5	5	1620	Sidewalk	PCC	Faulting	1/4" to 1/2"		1	No			Grind	
774	CORTINA	13082	500-251-38	E5	5	1626	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide
772	CORTINA	13152	500-263-01	E5	5	1626	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	2 ft wide
771	CORTINA	13172	500-263-03	E5	5	1626	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
770	CORTINA	13182	500-263-04	E5	5	1626	Sidewalk	PCC	Faulting	1/2" to 1"			Yes			Ramp	4.5 ft wide
12072	CORTINA	13182	500-263-04	E5	5	1626	Curb/Gutter	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
12071	CORTINA	13202	500-263-06	E5	5	1626	Curb/Gutter	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
789	CORTINA	2202	500-251-11	E5	5	1626	Sidewalk	PCC	Faulting	1/4" to 1/2"		1.5	No			Grind	
790	CORTINA	2202	500-251-11	E5	5	1626	Sidewalk	PCC	Faulting	1/4" to 1/2"		1	No			Grind	
791	CORTINA	2211	500-251-10	E5	5	1626	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
797	CORTINA	2212	500-261-07	E5	5	1626	Sidewalk	PCC	Faulting	1/2" to 1"		2	No			Ramp	
796	CORTINA	2221	500-261-08	E5	5	1626	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	
12073	CORTINA	2221	500-261-08	E5	5	1626	Sidewalk	PCC	Spalling	1/4" to 1/2"	0.5		No			Grind	
801				E5	5	1626	Sidewalk	PCC	Faulting	1/4" to 1/2"		2	No			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
802	CORTINA	2231	500-262-17	E5	5	1626	Sidewalk	PCC	Faulting	1/4" to 1/2"		3.5	No			Grind	
799	CORTINA	2232	500-262-16	E5	5	1626	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	Prev grind
800	CORTINA	2232	500-262-16	E5	5	1626	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
1041	COSTELLO DRIVE		999-000-65	B7	5	1627	Sidewalk	PCC	Other - Leave Comment	No Displacement	6	1'	No			Field Assess-Monitor	Scaling
1031	COSTELLO DRIVE		999-000-65	B7	5	1627	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
1032	COSTELLO DRIVE		999-000-65	B7	5	1627	Sidewalk	PCC	Spalling	1/2" to 1"	0.5		Yes			Replace C&G	
1033	COSTELLO DRIVE		999-000-65	B7	5	1627	Sidewalk	PCC	Spalling	1/4" to 1/2"	0.5		No			Grind	
1035	COSTELLO DRIVE		999-000-65	B7	5	1627	Sidewalk	PCC	Spalling	1/4" to 1/2"	0.5		No			Grind	
1223	EL CAMINO REAL	13800	500-191-14	E4	5	1060	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	At edison patch
1214	EL CAMINO REAL	13800	500-191-14	E4	5	1061	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	At pole
1218	EL CAMINO REAL	13800	500-191-14	E4	5	1061	Sidewalk	PCC	Other - Leave Comment	1" to 2"	0.5		No			Grind	Hole between curb and sidewalk
1233	EL CAMINO REAL	13800	500-191-14	F4	5	1060	Sidewalk	PCC	Faulting	1/2" to 1"	1		No			Ramp	
1215	EL CAMINO REAL	13800	500-191-14	E4	5	1061	Sidewalk	PCC	Faulting	1/2" to 1"	2		Yes			Ramp	
1225	EL CAMINO REAL	13800	500-191-14	E4	5	1060	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
1226	EL CAMINO REAL	13800	500-191-14	E4	5	1060	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
1227	EL CAMINO REAL	13800	500-191-14	E4	5	1060	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
1228	EL CAMINO REAL	13800	500-191-14	F4	5	1060	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
1229	EL CAMINO REAL	13800	500-191-14	F4	5	1060	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
1230	EL CAMINO REAL	13800	500-191-14	F4	5	1060	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
1231	EL CAMINO REAL	13800	500-191-14	F4	5	1060	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
1232	EL CAMINO REAL	13800	500-191-14	F4	5	1060	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
1234	EL CAMINO REAL	13800	500-191-14	F4	5	1060	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
1235	EL CAMINO REAL	13800	500-191-14	F4	5	1060	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
1236	EL CAMINO REAL	13800	500-191-14	F4	5	1060	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
1237	EL CAMINO REAL	13800	500-191-14	F4	5	1060	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
1216	EL CAMINO REAL	13800	500-191-14	E4	5	1061	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
1217	EL CAMINO REAL	13800	500-191-14	E4	5	1061	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
1219	EL CAMINO REAL	13800	500-191-14	E4	5	1061	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
1220	EL CAMINO REAL	13800	500-191-14	E4	5	1061	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
1222	EL CAMINO REAL	13800	500-191-14	E4	5	1061	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
1224	EL CAMINO REAL	13800	500-191-14	E4	5	1060	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	7		No			Grind	
1238	EL CAMINO REAL	13800	500-191-14	F4	5	1060	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	25		No			Grind	
1240	EL CAMINO REAL	13800	500-191-14	F4	5	1060	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	15		No			Grind	
1221	EL CAMINO REAL	13800	500-191-14	E4	5	1061	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	20		No			Grind	
1239	EL CAMINO REAL	13800	500-191-14	F4	5	1060	Curb/Gutter	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
560	EL CAMINO REAL	2505	500-185-06	F5	5	1062	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	1 ft wide
554	EL CAMINO REAL	2505	500-185-06	F5	5	1062	Sidewalk	PCC	Faulting	1/2" to 1"			Yes			Ramp	1.5 ft wide
551	EL CAMINO REAL	2505	500-185-06	F5	5	1062	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1.5 ft wide
552	EL CAMINO REAL	2505	500-185-06	F5	5	1062	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1.5 ft wide
553	EL CAMINO REAL	2505	500-185-06	F5	5	1062	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1.5 ft wide
557	EL CAMINO REAL	2505	500-185-06	F5	5	1062	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1.5 ft wide
558	EL CAMINO REAL	2505	500-185-06	F5	5	1062	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1.5 ft wide
559	EL CAMINO REAL	2505	500-185-06	F5	5	1062	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	2.5 ft wide
561	EL CAMINO REAL	2505	500-185-06	F5	5	1062	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	3 ft wide
555	EL CAMINO REAL	2505	500-185-06	F5	5	1062	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	4 ft wide
556	EL CAMINO REAL	2505	500-185-06	F5	5	1062	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"			No			Grind	Running across whole slab
568	EL CAMINO REAL	2655	500-185-04	F5	5	1062	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	8		No			Grind	8 ft length
571	EL CAMINO REAL	2655	500-185-04	F5	5	1062	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide
564	EL CAMINO REAL	2655	500-185-04	F5	5	1062	Ramp	PCC	Faulting	1/4" to 1/2"			No			Grind Ramp	1.5 ft wide
562	EL CAMINO REAL	2655	500-185-04	F5	5	1062	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"			No			Grind	12 ft length
565	EL CAMINO REAL	2655	500-185-04	F5	5	1062	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"			No			Grind	2 ft length
569	EL CAMINO REAL	2655	500-185-04	F5	5	1062	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	2.5 ft wide
566	EL CAMINO REAL	2655	500-185-04	F5	5	1062	Ramp	PCC	Faulting	1/4" to 1/2"			No			Grind Ramp	3 ft length
567	EL CAMINO REAL	2655	500-185-04	F5	5	1062	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	3 ft length
570	EL CAMINO REAL	2655	500-185-04	F5	5	1062	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	3 ft wide
572	EL CAMINO REAL	2655	500-185-04	F5	5	1062	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	3 ft wide
563	EL CAMINO REAL	2655	500-185-04	F5	5	1062	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"			No			Grind	Running along whole slab
356	EL CAMINO REAL	2821	500-312-05	F5	5	1064	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
359	EL CAMINO REAL	2821	500-312-05	F5	5	1064	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
364	EL CAMINO REAL	2821	500-312-05	F5	5	1064	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
365	EL CAMINO REAL	2821	500-312-05	F5	5	1064	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
366	EL CAMINO REAL	2821	500-312-05	F5	5	1064	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
355	EL CAMINO REAL	2821	500-312-05	F5	5	1064	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide
357				F5	5	1064	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"			No			Grind	15 ft along curb

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
363	EL CAMINO REAL	2821	500-312-05	F5	5	1064	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	2 ft wide
358	EL CAMINO REAL	2821	500-312-05	F5	5	1064	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	At traffic signal patch. .5 ft wide
360	EL CAMINO REAL	2821	500-312-05	F5	5	1064	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	Pole has some vertical faults surrounding
362	EL CAMINO REAL	2821	500-312-05	F5	5	1064	Sidewalk	PCC	Corner Break	1/4" to 1/2"			No			Grind	
361	EL CAMINO REAL	2821	500-312-05	F5	5	1064	Sidewalk	PCC	Divided Slab	No Displacement			No			Replace Slab	
374	EL CAMINO REAL	2992	500-291-06	F5	5	1063	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	2 ft wide
373	EL CAMINO REAL	2992	500-291-06	F5	5	1063	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"			No			Grind	On edison patch is vert. Crack on block
372	EL CAMINO REAL	3002	500-291-07	F5	5	1063	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	Surrounding pole.
387	EL CAMINO REAL		500-184-04	F5	5	1062	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	Yes			Grind	.5 ft wide
391	EL CAMINO REAL		500-184-04	F5	5	1062	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
514	EL CAMINO REAL		500-183-04	F5	5	1062	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
520	EL CAMINO REAL		500-183-04	E5	5	1062	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
375	EL CAMINO REAL		500-291-25	F5	5	1063	Sidewalk	PCC	Spalling	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
380	EL CAMINO REAL		500-291-21	F5	5	1063	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 wide ft
390	EL CAMINO REAL		500-184-04	F5	5	1062	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide
511	EL CAMINO REAL		500-183-04	F5	5	1062	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide
512	EL CAMINO REAL		500-183-04	F5	5	1062	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide
517	EL CAMINO REAL		500-183-04	F5	5	1062	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide
381	EL CAMINO REAL		500-291-21	F5	5	1063	Sidewalk	PCC	Faulting	1/4" to 1/2"			No	Yes		Grind	1 ft wide
378	EL CAMINO REAL		500-291-22	F5	5	1063	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide
382	EL CAMINO REAL		500-291-21	F5	5	1063	Sidewalk	PCC	Faulting	1/2" to 1"			No	Yes		Ramp	1.5 ft wide
386	EL CAMINO REAL		500-184-04	F5	5	1062	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1.5 ft wide
573	EL CAMINO REAL		500-311-02	F5	5	1062	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1.5 ft wide
516	EL CAMINO REAL		500-183-04	F5	5	1062	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1.5 ft wide
376	EL CAMINO REAL		500-291-22	F5	5	1063	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1.5 ft wide
518	EL CAMINO REAL		500-183-04	F5	5	1062	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1.5 ft wide, prev grinded
377	EL CAMINO REAL		500-291-22	F5	5	1063	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"			No			Grind	10 ft length
379	EL CAMINO REAL		500-291-22	F5	5	1063	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"			No			Grind	15 ft length
389	EL CAMINO REAL		500-184-04	F5	5	1062	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	2 ft wide
515	EL CAMINO REAL		500-183-04	F5	5	1062	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	2.5 ft wide, at edison patch
370	EL CAMINO REAL		500-291-25	F5	5	1063	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	3 ft wide
513	EL CAMINO REAL		500-183-04	F5	5	1062	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"			No			Grind	8 ft in length
1167	EL CAMINO REAL		500-192-08	E4	5	1061	Sidewalk	PCC	Faulting	1/4" to 1/2"	4.5		No			Grind	Corner break as well. Prev grinded
371	EL CAMINO REAL		500-291-25	F5	5	1063	Sidewalk	PCC	Patch / Utility Cut	No Displacement			No			Patch	Hole in blind bumps patch
574	EL CAMINO REAL		500-311-02	F5	5	1062	Sidewalk	PCC	Faulting	1/2" to 1"	3		No			Ramp	Hydrant base
1250	EL CAMINO REAL		500-206-81	E4	5	1060	Sidewalk	PCC	Faulting	1/4" to 1/2"	4.5		Yes			Grind	Prev grind
1168	EL CAMINO REAL		500-192-08	E4	5	1061	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	Prev grind
388	EL CAMINO REAL		500-184-04	F5	5	1062	Curb/Gutter	PCC	Faulting	1/4" to 1/2"			No			Grind C&G	Some spalding as well.
1164	EL CAMINO REAL		500-203-01	E4	5	1061	Sidewalk	PCC	Corner Break	1/4" to 1/2"	1		No		Yes	Grind	
1252	EL CAMINO REAL		500-206-81	E4	5	1060	Sidewalk	PCC	Faulting	1/2" to 1"	2		No			Ramp	
1246	EL CAMINO REAL		500-206-81	E4	5	1060	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
1247	EL CAMINO REAL		500-206-81	E4	5	1060	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
1248	EL CAMINO REAL		500-206-81	E4	5	1060	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
1249	EL CAMINO REAL		500-206-81	E4	5	1060	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
1251	EL CAMINO REAL		500-206-81	E4	5	1060	Sidewalk	PCC	Faulting	1/4" to 1/2"	4.5		No			Grind	
1241	EL CAMINO REAL		104-352-06	E4	5	1060	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
1243	EL CAMINO REAL		104-352-06	E4	5	1060	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
1244	EL CAMINO REAL		104-352-06	E4	5	1060	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
1165	EL CAMINO REAL		500-192-08	E4	5	1061	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No		Yes	Grind	
1166	EL CAMINO REAL		500-192-08	E4	5	1061	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No		Yes	Grind	
1169	EL CAMINO REAL		500-192-08	E4	5	1061	Sidewalk	PCC	Faulting	1/4" to 1/2"	4.5		No			Grind	
1170	EL CAMINO REAL		500-192-08	E4	5	1061	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
1171	EL CAMINO REAL		500-192-08	E4	5	1061	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
1172	EL CAMINO REAL		500-192-08	E4	5	1061	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
1173	EL CAMINO REAL		500-192-08	E4	5	1061	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
1174	EL CAMINO REAL		500-192-08	E4	5	1061	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
1175	EL CAMINO REAL		500-192-08	E4	5	1061	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
1163	EL CAMINO REAL		500-203-01	E4	5	1061	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No		Yes	Grind	
1276	EL CAMINO REAL		500-203-01	E4	5	1061	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No		Yes	Grind	
1277	EL CAMINO REAL		500-203-01	E4	5	1061	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No		Yes	Grind	
1245	EL CAMINO REAL		104-352-06	E4	5	1060	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	10		No			Grind	
1242	EL CAMINO REAL		104-352-06	E4	5	1060	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	55		No			Grind	
1275	EL CAMINO REAL		500-203-01	E4	5	1061	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	100		No		Yes	Grind	
519				F5	5	1062	Sidewalk	PCC	Spalling	No Displacement			No			Field Assess-Monitor	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
2712	GALLERY WAY		501-094-12	D6	5	1691	Ramp	PCC	Faulting	1/2" to 1"	8		Yes			Grind Ramp	Prev grind
2740	GALLERY WAY		501-114-01	D6	5	1691	Sidewalk	PCC	Other - Leave Comment	No Displacement			No			Field Assess-Monitor	Scaling this area
2711	GALLERY WAY		501-094-13	D6	5	1691	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
2739	GALLERY WAY		501-114-01	D6	5	1691	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
2719	GALLERY WAY		501-106-07	D6	5	1691	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
2720	GALLERY WAY		501-106-07	D6	5	1691	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No	Yes		Grind	
2713	GALLERY WAY		501-094-12	D6	5	1691	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
2715	GALLERY WAY		501-094-12	D6	5	1691	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
2716	GALLERY WAY		501-094-11	D6	5	1691	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
2718	GALLERY WAY		501-106-06	D6	5	1691	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	4		Yes			Grind	
2721	GALLERY WAY		501-106-07	D6	5	1691	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	4		No			Grind	
2717	GALLERY WAY		501-106-06	D6	5	1691	Sidewalk	PCC	Spalling	1" to 2"	1		No			Patch	
2714	GALLERY WAY		501-094-12	D6	5	1691	Curb/Gutter	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
2710	GALLERY WAY		501-114-01	D6	5	1691	Sidewalk	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
924	GREENWAY DRIVE		501-161-05	D5	5	1701	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	By hydrant
912	GREENWAY DRIVE		501-103-02	D5	5	1701	Driveway	PCC	Other - Leave Comment	No Displacement	14	14	No			Field Assess-Monitor	Cracks on edge of driveway
925	GREENWAY DRIVE		501-161-06	D5	5	1701	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	Prev grind
920	GREENWAY DRIVE		501-251-05	D5	5	1701	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
927	GREENWAY DRIVE		501-161-07	D5	5	1701	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
921	GREENWAY DRIVE		501-251-07	D5	5	1701	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
923	GREENWAY DRIVE		501-251-02	D5	5	1701	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
926	GREENWAY DRIVE		501-161-06	D5	5	1701	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
913	GREENWAY DRIVE		501-103-02	D5	5	1701	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
914	GREENWAY DRIVE		501-103-02	D5	5	1701	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
915	GREENWAY DRIVE		501-103-02	D5	5	1701	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
922	GREENWAY DRIVE		501-251-07	D5	5	1701	Curb/Gutter	PCC	Spalling	No Displacement	0.5		No			Field Assess-Monitor	
916	GREENWAY DRIVE		501-103-02	D5	5	1701	Sidewalk	PCC	Spalling	No Displacement	3	2"	No			Field Assess-Monitor	
203	HERITAGE WAY	13204	500-241-14	E5	5	1713	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
204	HERITAGE WAY	13204	500-241-14	E5	5	1713	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"			No			Grind	3 ft length
200	HERITAGE WAY	13402	500-244-05	F5	5	1713	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"			No			Grind	8 ft in length
195	HERITAGE WAY		500-243-10	F5	5	1713	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	Yes			Grind	.5 ft wide
185	HERITAGE WAY		500-244-11	F5	5	1713	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	Yes			Grind	.5 ft wide
186	HERITAGE WAY		500-244-11	F5	5	1713	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	Yes			Grind	.5 ft wide
199	HERITAGE WAY		500-244-11	F5	5	1713	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
202	HERITAGE WAY		500-241-24	E5	5	1713	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	Yes			Grind	.5 ft wide
655	HERITAGE WAY		500-232-12	E5	5	1712	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 wide
668	HERITAGE WAY		500-232-12	E5	5	1712	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	Yes			Grind	.5 wide
189	HERITAGE WAY		500-243-10	F5	5	1713	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"			No			Grind	1 ft length
201	HERITAGE WAY		500-244-04	F5	5	1713	Sidewalk	PCC	Faulting	1/2" to 1"			Yes			Ramp	1 ft wide
706	HERITAGE WAY		500-222-13	E5	5	1712	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide
698	HERITAGE WAY		500-235-48	E5	5	1712	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide
664	HERITAGE WAY		500-232-12	E5	5	1712	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	1 ft wide
669	HERITAGE WAY		500-232-12	E5	5	1712	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide
194	HERITAGE WAY		500-243-10	F5	5	1713	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	1 ft wide
196	HERITAGE WAY		500-243-10	F5	5	1713	Sidewalk	PCC	Faulting	1/4" to 1/2"			No	Yes		Grind	1 ft wide
702	HERITAGE WAY		500-222-12	E5	5	1712	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide. At manhole
701	HERITAGE WAY		500-222-12	E5	5	1712	Sidewalk	PCC	Faulting	1/2" to 1"			Yes			Ramp	1.5 ft wide
662	HERITAGE WAY		500-232-12	E5	5	1712	Sidewalk	PCC	Faulting	1/2" to 1"			Yes			Ramp	1.5 ft wide
193	HERITAGE WAY		500-243-10	F5	5	1713	Sidewalk	PCC	Faulting	1/2" to 1"			Yes			Ramp	1.5 ft wide
187	HERITAGE WAY		500-244-11	F5	5	1713	Sidewalk	PCC	Faulting	1/2" to 1"			Yes			Ramp	1.5 ft wide
188	HERITAGE WAY		500-244-11	F5	5	1713	Sidewalk	PCC	Faulting	1/2" to 1"			Yes			Ramp	1.5 ft wide
703	HERITAGE WAY		500-222-12	E5	5	1712	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1.5 ft wide
700	HERITAGE WAY		500-233-02	E5	5	1712	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	1.5 ft wide
707	HERITAGE WAY		500-222-13	E5	5	1712	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1.5 ft wide
697	HERITAGE WAY		500-235-48	E5	5	1712	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1.5 ft wide
657	HERITAGE WAY		500-232-12	E5	5	1712	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1.5 ft wide
208	HERITAGE WAY		500-241-23	E5	5	1713	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	1.5 ft wide
192	HERITAGE WAY		500-243-10	F5	5	1713	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"			No			Replace Slab	10 ft in length
190	HERITAGE WAY		500-243-10	F5	5	1713	Curb/Gutter	PCC	Sidewalk Curb Separation	1" to 2"			No			Replace Curb	13 ft length
711	HERITAGE WAY		500-331-50	E5	5	1712	Sidewalk	PCC	Faulting	1/2" to 1"			No			Ramp	2 ft wide
705	HERITAGE WAY		500-222-13	E5	5	1712	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	2 ft wide
656	HERITAGE WAY		500-232-12	E5	5	1712	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	2 ft wide
658	HERITAGE WAY		500-232-12	E5	5	1712	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	2 ft wide
660				E5	5	1712	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	2 ft wide

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP	Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
661	HERITAGE WAY		500-232-12	E5	5	1712		Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	2 ft wide
197	HERITAGE WAY		500-244-11	F5	5	1713		Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	2 ft wide
764	HERITAGE WAY		500-221-07	E5	5	1712		Curb/Gutter	PCC	Faulting	1/4" to 1/2"			No			Grind C&G	2.5 ft wide
710	HERITAGE WAY		500-331-50	E5	5	1712		Sidewalk	PCC	Faulting	1/2" to 1"			Yes			Ramp	2.5 ft wide
654	HERITAGE WAY		500-232-12	E5	5	1712		Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	2.5 ft wide
667	HERITAGE WAY		500-232-12	E5	5	1712		Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	2.5 ft wide
659	HERITAGE WAY		500-232-12	E5	5	1712		Sidewalk	PCC	Faulting	1/4" to 1/2"			No	Yes		Grind	3 ft running along street. At CATV patch
699	HERITAGE WAY		500-235-48	E5	5	1712		Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	3 ft wide, prev grinded
712	HERITAGE WAY		500-331-50	E5	5	1712		Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	3.5 ft wide
714	HERITAGE WAY		500-331-50	E5	5	1712		Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	3.5 ft wide. At manhole
665	HERITAGE WAY		500-232-12	E5	5	1712		Sidewalk	PCC	Faulting	1/2" to 1"			Yes			Ramp	4 ft wide
207	HERITAGE WAY		500-241-23	E5	5	1713		Sidewalk	PCC	Faulting	1/2" to 1"			Yes			Ramp	4 ft wide
191	HERITAGE WAY		500-243-10	F5	5	1713		Sidewalk	PCC	Faulting	1/2" to 1"			Yes			Ramp	4 ft wide. Prev grinded slab
663	HERITAGE WAY		500-232-12	E5	5	1712		Sidewalk	PCC	Faulting	1/2" to 1"			Yes			Ramp	4.5 ft wide
206	HERITAGE WAY		500-241-23	E5	5	1713		Sidewalk	PCC	Faulting	1/2" to 1"			Yes			Ramp	4.5 ft wide
708	HERITAGE WAY		500-222-13	E5	5	1712		Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	4.5 ft wide
198	HERITAGE WAY		500-244-11	F5	5	1713		Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	4.5 ft wide
713	HERITAGE WAY		500-331-50	E5	5	1712		Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"			No			Grind	5 ft wide
765	HERITAGE WAY		500-221-07	E5	5	1712		Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"			No			Grind	7 ft length
671	HERITAGE WAY		500-232-12	E5	5	1712		Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"			No			Grind	8 ft length
670	HERITAGE WAY		500-232-12	E5	5	1712		Sidewalk	PCC	Faulting	1/2" to 1"			No	Yes		Ramp	At CATV patch.
907	HERITAGE WAY		500-232-11	E5	5	1712		Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	Prev grind
908	HERITAGE WAY		500-232-11	E5	5	1712		Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Prev grind
910	HERITAGE WAY		500-232-11	E5	5	1712		Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
911	HERITAGE WAY		500-232-11	E5	5	1712		Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	Prev grind
709	HERITAGE WAY		500-222-13	E5	5	1712		Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Replace Slab	Prev grinded, 4 ft wide
666	HERITAGE WAY		500-232-12	E5	5	1712		Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Replace Slab	Prev grinded, 4.5 ft wide
653	HERITAGE WAY		500-232-11	E5	5	1712		Sidewalk	PCC	Faulting	1/2" to 1"			Yes			Replace Slab	Prev grinded. 3.5 ft wide
704	HERITAGE WAY		500-222-13	E5	5	1712		Driveway	PCC	Divided Slab	No Displacement			No			Replace Slab	Some of middle slab divided
909	HERITAGE WAY		500-232-11	E5	5	1712		Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
205	HERITAGE WAY		500-241-23	E5	5	1713		Sidewalk	PCC	Spalling	1/4" to 1/2"			No			Grind	
1644	IRVINE BLVD	12998	104-474-01	D5	5	1107		Sidewalk	PCC	Faulting	Over 2"	6		No			Replace Slab	
1584	IRVINE BLVD	13021	500-013-32	D5	5	1105		Sidewalk	PCC	Divided Slab	No Displacement			No			Replace Slab	Low
1539	IRVINE BLVD	13021	500-013-32	D5	5	1105		Curb/Gutter	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind C&G	
1577	IRVINE BLVD	13021	500-013-11	D5	5	1105		Sidewalk	PCC	Faulting	1/4" to 1/2"	5		Yes			Grind	
1578	IRVINE BLVD	13021	500-013-11	D5	5	1105		Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	2		No			Grind	
1579	IRVINE BLVD	13021	500-013-11	D5	5	1105		Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	3		No			Grind	
1580	IRVINE BLVD	13021	500-013-11	D5	5	1105		Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	2		No			Grind	
1583	IRVINE BLVD	13021	500-013-32	D5	5	1105		Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	25		No			Grind	
1585	IRVINE BLVD	13021	500-013-32	D5	5	1105		Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
1538	IRVINE BLVD	13022	500-011-54	D5	5	1106		Sidewalk	PCC	Divided Slab	1/4" to 1/2"			No			Replace Slab	Low
1581	IRVINE BLVD	13022	500-013-13	D5	5	1105		Sidewalk	PCC	Divided Slab	No Displacement			No			Replace Slab	Low
1586	IRVINE BLVD	13022	500-011-54	D5	5	1106		Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	2		No			Grind	
1588	IRVINE BLVD	13022	500-011-54	D5	5	1106		Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	2		No			Grind	
1587	IRVINE BLVD	13022	500-011-54	D5	5	1106		Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	15		No			Grind	
1582	IRVINE BLVD	13022	500-013-13	D5	5	1105		Sidewalk	PCC	Spalling	1/2" to 1"	2		No			Replace C&G	
1576	IRVINE BLVD	13031	500-013-10	D5	5	1105		Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	3		No			Grind	2 cracks also
236	IRVINE BLVD	13095	500-241-34	E5	5	1110		Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
235	IRVINE BLVD	13095	500-241-34	E5	5	1110		Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide
237	IRVINE BLVD	13095	500-241-34	E5	5	1110		Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"			No			Grind	1.5 ft in length
238	IRVINE BLVD	13095	500-241-34	E5	5	1110		Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	5 ft wide
239	IRVINE BLVD	13131	500-241-27	E5	5	1110		Sidewalk	PCC	Faulting	1/2" to 1"			Yes			Ramp	3 ft wide
240	IRVINE BLVD	13131	500-241-27	E5	5	1110		Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"			No			Grind	4 ft length
630	IRVINE BLVD		501-117-15	E5	5	1111		Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	Yes			Grind	.5 ft wide
633	IRVINE BLVD		501-117-15	E5	5	1111		Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
225	IRVINE BLVD		500-241-21	E5	5	1110		Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
226	IRVINE BLVD		500-241-21	E5	5	1110		Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
232	IRVINE BLVD		500-241-21	E5	5	1110		Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	Yes			Grind	.5 ft wide
233	IRVINE BLVD		500-241-21	E5	5	1110		Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
626	IRVINE BLVD		501-117-14	E5	5	1111		Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide
628	IRVINE BLVD		501-117-14	E5	5	1111		Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide
632	IRVINE BLVD		501-117-15	E5	5	1111		Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide
227	IRVINE BLVD		500-241-21	E5	5	1110		Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	1 ft wide
229				E5	5	1110		Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
230	IRVINE BLVD		500-241-21	E5	5	1110	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide
234	IRVINE BLVD		500-241-21	E5	5	1110	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide
224	IRVINE BLVD		500-241-21	E5	5	1110	Sidewalk	PCC	Faulting	1/4" to 1/2"			No	Yes		Grind	1.5 ft wide
623	IRVINE BLVD		501-117-14	E5	5	1111	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	2 ft wide
625	IRVINE BLVD		501-117-14	E5	5	1111	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	2.5 ft wide
624	IRVINE BLVD		501-117-14	E5	5	1111	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	3 ft wide
629	IRVINE BLVD		501-117-14	E5	5	1111	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	3 ft wide
627	IRVINE BLVD		501-117-14	E5	5	1111	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	4.5 ft wide
228	IRVINE BLVD		500-241-21	E5	5	1110	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	4.5 ft wide. Prev grinded
231	IRVINE BLVD		500-241-21	E5	5	1110	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	4.5 ft wide. Prev grinded
631	IRVINE BLVD		501-117-15	E5	5	1111	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	6 ft running along sidewalk
1642	IRVINE BLVD		501-104-08	E5	5	1109	Sidewalk	PCC	Divided Slab	No Displacement			No			Replace Slab	Low
1615	IRVINE BLVD		500-351-24	E5	5	1108	Sidewalk	PCC	Patch / Utility Cut	1" to 2"			No			Ramp	Pole base
1641	IRVINE BLVD		501-104-08	E5	5	1109	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
1638	IRVINE BLVD		501-231-50	E5	5	1109	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	Prev grind
1599	IRVINE BLVD		500-251-44	E5	5	1106	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	Prev grind
1600	IRVINE BLVD		500-251-44	E5	5	1106	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	Prev grind
1621	IRVINE BLVD		500-351-24	E5	5	1108	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Prev grind
1590	IRVINE BLVD		500-251-44	D5	5	1106	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
1593	IRVINE BLVD		500-251-44	D5	5	1106	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
1594	IRVINE BLVD		500-251-44	D5	5	1106	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
1595	IRVINE BLVD		500-251-44	D5	5	1106	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
1598	IRVINE BLVD		500-251-44	E5	5	1106	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
1631	IRVINE BLVD		501-117-14	E5	5	1111	Sidewalk	PCC	Other - Leave Comment	Over 2"	4		No			Replace Slab	Shoulder drop
1639	IRVINE BLVD		501-231-50	E5	5	1109	Sidewalk	PCC	Faulting	1/2" to 1"	2		No			Ramp	Util cover
1592	IRVINE BLVD		500-251-44	D5	5	1106	Sidewalk	PCC	Corner Break	1/2" to 1"	4		Yes			Ramp	
1609	IRVINE BLVD		500-341-77	E5	5	1108	Sidewalk	PCC	Corner Break	1/4" to 1/2"	2		No			Grind	
1591	IRVINE BLVD		500-251-44	D5	5	1106	Sidewalk	PCC	Corner Break	1/4" to 1/2"	2		No			Grind	
1650	IRVINE BLVD		501-107-24	D5	5	1107	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
1645	IRVINE BLVD		501-107-24	D5	5	1107	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
1646	IRVINE BLVD		501-107-24	D5	5	1107	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
1647	IRVINE BLVD		501-107-24	D5	5	1107	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
1648	IRVINE BLVD		501-107-24	D5	5	1107	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
1649	IRVINE BLVD		501-107-24	D5	5	1107	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
1651	IRVINE BLVD		501-107-24	D5	5	1107	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
1636	IRVINE BLVD		501-231-50	E5	5	1109	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
1637	IRVINE BLVD		501-231-50	E5	5	1109	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
1640	IRVINE BLVD		501-231-50	E5	5	1109	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
1643	IRVINE BLVD		501-104-08	E5	5	1109	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
1634	IRVINE BLVD		501-117-14	E5	5	1111	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
1611	IRVINE BLVD		500-351-24	E5	5	1108	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
1616	IRVINE BLVD		500-351-24	E5	5	1108	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
1620	IRVINE BLVD		500-351-24	E5	5	1108	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
1623	IRVINE BLVD		500-351-24	E5	5	1108	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		Yes			Grind	
1604	IRVINE BLVD		500-341-77	E5	5	1108	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
1605	IRVINE BLVD		500-341-77	E5	5	1108	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
1606	IRVINE BLVD		500-341-77	E5	5	1108	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
1607	IRVINE BLVD		500-341-77	E5	5	1108	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		Yes			Grind	
1608	IRVINE BLVD		500-341-77	E5	5	1108	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
1589	IRVINE BLVD		500-251-44	D5	5	1106	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
1596	IRVINE BLVD		500-251-44	D5	5	1106	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
1597	IRVINE BLVD		500-251-44	E5	5	1106	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
1601	IRVINE BLVD		500-251-44	E5	5	1106	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
1602	IRVINE BLVD		500-251-44	E5	5	1106	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
1626	IRVINE BLVD		500-222-09	E5	5	1110	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
1628	IRVINE BLVD		500-222-09	E5	5	1110	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
1629	IRVINE BLVD		500-222-09	E5	5	1110	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
1630	IRVINE BLVD		500-222-09	E5	5	1110	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	
1624	IRVINE BLVD		500-351-24	E5	5	1108	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	15		Yes			Grind	
1633	IRVINE BLVD		501-117-14	E5	5	1111	Sidewalk	PCC	Patch / Utility Cut	1/2" to 1"	4		No			Grind	
1622	IRVINE BLVD		500-351-24	E5	5	1108	Curb/Gutter	PCC	Sidewalk Curb Separation	1" to 2"	6		No			Replace Curb	
1617	IRVINE BLVD		500-351-24	E5	5	1108	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	4		No			Grind	
1619	IRVINE BLVD		500-351-24	E5	5	1108	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	40		No			Grind	
1618				E5	5	1108	Sidewalk	PCC	Spalling	1/2" to 1"	0.5		No			Replace C&G	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
1612	IRVINE BLVD		500-351-24	E5	5	1108	Curb/Gutter	PCC	Spalling	1/4" to 1/2"	0.5		No			Grind	
1625	IRVINE BLVD		500-351-21	E5	5	1110	Curb/Gutter	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
1632	IRVINE BLVD		501-117-14	E5	5	1111	Sidewalk	PCC	Spalling	1/4" to 1/2"	0.5		No			Grind	
1613	IRVINE BLVD		500-351-24	E5	5	1108	Sidewalk	PCC	Spalling	1/4" to 1/2"	0.5		No			Grind	
1614	IRVINE BLVD		500-351-24	E5	5	1108	Sidewalk	PCC	Spalling	1/4" to 1/2"	0.5		No			Grind	
1610	IRVINE BLVD		500-341-77	E5	5	1108	Sidewalk	PCC	Spalling	1/4" to 1/2"	3		No			Grind	
1603	IRVINE BLVD		500-251-44	E5	5	1106	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
1627	IRVINE BLVD		500-222-09	E5	5	1110	Sidewalk	PCC	Spalling	1/4" to 1/2"	2		No			Grind	
1635	IRVINE BLVD		501-231-50	E5	5	1109	Sidewalk	PCC	Temporary Ramp	1/4" to 1/2"	4		No	Yes		Replace Slab	
241	JAMBOREE ROAD	13131	500-241-27	E5	5	1337	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
242	JAMBOREE ROAD	13131	500-241-27	E5	5	1337	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	5 ft wide
151	JAMBOREE ROAD	13211	500-241-28	E5	5	1337	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide
152	JAMBOREE ROAD	13221	500-241-29	E5	5	1337	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide
153	JAMBOREE ROAD	13221	500-241-29	E5	5	1337	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1.5 ft wide
154	JAMBOREE ROAD	13321	500-241-31	F5	5	1337	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide. At missing pole hole.
367	JAMBOREE ROAD	2821	500-312-05	F5	5	1119	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"			No			Grind	5 ft long
245	JAMBOREE ROAD	2821	500-312-05	F5	5	1119	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	edison util cover
243	JAMBOREE ROAD	2821	500-312-05	F5	5	1119	Sidewalk	PCC	Patch / Utility Cut	1/2" to 1"	2.5		No			Grind	traffic signal util cover
12077	JAMBOREE ROAD	2821	500-312-05	F5	5	1119	Sidewalk	PCC	Patch / Utility Cut	1" to 2"	0.5		No			Ramp	Util cover
368	JAMBOREE ROAD	2821	500-312-05	F5	5	1119	Sidewalk	PCC	Faulting	1/4" to 1/2"	14		No			Grind	
369	JAMBOREE ROAD	2821	500-312-05	F5	5	1119	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
12075	JAMBOREE ROAD	2821	500-312-05	F5	5	1119	Sidewalk	PCC	Faulting	1/4" to 1/2"	12		No			Grind	
12080	JAMBOREE ROAD	2821	500-312-05	F5	5	1119	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
12078	JAMBOREE ROAD	2821	500-312-05	F5	5	1119	Cross Gutter	PCC	Linear Cracking	1/4" to 1/2"	2		No			Grind	
12076	JAMBOREE ROAD	2821	500-312-05	F5	5	1119	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	4		No			Grind	
244	JAMBOREE ROAD	2821	500-312-05	F5	5	1119	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"			No			Grind	
12081	JAMBOREE ROAD	2821	500-312-05	F5	5	1119	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	4		No			Grind	
12079	JAMBOREE ROAD	2821	500-312-05	F5	5	1119	Curb/Gutter	PCC	Spalling	1/4" to 1/2"	3		No			Grind	
641	JAMBOREE ROAD		500-312-05	F5	5	1118	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
164	JAMBOREE ROAD		500-244-07	F5	5	1335	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	Yes			Grind	.5 ft wide
13	JAMBOREE ROAD		501-141-04	D6	5	1129	Curb/Gutter	PCC	Spalling	1/2" to 1"		0.5	No			Replace C&G	.5'
649	JAMBOREE ROAD		500-291-25	F5	5	1118	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide
646	JAMBOREE ROAD		500-312-05	F5	5	1118	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide
156	JAMBOREE ROAD		500-244-07	F5	5	1335	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide
160	JAMBOREE ROAD		500-244-07	F5	5	1335	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide
167	JAMBOREE ROAD		500-244-07	F5	5	1335	Sidewalk	PCC	Corner Break	1/2" to 1"			No			Replace Slab	1 ft wide.
635	JAMBOREE ROAD		500-241-31	F5	5	1336	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1.5 ft wide
643	JAMBOREE ROAD		500-312-05	F5	5	1118	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1.5 ft wide
161	JAMBOREE ROAD		500-244-07	F5	5	1335	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1.5 wide. Prev grinded
14	JAMBOREE ROAD		999-000-33	D6	5	1129	Sidewalk	PCC	Corner Break	1/2" to 1"			No			Replace Slab	1'
89	JAMBOREE ROAD		501-141-04	D6	5	1128	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	1'
84	JAMBOREE ROAD		501-113-21	E6	5	1126	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	1'
85	JAMBOREE ROAD		501-151-09	D6	5	1126	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	1'
72	JAMBOREE ROAD		501-116-26	E6	5	1124	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1'
76	JAMBOREE ROAD		501-221-51	E6	5	1124	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1'
109	JAMBOREE ROAD		502-461-47	D7	5	1131	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1'
106	JAMBOREE ROAD		502-471-29	D7	5	1131	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	1'
10	JAMBOREE ROAD		501-095-19	D6	5	1129	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	1'
11	JAMBOREE ROAD		501-095-19	D6	5	1129	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	1'
29	JAMBOREE ROAD		501-116-26	E6	5	1125	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	1'
32	JAMBOREE ROAD		501-116-26	E6	5	1125	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1'
26	JAMBOREE ROAD		501-113-24	E6	5	1125	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	1'
108	JAMBOREE ROAD		502-461-48	D7	5	1131	Sidewalk	PCC	Spalling	1/4" to 1/2"			No			Grind	1'
75	JAMBOREE ROAD		501-113-24	E6	5	1124	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1', Manhole
645	JAMBOREE ROAD		500-312-05	F5	5	1118	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"			No			Grind	10 ft length
638	JAMBOREE ROAD		500-244-07	F5	5	1334	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	12 ft length running along sidewalk
77	JAMBOREE ROAD		501-221-51	E6	5	1124	Sidewalk	PCC	Linear Cracking	No Displacement			No			Joint Seal	15', Crack just starting to fault
642	JAMBOREE ROAD		500-312-05	F5	5	1118	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"			No			Grind	18 ft length
166	JAMBOREE ROAD		500-244-07	F5	5	1335	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"			No			Grind	2 ft length
162	JAMBOREE ROAD		500-244-07	F5	5	1335	Sidewalk	PCC	Faulting	1/2" to 1"			Yes			Ramp	2 ft wide
652	JAMBOREE ROAD		500-291-25	F5	5	1118	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	2 ft wide
155	JAMBOREE ROAD		500-244-07	F5	5	1335	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	2 ft wide
159	JAMBOREE ROAD		500-244-07	F5	5	1335	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	2 ft wide
650				F5	5	1118	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	2 ft wide at cox patch

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
165	JAMBOREE ROAD		500-244-07	F5	5	1335	Sidewalk	PCC	Faulting	1/2" to 1"			Yes			Ramp	2.5 ft wide
639	JAMBOREE ROAD		500-244-07	F5	5	1334	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	2.5 ft wide
90	JAMBOREE ROAD		501-141-04	D6	5	1128	Sidewalk	PCC	Corner Break	1/4" to 1/2"			No			Grind	2'
92	JAMBOREE ROAD		501-095-19	D6	5	1128	Sidewalk	PCC	Faulting	1" to 2"			Yes			Replace Slab	2'
97	JAMBOREE ROAD		502-461-47	D7	5	1130	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	2'
79	JAMBOREE ROAD		501-221-31	E6	5	1126	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	2'
71	JAMBOREE ROAD		501-116-26	E6	5	1124	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	2'
8	JAMBOREE ROAD		501-095-19	D6	5	1129	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	2'
9	JAMBOREE ROAD		501-095-19	D6	5	1129	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	2'
28	JAMBOREE ROAD		501-116-26	E6	5	1125	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	2'
33	JAMBOREE ROAD		501-116-26	E6	5	1125	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	2'
21	JAMBOREE ROAD		501-113-22	E6	5	1127	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	2'
78	JAMBOREE ROAD		501-221-32	E6	5	1124	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	2', prev grind
31	JAMBOREE ROAD		501-116-26	E6	5	1125	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	2', prev grind
16	JAMBOREE ROAD		501-151-09	D6	5	1127	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	2'. Manhole
651	JAMBOREE ROAD		500-291-25	F5	5	1118	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	3 ft wide
648	JAMBOREE ROAD		500-312-05	F5	5	1118	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	3 ft wide
25	JAMBOREE ROAD		501-113-24	E6	5	1125	Sidewalk	PCC	Faulting	1" to 2"			Yes			Replace Slab	3'
23	JAMBOREE ROAD		501-221-29	E6	5	1127	Sidewalk	PCC	Faulting	1/2" to 1"			Yes			Ramp	3'
101	JAMBOREE ROAD		999-000-97	C7	5	1130	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	3'
86	JAMBOREE ROAD		501-151-09	D6	5	1126	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	3'
15	JAMBOREE ROAD		501-151-09	D6	5	1127	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"			No	Yes		Grind	3'
12	JAMBOREE ROAD		501-141-04	D6	5	1129	Sidewalk	PCC	Spalling	1/4" to 1/2"			No			Grind	3", middle of slab
163	JAMBOREE ROAD		500-244-07	F5	5	1335	Sidewalk	PCC	Faulting	1/2" to 1"			Yes			Ramp	4 ft wide.
98	JAMBOREE ROAD		502-461-48	D7	5	1130	Sidewalk	PCC	Faulting	1" to 2"			Yes			Replace Slab	4'
7	JAMBOREE ROAD		501-095-19	D6	5	1129	Sidewalk	PCC	Faulting	1/4" to 1/2"			No	Yes		Grind	4'
19	JAMBOREE ROAD		501-113-21	E6	5	1127	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	4'
80	JAMBOREE ROAD		501-221-31	E6	5	1126	Ramp	PCC	Faulting	1/4" to 1/2"			No			Grind Ramp	4', crack also present
30	JAMBOREE ROAD		501-116-26	E6	5	1125	Sidewalk	PCC	Faulting	1/2" to 1"			Yes			Ramp	4', prev grind
647	JAMBOREE ROAD		500-312-05	F5	5	1118	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"			No			Grind	5 ft wide
87	JAMBOREE ROAD		501-151-09	D6	5	1126	Sidewalk	PCC	Faulting	1/2" to 1"			Yes			Ramp	5'
88	JAMBOREE ROAD		501-141-04	D6	5	1128	Sidewalk	PCC	Temporary Ramp	1/2" to 1"			Yes			Replace Slab	5'
82	JAMBOREE ROAD		501-113-22	E6	5	1126	Sidewalk	PCC	Temporary Ramp	1" to 2"			No			Replace Slab	5'
83	JAMBOREE ROAD		501-113-21	E6	5	1126	Sidewalk	PCC	Temporary Ramp	1" to 2"			No			Replace Slab	5'
644	JAMBOREE ROAD		500-312-05	F5	5	1118	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"			No			Grind	6 ft length
105	JAMBOREE ROAD		999-000-97	C7	5	1132	Sidewalk	PCC	Linear Cracking	No Displacement			No			Joint Seal	6'
100	JAMBOREE ROAD		502-471-29	D7	5	1130	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"			No			Grind	7'
634	JAMBOREE ROAD		500-241-27	E5	5	1336	Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"			No			Grind	At Patch
91	JAMBOREE ROAD		501-095-19	D6	5	1128	Sidewalk	PCC	Faulting	1" to 2"			Yes			Replace Slab	Both sides of slab faulted
27	JAMBOREE ROAD		501-116-26	E6	5	1125	Sidewalk	PCC	Patch / Utility Cut	1" to 2"			No	Yes		Ramp	Damaged util cover
640	JAMBOREE ROAD		500-244-07	F5	5	1334	Ramp	PCC	Sidewalk Curb Separation	No Displacement			No			Replace Slab	Large separation between curb and ramp. No vertical only horizonta
2002	JAMBOREE ROAD		525-101-62	C7	5	1135	Sidewalk	PCC	Divided Slab	No Displacement			Yes			Replace Slab	Low
18	JAMBOREE ROAD		501-113-21	E6	5	1127	Sidewalk	PCC	Other - Leave Comment	1" to 2"			No			Ramp	LSD 100'
1968	JAMBOREE ROAD		525-081-29	B7	5	1137	Sidewalk	PCC	Divided Slab	1/2" to 1"	8		Yes			Replace Slab(s)	Ned
636	JAMBOREE ROAD		500-241-31	F5	5	1336	Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"			No			Grind	Patch
637	JAMBOREE ROAD		500-241-30	F5	5	1334	Sidewalk	PCC	Patch / Utility Cut	No Displacement			No			Patch	Patch slightly falling apart
2742	JAMBOREE ROAD		501-117-15	E5	5	1123	Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	2		No			Grind	Pole base
2015	JAMBOREE ROAD		525-101-62	C7	5	1135	Sidewalk	PCC	Faulting	1/2" to 1"	5		Yes			Ramp	Prev grind
2029	JAMBOREE ROAD		502-491-49	C7	5	1133	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	Prev grind
1006	JAMBOREE ROAD		525-031-54	B7	5	1139	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
978	JAMBOREE ROAD		525-022-12	A7	5	1139	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
979	JAMBOREE ROAD		525-022-12	A7	5	1139	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
2014	JAMBOREE ROAD		525-101-62	C7	5	1135	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
2016	JAMBOREE ROAD		525-101-62	C7	5	1135	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Prev grind
2030	JAMBOREE ROAD		502-491-49	C7	5	1133	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
2031	JAMBOREE ROAD		502-491-49	C7	5	1133	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
2743	JAMBOREE ROAD		501-117-15	E5	5	1123	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
2744	JAMBOREE ROAD		501-117-15	E5	5	1123	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
2745	JAMBOREE ROAD		501-117-15	E5	5	1123	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
2747	JAMBOREE ROAD		501-117-15	E5	5	1123	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
977	JAMBOREE ROAD		525-022-13	A7	5	1139	Sidewalk	PCC	Linear Cracking	No Displacement	5		Yes			Joint Seal	Prev grind
107	JAMBOREE ROAD		502-461-48	D7	5	1131	Sidewalk	PCC	Buckled Slab	1/2" to 1"			Yes			Replace Slab	Prev grind
953	JAMBOREE ROAD		525-172-03	A7	5	1141	Sidewalk	PCC	Faulting	1" to 2"	2		Yes			Replace Slab	Prev grind
970				A7	5	1139	Sidewalk	PCC	Faulting	1" to 2"	5		Yes			Replace Slab	Prev grind

Sorted by Zone (1-7)



BUCKNAM
INFRASTRUCTURE GROUP, INC.

3548 Seagate Way, Suite 230
Oceanside, CA 92056
T: (760) 216-6529
www.bucknam-inc.com

Page 153 of 190

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
947	JAMBOREE ROAD		525-172-03	A7	5	1141	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
948	JAMBOREE ROAD		525-172-03	A7	5	1141	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
949	JAMBOREE ROAD		525-172-03	A7	5	1141	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
950	JAMBOREE ROAD		525-172-03	A7	5	1141	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
951	JAMBOREE ROAD		525-172-03	A7	5	1141	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
952	JAMBOREE ROAD		525-172-03	A7	5	1141	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
954	JAMBOREE ROAD		525-172-01	A7	5	1141	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
955	JAMBOREE ROAD		525-172-01	A7	5	1141	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
956	JAMBOREE ROAD		525-172-01	A7	5	1141	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
960	JAMBOREE ROAD		525-172-01	A7	5	1141	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
961	JAMBOREE ROAD		525-172-01	A7	5	1141	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
962	JAMBOREE ROAD		525-172-01	A7	5	1141	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
991	JAMBOREE ROAD		525-031-54	B7	5	1139	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		Yes			Grind	
993	JAMBOREE ROAD		525-031-54	B7	5	1139	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
994	JAMBOREE ROAD		525-031-54	B7	5	1139	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
995	JAMBOREE ROAD		525-031-54	B7	5	1139	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
996	JAMBOREE ROAD		525-031-54	B7	5	1139	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
997	JAMBOREE ROAD		525-031-54	B7	5	1139	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
999	JAMBOREE ROAD		525-031-54	B7	5	1139	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
1000	JAMBOREE ROAD		525-031-54	B7	5	1139	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
1001	JAMBOREE ROAD		525-031-54	B7	5	1139	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
1003	JAMBOREE ROAD		525-031-54	B7	5	1139	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		Yes			Grind	
1004	JAMBOREE ROAD		525-031-54	B7	5	1139	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
1005	JAMBOREE ROAD		525-031-54	B7	5	1139	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes	Yes		Grind	
1007	JAMBOREE ROAD		525-031-54	B7	5	1139	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
1008	JAMBOREE ROAD		525-031-54	B7	5	1139	Sidewalk	PCC	Faulting	1/4" to 1/2"	3					Grind	
988	JAMBOREE ROAD		525-022-11	B7	5	1139	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
989	JAMBOREE ROAD		525-022-11	B7	5	1139	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
980	JAMBOREE ROAD		525-022-12	A7	5	1139	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		Yes			Grind	
981	JAMBOREE ROAD		525-022-12	A7	5	1139	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
982	JAMBOREE ROAD		525-022-12	A7	5	1139	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
983	JAMBOREE ROAD		525-022-12	B7	5	1139	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
984	JAMBOREE ROAD		525-022-12	B7	5	1139	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
987	JAMBOREE ROAD		525-022-12	B7	5	1139	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
963	JAMBOREE ROAD		525-022-13	A7	5	1139	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
964	JAMBOREE ROAD		525-022-13	A7	5	1139	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
965	JAMBOREE ROAD		525-022-13	A7	5	1139	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
966	JAMBOREE ROAD		525-022-13	A7	5	1139	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
969	JAMBOREE ROAD		525-022-13	A7	5	1139	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
972	JAMBOREE ROAD		525-022-13	A7	5	1139	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
973	JAMBOREE ROAD		525-022-13	A7	5	1139	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
974	JAMBOREE ROAD		525-022-13	A7	5	1139	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
975	JAMBOREE ROAD		525-022-13	A7	5	1139	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
1966	JAMBOREE ROAD		525-081-29	B7	5	1137	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
1970	JAMBOREE ROAD		525-081-29	B7	5	1137	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
1971	JAMBOREE ROAD		525-081-29	B7	5	1137	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
1973	JAMBOREE ROAD		525-081-29	C7	5	1137	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
1974	JAMBOREE ROAD		525-081-29	C7	5	1137	Sidewalk	PCC	Faulting	1/4" to 1/2"	6		Yes			Grind	
1975	JAMBOREE ROAD		525-081-29	C7	5	1137	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
1977	JAMBOREE ROAD		525-081-29	C7	5	1137	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
1979	JAMBOREE ROAD		525-081-29	C7	5	1137	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
1981	JAMBOREE ROAD		525-081-29	C7	5	1137	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
1982	JAMBOREE ROAD		525-081-29	C7	5	1137	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
1955	JAMBOREE ROAD		525-061-58	B7	5	1137	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
1957	JAMBOREE ROAD		525-061-58	B7	5	1137	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
1958	JAMBOREE ROAD		525-061-58	B7	5	1137	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		Yes			Grind	
1959	JAMBOREE ROAD		525-061-58	B7	5	1137	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
1960	JAMBOREE ROAD		525-061-58	B7	5	1137	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
1961	JAMBOREE ROAD		525-061-58	B7	5	1137	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
1962	JAMBOREE ROAD		525-061-58	B7	5	1137	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
1964	JAMBOREE ROAD		525-061-58	B7	5	1137	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
1941	JAMBOREE ROAD		525-051-69	B7	5	1137	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
1942	JAMBOREE ROAD		525-051-69	B7	5	1137	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
1944				B7	5	1137	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
1945	JAMBOREE ROAD		525-051-69	B7	5	1137	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		Yes			Grind	
1946	JAMBOREE ROAD		525-051-69	B7	5	1137	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
1947	JAMBOREE ROAD		525-051-69	B7	5	1137	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
1949	JAMBOREE ROAD		525-051-69	B7	5	1137	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
1950	JAMBOREE ROAD		525-051-69	B7	5	1137	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
1951	JAMBOREE ROAD		525-051-69	B7	5	1137	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
1952	JAMBOREE ROAD		525-051-69	B7	5	1137	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
2003	JAMBOREE ROAD		525-101-62	C7	5	1135	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
2004	JAMBOREE ROAD		525-101-62	C7	5	1135	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
2005	JAMBOREE ROAD		525-101-62	C7	5	1135	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
2006	JAMBOREE ROAD		525-101-62	C7	5	1135	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
2007	JAMBOREE ROAD		525-101-62	C7	5	1135	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
2008	JAMBOREE ROAD		525-101-62	C7	5	1135	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
2009	JAMBOREE ROAD		525-101-62	C7	5	1135	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
2010	JAMBOREE ROAD		525-101-62	C7	5	1135	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
2011	JAMBOREE ROAD		525-101-62	C7	5	1135	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
2012	JAMBOREE ROAD		525-101-62	C7	5	1135	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
2013	JAMBOREE ROAD		525-101-62	C7	5	1135	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
2017	JAMBOREE ROAD		525-101-62	C7	5	1135	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
2020	JAMBOREE ROAD		525-101-62	C7	5	1135	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
1997	JAMBOREE ROAD		525-101-61	C7	5	1135	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
2001	JAMBOREE ROAD		525-101-61	C7	5	1135	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
1987	JAMBOREE ROAD		525-091-48	C7	5	1135	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
1988	JAMBOREE ROAD		525-091-48	C7	5	1135	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
1989	JAMBOREE ROAD		525-091-48	C7	5	1135	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
1991	JAMBOREE ROAD		525-091-48	C7	5	1135	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
1992	JAMBOREE ROAD		525-091-48	C7	5	1135	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
1985	JAMBOREE ROAD		525-081-29	C7	5	1135	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
1986	JAMBOREE ROAD		525-081-29	C7	5	1135	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
2044	JAMBOREE ROAD		502-501-50	C7	5	1133	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
2026	JAMBOREE ROAD		502-491-49	C7	5	1133	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
2027	JAMBOREE ROAD		502-491-49	C7	5	1133	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
2028	JAMBOREE ROAD		502-491-49	C7	5	1133	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
2032	JAMBOREE ROAD		502-491-49	C7	5	1133	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
2033	JAMBOREE ROAD		502-491-49	C7	5	1133	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
2034	JAMBOREE ROAD		502-491-49	C7	5	1133	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No			Grind	
2035	JAMBOREE ROAD		502-491-49	C7	5	1133	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
2036	JAMBOREE ROAD		502-491-49	C7	5	1133	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
2037	JAMBOREE ROAD		502-491-49	C7	5	1133	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
2756	JAMBOREE ROAD		501-112-05	E6	5	1123	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No	Yes		Grind	
2757	JAMBOREE ROAD		501-112-05	E6	5	1123	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No	Yes		Grind	
2759	JAMBOREE ROAD		501-112-05	E6	5	1123	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
2760	JAMBOREE ROAD		501-112-05	E5	5	1123	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
2746	JAMBOREE ROAD		501-117-15	E5	5	1123	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
2748	JAMBOREE ROAD		501-117-15	E5	5	1123	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
2749	JAMBOREE ROAD		501-117-15	E5	5	1123	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
967	JAMBOREE ROAD		525-022-13	A7	5	1139	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	5		Yes			Grind	
971	JAMBOREE ROAD		525-022-13	A7	5	1139	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	5		Yes			Grind	
1978	JAMBOREE ROAD		525-081-29	C7	5	1137	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	5		Yes			Grind	
1994	JAMBOREE ROAD		525-091-48	C7	5	1135	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	5		Yes			Grind	
2754	JAMBOREE ROAD		501-112-05	E6	5	1122	Sidewalk	PCC	Linear Cracking	No Displacement	7		No			Joint Seal	
1002	JAMBOREE ROAD		525-031-54	B7	5	1139	Sidewalk	PCC	Linear Cracking	No Displacement	5		Yes			Joint Seal	
1948	JAMBOREE ROAD		525-051-69	B7	5	1137	Sidewalk	PCC	Linear Cracking	No Displacement	8		Yes			Joint Seal	
2755	JAMBOREE ROAD		501-112-05	E6	5	1123	Sidewalk	PCC	Linear Cracking	No Displacement	4		No	Yes		Joint Seal	
74	JAMBOREE ROAD		501-116-26	E6	5	1124	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"			No			Grind	
73	JAMBOREE ROAD		501-116-26	E6	5	1124	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"			No			Grind	
102	JAMBOREE ROAD		999-000-97	C7	5	1132	Curb/Gutter	PCC	Spalling	1/4" to 1/2"			No			Grind	
2751	JAMBOREE ROAD		501-112-05	E6	5	1122	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
938	JAMBOREE ROAD		525-172-03	A7	5	1141	Sidewalk	PCC	Spalling	1/4" to 1/2"	0.5	0.5	No			Grind	
2000	JAMBOREE ROAD		525-101-61	C7	5	1135	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
81	JAMBOREE ROAD		501-221-31	E6	5	1126	Sidewalk	PCC	Temporary Ramp	1/2" to 1"			No			Replace Slab	
2023	JAMBOREE ROAD		502-491-49	C7	5	1135	Sidewalk	PCC	Temporary Ramp	Over 2"	6		Yes			Replace Slab	
2024	JAMBOREE ROAD		502-491-49	C7	5	1133	Sidewalk	PCC	Temporary Ramp	Over 2"	6		Yes			Replace Slab	
20				E6	5	1127	Sidewalk	PCC	Temporary Ramp	1" to 2"			No			Replace Slab	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP	Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
2750	JAMBOREE ROAD		501-117-15	E5	5	1123		Sidewalk	PCC	Temporary Ramp	1/2" to 1"	4		Yes			Replace Slab	
60	KELLER DRIVE	12950	501-112-01	E5	5	1724		Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	2'
65	KELLER DRIVE	12950	501-112-01	E5	5	1724		Driveway	PCC	Spalling	1/4" to 1/2"			No			Grind	Near corner break
63	KELLER DRIVE	12950	501-112-01	E5	5	1724		Driveway	PCC	Spalling	1/4" to 1/2"			No			Grind	Spalling and cracks on driveway edge
62	KELLER DRIVE	12950	501-112-01	E5	5	1724		Sidewalk	PCC	Divided Slab	No Displacement			No			Replace Slab	
64	KELLER DRIVE	12950	501-112-01	E5	5	1724		Curb/Gutter	PCC	Faulting	1" to 2"			No			Replace C&G	
66	KELLER DRIVE	12950	501-112-01	E5	5	1724		Curb/Gutter	PCC	Spalling	1" to 2"			No			Patch	
61	KELLER DRIVE	12950	501-112-01	E5	5	1724		Curb/Gutter	PCC	Spalling	1/4" to 1/2"			No			Grind	
54	KELLER DRIVE		501-117-13	E5	5	1724		Sidewalk	PCC	Faulting	1/2" to 1"			Yes			Ramp	2'
55	KELLER DRIVE		501-117-13	E5	5	1724		Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	2'
53	KELLER DRIVE		501-117-18	E5	5	1724		Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	2'
50	KELLER DRIVE		501-117-11	E5	5	1724		Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	2', prev grind
49	KELLER DRIVE		501-117-18	E5	5	1724		Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	2', Tree nearby
52	KELLER DRIVE		501-117-12	E5	5	1724		Sidewalk	PCC	Divided Slab	No Displacement			No			Replace Slab	Low divided
56	KELLER DRIVE		501-112-05	E5	5	1724		Sidewalk	PCC	Faulting	1/2" to 1"			No			Ramp	Manhole
57	KELLER DRIVE		501-112-05	E5	5	1724		Sidewalk	PCC	Corner Break	1/4" to 1/2"			No			Grind	
58	KELLER DRIVE		501-112-05	E5	5	1724		Sidewalk	PCC	Divided Slab	No Displacement			No			Replace Slab	
2741	KELLER DRIVE		501-117-15	E5	5	1724		Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
51	KELLER DRIVE		501-117-11	E5	5	1724		Sidewalk	PCC	Spalling	1/2" to 1"			No			Replace C&G	
59	KELLER DRIVE		501-112-05	E5	5	1724		Sidewalk	PCC	Spalling	1/4" to 1/2"			No			Grind	
2661	KINSMAN CIRCLE		500-341-27	E5	5	1731		Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	3		No			Grind	Pole base
2650	KINSMAN CIRCLE		500-221-07	E5	5	1731		Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
2655	KINSMAN CIRCLE		500-221-07	E5	5	1731		Sidewalk	PCC	Linear Cracking	No Displacement	7		Yes			Joint Seal	Prev grind
2644	KINSMAN CIRCLE		500-221-07	E5	5	1731		Sidewalk	PCC	Corner Break	No Displacement	2		No			Patch	Some spalling
2665	KINSMAN CIRCLE		500-341-32	E5	5	1731		Curb/Gutter	PCC	Faulting	1/2" to 1"	0.5		No			Replace C&G	
2658	KINSMAN CIRCLE		500-221-11	E5	5	1731		Driveway	PCC	Faulting	1/4" to 1/2"	5		No			Grind Driveway	
2657	KINSMAN CIRCLE		500-221-07	E5	5	1731		Driveway	PCC	Faulting	1/4" to 1/2"	4		No			Grind Driveway	
2662	KINSMAN CIRCLE		500-341-27	E5	5	1731		Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
2642	KINSMAN CIRCLE		500-221-07	E5	5	1731		Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
2648	KINSMAN CIRCLE		500-221-07	E5	5	1731		Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
2653	KINSMAN CIRCLE		500-221-07	E5	5	1731		Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	4		No			Grind	
2643	KINSMAN CIRCLE		500-221-07	E5	5	1731		Curb/Gutter	PCC	Spalling	Over 2"	0.5		No			Replace C&G	
919	LA COLINA DRIVE		501-161-05	D5	5	1144		Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	By manhole
11741	LA COLINA DRIVE		501-109-78	D5	5	1142		Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	Prev grind
11737	LA COLINA DRIVE		501-109-76	D5	5	1142		Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	Prev grind
11727	LA COLINA DRIVE		501-131-35	D5	5	1143		Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
11729	LA COLINA DRIVE		501-131-35	D5	5	1143		Sidewalk	PCC	Faulting	1/4" to 1/2"	6		Yes			Grind	Prev grind
11740	LA COLINA DRIVE		501-109-78	D5	5	1142		Sidewalk	PCC	Faulting	1/4" to 1/2"	6		Yes			Grind	Prev grind
11743	LA COLINA DRIVE		501-109-78	D5	5	1142		Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
11744	LA COLINA DRIVE		501-109-78	D5	5	1142		Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
11745	LA COLINA DRIVE		501-109-78	D5	5	1142		Sidewalk	PCC	Faulting	1/4" to 1/2"	6		Yes			Grind	Prev grind
11746	LA COLINA DRIVE		501-109-78	D5	5	1142		Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
11734	LA COLINA DRIVE		501-131-35	D5	5	1143		Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	
11735	LA COLINA DRIVE		501-131-35	D5	5	1143		Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	
11736	LA COLINA DRIVE		501-109-76	D5	5	1142		Sidewalk	PCC	Faulting	1/2" to 1"	3		No			Ramp	
917	LA COLINA DRIVE		501-103-02	D5	5	1144		Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
918	LA COLINA DRIVE		501-161-09	D5	5	1144		Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
11725	LA COLINA DRIVE		501-131-35	D5	5	1143		Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
11728	LA COLINA DRIVE		501-131-35	D5	5	1143		Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
11730	LA COLINA DRIVE		501-131-35	D5	5	1143		Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
11732	LA COLINA DRIVE		501-131-35	D5	5	1143		Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
11747	LA COLINA DRIVE		501-109-78	D5	5	1142		Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
11748	LA COLINA DRIVE		501-109-78	D5	5	1142		Sidewalk	PCC	Faulting	1/4" to 1/2"	6		No			Grind	
11731	LA COLINA DRIVE		501-131-35	D5	5	1143		Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	6		Yes			Grind	
11738	LA COLINA DRIVE		501-109-77	D5	5	1142		Sidewalk	PCC	Linear Cracking	No Displacement	6		No			Joint Seal	
11739	LA COLINA DRIVE		501-109-78	D5	5	1142		Sidewalk	PCC	Patch / Utility Cut	1/2" to 1"	1		No			Grind	
11726	LA COLINA DRIVE		501-131-35	D5	5	1143		Sidewalk	PCC	Spalling	1/4" to 1/2"	0.5		No			Grind	
11733	LA COLINA DRIVE		501-131-35	D5	5	1143		Sidewalk	PCC	Spalling	1/4" to 1/2"	0.5		No			Grind	
11742	LA COLINA DRIVE		501-109-78	D5	5	1142		Sidewalk	PCC	Spalling	1/4" to 1/2"	0.5		No			Grind	
675	LAGIER WAY	2395	500-232-14	E5	5	1734		Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1.5 ft wide. Prev grinded
677	LAGIER WAY	2395	500-232-14	E5	5	1734		Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"			No			Grind	6 ft length
676	LAGIER WAY	2395	500-232-14	E5	5	1734		Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	Prev grind
694	LAGIER WAY		500-234-69	E5	5	1734		Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
682				E5	5	1734		Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
672	LAGIER WAY		500-232-12	E5	5	1734	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide
686	LAGIER WAY		500-232-10	E5	5	1734	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft widw
688	LAGIER WAY		500-234-69	E5	5	1734	Sidewalk	PCC	Faulting	1/2" to 1"			Yes			Ramp	1.5 ft wide
689	LAGIER WAY		500-234-69	E5	5	1734	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	1.5 ft wide. Prev grinded
687	LAGIER WAY		500-234-69	E5	5	1734	Sidewalk	PCC	Corner Break	1/4" to 1/2"			No			Grind	2 ft
680	LAGIER WAY		500-232-13	E5	5	1734	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	2 ft wide
673	LAGIER WAY		500-232-12	E5	5	1734	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"			No			Grind	2.5 ft wide
684	LAGIER WAY		500-232-13	E5	5	1734	Sidewalk	PCC	Corner Break	1/4" to 1/2"			No			Grind	3 ft
696	LAGIER WAY		500-235-48	E5	5	1734	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	3 ft wide
679	LAGIER WAY		500-232-13	E5	5	1734	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"			Yes			Replace Slab	4 ft in length
691	LAGIER WAY		500-234-69	E5	5	1734	Curb/Gutter	PCC	Sidewalk Curb Separation	1" to 2"			No			Replace Curb	5 ft length
685	LAGIER WAY		500-232-13	E5	5	1734	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"			Yes			Replace Slab	5 ft length
695	LAGIER WAY		500-235-48	E5	5	1734	Curb/Gutter	PCC	Sidewalk Curb Separation	1" to 2"			No			Replace Curb	5.5 ft in length
692	LAGIER WAY		500-234-69	E5	5	1734	Curb/Gutter	PCC	Faulting	1" to 2"			No			Replace C&G	6 ft length
690	LAGIER WAY		500-234-69	E5	5	1734	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"			No			Grind	6 ft length
693	LAGIER WAY		500-234-69	E5	5	1734	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"			No			Grind	7 ft length
681	LAGIER WAY		500-232-13	E5	5	1734	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	Prev grind
683	LAGIER WAY		500-232-13	E5	5	1734	Sidewalk	PCC	Faulting	1/2" to 1"			Yes			Ramp	Prev grinded. Corner break as well.
674	LAGIER WAY		500-232-12	E5	5	1734	Curb/Gutter	PCC	Spalling	1/4" to 1/2"			No			Grind	
678	LAGIER WAY		500-232-13	E5	5	1734	Sidewalk	PCC	Spalling	1/4" to 1/2"			No			Grind	
760	LARACA STREET	13191	500-331-11	E5	5	1741	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1.5 ft wide
759	LARACA STREET	2436	500-331-12	E5	5	1741	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide
758	LARACA STREET	2457	500-332-24	E5	5	1741	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
795	MARSELINA	2162	500-262-09	E5	5	1763	Sidewalk	PCC	Faulting	1/4" to 1/2"		1	No			Grind	
769	MONTEREY STREET	13262	500-263-18	E5	5	1785	Sidewalk	PCC	Faulting	1/2" to 1"			No			Ramp	5 ft wide, prev grinded
217	MYFORD ROAD	13204	500-241-15	E5	5	1797	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
621	MYFORD ROAD	13211	500-222-08	E5	5	1797	Ramp	PCC	Faulting	1/4" to 1/2"			No			Grind Ramp	2 ft wide
615	MYFORD ROAD	13211	500-222-03	E5	5	1797	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	2 ft wide
614	MYFORD ROAD	13211	500-222-03	E5	5	1797	Ramp	PCC	Faulting	1/4" to 1/2"			No			Grind Ramp	4 ft wide
613	MYFORD ROAD	13211	500-222-03	E5	5	1797	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	4 ft wide
12098	MYFORD ROAD	2740	500-312-01	F5	5	1795	Sidewalk	PCC	Corner Break	1/4" to 1/2"	3		No	Yes		Grind	
264	MYFORD ROAD	2740	500-312-01	F5	5	1795	Sidewalk	PCC	Faulting	1/2" to 1"	5		No			Ramp	
347	MYFORD ROAD	2740	500-312-01	F5	5	1795	Sidewalk	PCC	Faulting	1/2" to 1"	3		No			Ramp	
348	MYFORD ROAD	2740	500-312-01	F5	5	1795	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	
12096	MYFORD ROAD	2740	500-312-01	F5	5	1795	Sidewalk	PCC	Faulting	1/2" to 1"	5		Yes			Ramp	
345	MYFORD ROAD	2740	500-312-01	F5	5	1795	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
346	MYFORD ROAD	2740	500-312-01	F5	5	1795	Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	4		No			Grind	
12097	MYFORD ROAD	2740	500-312-01	F5	5	1795	Driveway	PCC	Spalling	1/2" to 1"	1.5		No			Replace C&G	
349	MYFORD ROAD	2740	500-312-01	F5	5	1795	Sidewalk	PCC	Spalling	1/2" to 1"	2		No			Replace C&G	
354	MYFORD ROAD	2821	500-312-05	F5	5	1795	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	At hydrant. 1 ft wide
12094	MYFORD ROAD	2821	500-312-05	F5	5	1795	Sidewalk	PCC	Spalling	1/4" to 1/2"	0.5		No			Grind	Corner
351	MYFORD ROAD	2821	500-312-05	F5	5	1795	Sidewalk	PCC	Patch / Utility Cut	No Displacement			No			Patch	Patch broken
350	MYFORD ROAD	2821	500-312-05	F5	5	1795	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
352	MYFORD ROAD	2821	500-312-05	F5	5	1795	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
353	MYFORD ROAD	2821	500-312-05	F5	5	1795	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
12095	MYFORD ROAD	2821	500-312-05	F5	5	1795	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	3		No			Grind	
209	MYFORD ROAD		500-241-22	E5	5	1797	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	Yes			Grind	.5 ft wide
618	MYFORD ROAD		500-222-10	E5	5	1797	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
219	MYFORD ROAD		500-241-21	E5	5	1797	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
220	MYFORD ROAD		500-241-21	E5	5	1797	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
223	MYFORD ROAD		500-241-21	E5	5	1797	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
594	MYFORD ROAD		500-243-16	F5	5	1796	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
591	MYFORD ROAD		500-243-15	F5	5	1796	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	Yes			Grind	.5 ft wide
595	MYFORD ROAD		500-243-15	F5	5	1796	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
588	MYFORD ROAD		500-321-51	E5	5	1796	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
605	MYFORD ROAD		500-321-09	E5	5	1796	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
597	MYFORD ROAD		500-243-14	E5	5	1796	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
599	MYFORD ROAD		500-243-14	E5	5	1796	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
212	MYFORD ROAD		500-241-22	E5	5	1797	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	Yes			Grind	.5 ft wide, prev grinded
211	MYFORD ROAD		500-241-22	E5	5	1797	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	Yes			Grind	.5 ft wide. Prev grinded
210	MYFORD ROAD		500-241-22	E5	5	1797	Sidewalk	PCC	Divided Slab	1/4" to 1/2"		0.5	No			Replace Slab	.5 length of crack has vert
592	MYFORD ROAD		500-243-16	F5	5	1796	Sidewalk	PCC	Faulting	1/2" to 1"			Yes			Ramp	1 ft wide
611	MYFORD ROAD		500-222-11	E5	5	1797	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	1 ft wide
580				F5	5	1796	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
587	MYFORD ROAD		500-321-51	E5	5	1796	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	1 ft wide
589	MYFORD ROAD		500-321-24	E5	5	1796	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide
606	MYFORD ROAD		500-321-09	E5	5	1796	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	1 ft wide
598	MYFORD ROAD		500-243-14	E5	5	1796	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide
600	MYFORD ROAD		500-243-14	E5	5	1796	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide
601	MYFORD ROAD		500-243-14	E5	5	1796	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide
608	MYFORD ROAD		500-233-02	E5	5	1796	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide
590	MYFORD ROAD		500-243-15	E5	5	1796	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"			No			Grind	1.5 ft length
610	MYFORD ROAD		500-222-11	E5	5	1797	Sidewalk	PCC		1/2" to 1"			Yes			Ramp	1.5 ft wide
585	MYFORD ROAD		500-321-51	F5	5	1796	Sidewalk	PCC	Faulting	1/2" to 1"			Yes			Ramp	1.5 ft wide
213	MYFORD ROAD		500-241-22	E5	5	1797	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	1.5 ft wide
216	MYFORD ROAD		500-241-22	E5	5	1797	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1.5 ft wide
612	MYFORD ROAD		500-222-11	E5	5	1797	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	1.5 ft wide
616	MYFORD ROAD		500-222-10	E5	5	1797	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	1.5 ft wide
620	MYFORD ROAD		500-222-10	E5	5	1797	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	1.5 ft wide
581	MYFORD ROAD		500-321-51	F5	5	1796	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	1.5 ft wide
584	MYFORD ROAD		500-321-51	F5	5	1796	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	1.5 ft wide
603	MYFORD ROAD		500-321-09	E5	5	1796	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	1.5 ft wide
582	MYFORD ROAD		500-321-51	F5	5	1796	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1.5 ft wide, prev grinded
384	MYFORD ROAD		500-291-22	F5	5	1794	Sidewalk	PCC	Faulting	1/2" to 1"			No			Ramp	2 ft wide
604	MYFORD ROAD		500-321-09	E5	5	1796	Sidewalk	PCC	Faulting	1/2" to 1"			Yes			Ramp	2 ft wide
617	MYFORD ROAD		500-222-10	E5	5	1797	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	2 ft wide
583	MYFORD ROAD		500-321-51	F5	5	1796	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	2 ft wide
607	MYFORD ROAD		500-321-11	E5	5	1796	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	2 ft wide
383	MYFORD ROAD		500-291-22	F5	5	1794	Sidewalk	PCC	Faulting	1/2" to 1"			No			Ramp	2.5 ft wide
222	MYFORD ROAD		500-241-21	E5	5	1797	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	2.5 ft wide
586	MYFORD ROAD		500-321-51	F5	5	1796	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	3 ft length
622	MYFORD ROAD		500-222-09	E5	5	1797	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	3 ft wide
602	MYFORD ROAD		500-233-02	E5	5	1796	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	3 ft wide
579	MYFORD ROAD		500-321-51	F5	5	1796	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"			No			Grind	4 ft length
596	MYFORD ROAD		500-243-14	E5	5	1796	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"			No			Grind	4 ft length
593	MYFORD ROAD		500-243-16	F5	5	1796	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	4 ft wide
215	MYFORD ROAD		500-241-22	E5	5	1797	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	At CATV patch
218	MYFORD ROAD		500-241-21	E5	5	1797	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	At CATV patch
221	MYFORD ROAD		500-241-21	E5	5	1797	Sidewalk	PCC	Faulting	1" to 2"			No			Replace Slab	At edison patch
214	MYFORD ROAD		500-241-22	E5	5	1797	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	At edison patch
575	MYFORD ROAD		500-311-01	F5	5	1795	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	edison util cover
619	MYFORD ROAD		500-222-10	E5	5	1797	Sidewalk	PCC	Patch / Utility Cut	No Displacement			No			Patch	Hole in edison patch
609	MYFORD ROAD		500-222-11	E5	5	1797	Sidewalk	PCC	Other - Leave Comment	No Displacement			No			Replace Slab	Some holes in cement. Almost pothole.
385	MYFORD ROAD		500-291-22	F5	5	1794	Sidewalk	PCC	Divided Slab	No Displacement			No			Replace Slab	
577	MYFORD ROAD		500-311-01	F5	5	1795	Sidewalk	PCC	Faulting	1/2" to 1"	10		No	Yes		Ramp	
576	MYFORD ROAD		500-311-01	F5	5	1795	Sidewalk	PCC	Faulting	1/4" to 1/2"	6		No			Grind	
12093	MYFORD ROAD		500-311-02	F5	5	1795	Curb/Gutter	PCC	Linear Cracking	1/4" to 1/2"	1.5		No			Grind	
578	MYFORD ROAD		500-321-55	F5	5	1796	Sidewalk	PCC	Spalling	1/4" to 1/2"			No			Grind	
12092	MYFORD ROAD		500-311-01	F5	5	1795	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
2698	PALERMO	13132	500-251-43	E5	5	1824	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
2700	PALERMO	13132	500-251-43	E5	5	1824	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
773	PALERMO	13152	500-263-01	E5	5	1824	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide
2568	PALERMO	13152	500-263-01	E5	5	1824	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
794	PALERMO	2151	500-251-04	E5	5	1824	Sidewalk	PCC	Faulting	1/4" to 1/2"		1	No			Grind	
793	PALERMO	2181	500-251-07	E5	5	1824	Driveway	PCC	Spalling	No Displacement	0.25	2	No			Field Assess-Monitor	
792	PALERMO	2201	500-251-09	E5	5	1824	Sidewalk	PCC	Faulting	1/4" to 1/2"		2	No			Grind	Prev grind
1263	PARKCENTER LANE	13694	500-207-22	E4	5	1826	Curb/Gutter	PCC	Sidewalk Curb Separation	1" to 2"	8		No			Replace Curb	
1255	PARKCENTER LANE	13834	500-206-30	E4	5	1826	Curb/Gutter	PCC	Faulting	1/2" to 1"			No			Replace C&G	
767	PARKCENTER LANE		500-263-19	E5	5	1827	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	1 ft wide
766	PARKCENTER LANE		500-263-21	E5	5	1827	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	1 ft wide
768	PARKCENTER LANE		500-263-19	E5	5	1827	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	4.5 ft wide, prev grinded
900	PARKCENTER LANE		500-271-76	E5	5	1827	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	At CATV patch
905	PARKCENTER LANE		500-271-75	E5	5	1827	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	At CATV patch
906	PARKCENTER LANE		500-271-72	E5	5	1827	Sidewalk	PCC	Patch / Utility Cut	No Displacement			No			Patch	Patch is weak and could cave in soon
844	PARKCENTER LANE		500-205-78	E4	5	1826	Ramp	PCC	Faulting	1/2" to 1"	1		No			Grind Ramp	Prev grind
815	PARKCENTER LANE		500-211-14	E4	5	1827	Sidewalk	PCC	Faulting	1/2" to 1"	2		No			Ramp	Prev grind
806	PARKCENTER LANE		500-282-27	E5	5	1827	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	Prev grind
807				E5	5	1827	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
814	PARKCENTER LANE		500-211-15	E4	5	1827	Driveway	PCC	Faulting	1/4" to 1/2"	6		No			Grind Driveway	
895	PARKCENTER LANE		500-271-79	E4	5	1827	Sidewalk	PCC	Faulting	1/2" to 1"	5		No			Ramp	
816	PARKCENTER LANE		500-211-14	E4	5	1827	Sidewalk	PCC	Faulting	1/2" to 1"	2.5		No			Ramp	
899	PARKCENTER LANE		500-271-76	E5	5	1827	Sidewalk	PCC	Faulting	1/2" to 1"	1		No			Ramp	
1258	PARKCENTER LANE		500-206-82	E4	5	1826	Sidewalk	PCC	Faulting	1/2" to 1"	1		No			Ramp	
852	PARKCENTER LANE		500-205-76	E4	5	1826	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		No			Ramp	
855	PARKCENTER LANE		500-205-76	E4	5	1826	Sidewalk	PCC	Faulting	1/2" to 1"	5		No			Ramp	
843	PARKCENTER LANE		500-205-78	E4	5	1826	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		No			Ramp	
896	PARKCENTER LANE		500-271-78	E4	5	1827	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
897	PARKCENTER LANE		500-271-78	E4	5	1827	Sidewalk	PCC	Faulting	1/4" to 1/2"	4.5		No			Grind	
808	PARKCENTER LANE		500-211-13	E4	5	1827	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
809	PARKCENTER LANE		500-211-13	E4	5	1827	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
810	PARKCENTER LANE		500-211-13	E4	5	1827	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
811	PARKCENTER LANE		500-211-13	E4	5	1827	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
812	PARKCENTER LANE		500-211-13	E4	5	1827	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
898	PARKCENTER LANE		500-271-76	E4	5	1827	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
901	PARKCENTER LANE		500-271-76	E5	5	1827	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
902	PARKCENTER LANE		500-271-76	E5	5	1827	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
903	PARKCENTER LANE		500-272-37	E5	5	1827	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
904	PARKCENTER LANE		500-271-75	E5	5	1827	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
1253	PARKCENTER LANE		500-206-81	E4	5	1826	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
1254	PARKCENTER LANE		500-206-81	E4	5	1826	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
1259	PARKCENTER LANE		500-206-82	E4	5	1826	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
1260	PARKCENTER LANE		500-206-82	E4	5	1826	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
1262	PARKCENTER LANE		500-206-82	E4	5	1826	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
880	PARKCENTER LANE		500-203-01	E4	5	1826	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No		Yes	Grind	
1271	PARKCENTER LANE		500-203-01	E4	5	1826	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No		Yes	Grind	
1272	PARKCENTER LANE		500-203-01	E4	5	1826	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No		Yes	Grind	
1274	PARKCENTER LANE		500-203-01	E4	5	1826	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No		Yes	Grind	
881	PARKCENTER LANE		500-192-11	E4	5	1826	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No		Yes	Grind	
882	PARKCENTER LANE		500-192-11	E4	5	1826	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No		Yes	Grind	
883	PARKCENTER LANE		500-192-11	E4	5	1826	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
886	PARKCENTER LANE		500-192-15	E4	5	1826	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
887	PARKCENTER LANE		500-192-15	E4	5	1826	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
888	PARKCENTER LANE		500-192-15	E4	5	1826	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
846	PARKCENTER LANE		500-205-76	E4	5	1826	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
848	PARKCENTER LANE		500-205-76	E4	5	1826	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
849	PARKCENTER LANE		500-205-76	E4	5	1826	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
891	PARKCENTER LANE		500-192-16	E4	5	1826	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
892	PARKCENTER LANE		500-192-16	E4	5	1826	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
893	PARKCENTER LANE		500-192-16	E4	5	1826	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
894	PARKCENTER LANE		500-192-16	E4	5	1826	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
1265	PARKCENTER LANE		500-207-49	E4	5	1826	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
1266	PARKCENTER LANE		500-207-49	E4	5	1826	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
1267	PARKCENTER LANE		500-207-49	E4	5	1826	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
838	PARKCENTER LANE		500-205-78	E4	5	1826	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
841	PARKCENTER LANE		500-205-78	E4	5	1826	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
842	PARKCENTER LANE		500-205-78	E4	5	1826	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
847	PARKCENTER LANE		500-205-76	E4	5	1826	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	3		No			Grind	
1273	PARKCENTER LANE		500-203-01	E4	5	1826	Curb/Gutter	PCC	Sidewalk Curb Separation	1" to 2"	3		No		Yes	Replace Curb	
854	PARKCENTER LANE		500-205-76	E4	5	1826	Curb/Gutter	PCC	Sidewalk Curb Separation	1" to 2"	5		No		Yes	Replace Curb	
1269	PARKCENTER LANE		500-203-01	E4	5	1826	Ramp	PCC	Sidewalk Curb Separation	1/2" to 1"	2		No		Yes	Patch	
1261	PARKCENTER LANE		500-206-82	E4	5	1826	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	3		No			Grind	
839	PARKCENTER LANE		500-205-78	E4	5	1826	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	4		No			Grind	
813	PARKCENTER LANE		500-211-13	E4	5	1827	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	5		No			Grind	
1256	PARKCENTER LANE		500-206-82	E4	5	1826	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	6		No			Grind	
1257	PARKCENTER LANE		500-206-82	E4	5	1826	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	25		No			Grind	
1268	PARKCENTER LANE		500-203-01	E4	5	1826	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	10		No		Yes	Grind	
884	PARKCENTER LANE		500-192-11	E4	5	1826	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	12		No			Grind	
885	PARKCENTER LANE		500-192-15	E4	5	1826	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	7		No			Grind	
889	PARKCENTER LANE		500-192-15	E4	5	1826	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	5		No			Grind	
851	PARKCENTER LANE		500-205-76	E4	5	1826	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	15		No			Grind	
853	PARKCENTER LANE		500-205-76	E4	5	1826	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	8		No			Grind	
1264				E4	5	1826	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	4		No			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
850	PARKCENTER LANE		500-205-76	E4	5	1826	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	4		No			Grind	
845	PARKCENTER LANE		500-205-81	E4	5	1826	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	5		No			Grind	
890	PARKCENTER LANE		500-192-15	E4	5	1826	Curb/Gutter	PCC	Spalling	1" to 2"			No			Patch	
840	PARKCENTER LANE		500-205-78	E4	5	1826	Curb/Gutter	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
1270	PARKCENTER LANE		500-203-01	E4	5	1826	Sidewalk	PCC	Spalling	1/4" to 1/2"	0.5		No		Yes	Grind	
873	PARKVIEW WAY		500-207-49	E4	5	1829	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Prev grind
879	PARKVIEW WAY		500-207-49	E4	5	1829	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
864	PARKVIEW WAY		500-205-78	E4	5	1829	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
867	PARKVIEW WAY		500-205-78	E4	5	1829	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
865	PARKVIEW WAY		500-205-78	E4	5	1829	Sidewalk	PCC	Corner Break	1/4" to 1/2"	4		No			Grind	
860	PARKVIEW WAY		500-205-78	E4	5	1829	Curb/Gutter	PCC	Faulting	1" to 2"			No			Replace C&G	
856	PARKVIEW WAY		500-205-76	E4	5	1829	Curb/Gutter	PCC	Faulting	1/2" to 1"			No			Replace C&G	
857	PARKVIEW WAY		500-205-76	E4	5	1829	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
871	PARKVIEW WAY		500-207-49	E4	5	1829	Sidewalk	PCC	Faulting	1/4" to 1/2"	7		No			Grind	
872	PARKVIEW WAY		500-207-49	E4	5	1829	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
874	PARKVIEW WAY		500-207-49	E4	5	1829	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
875	PARKVIEW WAY		500-207-49	E4	5	1829	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
876	PARKVIEW WAY		500-207-49	E4	5	1829	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
877	PARKVIEW WAY		500-207-49	E4	5	1829	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
878	PARKVIEW WAY		500-207-49	E4	5	1829	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
869	PARKVIEW WAY		500-205-78	E4	5	1829	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
870	PARKVIEW WAY		500-205-78	E4	5	1829	Sidewalk	PCC	Linear Cracking	No Displacement	20		No			Joint Seal	
858	PARKVIEW WAY		500-205-76	E4	5	1829	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	10		No			Grind	
859	PARKVIEW WAY		500-205-76	E4	5	1829	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	20		No			Grind	
862	PARKVIEW WAY		500-205-78	E4	5	1829	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	6		No			Grind	
863	PARKVIEW WAY		500-205-78	E4	5	1829	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	25		No			Grind	
868	PARKVIEW WAY		500-205-78	E4	5	1829	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	3		No			Grind	
861	PARKVIEW WAY		500-205-78	E4	5	1829	Ramp	PCC	Sidewalk Curb Separation	1/4" to 1/2"			No			Grind	
866	PARKVIEW WAY		500-205-78	E4	5	1829	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	10		No			Grind	
1016	PATRIOT WAY		525-031-51	B7	5	1835	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	By manhole
1010	PATRIOT WAY		525-031-53	B7	5	1835	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
1937	PATRIOT WAY		525-041-45	B7	5	1835	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
1011	PATRIOT WAY		525-031-53	B7	5	1835	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
1012	PATRIOT WAY		525-031-53	B7	5	1835	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
1935	PATRIOT WAY		525-041-45	B7	5	1835	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
1936	PATRIOT WAY		525-041-45	B7	5	1835	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
1938	PATRIOT WAY		525-041-45	B7	5	1835	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
1939	PATRIOT WAY		525-041-45	B7	5	1835	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No			Grind	
1933	PATRIOT WAY		525-041-28	B7	5	1835	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
1934	PATRIOT WAY		525-041-28	B7	5	1835	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
1013	PATRIOT WAY		525-031-52	B7	5	1835	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
1014	PATRIOT WAY		525-031-52	B7	5	1835	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
1015	PATRIOT WAY		525-031-52	B7	5	1835	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
1940	PATRIOT WAY		525-051-69	B7	5	1835	Sidewalk	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
1095	PETERS CANYON ROAD		525-121-57	C7	5	1840	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	Borderline
1127	PETERS CANYON ROAD		502-451-29	C7	5	1840	Sidewalk	PCC	Divided Slab	No Displacement			No			Replace Slab	Low
1104	PETERS CANYON ROAD		502-671-31	B7	5	1841	Driveway	PCC	Divided Slab	1/4" to 1/2"	12		No			Replace Slab(s)	Med/high
1112	PETERS CANYON ROAD		502-671-28	B7	5	1841	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	Prev grind
1118	PETERS CANYON ROAD		502-671-28	B7	5	1841	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	Prev grind
1120	PETERS CANYON ROAD		502-451-29	C7	5	1840	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
1096	PETERS CANYON ROAD		525-121-56	C7	5	1840	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
1101	PETERS CANYON ROAD		525-131-74	B7	5	1841	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	Prev grind
1110	PETERS CANYON ROAD		502-671-28	B7	5	1841	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
1116	PETERS CANYON ROAD		502-671-28	B7	5	1841	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		Yes			Grind	Prev grind
1117	PETERS CANYON ROAD		502-671-28	B7	5	1841	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
1125	PETERS CANYON ROAD		502-451-29	C7	5	1840	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Some spalling
1119	PETERS CANYON ROAD		502-451-23	C7	5	1840	Sidewalk	PCC	Corner Break	1/4" to 1/2"	2		No			Grind	
1124	PETERS CANYON ROAD		502-451-29	C7	5	1840	Curb/Gutter	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind C&G	
1126	PETERS CANYON ROAD		502-451-29	C7	5	1840	Curb/Gutter	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind C&G	
1109	PETERS CANYON ROAD		502-671-28	B7	5	1841	Curb/Gutter	PCC	Faulting	1/4" to 1/2"	0.5		Yes			Grind C&G	
1097	PETERS CANYON ROAD		525-121-56	C7	5	1840	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
1098	PETERS CANYON ROAD		525-131-74	C7	5	1841	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
1100	PETERS CANYON ROAD		525-131-74	B7	5	1841	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
1102				B7	5	1841	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
1103	PETERS CANYON ROAD		525-131-74	B7	5	1841	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
1111	PETERS CANYON ROAD		502-671-28	B7	5	1841	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
1113	PETERS CANYON ROAD		502-671-28	B7	5	1841	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
1114	PETERS CANYON ROAD		502-671-28	B7	5	1841	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
1115	PETERS CANYON ROAD		502-671-28	B7	5	1841	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		Yes			Grind	
1107	PETERS CANYON ROAD		502-671-29	B6	5	1841	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
1105	PETERS CANYON ROAD		502-671-31	B7	5	1841	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	3		No			Grind	
1123	PETERS CANYON ROAD		502-451-29	C7	5	1840	Sidewalk	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
1108	PETERS CANYON ROAD		502-671-28	B6	5	1841	Curb/Gutter	PCC	Spalling	1/4" to 1/2"	0.5		No			Grind	
1121	PETERS CANYON ROAD		502-451-29	C7	5	1840	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
1122	PETERS CANYON ROAD		502-451-29	C7	5	1840	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
1099	PETERS CANYON ROAD		525-131-74	B7	5	1841	Sidewalk	PCC	Spalling	1/4" to 1/2"	2		No			Grind	
1106	PETERS CANYON ROAD		502-671-29	B6	5	1841	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
930	PIONEER ROAD	10250	525-022-03	A7	5	1851	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
931	PIONEER ROAD	10250	525-022-03	A7	5	1851	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
932	PIONEER ROAD	10250	525-022-03	A7	5	1851	Sidewalk	PCC	Temporary Ramp	1" to 2"	3		Yes			Replace Slab	
933	PIONEER ROAD	10250	525-022-03	A7	5	1851	Sidewalk	PCC	Temporary Ramp	1" to 2"	4		Yes			Replace Slab	
1754	PIONEER ROAD	11215	525-101-01	C7	5	1846	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		Yes			Grind	
1737	PIONEER ROAD	11490	502-453-13	C7	5	1846	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No			Grind	
1738	PIONEER ROAD	11490	502-453-13	C7	5	1846	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
1140	PIONEER ROAD	2713	525-081-20	B7	5	1848	Curb/Gutter	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind C&G	
937	PIONEER ROAD		525-022-13	A7	5	1851	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	By hydrant
1139	PIONEER ROAD		525-081-06	C7	5	1847	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	By hydrant
1689	PIONEER ROAD		502-521-08	C6	5	1845	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	By hydrant
1077	PIONEER ROAD		525-181-12	B7	5	1850	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	By manhole
1736	PIONEER ROAD		502-453-20	C7	5	1846	Sidewalk	PCC	Other - Leave Comment	1/4" to 1/2"	0.5		No			Grind	Hole from prev pole
1734	PIONEER ROAD		502-453-20	C7	5	1846	Ramp	PCC	Divided Slab	No Displacement			No			Replace Slab	Low
1161	PIONEER ROAD		525-041-28	B7	5	1849	Sidewalk	PCC	Divided Slab	No Displacement			No			Replace Slab	Low
1094	PIONEER ROAD		525-121-57	C7	5	1847	Sidewalk	PCC	Divided Slab	No Displacement			No			Replace Slab	Low
1687	PIONEER ROAD		502-521-08	C6	5	1845	Sidewalk	PCC	Divided Slab	No Displacement			No			Replace Slab	Low
1747	PIONEER ROAD		502-481-40	C7	5	1846	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Manhole
1162	PIONEER ROAD		525-041-28	B7	5	1849	Sidewalk	PCC	Divided Slab	No Displacement			No			Replace Slab	Med
1672	PIONEER ROAD		502-451-31	C7	5	1846	Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	2		No			Grind	Pole base
1758	PIONEER ROAD		525-101-55	C7	5	1847	Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	2		No			Grind	Pole base
1690	PIONEER ROAD		502-521-08	C6	5	1845	Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	2		No			Grind	Pole base
1685	PIONEER ROAD		502-521-09	C6	5	1845	Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	2		No			Grind	Pole base
1050	PIONEER ROAD		525-031-49	B7	5	1850	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
1019	PIONEER ROAD		525-031-51	B7	5	1849	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	Prev grind
1020	PIONEER ROAD		525-031-51	B7	5	1849	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	Prev grind
1142	PIONEER ROAD		525-081-24	B7	5	1848	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		Yes			Grind	Prev grind
1136	PIONEER ROAD		525-091-44	C7	5	1847	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		Yes			Grind	Prev grind
1137	PIONEER ROAD		525-091-44	C7	5	1847	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		Yes			Grind	Prev grind
1024	PIONEER ROAD		525-031-51	B7	5	1849	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	Prev grind
1150	PIONEER ROAD		525-061-44	B7	5	1848	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	Prev grind
1750	PIONEER ROAD		525-101-50	C7	5	1846	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
1061	PIONEER ROAD		525-151-11	A7	5	1851	Sidewalk	PCC	Faulting	1/4" to 1/2"	6		No			Grind	Prev grind
1067	PIONEER ROAD		525-181-12	A7	5	1851	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
1044	PIONEER ROAD		525-031-49	B7	5	1850	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
1022	PIONEER ROAD		525-031-51	B7	5	1849	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
1023	PIONEER ROAD		525-031-51	B7	5	1849	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
1028	PIONEER ROAD		525-031-51	B7	5	1849	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		Yes			Grind	Prev grind
1082	PIONEER ROAD		525-181-09	B7	5	1849	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
1147	PIONEER ROAD		525-061-45	B7	5	1848	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
1157	PIONEER ROAD		525-051-59	B7	5	1848	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
1158	PIONEER ROAD		525-051-60	B7	5	1848	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
1755	PIONEER ROAD		525-101-55	C7	5	1847	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		Yes			Grind	Prev grind
1686	PIONEER ROAD		502-522-58	C6	5	1845	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
1129	PIONEER ROAD		525-091-44	C7	5	1847	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		Yes			Grind	Prev grind
1131	PIONEER ROAD		525-091-44	C7	5	1847	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes	Yes		Grind	Prev grind
1017	PIONEER ROAD		525-031-51	B7	5	1849	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No	Yes		Grind	Small corner break
936	PIONEER ROAD		525-022-14	A7	5	1851	Sidewalk	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	Spall from linear crack
1069	PIONEER ROAD		525-181-12	A7	5	1851	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Util cover
1078	PIONEER ROAD		525-181-09	B7	5	1850	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Util cover
1739				C7	5	1846	Sidewalk	PCC	Corner Break	1/4" to 1/2"	2		Yes			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
935	PIONEER ROAD		525-022-14	A7	5	1851	Curb/Gutter	PCC	Faulting	1/4" to 1/2"	1		No			Grind C&G	
1089	PIONEER ROAD		525-121-59	B7	5	1847	Ramp	PCC	Faulting	1/4" to 1/2"	12		Yes			Grind Ramp	
1130	PIONEER ROAD		525-091-44	C7	5	1847	Sidewalk	PCC	Faulting	1" to 2"	4		Yes			Replace Slab	
1071	PIONEER ROAD		525-181-12	A7	5	1851	Sidewalk	PCC	Faulting	1/2" to 1"	2		Yes			Ramp	
1018	PIONEER ROAD		525-031-51	B7	5	1849	Sidewalk	PCC	Faulting	1/2" to 1"	4		No	Yes		Ramp	
1080	PIONEER ROAD		525-181-09	B7	5	1849	Sidewalk	PCC	Faulting	1/2" to 1"	3		No			Ramp	
1760	PIONEER ROAD		525-101-55	C7	5	1847	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
1764	PIONEER ROAD		525-101-58	C7	5	1847	Sidewalk	PCC	Faulting	1/2" to 1"	3		No			Ramp	
1735	PIONEER ROAD		502-453-20	C7	5	1846	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No			Grind	
1740	PIONEER ROAD		502-481-37	C7	5	1846	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
1741	PIONEER ROAD		502-481-37	C7	5	1846	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
1743	PIONEER ROAD		502-481-37	C7	5	1846	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
1744	PIONEER ROAD		502-481-37	C7	5	1846	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
1745	PIONEER ROAD		502-481-46	C7	5	1846	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
1751	PIONEER ROAD		525-101-50	C7	5	1846	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
1752	PIONEER ROAD		525-101-50	C7	5	1846	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		Yes			Grind	
1753	PIONEER ROAD		525-101-50	C7	5	1846	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		Yes			Grind	
1675	PIONEER ROAD		502-451-31	C7	5	1846	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
1676	PIONEER ROAD		502-451-31	C7	5	1846	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
1057	PIONEER ROAD		525-151-07	A7	5	1851	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
1058	PIONEER ROAD		525-151-07	A7	5	1851	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
1059	PIONEER ROAD		525-151-07	A7	5	1851	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
928	PIONEER ROAD		525-022-15	A7	5	1851	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
929	PIONEER ROAD		525-022-15	A7	5	1851	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
1062	PIONEER ROAD		525-022-15	A7	5	1851	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
1066	PIONEER ROAD		525-181-12	A7	5	1851	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
1070	PIONEER ROAD		525-181-12	A7	5	1851	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
1063	PIONEER ROAD		525-161-49	A7	5	1851	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
1043	PIONEER ROAD		525-031-49	B7	5	1850	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
1045	PIONEER ROAD		525-031-49	B7	5	1850	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
1046	PIONEER ROAD		525-031-49	B7	5	1850	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes	Yes		Grind	
1047	PIONEER ROAD		525-031-49	B7	5	1850	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
1048	PIONEER ROAD		525-031-49	B7	5	1850	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
1051	PIONEER ROAD		525-151-51	B7	5	1850	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
1052	PIONEER ROAD		525-151-51	B7	5	1850	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
1053	PIONEER ROAD		525-151-51	B7	5	1850	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
1054	PIONEER ROAD		525-151-51	B7	5	1850	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
1055	PIONEER ROAD		525-151-51	B7	5	1850	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
1056	PIONEER ROAD		525-151-51	B7	5	1850	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes	Yes		Grind	
1072	PIONEER ROAD		525-181-12	B7	5	1850	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No	Yes		Grind	
1073	PIONEER ROAD		525-181-12	B7	5	1850	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No	Yes		Grind	
1075	PIONEER ROAD		525-181-12	B7	5	1850	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
1076	PIONEER ROAD		525-181-12	B7	5	1850	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
1159	PIONEER ROAD		525-041-28	B7	5	1849	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
1160	PIONEER ROAD		525-041-28	B7	5	1849	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
1021	PIONEER ROAD		525-031-51	B7	5	1849	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
1026	PIONEER ROAD		525-031-51	B7	5	1849	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
1027	PIONEER ROAD		525-031-51	B7	5	1849	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
1029	PIONEER ROAD		525-031-51	B7	5	1849	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
1030	PIONEER ROAD		525-031-51	B7	5	1849	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
1079	PIONEER ROAD		525-181-09	B7	5	1849	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
1081	PIONEER ROAD		525-181-09	B7	5	1849	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
1084	PIONEER ROAD		525-181-09	B7	5	1849	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
1143	PIONEER ROAD		525-071-39	B7	5	1848	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
1144	PIONEER ROAD		525-071-39	B7	5	1848	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes	Yes		Grind	
1145	PIONEER ROAD		525-071-39	B7	5	1848	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
1148	PIONEER ROAD		525-061-45	B7	5	1848	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
1149	PIONEER ROAD		525-061-44	B7	5	1848	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
1152	PIONEER ROAD		525-061-44	B7	5	1848	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
1153	PIONEER ROAD		525-061-44	B7	5	1848	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
1154	PIONEER ROAD		525-051-59	B7	5	1848	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
1155	PIONEER ROAD		525-051-59	B7	5	1848	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
1156	PIONEER ROAD		525-051-59	B7	5	1848	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
1085				B7	5	1848	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No	Yes		Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
1086	PIONEER ROAD		525-182-44	B7	5	1848	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
1141	PIONEER ROAD		525-081-24	B7	5	1848	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
1087	PIONEER ROAD		525-142-82	B7	5	1848	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
1756	PIONEER ROAD		525-101-55	C7	5	1847	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No	Yes		Grind	
1757	PIONEER ROAD		525-101-55	C7	5	1847	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
1759	PIONEER ROAD		525-101-55	C7	5	1847	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
1761	PIONEER ROAD		525-101-55	C7	5	1847	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
1762	PIONEER ROAD		525-101-55	C7	5	1847	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
1763	PIONEER ROAD		525-101-55	C7	5	1847	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
1765	PIONEER ROAD		525-101-58	C7	5	1847	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
1665	PIONEER ROAD		502-451-29	C7	5	1847	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
1668	PIONEER ROAD		502-451-29	C7	5	1847	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
1669	PIONEER ROAD		502-451-29	C7	5	1847	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
1132	PIONEER ROAD		525-091-44	C7	5	1847	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
1133	PIONEER ROAD		525-091-44	C7	5	1847	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
1134	PIONEER ROAD		525-091-44	C7	5	1847	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
1135	PIONEER ROAD		525-091-44	C7	5	1847	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		Yes			Grind	
1093	PIONEER ROAD		525-121-57	C7	5	1847	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No			Grind	
1138	PIONEER ROAD		525-081-06	C7	5	1847	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
1090	PIONEER ROAD		525-121-58	B7	5	1847	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No	Yes		Grind	
1091	PIONEER ROAD		525-121-58	C7	5	1847	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
1092	PIONEER ROAD		525-121-58	C7	5	1847	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
1678	PIONEER ROAD		502-451-26	C7	5	1845	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
1688	PIONEER ROAD		502-521-08	C6	5	1845	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No			Grind	
1679	PIONEER ROAD		502-521-09	C7	5	1845	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
1682	PIONEER ROAD		502-521-09	C6	5	1845	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
1749	PIONEER ROAD		502-481-40	C7	5	1846	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	3		Yes			Grind	
1049	PIONEER ROAD		525-031-49	B7	5	1850	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	5		Yes			Grind	
1671	PIONEER ROAD		502-451-29	C7	5	1846	Sidewalk	PCC	Linear Cracking	No Displacement	8		No			Joint Seal	
1683	PIONEER ROAD		502-521-09	C6	5	1845	Sidewalk	PCC	Linear Cracking	No Displacement	5		No			Joint Seal	
1748	PIONEER ROAD		502-481-40	C7	5	1846	Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	2		No			Grind	
1677	PIONEER ROAD		502-451-26	C7	5	1845	Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	2		No			Grind	
1684	PIONEER ROAD		502-521-09	C6	5	1845	Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	4		No			Grind	
1742	PIONEER ROAD		502-481-37	C7	5	1846	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	4		No			Grind	
1673	PIONEER ROAD		502-451-31	C7	5	1846	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	7		No			Grind	
1746	PIONEER ROAD		502-481-46	C7	5	1846	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	4		No			Grind	
1151	PIONEER ROAD		525-061-44	B7	5	1848	Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	12		Yes			Replace Slab(s)	
1088	PIONEER ROAD		525-131-82	B7	5	1847	Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	7		Yes			Replace Slab(s)	
1042	PIONEER ROAD		999-000-65	B7	5	1850	Curb/Gutter	PCC	Spalling	1" to 2"	0.25		No			Patch	
1666	PIONEER ROAD		502-451-29	C7	5	1847	Curb/Gutter	PCC	Spalling	1" to 2"	0.5		No			Patch	
1667	PIONEER ROAD		502-451-29	C7	5	1847	Curb/Gutter	PCC	Spalling	1" to 2"	0.5		No			Patch	
1680	PIONEER ROAD		502-521-09	C7	5	1845	Curb/Gutter	PCC	Spalling	1" to 2"	0.5		No			Patch	
1146	PIONEER ROAD		525-061-45	B7	5	1848	Curb/Gutter	PCC	Spalling	1/2" to 1"	0.5		No			Replace C&G	
1681	PIONEER ROAD		502-521-09	C6	5	1845	Curb/Gutter	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
1065	PIONEER ROAD		525-181-12	A7	5	1851	Sidewalk	PCC	Spalling	1/2" to 1"	0.5		No			Replace C&G	
1068	PIONEER ROAD		525-181-12	A7	5	1851	Sidewalk	PCC	Spalling	1/2" to 1"	0.5		Yes			Replace C&G	
934	PIONEER ROAD		525-022-14	A7	5	1851	Sidewalk	PCC	Spalling	1/2" to 1"	1	1	No			Replace C&G	
1064	PIONEER ROAD		525-161-49	A7	5	1851	Curb/Gutter	PCC	Spalling	1/4" to 1/2"	0.5		No			Grind	
1074	PIONEER ROAD		525-181-12	B7	5	1850	Curb/Gutter	PCC	Spalling	1/4" to 1/2"	0.5		No			Grind	
1670	PIONEER ROAD		502-451-29	C7	5	1846	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
1025	PIONEER ROAD		525-031-51	B7	5	1849	Sidewalk	PCC	Spalling	1/4" to 1/2"	4		No			Grind	
1083	PIONEER ROAD		525-181-09	B7	5	1849	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
1128	PIONEER ROAD		502-451-29	C7	5	1847	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
1674	PIONEER ROAD		502-451-31	C7	5	1846	Sidewalk	PCC	Temporary Ramp	1" to 2"	5		No			Replace Slab	
1060	PIONEER ROAD		525-151-11	A7	5	1851	Sidewalk	PCC	Temporary Ramp	1/2" to 1"	6		No			Replace Slab	
1693	PIONEER WAY		502-521-13	C7	5	2005	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	Corner
1698	PIONEER WAY		502-521-13	C7	5	2005	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	Prev grind
1697	PIONEER WAY		502-521-13	C7	5	2005	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
1691	PIONEER WAY		502-521-13	C7	5	2005	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
1692	PIONEER WAY		502-521-13	C7	5	2005	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
1694	PIONEER WAY		502-521-13	C7	5	2005	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
1696	PIONEER WAY		502-521-13	C7	5	2005	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
1699	PIONEER WAY		502-521-13	C7	5	2005	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
1695				C7	5	2005	Sidewalk	PCC	Linear Cracking	No Displacement			Yes			Joint Seal	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
1733	PIONEER WAY		502-453-20	C7	5	2006	Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	1		No			Grind	
1700	PIONEER WAY		502-521-13	C7	5	2005	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	6		Yes			Grind	
5	PORTOLA PARKWAY		501-095-19	D6	5	1183	Sidewalk	PCC	Spalling	1/4" to 1/2"		0.5	No			Grind	.5'
113	PORTOLA PARKWAY		502-461-43	D6	5	1184	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	1'
4	PORTOLA PARKWAY		501-095-19	D6	5	1183	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	1'
6	PORTOLA PARKWAY		501-095-19	D6	5	1183	Sidewalk	PCC	Spalling	1/4" to 1/2"			No			Grind	1' Curb edge. Popouts also present
110	PORTOLA PARKWAY		502-461-46	D7	5	1184	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	2'
111	PORTOLA PARKWAY		502-461-46	D6	5	1184	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	2'
112	PORTOLA PARKWAY		502-461-46	D6	5	1184	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	2'
114	PORTOLA PARKWAY		502-461-43	D6	5	1184	Sidewalk	PCC	Faulting	1/4" to 1/2"			No	Yes		Grind	2'
115	PORTOLA PARKWAY		502-461-43	D6	5	1184	Sidewalk	PCC	Faulting	1/4" to 1/2"			No	Yes		Grind	2'
118	PORTOLA PARKWAY		501-095-19	D6	5	1183	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	2'
119	PORTOLA PARKWAY		501-095-19	D6	5	1183	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	2'
2	PORTOLA PARKWAY		501-095-19	D6	5	1183	Sidewalk	PCC	Spalling	1/4" to 1/2"			No	Yes		Grind	2', prev grind
120	PORTOLA PARKWAY		501-095-19	D6	5	1183	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	2', util cover
11633	PORTOLA PARKWAY		501-095-19	D6	5	1183	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	2', util cover
3	PORTOLA PARKWAY		501-095-19	D6	5	1183	Sidewalk	PCC	Faulting	1/4" to 1/2"			No	Yes		Grind	4'
11634	PORTOLA PARKWAY		501-095-19	D6	5	1183	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
11635	PORTOLA PARKWAY		501-095-19	D6	5	1183	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
116	PORTOLA PARKWAY		502-462-30	D6	5	1184	Sidewalk	PCC	Spalling	1/2" to 1"			No			Replace C&G	
146	PRESIDIO PLACE	13272	500-284-01	E4	5	1857	Curb/Gutter	PCC	Spalling	1/4" to 1/2"			No			Grind	1'
147	PRESIDIO PLACE	13292	500-284-03	E4	5	1857	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	2'
124	PRESIDIO PLACE	13301	500-281-21	E4	5	1857	Sidewalk	PCC	Spalling	1/4" to 1/2"			No			Grind	
148	PRESIDIO PLACE	13312	500-284-05	E4	5	1857	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"			No			Grind	
123	PRESIDIO PLACE	13321	500-281-23	E4	5	1857	Driveway	PCC	Spalling	1/4" to 1/2"			No			Grind	
122	PRESIDIO PLACE	13331	500-281-24	E4	5	1857	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1', prev grind
149	PRESIDIO PLACE	13362	500-284-10	E4	5	1857	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"			No			Grind	4'
150	PRESIDIO PLACE	13382	500-284-12	E4	5	1857	Driveway	PCC	Faulting	1" to 2"			No			Replace Driveway	20', Driveway higher than sidewalk.
1540	RANCHWOOD ROAD	13021	500-013-32	D5	5	1864	Driveway	PCC	Faulting	1/4" to 1/2"	2		No			Grind Driveway	
1537	RANCHWOOD ROAD	13022	500-011-54	D5	5	1864	Sidewalk	PCC	Other - Leave Comment	1/2" to 1"			No			Grind	Hole from prev sign
1536	RANCHWOOD ROAD	13022	500-011-54	D5	5	1864	Driveway	PCC	Faulting	1/4" to 1/2"	4		No			Grind Driveway	
1543	RANCHWOOD ROAD	13031	500-013-31	D5	5	1864	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
1541	RANCHWOOD ROAD	13031	500-013-31	D5	5	1864	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	6		No			Grind	
1542	RANCHWOOD ROAD	13031	500-013-31	D5	5	1864	Sidewalk	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
1535	RANCHWOOD ROAD	13032	500-011-53	D5	5	1864	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	10		No			Grind	
1534	RANCHWOOD ROAD	13042	500-011-52	D5	5	1864	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	10		No			Grind	
1533	RANCHWOOD ROAD	13076	500-011-49	D5	5	1864	Curb/Gutter	PCC	Spalling	1/4" to 1/2"	0.5		No			Grind	
1544	RANCHWOOD ROAD	13091	500-013-26	D5	5	1864	Sidewalk	PCC	Faulting	1/2" to 1"	3		No			Ramp	
1532	RANCHWOOD ROAD	13092	500-011-48	D5	5	1864	Sidewalk	PCC	Other - Leave Comment	1/4" to 1/2"			No			Grind	Popouts
1545	RANCHWOOD ROAD	13111	500-013-24	D5	5	1864	Curb/Gutter	PCC	Spalling	1" to 2"	0.5		No			Patch	
1531	RANCHWOOD ROAD	13122	500-011-45	E5	5	1864	Sidewalk	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	Corner
1530	RANCHWOOD ROAD	13142	500-011-43	E5	5	1864	Curb/Gutter	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
1521	RANCHWOOD ROAD	13151	500-011-24	E5	5	1864	Driveway	PCC	Other - Leave Comment	1/4" to 1/2"			No			Grind	Popout/scaling
1522	RANCHWOOD ROAD	13165	500-011-25	E5	5	1864	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
1529	RANCHWOOD ROAD	13182	500-011-40	E5	5	1864	Curb/Gutter	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
1528	RANCHWOOD ROAD	13192	500-011-39	E5	5	1864	Driveway	PCC	Faulting	1/4" to 1/2"	4		No			Grind Driveway	
1526	RANCHWOOD ROAD	13192	500-011-39	E5	5	1864	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	4		No			Grind	
1527	RANCHWOOD ROAD	13192	500-011-39	E5	5	1864	Curb/Gutter	PCC	Spalling	1/2" to 1"	2		No			Replace C&G	
1525	RANCHWOOD ROAD	13202	500-011-38	E5	5	1864	Sidewalk	PCC	Spalling	1/4" to 1/2"	4		No			Grind	
1524	RANCHWOOD ROAD	13212	500-011-37	E5	5	1864	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	17		No			Grind	
1523	RANCHWOOD ROAD	13222	500-011-36	E5	5	1864	Curb/Gutter	PCC	Spalling	1/4" to 1/2"	0.5		No			Grind	
11669	RAWLINGS WAY	15212	501-281-30	D6	5	1865	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
11673	RAWLINGS WAY	2515	501-281-35	D6	5	1865	Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	3		No			Grind	Util cover
11675	RAWLINGS WAY	2515	501-281-35	D6	5	1865	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
11674	RAWLINGS WAY	2515	501-281-35	D6	5	1865	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	55	1"	Yes			Grind	
11672	RAWLINGS WAY	2515	501-281-35	D6	5	1865	Curb/Gutter	PCC	Spalling	1/2" to 1"	0.5		No			Replace C&G	
12067	RAWLINGS WAY		501-097-61	D6	5	1866	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Borderline
11667	RAWLINGS WAY		501-281-33	D6	5	1865	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Manhole
2731	RAWLINGS WAY		501-114-01	D6	5	1866	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
2730	RAWLINGS WAY		501-094-09	D6	5	1866	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
12066	RAWLINGS WAY		501-114-01	D6	5	1866	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
2738	RAWLINGS WAY		501-114-01	D6	5	1866	Sidewalk	PCC	Other - Leave Comment	No Displacement			No			Field Assess-Monitor	Scaling this area
2726	RAWLINGS WAY		501-094-10	D6	5	1866	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	
2727				D6	5	1866	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
2734	RAWLINGS WAY		501-114-01	D6	5	1866	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
2737	RAWLINGS WAY		501-114-01	D6	5	1866	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
2729	RAWLINGS WAY		501-094-09	D6	5	1866	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
2722	RAWLINGS WAY		501-097-61	D6	5	1866	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
11668	RAWLINGS WAY		501-281-28	D6	5	1865	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
11671	RAWLINGS WAY		501-281-29	D6	5	1865	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		Yes			Grind	
11680	RAWLINGS WAY		501-211-93	D6	5	1865	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
11678	RAWLINGS WAY		501-211-92	D6	5	1865	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
11682	RAWLINGS WAY		501-211-93	D6	5	1865	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	20	1"	No			Grind	
11677	RAWLINGS WAY		501-211-92	D6	5	1865	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	4		No			Grind	
11679	RAWLINGS WAY		501-211-92	D6	5	1865	Sidewalk	PCC	Sidewalk Curb Separation	No Displacement	20	0.5"	Yes			Field Assess-Monitor	
2725	RAWLINGS WAY		501-096-68	D6	5	1866	Sidewalk	PCC	Spalling	1/2" to 1"	0.5		No			Replace C&G	
2723	RAWLINGS WAY		501-097-61	D6	5	1866	Curb/Gutter	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
11681	RAWLINGS WAY		501-211-93	D6	5	1865	Curb/Gutter	PCC	Spalling	1/4" to 1/2"	0.5		No			Grind	
2728	RAWLINGS WAY		501-094-15	D6	5	1866	Ramp	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
11670	RAWLINGS WAY		501-281-26	D6	5	1865	Ramp	PCC	Spalling	1/4" to 1/2"	4		No			Grind	
11676	RAWLINGS WAY		501-281-36	D6	5	1865	Ramp	PCC	Spalling	1/4" to 1/2"	4		No			Grind	
2732	RAWLINGS WAY		501-114-01	D6	5	1866	Sidewalk	PCC	Spalling	1/4" to 1/2"	4		No			Grind	
2733	RAWLINGS WAY		501-114-01	D6	5	1866	Sidewalk	PCC	Spalling	1/4" to 1/2"	2		No			Grind	
2735	RAWLINGS WAY		501-114-01	D6	5	1866	Sidewalk	PCC	Spalling	1/4" to 1/2"	2		No			Grind	
2736	RAWLINGS WAY		501-114-01	D6	5	1866	Sidewalk	PCC	Spalling	1/4" to 1/2"	2		No			Grind	
2724	RAWLINGS WAY		501-097-61	D6	5	1866	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
67	ROBINSON DR	12950	501-112-01	E5	5	1873	Curb/Gutter	PCC	Linear Cracking	1/4" to 1/2"			No			Grind	
36	ROBINSON DR		501-116-24	E6	5	1873	Sidewalk	PCC	Spalling	1/4" to 1/2"		0.5	No			Grind	.5', manhole
43	ROBINSON DR		501-113-28	E5	5	1873	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	1'
34	ROBINSON DR		501-116-25	E6	5	1873	Sidewalk	PCC	Spalling	1/4" to 1/2"			No			Grind	1'
46	ROBINSON DR		501-231-50	E5	5	1873	Sidewalk	PCC	Spalling	1/4" to 1/2"			No			Grind	1'
45	ROBINSON DR		501-231-73	E5	5	1873	Sidewalk	PCC	Faulting	1/4" to 1/2"			No	Yes		Grind	1', util cover
42	ROBINSON DR		501-113-28	E5	5	1873	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"			No			Grind	10'
48	ROBINSON DR		501-117-09	E5	5	1873	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	2', prev grind
44	ROBINSON DR		501-113-28	E5	5	1873	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	2', prev grind
70	ROBINSON DR		501-112-05	E6	5	1873	Sidewalk	PCC	Faulting	1/4" to 1/2"			No	Yes		Grind	2', prev grind
37	ROBINSON DR		501-116-24	E6	5	1873	Sidewalk	PCC	Faulting	1/2" to 1"			Yes			Ramp	3'
41	ROBINSON DR		501-261-13	E6	5	1873	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	3'
35	ROBINSON DR		501-116-28	E6	5	1873	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	3', manhole
47	ROBINSON DR		501-231-50	E5	5	1873	Sidewalk	PCC	Temporary Ramp	1/2" to 1"			No			Replace Slab	7'
68	ROBINSON DR		501-112-05	E5	5	1873	Sidewalk	PCC	Faulting	1/2" to 1"			No			Ramp	Edge with curb
69	ROBINSON DR		501-112-05	E5	5	1873	Curb/Gutter	PCC	Faulting	Over 2"			No			Replace Curb	
38	ROBINSON DR		501-116-24	E6	5	1873	Curb/Gutter	PCC	Spalling	1" to 2"			No			Patch	
39	ROBINSON DR		501-116-24	E6	5	1873	Curb/Gutter	PCC	Spalling	1" to 2"			No			Patch	
40	ROBINSON DR		501-261-14	E6	5	1873	Curb/Gutter	PCC	Spalling	1/2" to 1"			No			Replace C&G	
715	SAN JACINTO STREET		500-331-50	E5	5	1884	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"			No			Grind	2 ft length
761	SAN SABA STREET	2452	500-331-06	E5	5	1888	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	2 ft wide
757	SAN SABA STREET	2465	500-332-23	E5	5	1888	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide
756	SAN SABA STREET	2473	500-332-22	E5	5	1888	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	2 ft wide
762	SAN SABA STREET	2476	500-331-03	E5	5	1888	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	2 ft wide
755	SAN SABA STREET	2481	500-332-21	E5	5	1888	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
763	SAN SABA STREET	2492	500-331-01	E5	5	1888	Sidewalk	PCC	Faulting	1/2" to 1"			No			Ramp	4 ft wide
753	SAN SABA STREET	2505	500-332-18	E5	5	1888	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide
754	SAN SABA STREET	2505	500-332-18	E5	5	1888	Sidewalk	PCC	Faulting	1/2" to 1"			Yes			Ramp	1.5 ft wide
717	SAN SABA STREET	2508	500-331-47	E5	5	1888	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1.5 ft wide
716	SAN SABA STREET	2508	500-331-47	E5	5	1888	Sidewalk	PCC	Faulting	1/2" to 1"			No			Ramp	5 ft wide
718	SAN SABA STREET	2516	500-331-46	E5	5	1888	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide
719	SAN SABA STREET	2532	500-331-44	E5	5	1888	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
720	SAN SABA STREET	2532	500-331-44	E5	5	1888	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide
752	SAN SABA STREET	2545	500-332-13	E5	5	1888	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide
721	SAN SABA STREET	2548	500-331-42	E5	5	1888	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	Yes			Grind	.5 ft wide
722	SAN SABA STREET	2556	500-331-41	E5	5	1888	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	Yes			Grind	.5 ft wide
728	SAN SABA STREET	2561	500-331-36	E5	5	1888	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
727	SAN SABA STREET	2561	500-331-36	E5	5	1888	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide
723	SAN SABA STREET	2564	500-331-40	E5	5	1888	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	2.5 ft wide
724	SAN SABA STREET	2572	500-331-39	E5	5	1888	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide
725	SAN SABA STREET	2580	500-331-38	E5	5	1888	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
726				E5	5	1888	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	1.5 ft wide

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
737	SAN SIMON	2428	500-331-13	E5	5	1883	Sidewalk	PCC	Faulting	1/4" to 1/2"			Yes			Grind	1 ft wide
738	SAN SIMON	2428	500-331-13	E5	5	1883	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1.5 ft wide
736	SAN SIMON	2465	500-331-20	E5	5	1883	Sidewalk	PCC	Faulting	1/2" to 1"			No			Ramp	3 ft wide
740	SAN SIMON	2476	500-332-04	E5	5	1883	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide, prev grinded
739	SAN SIMON	2476	500-332-04	E5	5	1883	Sidewalk	PCC	Faulting	1" to 2"			No			Replace Slab	2 ft wide with some spalling, prev grinded
741	SAN SIMON	2492	500-332-06	E5	5	1883	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1.5 ft wide
743	SAN SIMON	2500	500-332-07	E5	5	1883	Sidewalk	PCC	Faulting	1/2" to 1"			No			Ramp	1 ft wide
742	SAN SIMON	2500	500-332-07	E5	5	1883	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	2 ft wide
735	SAN SIMON	2505	500-331-25	E5	5	1883	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide
744	SAN SIMON	2508	500-332-08	E5	5	1883	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1.5 ft wide
745	SAN SIMON	2508	500-332-08	E5	5	1883	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Replace Slab	Prev grinded, 1 ft wide
734	SAN SIMON	2513	500-331-26	E5	5	1883	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	4 ft wide
746	SAN SIMON	2524	500-332-10	E5	5	1883	Sidewalk	PCC	Faulting	1/2" to 1"			Yes			Ramp	2 ft wide
747	SAN SIMON	2540	500-332-12	E5	5	1883	Sidewalk	PCC	Faulting	1/2" to 1"			No			Ramp	1.5 ft wide
1654	SARATOGA DRIVE	13331	500-284-18	E4	5	1894	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
1658	SARATOGA DRIVE	2091	500-283-11	E4	5	1894	Driveway	PCC	Faulting	1/4" to 1/2"	4		No			Grind Driveway	Prev grind
779	SOLINDA	13061	500-251-22	D5	5	1920	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
780	SOLINDA	13061	500-251-22	D5	5	1920	Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
781	SOLINDA	13071	500-251-21	E5	5	1920	Driveway	PCC	Faulting	1/4" to 1/2"			No			Grind Driveway	Running along sidewalk, between driveway and house
782	SOLINDA	13091	500-251-19	E5	5	1920	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide
12074	SONBRIA	2152	500-262-28	E5	5	1921	Sidewalk	PCC	Spalling	1/4" to 1/2"	0.5		No			Grind	
804	SONBRIA	2162	500-262-29	E5	5	1921	Sidewalk	PCC	Spalling	1" to 2"	1.5	1	No			Patch	
803	SONBRIA	2171	500-262-23	E5	5	1921	Curb/Gutter	PCC	Spalling	1" to 2"	1		No			Patch	
12069	SONBRIA	2212	500-263-15	E5	5	1921	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
12070	SONBRIA	2232	500-263-13	E5	5	1921	Sidewalk	PCC	Spalling	1/4" to 1/2"	0.5		No			Grind	
805	TIBURON WAY	13261	500-262-33	E5	5	1933	Driveway	PCC	Faulting	1/4" to 1/2"		1	No			Grind Driveway	
136	TIBURON WAY	13332	500-282-21	E5	5	1933	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	2'
137	TIBURON WAY	13332	500-282-21	E5	5	1933	Driveway	PCC	Other - Leave Comment	1/4" to 1/2"			No			Grind	Popout
138	TIBURON WAY	13342	500-282-20	E5	5	1933	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	2'
139	TIBURON WAY	13362	500-282-18	E5	5	1933	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1'
140	TIBURON WAY	13362	500-282-18	E5	5	1933	Sidewalk	PCC	Other - Leave Comment	1/4" to 1/2"			No			Grind	Popouts
1659	TIBURON WAY	2142	500-282-15	E4	5	1933	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
134	TIBURON WAY	2161	500-281-01	E5	5	1933	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1'
133	TIBURON WAY	2161	500-281-01	E5	5	1933	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	4'
135	TIBURON WAY	2161	500-281-01	E5	5	1933	Curb/Gutter	PCC	Spalling	Over 2"			No			Replace C&G	
541	TUSTIN RANCH ROAD	13800	500-191-14	F4	5	1231	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide
542	TUSTIN RANCH ROAD	13800	500-191-14	F4	5	1231	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide
544	TUSTIN RANCH ROAD	13800	500-191-14	F4	5	1231	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide
536	TUSTIN RANCH ROAD	13800	500-191-14	F4	5	1229	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide
538	TUSTIN RANCH ROAD	13800	500-191-14	F4	5	1231	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide, at manhole
527	TUSTIN RANCH ROAD	13800	500-191-14	F4	5	1231	Sidewalk	PCC	Faulting	1/2" to 1"			No			Ramp	1.5 ft wide
528	TUSTIN RANCH ROAD	13800	500-191-14	F4	5	1231	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1.5 ft wide
547	TUSTIN RANCH ROAD	13800	500-191-14	E4	5	1231	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1.5 ft wide
533	TUSTIN RANCH ROAD	13800	500-191-14	F4	5	1229	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1.5 ft wide
535	TUSTIN RANCH ROAD	13800	500-191-14	F4	5	1229	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1.5 ft wide
539	TUSTIN RANCH ROAD	13800	500-191-14	F4	5	1231	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	2 ft wide
546	TUSTIN RANCH ROAD	13800	500-191-14	F4	5	1231	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	2 ft wide
534	TUSTIN RANCH ROAD	13800	500-191-14	F4	5	1229	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	2 ft wide
531	TUSTIN RANCH ROAD	13800	500-191-14	F4	5	1229	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"			No			Grind	2 ft wide
537	TUSTIN RANCH ROAD	13800	500-191-14	F4	5	1229	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	2.5 ft wide
532	TUSTIN RANCH ROAD	13800	500-191-14	F4	5	1229	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"			No			Grind	2.5 ft wide
530	TUSTIN RANCH ROAD	13800	500-191-14	F4	5	1229	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"			No			Grind	4 ft length
543	TUSTIN RANCH ROAD	13800	500-191-14	F4	5	1231	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	4 ft wide
529	TUSTIN RANCH ROAD	13800	500-191-14	F4	5	1229	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	4.5 ft wide
540	TUSTIN RANCH ROAD	13800	500-191-14	F4	5	1231	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"			No			Grind	5 ft in length
548	TUSTIN RANCH ROAD	13800	500-191-14	E4	5	1231	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"			No			Grind	5 ft wide
549	TUSTIN RANCH ROAD	13800	500-191-14	E4	5	1231	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"			No			Grind	6 ft length
545	TUSTIN RANCH ROAD	13800	500-191-14	F4	5	1231	Sidewalk	PCC	Spalling	1/4" to 1/2"			No			Grind	
1192	TUSTIN RANCH ROAD	2452	500-185-01	E5	5	1232	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
1193	TUSTIN RANCH ROAD	2452	500-185-01	E5	5	1232	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	Prev grind
1190	TUSTIN RANCH ROAD	2452	500-185-01	E5	5	1232	Sidewalk	PCC	Faulting	1/2" to 1"	3		No			Ramp	
1191	TUSTIN RANCH ROAD	2452	500-185-01	E5	5	1232	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
1194	TUSTIN RANCH ROAD	2452	500-185-01	E5	5	1232	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
1203				i	E5	5	1232	Cross Gutter	PCC	Linear Cracking	No Displacement		No			Joint Seal	Crack going across most of gutter

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP	Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
1205	TUSTIN RANCH ROAD	2505	500-185-06	E5	5	1232		Sidewalk	PCC	Linear Cracking	1/2" to 1"	2		No			Grind	Crack running across whole sidewalk
1206	TUSTIN RANCH ROAD	2505	500-185-06	E5	5	1232		Sidewalk	PCC	Faulting	1/2" to 1"	8		No			Ramp	
1195	TUSTIN RANCH ROAD	2505	500-185-06	E5	5	1232		Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
1197	TUSTIN RANCH ROAD	2505	500-185-06	E5	5	1232		Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
1199	TUSTIN RANCH ROAD	2505	500-185-06	E5	5	1232		Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
1201	TUSTIN RANCH ROAD	2505	500-185-06	E5	5	1232		Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
1204	TUSTIN RANCH ROAD	2505	500-185-06	E5	5	1232		Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
1207	TUSTIN RANCH ROAD	2505	500-185-06	E5	5	1232		Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
1209	TUSTIN RANCH ROAD	2505	500-185-06	E5	5	1232		Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		Yes			Grind	
1211	TUSTIN RANCH ROAD	2505	500-185-06	E5	5	1232		Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
1212	TUSTIN RANCH ROAD	2505	500-185-06	E5	5	1232		Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
1213	TUSTIN RANCH ROAD	2505	500-185-06	E5	5	1232		Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
1196	TUSTIN RANCH ROAD	2505	500-185-06	E5	5	1232		Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	3.5		No			Grind	
1202	TUSTIN RANCH ROAD	2505	500-185-06	E5	5	1232		Sidewalk	PCC	Linear Cracking	No Displacement	8	1"	No			Joint Seal	
1208	TUSTIN RANCH ROAD	2505	500-185-06	E5	5	1232		Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	70		No			Grind	
1200	TUSTIN RANCH ROAD	2505	500-185-06	E5	5	1232		Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	4.5		No			Grind	
1210	TUSTIN RANCH ROAD	2505	500-185-06	E5	5	1232		Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	30		No			Grind	
1198	TUSTIN RANCH ROAD	2505	500-185-06	E5	5	1232		Curb/Gutter	PCC	Spalling	1/2" to 1"	1.5		No			Replace C&G	
490	TUSTIN RANCH ROAD		500-181-07	F4	5	1228		Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
495	TUSTIN RANCH ROAD		500-181-07	F4	5	1228		Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 ft wide
521	TUSTIN RANCH ROAD		500-183-04	F4	5	1230		Sidewalk	PCC	Faulting	1/4" to 1/2"		0.5	No			Grind	.5 wide ft
485	TUSTIN RANCH ROAD		500-181-04	F4	5	1228		Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide
526	TUSTIN RANCH ROAD		500-183-04	F4	5	1230		Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide
492	TUSTIN RANCH ROAD		500-181-07	F4	5	1228		Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"			No			Grind	1 ft wide at edison patch
494	TUSTIN RANCH ROAD		500-181-07	F4	5	1228		Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1.5 ft wide
493	TUSTIN RANCH ROAD		500-181-07	F4	5	1228		Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	2 ft wide
486	TUSTIN RANCH ROAD		500-181-06	F4	5	1228		Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	2.5 ft wide
522	TUSTIN RANCH ROAD		500-183-04	F4	5	1230		Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	2.5 ft wide
487	TUSTIN RANCH ROAD		500-181-06	F4	5	1228		Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"			No			Grind	3 ft length
489	TUSTIN RANCH ROAD		500-181-07	F4	5	1228		Curb/Gutter	PCC	Sidewalk Curb Separation	1" to 2"			No			Replace Curb	3.5 ft length
482	TUSTIN RANCH ROAD		500-181-04	F4	5	1228		Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"			No			Grind	4 ft length
524	TUSTIN RANCH ROAD		500-183-04	F4	5	1230		Sidewalk	PCC	Faulting	1/2" to 1"			No			Ramp	4 ft wide
488	TUSTIN RANCH ROAD		500-181-07	F4	5	1228		Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	4 ft wide
491	TUSTIN RANCH ROAD		500-181-07	F4	5	1228		Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	4 ft wide
525	TUSTIN RANCH ROAD		500-183-04	F4	5	1230		Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"			No			Grind	5 ft length
117	TUSTIN RANCH ROAD		502-462-30	C6	5	1250		Sidewalk	PCC	Temporary Ramp	Over 2"			No			Replace Slab	5'
550	TUSTIN RANCH ROAD		500-192-20	E4	5	1233		Ramp	PCC	Linear Cracking	No Displacement			No			Joint Seal	Across whole ramp
484	TUSTIN RANCH ROAD		500-181-04	F4	5	1228		Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"			No			Grind	At edison patch
2631	TUSTIN RANCH ROAD		500-232-10	E5	5	1234		Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Borderline
11638	TUSTIN RANCH ROAD		502-521-19	D6	5	1249		Sidewalk	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	Corner
12065	TUSTIN RANCH ROAD		501-094-11	D6	5	1246		Sidewalk	PCC	Spalling	1/4" to 1/2"	0.5		No			Grind	Corner
1706	TUSTIN RANCH ROAD		502-521-13	C6	5	1251		Sidewalk	PCC	Other - Leave Comment	1/2" to 1"			No			Grind	Hole from prev pole
11870	TUSTIN RANCH ROAD		501-095-08	D6	5	1248		Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Hydrant
12068	TUSTIN RANCH ROAD		501-106-06	D6	5	1244		Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	4		No			Grind	Hydrant base
11817	TUSTIN RANCH ROAD		501-161-05	D5	5	1240		Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Near manhole
11837	TUSTIN RANCH ROAD		501-104-16	D6	5	1244		Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Near manhole
11838	TUSTIN RANCH ROAD		501-106-06	D6	5	1244		Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Near manhole
11754	TUSTIN RANCH ROAD		501-109-79	D5	5	1241		Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Near manhole
11807	TUSTIN RANCH ROAD		501-107-24	D5	5	1239		Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Near manhole
483	TUSTIN RANCH ROAD		500-181-04	F4	5	1228		Sidewalk	PCC	Patch / Utility Cut	1" to 2"			No			Patch	Patch is broken in.
2638	TUSTIN RANCH ROAD		500-221-07	E5	5	1236		Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	2		No			Grind	Pole base
1721	TUSTIN RANCH ROAD		502-471-27	C7	5	1250		Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	2		No			Grind	Pole base
11750	TUSTIN RANCH ROAD		501-109-79	D5	5	1241		Sidewalk	PCC	Faulting	1" to 2"	5		Yes			Replace Slab	Prev grind
2618	TUSTIN RANCH ROAD		500-234-69	E5	5	1234		Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	Prev grind
2679	TUSTIN RANCH ROAD		500-251-44	E5	5	1237		Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	Prev grind
2592	TUSTIN RANCH ROAD		500-272-41	E5	5	1235		Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	Prev grind
11812	TUSTIN RANCH ROAD		501-251-02	D5	5	1238		Sidewalk	PCC	Faulting	1/2" to 1"	5		Yes			Ramp	Prev grind
11843	TUSTIN RANCH ROAD		501-106-06	D6	5	1244		Sidewalk	PCC	Faulting	1/2" to 1"	5		Yes			Ramp	Prev grind
11656	TUSTIN RANCH ROAD		501-281-32	D6	5	1249		Sidewalk	PCC	Faulting	1/2" to 1"	6		Yes			Ramp	Prev grind
11698	TUSTIN RANCH ROAD		501-241-89	D6	5	1245		Sidewalk	PCC	Faulting	1/2" to 1"	6		Yes			Ramp	Prev grind
2607	TUSTIN RANCH ROAD		500-234-69	E5	5	1234		Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
2617	TUSTIN RANCH ROAD		500-234-69	E5	5	1234		Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
2628	TUSTIN RANCH ROAD		500-232-10	E5	5	1234		Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
2572				E5	5	1237		Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
2684	TUSTIN RANCH ROAD		500-251-44	E5	5	1237	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
2686	TUSTIN RANCH ROAD		500-251-44	E5	5	1237	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		Yes			Grind	Prev grind
2597	TUSTIN RANCH ROAD		500-271-78	E5	5	1235	Sidewalk	PCC	Faulting	1/4" to 1/2"	6		No			Grind	Prev grind
2581	TUSTIN RANCH ROAD		500-272-41	E5	5	1235	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
2582	TUSTIN RANCH ROAD		500-272-41	E5	5	1235	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Prev grind
2580	TUSTIN RANCH ROAD		500-271-72	E5	5	1235	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
11816	TUSTIN RANCH ROAD		501-251-02	D5	5	1238	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
11822	TUSTIN RANCH ROAD		501-161-05	D5	5	1240	Sidewalk	PCC	Faulting	1/4" to 1/2"	6		No			Grind	Prev grind
11828	TUSTIN RANCH ROAD		501-191-59	D5	5	1242	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
11829	TUSTIN RANCH ROAD		501-191-59	D5	5	1242	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
11831	TUSTIN RANCH ROAD		501-191-59	D5	5	1242	Sidewalk	PCC	Faulting	1/4" to 1/2"	6		Yes			Grind	Prev grind
11850	TUSTIN RANCH ROAD		501-094-11	D6	5	1246	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
11691	TUSTIN RANCH ROAD		501-211-95	D6	5	1247	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
11692	TUSTIN RANCH ROAD		501-211-95	D6	5	1247	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	Prev grind
11658	TUSTIN RANCH ROAD		501-281-32	D6	5	1249	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
11659	TUSTIN RANCH ROAD		501-281-32	D6	5	1249	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
11660	TUSTIN RANCH ROAD		501-281-32	D6	5	1249	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	Prev grind
11661	TUSTIN RANCH ROAD		501-281-32	D6	5	1249	Sidewalk	PCC	Faulting	1/4" to 1/2"	6		Yes			Grind	Prev grind
11700	TUSTIN RANCH ROAD		501-241-89	D6	5	1245	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
11693	TUSTIN RANCH ROAD		501-211-95	D6	5	1245	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
11722	TUSTIN RANCH ROAD		501-131-33	D5	5	1243	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
11716	TUSTIN RANCH ROAD		501-131-32	D5	5	1243	Sidewalk	PCC	Faulting	1/4" to 1/2"	6		No			Grind	Prev grind
11799	TUSTIN RANCH ROAD		501-108-71	D5	5	1239	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
11719	TUSTIN RANCH ROAD		501-131-32	D5	5	1243	Sidewalk	PCC	Temporary Ramp	1/2" to 1"	6		Yes			Replace Slab	Prev grind
2584	TUSTIN RANCH ROAD		500-272-41	E5	5	1235	Sidewalk	PCC	Faulting	1" to 2"	5		Yes			Replace Slab	Prev grind
1728	TUSTIN RANCH ROAD		502-501-50	C7	5	1251	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		Yes			Grind	Prev grind
1729	TUSTIN RANCH ROAD		502-501-50	C7	5	1251	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		Yes			Grind	Prev grind
1702	TUSTIN RANCH ROAD		502-521-13	C6	5	1251	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	Prev grind
1707	TUSTIN RANCH ROAD		502-521-13	C6	5	1251	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
1711	TUSTIN RANCH ROAD		502-521-13	C6	5	1251	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
1712	TUSTIN RANCH ROAD		502-521-13	C6	5	1251	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Replace Slab	Prev grind, slab raised
1713	TUSTIN RANCH ROAD		502-521-13	C6	5	1251	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Replace Slab	Prev grind, slab raised
11653	TUSTIN RANCH ROAD		501-281-32	D6	5	1249	Sidewalk	PCC	Faulting	1/4" to 1/2"	6		Yes			Replace Slab	Prev grind, spall
11858	TUSTIN RANCH ROAD		501-096-68	D6	5	1248	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Replace Slab	Slab tilted
11859	TUSTIN RANCH ROAD		501-096-68	D6	5	1248	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Replace Slab	Slab tilted
11860	TUSTIN RANCH ROAD		501-096-68	D6	5	1248	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Replace Slab	Slab tilted
11861	TUSTIN RANCH ROAD		501-096-68	D6	5	1248	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Replace Slab	Slab tilted
11723	TUSTIN RANCH ROAD		501-131-33	D5	5	1243	Sidewalk	PCC	Patch / Utility Cut	1/2" to 1"	6		No			Grind	Util cover
11724	TUSTIN RANCH ROAD		501-131-33	D5	5	1243	Sidewalk	PCC	Patch / Utility Cut	1/2" to 1"	2		No			Grind	Util cover
11640	TUSTIN RANCH ROAD		502-521-19	D6	5	1249	Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	2		No			Grind	Util cover
11712	TUSTIN RANCH ROAD		501-131-31	D5	5	1243	Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	3		No			Grind	Util cover
1720	TUSTIN RANCH ROAD		502-471-27	C7	5	1250	Sidewalk	PCC	Faulting	1" to 2"	2		No			Replace Slab	Util cover
523	TUSTIN RANCH ROAD		500-183-04	F4	5	1230	Sidewalk	PCC	Divided Slab	1/4" to 1/2"			No			Replace Slab	Vert on 1 ft of crack
2613	TUSTIN RANCH ROAD		500-234-69	E5	5	1234	Sidewalk	PCC	Corner Break	1/4" to 1/2"	4		No			Grind	
2574	TUSTIN RANCH ROAD		500-263-21	E5	5	1237	Sidewalk	PCC	Corner Break	1/4" to 1/2"	2		No			Grind	
2623	TUSTIN RANCH ROAD		500-234-69	E5	5	1234	Sidewalk	PCC	Faulting	1" to 2"	4		Yes			Replace Slab	
2595	TUSTIN RANCH ROAD		500-272-41	E5	5	1235	Sidewalk	PCC	Faulting	1" to 2"	10		No			Replace Slab	
1732	TUSTIN RANCH ROAD		502-453-18	C7	5	1251	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	
2585	TUSTIN RANCH ROAD		500-272-41	E5	5	1235	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	
2591	TUSTIN RANCH ROAD		500-272-41	E5	5	1235	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	
11857	TUSTIN RANCH ROAD		501-096-68	D6	5	1248	Sidewalk	PCC	Faulting	1/2" to 1"	5		No			Ramp	
11862	TUSTIN RANCH ROAD		501-096-68	D6	5	1248	Sidewalk	PCC	Faulting	1/2" to 1"	2		Yes			Ramp	
11864	TUSTIN RANCH ROAD		501-096-68	D6	5	1248	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	
11867	TUSTIN RANCH ROAD		501-096-68	D6	5	1248	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	
11665	TUSTIN RANCH ROAD		501-281-33	D6	5	1249	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	
11707	TUSTIN RANCH ROAD		501-241-89	D6	5	1245	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	
11749	TUSTIN RANCH ROAD		501-109-79	D5	5	1241	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
2602	TUSTIN RANCH ROAD		500-233-05	E5	5	1234	Sidewalk	PCC	Faulting	1/4" to 1/2"	6		No			Grind	
2605	TUSTIN RANCH ROAD		500-233-05	E5	5	1234	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
2609	TUSTIN RANCH ROAD		500-234-69	E5	5	1234	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
2611	TUSTIN RANCH ROAD		500-234-69	E5	5	1234	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
2615	TUSTIN RANCH ROAD		500-234-69	E5	5	1234	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
2620	TUSTIN RANCH ROAD		500-234-69	E5	5	1234	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
2625				E5	5	1234	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
2636	TUSTIN RANCH ROAD		500-221-07	E5	5	1236	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
1718	TUSTIN RANCH ROAD		502-471-72	C7	5	1250	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
1722	TUSTIN RANCH ROAD		502-501-50	C7	5	1251	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
1723	TUSTIN RANCH ROAD		502-501-50	C7	5	1251	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
1724	TUSTIN RANCH ROAD		502-501-50	C7	5	1251	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
1725	TUSTIN RANCH ROAD		502-501-50	C7	5	1251	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
1726	TUSTIN RANCH ROAD		502-501-50	C7	5	1251	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		Yes			Grind	
1727	TUSTIN RANCH ROAD		502-501-50	C7	5	1251	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
1730	TUSTIN RANCH ROAD		502-453-18	C7	5	1251	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
1731	TUSTIN RANCH ROAD		502-453-18	C7	5	1251	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
1701	TUSTIN RANCH ROAD		502-521-13	C6	5	1251	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
1705	TUSTIN RANCH ROAD		502-521-13	C6	5	1251	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
1708	TUSTIN RANCH ROAD		502-521-13	C6	5	1251	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
1709	TUSTIN RANCH ROAD		502-521-13	C6	5	1251	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
1715	TUSTIN RANCH ROAD		502-521-13	C6	5	1249	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
2569	TUSTIN RANCH ROAD		500-263-21	E5	5	1237	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
2570	TUSTIN RANCH ROAD		500-263-21	E5	5	1237	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes	Yes		Grind	
2571	TUSTIN RANCH ROAD		500-263-21	E5	5	1237	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes	Yes		Grind	
2573	TUSTIN RANCH ROAD		500-263-21	E5	5	1237	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
2575	TUSTIN RANCH ROAD		500-263-21	E5	5	1237	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
2576	TUSTIN RANCH ROAD		500-263-21	E5	5	1237	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
2577	TUSTIN RANCH ROAD		500-263-21	E5	5	1237	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
2578	TUSTIN RANCH ROAD		500-263-21	E5	5	1237	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
2674	TUSTIN RANCH ROAD		500-251-44	E5	5	1237	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
2675	TUSTIN RANCH ROAD		500-251-44	E5	5	1237	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
2680	TUSTIN RANCH ROAD		500-251-44	E5	5	1237	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
2681	TUSTIN RANCH ROAD		500-251-44	E5	5	1237	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
2682	TUSTIN RANCH ROAD		500-251-44	E5	5	1237	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
2687	TUSTIN RANCH ROAD		500-251-44	E5	5	1237	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
2689	TUSTIN RANCH ROAD		500-251-44	E5	5	1237	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
2691	TUSTIN RANCH ROAD		500-251-44	E5	5	1237	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
2692	TUSTIN RANCH ROAD		500-251-44	E5	5	1237	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
2693	TUSTIN RANCH ROAD		500-251-44	E5	5	1237	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
2695	TUSTIN RANCH ROAD		500-251-44	E5	5	1237	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
2696	TUSTIN RANCH ROAD		500-251-44	E5	5	1237	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
2599	TUSTIN RANCH ROAD		500-271-78	E5	5	1235	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
2583	TUSTIN RANCH ROAD		500-272-41	E5	5	1235	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No	Yes		Grind	
2586	TUSTIN RANCH ROAD		500-272-41	E5	5	1235	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
2587	TUSTIN RANCH ROAD		500-272-41	E5	5	1235	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
2588	TUSTIN RANCH ROAD		500-272-41	E5	5	1235	Sidewalk	PCC	Faulting	1/4" to 1/2"	2					Grind	
2589	TUSTIN RANCH ROAD		500-272-41	E5	5	1235	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
2590	TUSTIN RANCH ROAD		500-272-41	E5	5	1235	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
2579	TUSTIN RANCH ROAD		500-271-72	E5	5	1235	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No			Grind	
1176	TUSTIN RANCH ROAD		500-192-20	E5	5	1233	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
1177	TUSTIN RANCH ROAD		500-192-20	E5	5	1233	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
1178	TUSTIN RANCH ROAD		500-192-20	E5	5	1233	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
1179	TUSTIN RANCH ROAD		500-192-20	E5	5	1233	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
1180	TUSTIN RANCH ROAD		500-192-20	E5	5	1233	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
1181	TUSTIN RANCH ROAD		500-192-20	E5	5	1233	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
1182	TUSTIN RANCH ROAD		500-192-20	E5	5	1233	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
1183	TUSTIN RANCH ROAD		500-192-20	E5	5	1233	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
1186	TUSTIN RANCH ROAD		500-192-20	E5	5	1233	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
1189	TUSTIN RANCH ROAD		500-192-20	E5	5	1233	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
11808	TUSTIN RANCH ROAD		501-104-08	D5	5	1238	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
11809	TUSTIN RANCH ROAD		501-251-02	D5	5	1238	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
11811	TUSTIN RANCH ROAD		501-251-02	D5	5	1238	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
11813	TUSTIN RANCH ROAD		501-251-02	D5	5	1238	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
11815	TUSTIN RANCH ROAD		501-251-02	D5	5	1238	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
11819	TUSTIN RANCH ROAD		501-161-05	D5	5	1240	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
11820	TUSTIN RANCH ROAD		501-161-05	D5	5	1240	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
11821	TUSTIN RANCH ROAD		501-161-05	D5	5	1240	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
11823	TUSTIN RANCH ROAD		501-161-05	D5	5	1240	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
11824	TUSTIN RANCH ROAD		501-161-05	D5	5	1240	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
11825				D5	5	1240	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
11826	TUSTIN RANCH ROAD		501-191-59	D5	5	1242	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
11827	TUSTIN RANCH ROAD		501-191-59	D5	5	1242	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
11830	TUSTIN RANCH ROAD		501-191-59	D5	5	1242	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
11832	TUSTIN RANCH ROAD		501-191-59	D5	5	1242	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
11833	TUSTIN RANCH ROAD		501-191-59	D5	5	1242	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		Yes			Grind	
11834	TUSTIN RANCH ROAD		501-104-16	D5	5	1242	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
11835	TUSTIN RANCH ROAD		501-104-16	D5	5	1242	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No	Yes		Grind	
11836	TUSTIN RANCH ROAD		501-104-16	D5	5	1244	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
11839	TUSTIN RANCH ROAD		501-106-06	D6	5	1244	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
11840	TUSTIN RANCH ROAD		501-106-06	D6	5	1244	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		Yes			Grind	
11842	TUSTIN RANCH ROAD		501-106-06	D6	5	1244	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
11844	TUSTIN RANCH ROAD		501-106-06	D6	5	1244	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
11845	TUSTIN RANCH ROAD		501-106-06	D6	5	1244	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
11846	TUSTIN RANCH ROAD		501-106-06	D6	5	1244	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
11847	TUSTIN RANCH ROAD		501-106-06	D6	5	1244	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No			Grind	
11848	TUSTIN RANCH ROAD		501-094-11	D6	5	1246	Sidewalk	PCC	Faulting	1/4" to 1/2"	6		No			Grind	
11849	TUSTIN RANCH ROAD		501-094-11	D6	5	1246	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
11851	TUSTIN RANCH ROAD		501-094-11	D6	5	1246	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
11852	TUSTIN RANCH ROAD		501-094-11	D6	5	1246	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
11853	TUSTIN RANCH ROAD		501-094-11	D6	5	1246	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
11854	TUSTIN RANCH ROAD		501-094-11	D6	5	1246	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
11856	TUSTIN RANCH ROAD		501-096-68	D6	5	1248	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No			Grind	
11865	TUSTIN RANCH ROAD		501-096-68	D6	5	1248	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
11866	TUSTIN RANCH ROAD		501-096-68	D6	5	1248	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
11868	TUSTIN RANCH ROAD		501-096-68	D6	5	1248	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
11869	TUSTIN RANCH ROAD		501-096-68	D6	5	1248	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
11685	TUSTIN RANCH ROAD		501-211-95	D6	5	1247	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes	Yes		Grind	
11686	TUSTIN RANCH ROAD		501-211-95	D6	5	1247	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
11687	TUSTIN RANCH ROAD		501-211-95	D6	5	1247	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
11688	TUSTIN RANCH ROAD		501-211-95	D6	5	1247	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
11689	TUSTIN RANCH ROAD		501-211-95	D6	5	1247	Sidewalk	PCC	Faulting	1/4" to 1/2"	6		Yes			Grind	
11690	TUSTIN RANCH ROAD		501-211-95	D6	5	1247	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
11684	TUSTIN RANCH ROAD		501-211-94	D6	5	1247	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
11666	TUSTIN RANCH ROAD		501-281-33	D6	5	1249	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
11652	TUSTIN RANCH ROAD		501-281-32	D6	5	1249	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		Yes			Grind	
11655	TUSTIN RANCH ROAD		501-281-32	D6	5	1249	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
11657	TUSTIN RANCH ROAD		501-281-32	D6	5	1249	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
11663	TUSTIN RANCH ROAD		501-281-32	D6	5	1249	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
11664	TUSTIN RANCH ROAD		501-281-32	D6	5	1249	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
11637	TUSTIN RANCH ROAD		502-521-19	D6	5	1249	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
11641	TUSTIN RANCH ROAD		502-521-19	D6	5	1249	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
11642	TUSTIN RANCH ROAD		502-521-19	D6	5	1249	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
11710	TUSTIN RANCH ROAD		501-241-90	D6	5	1245	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
11711	TUSTIN RANCH ROAD		501-241-90	D5	5	1245	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
11695	TUSTIN RANCH ROAD		501-241-89	D6	5	1245	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
11696	TUSTIN RANCH ROAD		501-241-89	D6	5	1245	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
11697	TUSTIN RANCH ROAD		501-241-89	D6	5	1245	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
11699	TUSTIN RANCH ROAD		501-241-89	D6	5	1245	Sidewalk	PCC	Faulting	1/4" to 1/2"	6		Yes			Grind	
11701	TUSTIN RANCH ROAD		501-241-89	D6	5	1245	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
11702	TUSTIN RANCH ROAD		501-241-89	D6	5	1245	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
11703	TUSTIN RANCH ROAD		501-241-89	D6	5	1245	Sidewalk	PCC	Faulting	1/4" to 1/2"	6		Yes			Grind	
11705	TUSTIN RANCH ROAD		501-241-89	D6	5	1245	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
11706	TUSTIN RANCH ROAD		501-241-89	D6	5	1245	Sidewalk	PCC	Faulting	1/4" to 1/2"	6		No			Grind	
11708	TUSTIN RANCH ROAD		501-241-89	D6	5	1245	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
11709	TUSTIN RANCH ROAD		501-241-89	D6	5	1245	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
11694	TUSTIN RANCH ROAD		501-211-95	D6	5	1245	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
11715	TUSTIN RANCH ROAD		501-131-32	D5	5	1243	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		Yes			Grind	
11717	TUSTIN RANCH ROAD		501-131-32	D5	5	1243	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
11718	TUSTIN RANCH ROAD		501-131-32	D5	5	1243	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
11720	TUSTIN RANCH ROAD		501-131-32	D5	5	1243	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		Yes			Grind	
11721	TUSTIN RANCH ROAD		501-131-32	D5	5	1243	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
11713	TUSTIN RANCH ROAD		501-131-31	D5	5	1243	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
11714	TUSTIN RANCH ROAD		501-131-31	D5	5	1243	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
11751				D5	5	1241	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
11801	TUSTIN RANCH ROAD		501-108-72	D5	5	1239	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
11795	TUSTIN RANCH ROAD		501-108-71	D5	5	1239	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		Yes			Grind	
11796	TUSTIN RANCH ROAD		501-108-71	D5	5	1239	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
11797	TUSTIN RANCH ROAD		501-108-71	D5	5	1239	Sidewalk	PCC	Faulting	1/4" to 1/2"	6		Yes			Grind	
11798	TUSTIN RANCH ROAD		501-108-71	D5	5	1239	Sidewalk	PCC	Faulting	1/4" to 1/2"	6		Yes			Grind	
11800	TUSTIN RANCH ROAD		501-108-71	D5	5	1239	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
11802	TUSTIN RANCH ROAD		501-107-24	D5	5	1239	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
11803	TUSTIN RANCH ROAD		501-107-24	D5	5	1239	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
11804	TUSTIN RANCH ROAD		501-107-24	D5	5	1239	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
11805	TUSTIN RANCH ROAD		501-107-24	D5	5	1239	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
1714	TUSTIN RANCH ROAD		502-521-13	C6	5	1249	Ramp	PCC	Linear Cracking	No Displacement	12		No			Joint Seal	
2600	TUSTIN RANCH ROAD		500-271-79	E5	5	1235	Ramp	PCC	Linear Cracking	1/4" to 1/2"	7		No			Replace Ramp	
11810	TUSTIN RANCH ROAD		501-251-02	D5	5	1238	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	6		Yes			Grind	
11654	TUSTIN RANCH ROAD		501-281-32	D6	5	1249	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	6		Yes			Grind	
11806	TUSTIN RANCH ROAD		501-107-24	D5	5	1239	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	5		No	Yes		Grind	
1703	TUSTIN RANCH ROAD		502-521-13	C6	5	1251	Sidewalk	PCC	Linear Cracking	No Displacement	4		Yes			Joint Seal	
1704	TUSTIN RANCH ROAD		502-521-13	C6	5	1251	Sidewalk	PCC	Linear Cracking	No Displacement	4		Yes			Joint Seal	
1710	TUSTIN RANCH ROAD		502-521-13	C6	5	1251	Sidewalk	PCC	Linear Cracking	No Displacement	4		Yes			Joint Seal	
2593	TUSTIN RANCH ROAD		500-272-41	E5	5	1235	Sidewalk	PCC	Linear Cracking	No Displacement	5		Yes			Joint Seal	
2594	TUSTIN RANCH ROAD		500-272-41	E5	5	1235	Sidewalk	PCC	Patch / Utility Cut	1/2" to 1"	3		No			Grind	
2606	TUSTIN RANCH ROAD		500-234-69	E5	5	1234	Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	5		No			Grind	
11683	TUSTIN RANCH ROAD		501-211-94	D6	5	1247	Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	4		No	Yes		Grind	
2598	TUSTIN RANCH ROAD		500-271-78	E5	5	1235	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	3		No			Grind	
1188	TUSTIN RANCH ROAD		500-192-20	E5	5	1233	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	4		No			Grind	
1184	TUSTIN RANCH ROAD		500-192-20	E5	5	1233	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	5		No			Grind	
11636	TUSTIN RANCH ROAD		502-521-19	D6	5	1249	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	5		No			Grind	
1717	TUSTIN RANCH ROAD		502-471-71	C7	5	1250	Curb/Gutter	PCC	Spalling	1" to 2"	1		No			Patch	
1185	TUSTIN RANCH ROAD		500-192-20	E5	5	1233	Curb/Gutter	PCC	Spalling	1" to 2"			No			Patch	
1716	TUSTIN RANCH ROAD		502-461-90	C7	5	1250	Curb/Gutter	PCC	Spalling	1/2" to 1"	0.5		No			Replace C&G	
11841	TUSTIN RANCH ROAD		501-106-06	D6	5	1244	Sidewalk	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
11863	TUSTIN RANCH ROAD		501-096-68	D6	5	1248	Sidewalk	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
11648	TUSTIN RANCH ROAD		502-521-19	D6	5	1249	Sidewalk	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
1187	TUSTIN RANCH ROAD		500-192-20	E5	5	1233	Curb/Gutter	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
11855	TUSTIN RANCH ROAD		501-094-11	D6	5	1246	Curb/Gutter	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
11651	TUSTIN RANCH ROAD		501-281-31	D6	5	1249	Curb/Gutter	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
11639	TUSTIN RANCH ROAD		502-521-19	D6	5	1249	Curb/Gutter	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
11643	TUSTIN RANCH ROAD		502-521-19	D6	5	1249	Curb/Gutter	PCC	Spalling	1/4" to 1/2"	0.5		No			Grind	
2601	TUSTIN RANCH ROAD		500-271-79	E5	5	1235	Ramp	PCC	Spalling	1/4" to 1/2"	1.5		No			Grind	
2641	TUSTIN RANCH ROAD		500-221-07	E5	5	1236	Sidewalk	PCC	Spalling	1/4" to 1/2"	4		No			Grind	
1719	TUSTIN RANCH ROAD		502-471-72	C7	5	1250	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
11814	TUSTIN RANCH ROAD		501-251-02	D5	5	1238	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
11818	TUSTIN RANCH ROAD		501-161-05	D5	5	1240	Sidewalk	PCC	Spalling	1/4" to 1/2"	0.5		No			Grind	
11662	TUSTIN RANCH ROAD		501-281-32	D6	5	1249	Sidewalk	PCC	Spalling	1/4" to 1/2"	1.5		No			Grind	
11649	TUSTIN RANCH ROAD		501-281-31	D6	5	1249	Sidewalk	PCC	Spalling	1/4" to 1/2"	0.5		No			Grind	
11650	TUSTIN RANCH ROAD		501-281-31	D6	5	1249	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
11644	TUSTIN RANCH ROAD		502-521-19	D6	5	1249	Sidewalk	PCC	Spalling	1/4" to 1/2"	0.5		No			Grind	
11645	TUSTIN RANCH ROAD		502-521-19	D6	5	1249	Sidewalk	PCC	Spalling	1/4" to 1/2"	0.5		No			Grind	
11646	TUSTIN RANCH ROAD		502-521-19	D6	5	1249	Sidewalk	PCC	Spalling	1/4" to 1/2"	0.5		No			Grind	
11647	TUSTIN RANCH ROAD		502-521-19	D6	5	1249	Sidewalk	PCC	Spalling	1/4" to 1/2"	0.5		No			Grind	
11704	TUSTIN RANCH ROAD		501-241-89	D6	5	1245	Sidewalk	PCC	Spalling	1/4" to 1/2"	1.5		No			Grind	
11752	TUSTIN RANCH ROAD		501-109-79	D5	5	1241	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
11753	TUSTIN RANCH ROAD		501-109-79	D5	5	1241	Sidewalk	PCC	Spalling	1/4" to 1/2"	2		No			Grind	
2604	TUSTIN RANCH ROAD		500-233-05	E5	5	1234	Curb/Gutter	PCC	Spalling	Over 2"	1		No			Replace C&G	
2603	TUSTIN RANCH ROAD		500-233-05	E5	5	1234	Sidewalk	PCC	Temporary Ramp	Over 2"	6		No			Replace Slab	
2596	TUSTIN RANCH ROAD		500-271-78	E5	5	1235	Sidewalk	PCC	Temporary Ramp	Over 2"	6		No			Replace Slab	
125	VALLEJO DRIVE	13261	500-281-17	E4	5	1945	Sidewalk	PCC	Spalling	1/4" to 1/2"			No			Grind	Small corner spalls
144	VALLEJO DRIVE	13271	500-284-24	E5	5	1945	Curb/Gutter	PCC	Spalling	1/4" to 1/2"			No			Grind	1'
145	VALLEJO DRIVE	13272	500-284-01	E5	5	1945	Curb/Gutter	PCC	Spalling	1/4" to 1/2"			No			Grind	1.5'
126	VALLEJO DRIVE	2011	500-281-16	E5	5	1945	Curb/Gutter	PCC	Spalling	1/4" to 1/2"			No			Grind	
127	VALLEJO DRIVE	2031	500-281-14	E5	5	1945	Curb/Gutter	PCC	Spalling	1/4" to 1/2"			No			Grind	1'
128	VALLEJO DRIVE	2081	500-281-09	E5	5	1945	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	2'
129	VALLEJO DRIVE	2101	500-281-07	E5	5	1945	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	2'
130	VALLEJO DRIVE	2111	500-281-06	E5	5	1945	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	2'
142				E5	5	1945	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	2'

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
143	VALLEJO DRIVE	2112	500-283-24	E5	5	1945	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	2', 1" gap between slabs
141	VALLEJO DRIVE	2152	500-283-20	E5	5	1945	Sidewalk	PCC	Spalling	1/4" to 1/2"			No			Grind	6", in center of slab
131	VALLEJO DRIVE	2161	500-281-01	E5	5	1945	Sidewalk	PCC	Spalling	1/4" to 1/2"			No			Grind	1'
132	VALLEJO DRIVE	2161	500-281-01	E5	5	1945	Curb/Gutter	PCC	Spalling	1/2" to 1"			No			Replace C&G	
777	VENTIA	13031	500-251-25	D5	5	1950	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	1 ft wide
778	VENTIA	13041	500-251-24	D5	5	1950	Driveway	PCC	Spalling	1/4" to 1/2"			No			Grind	
785	VENTIA	2162	500-252-01	D5	5	1950	Sidewalk	PCC	Faulting	1/4" to 1/2"		1	No			Grind	
786	VENTIA	2162	500-252-01	D5	5	1950	Sidewalk	PCC	Faulting	1/4" to 1/2"		1	No			Grind	
776	VENTIA	2181	500-251-30	D5	5	1950	Driveway	PCC	Faulting	1/2" to 1"			No			Grind Driveway	1 ft wide
775	VENTIA	2181	500-251-30	E5	5	1950	Driveway	PCC	Faulting	1/2" to 1"			No			Grind Driveway	Between driveway and house. Fault running along sidewalk
784	VENTIA	2202	500-252-05	E5	5	1950	Sidewalk	PCC	Faulting	1/4" to 1/2"			No			Grind	2 ft wide
1554	WICKSHIRE LANE	13021	500-013-11	D5	5	1966	Driveway	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
1553	WICKSHIRE LANE	13022	500-013-13	D5	5	1966	Driveway	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	
1552	WICKSHIRE LANE	13032	500-013-14	D5	5	1966	Driveway	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	
1551	WICKSHIRE LANE	13042	500-013-15	D5	5	1966	Driveway	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	
1550	WICKSHIRE LANE	13052	500-013-16	D5	5	1966	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
1549	WICKSHIRE LANE	13052	500-013-16	D5	5	1966	Driveway	PCC	Spalling	1/4" to 1/2"	2		No			Grind	
1555	WICKSHIRE LANE	13061	500-013-07	D5	5	1966	Curb/Gutter	PCC	Spalling	1" to 2"	0.5		No			Patch	
1556	WICKSHIRE LANE	13075	500-013-06	D5	5	1966	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
1557	WICKSHIRE LANE	13075	500-013-06	D5	5	1966	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
1558	WICKSHIRE LANE	13101	500-013-04	D5	5	1966	Curb/Gutter	PCC	Spalling	1/2" to 1"	0.5		No			Replace C&G	
1559	WICKSHIRE LANE	13111	500-013-03	D5	5	1966	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	4		No			Grind	
1560	WICKSHIRE LANE	13111	500-013-03	D5	5	1966	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	4		No			Grind	
1503	WICKSHIRE LANE	13141	500-011-02	D5	5	1966	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
1515	WICKSHIRE LANE	13142	500-011-22	D5	5	1966	Ramp	PCC	Faulting	1/4" to 1/2"	3		No			Grind Ramp	
1514	WICKSHIRE LANE	13152	500-011-21	D5	5	1966	Curb/Gutter	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
1513	WICKSHIRE LANE	13192	500-011-18	E5	5	1966	Curb/Gutter	PCC	Spalling	1/2" to 1"	0.5		No			Replace C&G	
1504	WICKSHIRE LANE	13201	500-011-07	E5	5	1966	Curb/Gutter	PCC	Spalling	1/4" to 1/2"	0.5		No			Grind	
1512	WICKSHIRE LANE	13202	500-011-17	E5	5	1966	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
1511	WICKSHIRE LANE	13212	500-011-16	E5	5	1966	Curb/Gutter	PCC	Spalling	1/2" to 1"	0.5		No			Replace C&G	
1507	WICKSHIRE LANE	13221	500-011-09	E5	5	1966	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
1506	WICKSHIRE LANE	13221	500-011-09	E5	5	1966	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	3		No			Grind	
1505	WICKSHIRE LANE	13221	500-011-09	E5	5	1966	Curb/Gutter	PCC	Spalling	1/4" to 1/2"	0.5		No			Grind	
1510	WICKSHIRE LANE	13222	500-011-15	E5	5	1966	Driveway	PCC	Faulting	1/4" to 1/2"	2		No			Grind Driveway	
1509	WICKSHIRE LANE	13232	500-011-14	E5	5	1966	Driveway	PCC	Spalling	1/4" to 1/2"	2		No			Grind	
1508	WICKSHIRE LANE	13232	500-011-14	E5	5	1966	Sidewalk	PCC	Spalling	1/4" to 1/2"	2		No			Grind	

Zone 6

2905	BARRANCA PARKWAY	2457	434-441-16	I2	6	1280	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	8		No			Grind	Running parallel to sidewalk
2903	BARRANCA PARKWAY	2457	434-441-16	I2	6	1280	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		No			Ramp	
2902	BARRANCA PARKWAY	2457	434-441-16	I2	6	1280	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
2904	BARRANCA PARKWAY	2457	434-441-16	I2	6	1280	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
2906	BARRANCA PARKWAY	2457	434-441-16	I2	6	1280	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
2907	BARRANCA PARKWAY	2457	434-441-16	I2	6	1280	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
2899	BARRANCA PARKWAY	2677	434-441-30	I2	6	1279	Sidewalk	PCC	Faulting	1/4" to 1/2"	4.5		No			Grind	
2900	BARRANCA PARKWAY	2677	434-441-30	I2	6	1279	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
2901	BARRANCA PARKWAY	2677	434-441-30	I2	6	1279	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
2898	BARRANCA PARKWAY	2687	434-441-29	I2	6	1279	Sidewalk	PCC	Faulting	1/2" to 1"	2.5		No			Ramp	
2891	BARRANCA PARKWAY	2687	434-441-29	I3	6	1279	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
2892	BARRANCA PARKWAY	2687	434-441-29	I3	6	1279	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
2893	BARRANCA PARKWAY	2687	434-441-29	I3	6	1279	Sidewalk	PCC	Faulting	1/4" to 1/2"	9		No			Grind	
2894	BARRANCA PARKWAY	2687	434-441-29	I3	6	1279	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
2895	BARRANCA PARKWAY	2687	434-441-29	I3	6	1279	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
2896	BARRANCA PARKWAY	2687	434-441-29	I3	6	1279	Sidewalk	PCC	Faulting	1/4" to 1/2"	8		No			Grind	
2897	BARRANCA PARKWAY	2687	434-441-29	I3	6	1279	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
2888	BARRANCA PARKWAY	2895	434-441-12	I3	6	1279	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
2889	BARRANCA PARKWAY	2895	434-441-12	I3	6	1279	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
2890	BARRANCA PARKWAY	2895	434-441-12	I3	6	1279	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
2919	BARRANCA PARKWAY		434-021-22	I2	6	1280	Sidewalk	AC	Alligator Cracking	No Displacement	3	5	No			AC Patch	15 sq ft
2920	BARRANCA PARKWAY		434-021-22	I2	6	1280	Sidewalk	PCC	Other - Leave Comment	No Displacement			No			Field Assess-Monitor	Large chunk missing in sidewalk. Some raveling
2913	BARRANCA PARKWAY		434-021-22	I2	6	1280	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Prev grind
2910	BARRANCA PARKWAY		434-021-22	I2	6	1280	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	5		No			Grind	Running parallel with sidewalk
2918	BARRANCA PARKWAY		434-021-22	I2	6	1280	Driveway	AC	Faulting	1/4" to 1/2"	7		No			Grind Driveway	
2908				I2	6	1280	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
2909	BARRANCA PARKWAY		434-021-22	I2	6	1280	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
2911	BARRANCA PARKWAY		434-021-22	I2	6	1280	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
2912	BARRANCA PARKWAY		434-021-22	I2	6	1280	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
2914	BARRANCA PARKWAY		434-021-22	I2	6	1280	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
2915	BARRANCA PARKWAY		434-021-22	I2	6	1280	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
2916	BARRANCA PARKWAY		434-021-22	I2	6	1280	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
2917	BARRANCA PARKWAY		434-021-22	I2	6	1280	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
8410	BENTLEY CIRCLE	14712	432-511-06	G4	6	1547	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
8411	BENTLEY CIRCLE	14712	432-511-06	G4	6	1547	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
8409	BENTLEY CIRCLE	2722	432-511-07	G4	6	1547	Sidewalk	PCC	Linear Cracking	No Displacement			No			Joint Seal	Lots or cracks on whole driveway. Not much vert.
8408	BENTLEY CIRCLE	2722	432-511-07	G4	6	1547	Driveway	PCC	Linear Cracking	1/4" to 1/2"	5		No			Grind	
10722	CHAMBERS ROAD	14131	432-471-22	F4	6	1603	Sidewalk	PCC	Divided Slab	1/4" to 1/2"	12		No			Replace Slab	
10723	CHAMBERS ROAD	14131	432-471-22	F4	6	1603	Sidewalk	PCC	Divided Slab	1/4" to 1/2"	12		No			Replace Slab	
10720	CHAMBERS ROAD	14131	432-471-22	F4	6	1603	Driveway	PCC	Linear Cracking	1/4" to 1/2"	6		No			Grind	
10721	CHAMBERS ROAD	14131	432-471-22	F4	6	1603	Driveway	PCC	Linear Cracking	1/4" to 1/2"	6		No			Grind	
10719	CHAMBERS ROAD	14131	432-471-22	F4	6	1603	Curb/Gutter	PCC	Spalling	1/2" to 1"	5		No			Replace C&G	
10724	CHAMBERS ROAD	14152	432-472-23	F4	6	1603	Driveway	PCC	Linear Cracking	1/2" to 1"	6		No			Grind	
10725	CHAMBERS ROAD	14152	432-472-23	F4	6	1603	Driveway	PCC	Linear Cracking	1/4" to 1/2"	6		No			Grind	
10717	CHAMBERS ROAD	14171	432-471-13	F4	6	1603	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
10718	CHAMBERS ROAD	14171	432-471-13	F4	6	1603	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	10		No			Grind	
10716	CHAMBERS ROAD	14201	432-471-12	F4	6	1603	Sidewalk	PCC	Patch / Utility Cut	1" to 2"	5		No			Ramp	Manhole patch
10712	CHAMBERS ROAD	14251	432-471-11	F4	6	1603	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Prev grind
10713	CHAMBERS ROAD	14251	432-471-11	F4	6	1603	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
10715	CHAMBERS ROAD	14251	432-471-11	F4	6	1603	Sidewalk	PCC	Punchout	1/2" to 1"	3		No			Replace Slab	
10714	CHAMBERS ROAD	14251	432-471-11	F4	6	1603	Sidewalk	PCC	Spalling	1/4" to 1/2"	2		No			Grind	
10704	CHAMBERS ROAD	14272	432-472-07	F4	6	1603	Curb/Gutter	PCC	Linear Cracking	1/2" to 1"	2		No			Grind	5 cracks in gutter
10707	CHAMBERS ROAD	14272	432-472-07	F4	6	1603	Sidewalk	PCC	Buckled Slab	1" to 2"	12		Yes			Replace Slab(s)	Prev grind
10703	CHAMBERS ROAD	14272	432-472-07	F4	6	1603	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10708	CHAMBERS ROAD	14272	432-472-07	F4	6	1603	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No	Yes		Grind	
10706	CHAMBERS ROAD	14272	432-472-07	F4	6	1603	Driveway	PCC	Linear Cracking	1" to 2"	6		No			Replace Driveway	
10705	CHAMBERS ROAD	14272	432-472-07	F4	6	1603	Sidewalk	PCC	Spalling	1" to 2"	1		No			Patch	
10702	CHAMBERS ROAD	14312	432-472-06	F4	6	1603	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		Yes			Grind	
10711	CHAMBERS ROAD	14321	432-471-09	F4	6	1603	Curb/Gutter	PCC	Linear Cracking	1/2" to 1"	2		No			Grind	
10710	CHAMBERS ROAD	14321	432-471-09	F4	6	1603	Driveway	PCC	Linear Cracking	1/2" to 1"	8		No			Grind	
10709	CHAMBERS ROAD	14341	432-471-08	F4	6	1603	Sidewalk	PCC	Corner Break	1/2" to 1"	3		No			Ramp	
10701	CHAMBERS ROAD	14402	432-472-02	G4	6	1603	Sidewalk	PCC	Other - Leave Comment	No Displacement			No			N/A	No distress
10699	CHAMBERS ROAD	14450	432-472-01	G4	6	1603	Sidewalk	PCC	Other - Leave Comment	No Displacement			No			Field Assess-Monitor	New sidewalk added
10700	CHAMBERS ROAD	14450	432-472-01	G4	6	1603	Sidewalk	PCC	Other - Leave Comment	No Displacement			No			Field Assess-Monitor	New sidewalk added
10695	CHAMBERS ROAD	14451	432-471-26	G4	6	1603	Curb/Gutter	PCC	Linear Cracking	1/2" to 1"	2		No			Grind	4 cracks in gutter
10697	CHAMBERS ROAD	14451	432-472-22	G4	6	1603	Sidewalk	PCC	Patch / Utility Cut	1" to 2"	3		No			Ramp	Util cover
10694	CHAMBERS ROAD	14451	432-471-26	G4	6	1603	Driveway	PCC	Corner Break	1/4" to 1/2"	4		No			Grind	
10692	CHAMBERS ROAD	14451	432-471-26	G4	6	1603	Sidewalk	PCC	Faulting	1/2" to 1"	12		No			Ramp	
10696	CHAMBERS ROAD	14451	432-472-22	G4	6	1603	Sidewalk	PCC	Faulting	1/4" to 1/2"	10		No			Grind	
10698	CHAMBERS ROAD	14451	432-472-22	G4	6	1603	Driveway	PCC	Linear Cracking	1/4" to 1/2"	8		No			Grind	
10693	CHAMBERS ROAD	14451	432-471-26	G4	6	1603	Driveway	PCC	Punchout	1/4" to 1/2"	4		No			Replace Slab	
10691	CHAMBERS ROAD	14471	432-471-29	G4	6	1603	Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	3		No			Grind	Hydrant base
10690	CHAMBERS ROAD	14471	432-471-29	G4	6	1603	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
10993	DOW AVENUE	2692	432-491-13	G4	6	1651	Sidewalk	PCC	Faulting	1/2" to 1"	3		No			Ramp	At water meter patch
11001	DOW AVENUE	2911	432-492-64	H4	6	1651	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
10994	DOW AVENUE	2942	432-491-24	H4	6	1651	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
10995	DOW AVENUE	2942	432-491-24	H4	6	1651	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
10999	DOW AVENUE	2961	432-492-63	H4	6	1651	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
11000	DOW AVENUE	2961	432-492-63	H4	6	1651	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
10998	DOW AVENUE	3002	432-502-05	H4	6	1651	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
10997	DOW AVENUE	3002	432-502-05	H4	6	1651	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	40		No			Grind	
10996	DOW AVENUE	3002	432-502-05	H4	6	1651	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	5		No			Grind	
8967	EDINGER AVENUE	3017	434-341-03	H4	6	1052	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
8968	EDINGER AVENUE	3017	434-341-03	H4	6	1052	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
8974	EDINGER AVENUE	3091	434-201-24	H4	6	1052	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
8940	EDINGER AVENUE		434-371-61	H4	6	1053	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
8929	EDINGER AVENUE		434-371-62	I4	6	1053	Sidewalk	PCC	Faulting	1/4" to 1/2"	4.5		No			Grind	Prev grind
8931	EDINGER AVENUE		434-371-62	I4	6	1053	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	Prev grind
8932	EDINGER AVENUE		434-371-62	I4	6	1053	Sidewalk	PCC	Faulting	1/4" to 1/2"	6.5		No			Grind	Prev grind
8937				I4	6	1053	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
8962	EDINGER AVENUE		434-331-03	H4	6	1050	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	20		No			Grind	Running parallel with sidewalk
8943	EDINGER AVENUE		434-371-61	H4	6	1053	Sidewalk	PCC	Faulting	1" to 2"	5		Yes			Replace Slab	
8922	EDINGER AVENUE		434-371-62	I4	6	1053	Sidewalk	PCC	Faulting	1/2" to 1"	3.5		No			Ramp	
8941	EDINGER AVENUE		434-371-61	H4	6	1053	Sidewalk	PCC	Faulting	1/2" to 1"	5		Yes			Ramp	
8926	EDINGER AVENUE		434-371-62	I4	6	1053	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		Yes			Ramp	
8930	EDINGER AVENUE		434-371-62	I4	6	1053	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		No			Ramp	
8948	EDINGER AVENUE		Not Assigned	H4	6	1051	Sidewalk	PCC	Faulting	1/2" to 1"	2		No			Ramp	
8956	EDINGER AVENUE		Not Assigned	H4	6	1051	Sidewalk	PCC	Faulting	1/2" to 1"	6		No			Ramp	
8995	EDINGER AVENUE		434-361-37	H4	6	1054	Sidewalk	PCC	Faulting	1/2" to 1"	3		No			Ramp	
8991	EDINGER AVENUE		434-361-18	H4	6	1054	Sidewalk	PCC	Faulting	1/2" to 1"	2.5		No			Ramp	
8972	EDINGER AVENUE		434-204-25	H4	6	1052	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		No			Ramp	
8973	EDINGER AVENUE		434-204-25	H4	6	1052	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		No			Ramp	
8971	EDINGER AVENUE		434-201-14	H4	6	1052	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		No			Ramp	
9033	EDINGER AVENUE		999-000-07	G4	6	1293	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
8939	EDINGER AVENUE		434-371-61	H4	6	1053	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
8942	EDINGER AVENUE		434-371-61	H4	6	1053	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
8944	EDINGER AVENUE		434-371-61	H4	6	1053	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
8945	EDINGER AVENUE		434-371-61	H4	6	1053	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
8946	EDINGER AVENUE		434-371-61	H4	6	1053	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
8947	EDINGER AVENUE		434-371-61	H4	6	1053	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
8923	EDINGER AVENUE		434-371-62	I4	6	1053	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
8924	EDINGER AVENUE		434-371-62	I4	6	1053	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
8925	EDINGER AVENUE		434-371-62	I4	6	1053	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
8927	EDINGER AVENUE		434-371-62	I4	6	1053	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
8928	EDINGER AVENUE		434-371-62	I4	6	1053	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
8933	EDINGER AVENUE		434-371-62	I4	6	1053	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
8934	EDINGER AVENUE		434-371-62	I4	6	1053	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
8935	EDINGER AVENUE		434-371-62	I4	6	1053	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
8936	EDINGER AVENUE		434-371-62	H4	6	1053	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
8938	EDINGER AVENUE		434-371-62	H4	6	1053	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
8949	EDINGER AVENUE		Not Assigned	H4	6	1051	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
8951	EDINGER AVENUE		Not Assigned	H4	6	1051	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
8952	EDINGER AVENUE		Not Assigned	H4	6	1051	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
8954	EDINGER AVENUE		Not Assigned	H4	6	1051	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
8955	EDINGER AVENUE		Not Assigned	H4	6	1051	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No			Grind	
8996	EDINGER AVENUE		434-361-22	H4	6	1054	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
8997	EDINGER AVENUE		434-361-22	H4	6	1054	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
8998	EDINGER AVENUE		434-361-22	I4	6	1054	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No			Grind	
8987	EDINGER AVENUE		434-361-18	H4	6	1054	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
8988	EDINGER AVENUE		434-361-18	H4	6	1054	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
8989	EDINGER AVENUE		434-361-18	H4	6	1054	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
8990	EDINGER AVENUE		434-361-18	H4	6	1054	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
8992	EDINGER AVENUE		434-361-18	H4	6	1054	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
8993	EDINGER AVENUE		434-361-18	H4	6	1054	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
8994	EDINGER AVENUE		434-361-18	H4	6	1054	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
8986	EDINGER AVENUE		999-000-03	H4	6	1054	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
8975	EDINGER AVENUE		434-204-23	H4	6	1052	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
8969	EDINGER AVENUE		434-341-05	H4	6	1052	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
8970	EDINGER AVENUE		434-341-05	H4	6	1052	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
8981	EDINGER AVENUE		999-000-03	H4	6	1052	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
8957	EDINGER AVENUE		434-331-03	H4	6	1050	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
8958	EDINGER AVENUE		434-331-03	H4	6	1050	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
8960	EDINGER AVENUE		434-331-03	H4	6	1050	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
8961	EDINGER AVENUE		434-331-03	H4	6	1050	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
8963	EDINGER AVENUE		434-331-03	H4	6	1050	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
8965	EDINGER AVENUE		434-331-03	H4	6	1050	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
8966	EDINGER AVENUE		434-331-03	H4	6	1050	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
8959	EDINGER AVENUE		434-331-03	H4	6	1050	Ramp	PCC	Linear Cracking	1/4" to 1/2"	4		No			Replace Ramp	
9034	EDINGER AVENUE		999-000-07	G4	6	1293	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	3		No			Grind	
8964	EDINGER AVENUE		434-331-03	H4	6	1050	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	30		No			Grind	
8953	EDINGER AVENUE		Not Assigned	H4	6	1051	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	10		No			Grind	
8950	EDINGER AVENUE		Not Assigned	H4	6	1051	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	5		Yes			Grind	
10734	FRANKLIN AVENUE	14101	432-472-12	F4	6	1690	Curb/Gutter	PCC	Spalling	1" to 2"	0.5		No			Patch	
10737				F4	6	1690	Sidewalk	PCC	Faulting	1/2" to 1"	4		No			Replace Slab	Slab sunken, prev grind

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
10738	FRANKLIN AVENUE	14131	432-472-13	F4	6	1690	Driveway	PCC	Linear Cracking	1/2" to 1"	6		No			Grind	
10736	FRANKLIN AVENUE	14131	432-472-13	F4	6	1690	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	1		No			Grind	
10735	FRANKLIN AVENUE	14131	432-472-13	F4	6	1690	Sidewalk	PCC	Spalling	1/4" to 1/2"	2		No			Grind	
10739	FRANKLIN AVENUE	14171	432-472-14	F4	6	1690	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
10743	FRANKLIN AVENUE	14272	432-473-42	F4	6	1690	Sidewalk	PCC	Faulting	1/2" to 1"	5		Yes			Ramp	Prev grind
10742	FRANKLIN AVENUE	14272	432-473-42	F4	6	1690	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	12		Yes			Grind	Some spalling
10740	FRANKLIN AVENUE	14272	432-473-42	F4	6	1690	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
10741	FRANKLIN AVENUE	14272	432-473-42	F4	6	1690	Curb/Gutter	PCC	Spalling	1/2" to 1"	0.5		No			Replace C&G	
10744	FRANKLIN AVENUE	14281	432-472-17	G4	6	1690	Driveway	PCC	Divided Slab	1/4" to 1/2"	15		No			Replace Slab	
10745	FRANKLIN AVENUE	14281	432-472-17	G4	6	1690	Driveway	PCC	Linear Cracking	1/4" to 1/2"	6		No			Grind	
10764	FRANKLIN AVENUE	14352	432-473-27	G4	6	1690	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10765	FRANKLIN AVENUE	14352	432-473-27	G4	6	1690	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		Yes			Grind	
10746	FRANKLIN AVENUE	14381	432-472-20	G4	6	1690	Curb/Gutter	PCC	Spalling	1" to 2"	2		No			Patch	
10747	FRANKLIN AVENUE	14401	432-472-21	G4	6	1690	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
10748	FRANKLIN AVENUE	14401	432-472-21	G4	6	1690	Sidewalk	PCC	Patch / Utility Cut	1" to 2"	3		No	Yes		Ramp	
10760	FRANKLIN AVENUE	14402	432-473-26	G4	6	1690	Sidewalk	PCC	Faulting	1/2" to 1"	6		No	Yes		Ramp	
10761	FRANKLIN AVENUE	14402	432-473-26	G4	6	1690	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No			Grind	
10762	FRANKLIN AVENUE	14402	432-473-26	G4	6	1690	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No			Grind	
10763	FRANKLIN AVENUE	14402	432-473-26	G4	6	1690	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No			Grind	
10750	FRANKLIN AVENUE	14451	432-472-22	G4	6	1690	Sidewalk	PCC	Faulting	1/2" to 1"	4		No			Ramp	
10751	FRANKLIN AVENUE	14451	432-472-22	G4	6	1690	Sidewalk	PCC	Faulting	1/2" to 1"	4		No	Yes		Ramp	
10752	FRANKLIN AVENUE	14451	432-472-22	G4	6	1690	Sidewalk	PCC	Faulting	1/2" to 1"	6		No			Ramp	
10753	FRANKLIN AVENUE	14451	432-472-22	G4	6	1690	Sidewalk	PCC	Faulting	1/2" to 1"	4		No			Ramp	
10754	FRANKLIN AVENUE	14451	432-472-22	G4	6	1690	Sidewalk	PCC	Faulting	1/2" to 1"	12		No			Ramp	
10749	FRANKLIN AVENUE	14451	432-472-22	G4	6	1690	Driveway	PCC	Linear Cracking	1/4" to 1/2"	6		No			Grind	
10755	FRANKLIN AVENUE	14452	432-473-25	G4	6	1689	Sidewalk	PCC	Faulting	1/4" to 1/2"	6		No			Grind	
10756	FRANKLIN AVENUE	14452	432-473-25	G4	6	1690	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	6		No			Grind	
10757	FRANKLIN AVENUE	14452	432-473-25	G4	6	1690	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	10		Yes			Grind	
10758	FRANKLIN AVENUE	14452	432-473-25	G4	6	1690	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	5		Yes			Grind	
10759	FRANKLIN AVENUE	14452	432-473-25	G4	6	1690	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	5		Yes			Grind	
10766	FRANKLIN AVENUE	14511	432-471-20	G4	6	1689	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No	Yes		Grind	Prev grind
10767	FRANKLIN AVENUE	14511	432-471-20	G4	6	1689	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	3		No	Yes		Grind	
8395	FRANKLIN AVENUE	2552	432-491-37	G4	6	1688	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	2		No			Grind	Prev grind
8393	FRANKLIN AVENUE	2552	432-491-37	G4	6	1688	Sidewalk	PCC	Corner Break	1/2" to 1"	1		No			Ramp	
8394	FRANKLIN AVENUE	2552	432-491-37	G4	6	1688	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	6		No			Grind	
8399	FRANKLIN AVENUE	2650	432-492-31	G4	6	1688	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
8396	FRANKLIN AVENUE	2650	432-492-31	G4	6	1688	Sidewalk	PCC	Faulting	1" to 2"	3		No			Replace Slab	
8397	FRANKLIN AVENUE	2650	432-492-31	G4	6	1688	Sidewalk	PCC	Faulting	1/2" to 1"	2		No			Ramp	
8398	FRANKLIN AVENUE	2650	432-492-31	G4	6	1688	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
8400	FRANKLIN AVENUE	2650	432-492-31	G4	6	1688	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
8401	FRANKLIN AVENUE	2650	432-492-31	G4	6	1688	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
9025	HARVARD AVENUE		434-491-56	I4	6	1081	Sidewalk	PCC	Faulting	1/2" to 1"	3		No			Ramp	Prev grind
9026	HARVARD AVENUE		434-491-56	I4	6	1081	Sidewalk	PCC	Faulting	1/2" to 1"	4		No			Ramp	Prev grind
8918	HARVARD AVENUE		434-371-63	I4	6	1080	Sidewalk	PCC	Faulting	1/2" to 1"	4		No			Ramp	Prev grind
9001	HARVARD AVENUE		434-361-26	I4	6	1079	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	Prev grind
9012	HARVARD AVENUE		434-351-13	H4	6	1079	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	Prev grind
9014	HARVARD AVENUE		434-351-13	H4	6	1079	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
8896	HARVARD AVENUE		434-371-63	I4	6	1080	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
8899	HARVARD AVENUE		434-371-63	I4	6	1080	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	Prev grind
8900	HARVARD AVENUE		434-371-63	I4	6	1080	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
8904	HARVARD AVENUE		434-371-63	I4	6	1080	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	Prev grind
8906	HARVARD AVENUE		434-371-63	I4	6	1080	Sidewalk	PCC	Faulting	1" to 2"	4		No			Replace Slab	
8908	HARVARD AVENUE		434-371-63	I4	6	1080	Sidewalk	PCC	Faulting	1" to 2"	4		Yes			Replace Slab	
8911	HARVARD AVENUE		434-371-63	I4	6	1080	Sidewalk	PCC	Faulting	1" to 2"	2.5		No			Replace Slab	
8916	HARVARD AVENUE		434-371-63	I4	6	1080	Sidewalk	PCC	Faulting	1" to 2"	2.5		Yes			Replace Slab	
9018	HARVARD AVENUE		434-491-56	I4	6	1081	Sidewalk	PCC	Faulting	1/2" to 1"	3.5		Yes			Ramp	
9019	HARVARD AVENUE		434-491-56	I4	6	1081	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		No			Ramp	
9024	HARVARD AVENUE		434-491-56	I4	6	1081	Sidewalk	PCC	Faulting	1/2" to 1"	3.5		Yes			Ramp	
9030	HARVARD AVENUE		434-491-56	I4	6	1081	Sidewalk	PCC	Faulting	1/2" to 1"	1		No			Ramp	
9011	HARVARD AVENUE		434-351-13	H4	6	1079	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		No			Ramp	
8890	HARVARD AVENUE		434-371-63	I4	6	1080	Sidewalk	PCC	Faulting	1/2" to 1"	4		No			Ramp	
8891	HARVARD AVENUE		434-371-63	I4	6	1080	Sidewalk	PCC	Faulting	1/2" to 1"	1		Yes			Ramp	
8897	HARVARD AVENUE		434-371-63	I4	6	1080	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		Yes			Ramp	
8898				I4	6	1080	Sidewalk	PCC	Faulting	1/2" to 1"	4		No			Ramp	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
8901	HARVARD AVENUE		434-371-63	I4	6	1080	Sidewalk	PCC	Faulting	1/2" to 1"	2		No			Ramp	
8903	HARVARD AVENUE		434-371-63	I4	6	1080	Sidewalk	PCC	Faulting	1/2" to 1"	2.5		No			Ramp	
8907	HARVARD AVENUE		434-371-63	I4	6	1080	Sidewalk	PCC	Faulting	1/2" to 1"	1		No			Ramp	
8909	HARVARD AVENUE		434-371-63	I4	6	1080	Sidewalk	PCC	Faulting	1/2" to 1"	2		No			Ramp	
8917	HARVARD AVENUE		434-371-63	I4	6	1080	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		No			Ramp	
8919	HARVARD AVENUE		434-371-63	I4	6	1080	Sidewalk	PCC	Faulting	1/2" to 1"	4		No			Ramp	
8921	HARVARD AVENUE		434-371-63	I4	6	1080	Sidewalk	PCC	Faulting	1/2" to 1"	2.5		No			Ramp	
9015	HARVARD AVENUE		434-491-56	I4	6	1081	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9016	HARVARD AVENUE		434-491-56	I4	6	1081	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
9017	HARVARD AVENUE		434-491-56	I4	6	1081	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
9020	HARVARD AVENUE		434-491-56	I4	6	1081	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
9021	HARVARD AVENUE		434-491-56	I4	6	1081	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9022	HARVARD AVENUE		434-491-56	I4	6	1081	Sidewalk	PCC	Faulting	1/4" to 1/2"	4.5		No			Grind	
9023	HARVARD AVENUE		434-491-56	I4	6	1081	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
9027	HARVARD AVENUE		434-491-56	I4	6	1081	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
9028	HARVARD AVENUE		434-491-56	I4	6	1081	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9029	HARVARD AVENUE		434-491-56	I4	6	1081	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
9031	HARVARD AVENUE		434-491-56	I4	6	1081	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
9000	HARVARD AVENUE		434-361-26	I4	6	1079	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
9002	HARVARD AVENUE		434-361-26	I4	6	1079	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	
9003	HARVARD AVENUE		434-361-26	I4	6	1079	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
9004	HARVARD AVENUE		434-361-26	H4	6	1079	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
8999	HARVARD AVENUE		434-361-22	I4	6	1079	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
9005	HARVARD AVENUE		434-351-13	H4	6	1079	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
9006	HARVARD AVENUE		434-351-13	H4	6	1079	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
9007	HARVARD AVENUE		434-351-13	H4	6	1079	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
9008	HARVARD AVENUE		434-351-13	H4	6	1079	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9010	HARVARD AVENUE		434-351-13	H4	6	1079	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
9013	HARVARD AVENUE		434-351-13	H4	6	1079	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
8892	HARVARD AVENUE		434-371-63	I4	6	1080	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
8893	HARVARD AVENUE		434-371-63	I4	6	1080	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
8894	HARVARD AVENUE		434-371-63	I4	6	1080	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
8895	HARVARD AVENUE		434-371-63	I4	6	1080	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
8902	HARVARD AVENUE		434-371-63	I4	6	1080	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
8905	HARVARD AVENUE		434-371-63	I4	6	1080	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
8910	HARVARD AVENUE		434-371-63	I4	6	1080	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
8912	HARVARD AVENUE		434-371-63	I4	6	1080	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
8913	HARVARD AVENUE		434-371-63	I4	6	1080	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
8914	HARVARD AVENUE		434-371-63	I4	6	1080	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
8915	HARVARD AVENUE		434-371-63	I4	6	1080	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
8920	HARVARD AVENUE		434-371-63	I4	6	1080	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
9009	HARVARD AVENUE		434-351-13	H4	6	1079	Sidewalk	PCC	Linear Cracking	1/2" to 1"	2		No			Grind	
8980	JAMBOREE ROAD		434-204-23	H4	6	1117	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	At CATV
8977	JAMBOREE ROAD		434-204-23	H4	6	1117	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	At CATV grate
2887	JAMBOREE ROAD		434-441-33	I3	6	1115	Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	1		No			Grind	Blind bumps lifted on one side
8979	JAMBOREE ROAD		434-204-23	H4	6	1117	Sidewalk	PCC	Corner Break	1/4" to 1/2"	1		No			Grind	
8984	JAMBOREE ROAD		999-000-03	H4	6	1116	Sidewalk	PCC	Faulting	1" to 2"	2		No			Replace Slab	
8983	JAMBOREE ROAD		999-000-03	H4	6	Bridge	Sidewalk	PCC	Faulting	1/2" to 1"	4		No			Ramp	
8976	JAMBOREE ROAD		434-204-23	H4	6	Bridge	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
8985	JAMBOREE ROAD		999-000-03	H4	6	1116	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
8982	JAMBOREE ROAD		999-000-03	H4	6	Bridge	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
8978	JAMBOREE ROAD		434-204-23	H4	6	1117	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
10782	MICHELLE DRIVE	14101	432-473-10	F4	6	1777	Curb/Gutter	PCC	Linear Cracking	1/4" to 1/2"	1.5		No			Grind	
10783	MICHELLE DRIVE	14101	432-473-10	F4	6	1777	Curb/Gutter	PCC	Linear Cracking	1/4" to 1/2"	1.5		No			Grind	
10784	MICHELLE DRIVE	14101	432-473-10	F4	6	1777	Curb/Gutter	PCC	Linear Cracking	1/4" to 1/2"	1.5		No			Grind	
10785	MICHELLE DRIVE	14101	432-473-10	F4	6	1777	Curb/Gutter	PCC	Linear Cracking	1/4" to 1/2"	1.5		No			Grind	
10786	MICHELLE DRIVE	14101	432-473-10	F4	6	1777	Curb/Gutter	PCC	Linear Cracking	1/4" to 1/2"	1.5		No			Grind	
10787	MICHELLE DRIVE	14101	432-473-10	F4	6	1777	Curb/Gutter	PCC	Linear Cracking	1/4" to 1/2"	1.5		No			Grind	
10730	MICHELLE DRIVE	14101	432-472-12	F4	6	1776	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
10732	MICHELLE DRIVE	14101	432-472-12	F4	6	1776	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	15		No			Replace Slab	
10788	MICHELLE DRIVE	14101	432-473-10	F4	6	1777	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	30		No			Grind	
10731	MICHELLE DRIVE	14101	432-472-12	F4	6	1776	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
10733	MICHELLE DRIVE	14101	432-472-12	F4	6	1776	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
10727				I4	6	1776	Curb/Gutter	PCC	Linear Cracking	1/4" to 1/2"	1.5		No			Grind	4 cracks

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
10726	MICHELLE DRIVE	14152	432-472-23	F4	6	1776	Sidewalk	PCC	Divided Slab	1/4" to 1/2"	12		No			Replace Slab	
10728	MICHELLE DRIVE	14152	432-472-23	F4	6	1776	Driveway	PCC	Linear Cracking	1/2" to 1"	6		No			Grind	
10729	MICHELLE DRIVE	14152	432-472-23	F4	6	1776	Driveway	PCC	Linear Cracking	1/2" to 1"	6		No			Grind	
10777	MICHELLE DRIVE	14192	432-473-40	F4	6	1777	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10774	MICHELLE DRIVE	14192	432-473-40	F4	6	1777	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	14		No			Grind	
10775	MICHELLE DRIVE	14192	432-473-40	F4	6	1777	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	8		Yes			Grind	
10776	MICHELLE DRIVE	14192	432-473-40	F4	6	1777	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	8		Yes			Grind	
10768	MICHELLE DRIVE	2521	432-471-17	F4	6	1777	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	
10773	MICHELLE DRIVE	2521	432-471-17	F4	6	1777	Curb/Gutter	PCC	Linear Cracking	1/2" to 1"	2		No			Grind	
10769	MICHELLE DRIVE	2631	432-471-18	F4	6	1777	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
10772	MICHELLE DRIVE	2631	432-471-18	F4	6	1777	Curb/Gutter	PCC	Linear Cracking	1/2" to 1"	2		No			Grind	
10770	MICHELLE DRIVE	2631	432-471-18	F4	6	1777	Curb/Gutter	PCC	Linear Cracking	1/4" to 1/2"	1		No			Grind	
10771	MICHELLE DRIVE	2631	432-471-18	F4	6	1777	Curb/Gutter	PCC	Spalling	1/2" to 1"	2		No			Replace C&G	
10780	MICHELLE DRIVE		432-473-41	F4	6	1777	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
10778	MICHELLE DRIVE		432-473-41	F4	6	1777	Sidewalk	PCC	Patch / Utility Cut	1/2" to 1"	3		No	Yes		Grind	
10779	MICHELLE DRIVE		432-473-41	F4	6	1777	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	30		No			Grind	
10781	MICHELLE DRIVE		432-473-41	F4	6	1777	Curb/Gutter	PCC	Spalling	1" to 2"	1.5		No			Patch	
8888	MOFFETT DR		434-382-50	I4	6	5020	Sidewalk	PCC	Faulting	1/2" to 1"	3.5		No			Ramp	
9032	MOFFETT DR		434-492-50	I4	6	5020	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	
8876	MOFFETT DR		434-381-43	I4	6	5021	Sidewalk	PCC	Faulting	1/2" to 1"	3.5		No			Ramp	
8879	MOFFETT DR		434-381-43	I4	6	5021	Sidewalk	PCC	Faulting	1/2" to 1"	2		Yes			Ramp	
1919	MOFFETT DR		430-381-46	H3	6	5036	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
1920	MOFFETT DR		430-381-46	H3	6	5036	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
1917	MOFFETT DR		430-391-32	H3	6	5036	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
1918	MOFFETT DR		430-391-32	H3	6	5036	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
1921	MOFFETT DR		430-381-18	H3	6	5037	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
8883	MOFFETT DR		434-382-50	I4	6	5020	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
8884	MOFFETT DR		434-382-50	I4	6	5020	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
8885	MOFFETT DR		434-382-50	I4	6	5020	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
8886	MOFFETT DR		434-382-50	I4	6	5020	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
8887	MOFFETT DR		434-382-50	I4	6	5020	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
8889	MOFFETT DR		434-382-50	I4	6	5020	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
8871	MOFFETT DR		434-481-80	I4	6	5021	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		Yes			Grind	
8872	MOFFETT DR		434-481-80	I4	6	5021	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
8873	MOFFETT DR		434-381-43	I4	6	5021	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
8874	MOFFETT DR		434-381-43	I4	6	5021	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
8875	MOFFETT DR		434-381-43	I4	6	5021	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
8877	MOFFETT DR		434-381-43	I4	6	5021	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
8878	MOFFETT DR		434-381-43	I4	6	5021	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
8880	MOFFETT DR		434-381-43	I4	6	5021	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
8881	MOFFETT DR		434-381-43	I4	6	5021	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
8882	MOFFETT DR		434-381-43	I4	6	5021	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
10789	MYFORD ROAD	14101	432-473-10	G4	6	1793	Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	6		No			Grind	Manhole patch
10790	MYFORD ROAD	14101	432-473-10	G4	6	1793	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No			Grind	
10791	MYFORD ROAD	14101	432-473-10	G4	6	1793	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10792	MYFORD ROAD	14101	432-473-10	G4	6	1793	Sidewalk	PCC	Faulting	1/4" to 1/2"	6		Yes			Grind	
10793	MYFORD ROAD	14101	432-473-10	G4	6	1793	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
10794	MYFORD ROAD	14101	432-473-10	G4	6	1793	Curb/Gutter	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
10796	MYFORD ROAD	14191	432-473-11	G4	6	1793	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
10797	MYFORD ROAD	14191	432-473-11	G4	6	1793	Driveway	PCC	Linear Cracking	1/4" to 1/2"	7		No			Grind	
10795	MYFORD ROAD	14191	432-473-11	G4	6	1793	Curb/Gutter	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
10798	MYFORD ROAD	14251	432-473-12	G4	6	1793	Curb/Gutter	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
10799	MYFORD ROAD	14251	432-473-12	G4	6	1793	Curb/Gutter	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
10800	MYFORD ROAD	14321	432-473-13	G4	6	1793	Driveway	PCC	Divided Slab	1/2" to 1"	10		No			Replace Slab(s)	
10801	MYFORD ROAD	14321	432-473-13	G4	6	1793	Curb/Gutter	PCC	Linear Cracking	1/4" to 1/2"	2		No			Grind	
10804	MYFORD ROAD	14351	432-473-19	G4	6	1793	Sidewalk	PCC	Corner Break	1/2" to 1"	3		Yes			Replace Slab	Hydrant
10802	MYFORD ROAD	14351	432-473-19	G4	6	1793	Ramp	PCC	Faulting	1/2" to 1"	2		Yes			Grind Ramp	
10803	MYFORD ROAD	14351	432-473-19	G4	6	1793	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
10805	MYFORD ROAD	14351	432-473-19	G4	6	1793	Ramp	PCC	Sidewalk Curb Separation	1/2" to 1"	3		Yes			Grind	
10811	MYFORD ROAD	14511	432-473-17	G4	6	1793	Ramp	PCC	Faulting	1/4" to 1/2"	2		No			Grind Ramp	
10812	MYFORD ROAD	14511	432-473-17	G4	6	1793	Sidewalk	PCC	Spalling	1/4" to 1/2"	2		No			Grind	
10809	MYFORD ROAD		432-473-20	G4	6	1793	Sidewalk	PCC	Other - Leave Comment	No Displacement			No			Field Assess-Monitor	Driveway replaced with sidewalk
10810	MYFORD ROAD		432-473-21	G4	6	1793	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
10806				)	G4	6	1793	Sidewalk	PCC	Patch / Utility Cut	1/2" to 1"	6		No		Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
10807	MYFORD ROAD		432-473-20	G4	6	1793	Sidewalk	AC	Patch / Utility Cut	1/4" to 1/2"	5		No			AC Patch	
10808	MYFORD ROAD		432-473-20	G4	6	1793	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	15		No			Grind	
3016	PARK AVE	2237	434-441-18	I2	6	1825	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
3015	PARK AVE	2237	434-441-18	I2	6	1825	Sidewalk	PCC	Corner Break	1/4" to 1/2"	4		No			Grind	
3012	PARK AVE	2237	434-441-18	I2	6	1825	Sidewalk	PCC	Faulting	1/2" to 1"	3		No			Ramp	
3011	PARK AVE	2237	434-441-18	I2	6	1825	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
3013	PARK AVE	2237	434-441-18	I2	6	1825	Sidewalk	PCC	Faulting	1/4" to 1/2"	7		No			Grind	
3014	PARK AVE	2237	434-441-18	I2	6	1825	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
5894	PARK AVE	2300	434-441-28	I3	6	2000	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
5900	PARK AVE	2300	434-441-28	I3	6	2000	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	Prev grind
5890	PARK AVE	2300	434-441-28	I3	6	2000	Sidewalk	PCC	Faulting	1/2" to 1"	2		No			Ramp	
5897	PARK AVE	2300	434-441-28	I3	6	2000	Sidewalk	PCC	Faulting	1/2" to 1"	4		No			Ramp	
5898	PARK AVE	2300	434-441-28	I3	6	2000	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		No			Ramp	
5887	PARK AVE	2300	434-441-28	I3	6	2000	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5888	PARK AVE	2300	434-441-28	I3	6	2000	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
5889	PARK AVE	2300	434-441-28	I3	6	2000	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
5891	PARK AVE	2300	434-441-28	I3	6	2000	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
5892	PARK AVE	2300	434-441-28	I3	6	2000	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5893	PARK AVE	2300	434-441-28	I3	6	2000	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5895	PARK AVE	2300	434-441-28	I3	6	2000	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
5896	PARK AVE	2300	434-441-28	I3	6	2000	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
5899	PARK AVE	2300	434-441-28	I3	6	2000	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5901	PARK AVE	2300	434-441-28	I3	6	2000	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
5902	PARK AVE	2300	434-441-28	I3	6	2000	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
5903	PARK AVE	2300	434-441-28	I3	6	2000	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
5904	PARK AVE	2300	434-441-28	I2	6	2000	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
3027	PARK AVE	2457	434-441-16	I3	6	1825	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
3028	PARK AVE	2457	434-441-16	I3	6	1825	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
3029	PARK AVE	2457	434-441-16	I3	6	1825	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
3030	PARK AVE	2457	434-441-16	I3	6	1825	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
5883	PARK AVE	2500	434-431-35	I3	6	2002	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	Prev grind
5879	PARK AVE	2500	434-431-35	I3	6	2002	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		No			Ramp	
5880	PARK AVE	2500	434-431-35	I3	6	2002	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		No			Ramp	
5882	PARK AVE	2500	434-431-35	I3	6	2002	Sidewalk	PCC	Faulting	1/2" to 1"	1		No			Ramp	
5877	PARK AVE	2500	434-431-35	I3	6	2002	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
5878	PARK AVE	2500	434-431-35	I3	6	2002	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
5881	PARK AVE	2500	434-431-35	I3	6	2002	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
5884	PARK AVE	2500	434-431-35	I3	6	2002	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
5885	PARK AVE	2500	434-431-35	I3	6	2002	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
5886	PARK AVE	2500	434-431-35	I3	6	2002	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
5851	PARK AVE	2700	434-431-37	I3	6	2002	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
5853	PARK AVE	2700	434-431-37	I3	6	2002	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Prev grind
5854	PARK AVE	2700	434-431-37	I3	6	2002	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
5859	PARK AVE	2700	434-431-37	I3	6	2002	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
5865	PARK AVE	2700	434-431-37	I3	6	2002	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
5861	PARK AVE	2700	434-431-37	I3	6	2002	Sidewalk	PCC	Faulting	1/2" to 1"	3		No			Ramp	
5863	PARK AVE	2700	434-431-37	I3	6	2002	Sidewalk	PCC	Faulting	1/2" to 1"	3.5		No			Ramp	
5852	PARK AVE	2700	434-431-37	I3	6	2002	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
5855	PARK AVE	2700	434-431-37	I3	6	2002	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
5856	PARK AVE	2700	434-431-37	I3	6	2002	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
5857	PARK AVE	2700	434-431-37	I3	6	2002	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
5858	PARK AVE	2700	434-431-37	I3	6	2002	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
5860	PARK AVE	2700	434-431-37	I3	6	2002	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
5862	PARK AVE	2700	434-431-37	I3	6	2002	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5864	PARK AVE	2700	434-431-37	I3	6	2002	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
5866	PARK AVE	2700	434-431-37	I3	6	2002	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
5761	PARK AVE	2701	434-441-23	I3	6	2001	Sidewalk	PCC	Faulting	1/2" to 1"	4		No			Ramp	
5762	PARK AVE	2701	434-441-23	I3	6	2001	Sidewalk	PCC	Faulting	1/2" to 1"	2.5		No			Ramp	
5756	PARK AVE	2701	434-441-23	I3	6	2001	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
5757	PARK AVE	2701	434-441-23	I3	6	2001	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
5758	PARK AVE	2701	434-441-23	I3	6	2001	Sidewalk	PCC	Faulting	1/4" to 1/2"	4.5		No			Grind	
5759	PARK AVE	2701	434-441-23	I3	6	2001	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
5760	PARK AVE	2701	434-441-23	I3	6	2001	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
3043				I3	6	2001	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	3		No			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
3041	PARK AVE	2817	434-441-33	I3	6	2001	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
3033	PARK AVE	2817	434-441-33	I3	6	2001	Sidewalk	PCC	Faulting	1/2" to 1"	3		No			Ramp	
3039	PARK AVE	2817	434-441-33	I3	6	2001	Sidewalk	PCC	Faulting	1/2" to 1"	3.5		No			Ramp	
3031	PARK AVE	2817	434-441-33	I3	6	2001	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
3032	PARK AVE	2817	434-441-33	I3	6	2001	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
3034	PARK AVE	2817	434-441-33	I3	6	2001	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
3035	PARK AVE	2817	434-441-33	I3	6	2001	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
3036	PARK AVE	2817	434-441-33	I3	6	2001	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
3037	PARK AVE	2817	434-441-33	I3	6	2001	Sidewalk	PCC	Faulting	1/4" to 1/2"	4.5		No			Grind	
3038	PARK AVE	2817	434-441-33	I3	6	2001	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
3040	PARK AVE	2817	434-441-33	I3	6	2001	Sidewalk	PCC	Faulting	1/4" to 1/2"	7		No			Grind	
3042	PARK AVE	2817	434-441-33	I3	6	2001	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5780	PARK AVE		434-431-24	I3	6	2001	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	At CATV grate
5850	PARK AVE		430-381-36	I3	6	5030	Sidewalk	PCC	Faulting	1/2" to 1"	4		No			Ramp	At manhole
5787	PARK AVE		430-401-89	I3	6	5032	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	At manhole
5870	PARK AVE		434-431-28	I3	6	2002	Sidewalk	PCC	Faulting	1/2" to 1"	3		No			Ramp	Prev grind
5765	PARK AVE		434-431-24	I3	6	2001	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	Prev grind
5868	PARK AVE		434-431-28	I3	6	2002	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
5874	PARK AVE		434-431-27	I3	6	2002	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No			Grind	Prev grind
3017	PARK AVE		434-441-17	I2	6	1825	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
3024	PARK AVE		434-441-17	I2	6	1825	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
5766	PARK AVE		434-431-24	I3	6	2001	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	30		No			Grind	Running parallel to sidewalk
5764	PARK AVE		434-431-24	I3	6	2001	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	10		No			Grind	Running parallel with sidewalk
5771	PARK AVE		434-431-24	I3	6	2001	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	20		No			Grind	Some parts vert. Running parallel with sidewalk
5779	PARK AVE		434-431-24	I3	6	2001	Sidewalk	PCC	Faulting	1" to 2"	2		No			Replace Slab	
3023	PARK AVE		434-441-17	I2	6	1825	Sidewalk	PCC	Faulting	1/2" to 1"	3		No			Ramp	
5788	PARK AVE		430-401-89	I3	6	5032	Sidewalk	PCC	Faulting	1/2" to 1"	4.5		No			Ramp	
5785	PARK AVE		434-431-18	I3	6	5032	Sidewalk	PCC	Faulting	1/2" to 1"	3		No			Ramp	
5849	PARK AVE		430-381-36	I3	6	5030	Sidewalk	PCC	Faulting	1/2" to 1"	4.5		No			Ramp	
5763	PARK AVE		434-431-24	I3	6	2001	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
5767	PARK AVE		434-431-24	I3	6	2001	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
5768	PARK AVE		434-431-24	I3	6	2001	Sidewalk	PCC	Faulting	1/4" to 1/2"	6		No			Grind	
5769	PARK AVE		434-431-24	I3	6	2001	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5770	PARK AVE		434-431-24	I3	6	2001	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5772	PARK AVE		434-431-24	I3	6	2001	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
5773	PARK AVE		434-431-24	I3	6	2001	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
5774	PARK AVE		434-431-24	I3	6	2001	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5775	PARK AVE		434-431-24	I3	6	2001	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
5776	PARK AVE		434-431-24	I3	6	2001	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
5777	PARK AVE		434-431-24	I3	6	2001	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5778	PARK AVE		434-431-24	I3	6	2001	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
5867	PARK AVE		434-431-28	I3	6	2002	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
5869	PARK AVE		434-431-28	I3	6	2002	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5871	PARK AVE		434-431-28	I3	6	2002	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5872	PARK AVE		434-431-28	I3	6	2002	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5873	PARK AVE		434-431-27	I3	6	2002	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
5875	PARK AVE		434-431-27	I3	6	2002	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
5876	PARK AVE		434-431-27	I3	6	2002	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
3018	PARK AVE		434-441-17	I2	6	1825	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
3019	PARK AVE		434-441-17	I2	6	1825	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
3020	PARK AVE		434-441-17	I2	6	1825	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
3021	PARK AVE		434-441-17	I2	6	1825	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
3022	PARK AVE		434-441-17	I2	6	1825	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
3025	PARK AVE		434-441-17	I3	6	1825	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No			Grind	
5792	PARK AVE		430-431-75	I3	6	5032	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5781	PARK AVE		434-431-32	I3	6	5032	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
5782	PARK AVE		434-431-32	I3	6	5032	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
5783	PARK AVE		434-431-32	I3	6	5032	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
5784	PARK AVE		434-431-32	I3	6	5032	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
5789	PARK AVE		430-401-89	I3	6	5032	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
5790	PARK AVE		430-401-89	I3	6	5032	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
5791	PARK AVE		430-401-89	I3	6	5032	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
5786	PARK AVE		434-431-18	I3	6	5032	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
5848				I3	6	5030	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
5794	PARK AVE		430-441-59	H3	6	5034	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
5793	PARK AVE		430-431-67	H3	6	5034	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
12036	PARK AVE		430-381-45	H3	6	5035	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
3026	PARK AVE		434-441-17	I3	6	1825	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
11033	TUSTIN RANCH ROAD	14131	432-471-22	F4	6	1226	Sidewalk	PCC	Corner Break	1" to 2"	5		No			Replace Slab	
11032	TUSTIN RANCH ROAD	14131	432-471-22	F4	6	1226	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
11034	TUSTIN RANCH ROAD	14131	432-471-22	F4	6	1226	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
11035	TUSTIN RANCH ROAD	14131	432-471-22	F4	6	1226	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
11036	TUSTIN RANCH ROAD	14131	432-471-22	F4	6	1226	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
11026	TUSTIN RANCH ROAD	14171	432-471-13	F4	6	1226	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
11027	TUSTIN RANCH ROAD	14171	432-471-13	F4	6	1226	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
11028	TUSTIN RANCH ROAD	14171	432-471-13	F4	6	1226	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
11029	TUSTIN RANCH ROAD	14171	432-471-13	F4	6	1226	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
11031	TUSTIN RANCH ROAD	14171	432-471-13	F4	6	1226	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
11030	TUSTIN RANCH ROAD	14171	432-471-13	F4	6	1226	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	15		No			Grind	
11024	TUSTIN RANCH ROAD	14201	432-471-12	F4	6	1226	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
11025	TUSTIN RANCH ROAD	14201	432-471-12	F4	6	1226	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	2.5		No			Grind	
11022	TUSTIN RANCH ROAD	14251	432-471-11	F4	6	1226	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
11021	TUSTIN RANCH ROAD	14251	432-471-11	F4	6	1226	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
11023	TUSTIN RANCH ROAD	14251	432-471-11	F4	6	1226	Sidewalk	PCC	Linear Cracking	1/2" to 1"	2.5		No			Grind	
11020	TUSTIN RANCH ROAD	14281	432-471-10	F4	6	1226	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
11019	TUSTIN RANCH ROAD	14321	432-471-09	F4	6	1226	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
11018	TUSTIN RANCH ROAD	14341	432-471-08	F4	6	1226	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	2		No			Grind	At pole
11016	TUSTIN RANCH ROAD	14401	432-471-06	G4	6	1226	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
11014	TUSTIN RANCH ROAD	14401	432-471-06	G4	6	1226	Sidewalk	PCC	Faulting	1/2" to 1"	4.5		Yes			Ramp	
11017	TUSTIN RANCH ROAD	14401	432-471-06	G4	6	1226	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
11015	TUSTIN RANCH ROAD	14401	432-471-06	G4	6	1226	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	10		No			Grind	
11013	TUSTIN RANCH ROAD	14451	432-471-26	G4	6	1226	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
11005	TUSTIN RANCH ROAD	14731	432-491-02	G4	6	5008	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	At water meter
11007	TUSTIN RANCH ROAD	14731	432-491-02	G4	6	5008	Sidewalk	PCC	Faulting	1/2" to 1"	3		No			Ramp	
11004	TUSTIN RANCH ROAD	14731	432-491-02	G4	6	5008	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
11006	TUSTIN RANCH ROAD	14731	432-491-02	G4	6	5008	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
11008	TUSTIN RANCH ROAD	14731	432-491-02	G4	6	5008	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
2967	TUSTIN RANCH ROAD	2237	434-441-18	I2	6	1313	Sidewalk	PCC	Faulting	1/2" to 1"	3.5		Yes			Ramp	
2963	TUSTIN RANCH ROAD	2237	434-441-18	I2	6	1313	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
2964	TUSTIN RANCH ROAD	2237	434-441-18	I2	6	1313	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
2965	TUSTIN RANCH ROAD	2237	434-441-18	I2	6	1313	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
2966	TUSTIN RANCH ROAD	2237	434-441-18	I2	6	1313	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
2968	TUSTIN RANCH ROAD	2237	434-441-18	I2	6	1313	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
2969	TUSTIN RANCH ROAD	2237	434-441-18	I2	6	1313	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
2970	TUSTIN RANCH ROAD	2237	434-441-18	I2	6	1313	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
2976	TUSTIN RANCH ROAD	2300	434-441-28	I3	6	1315	Sidewalk	PCC	Faulting	1/2" to 1"	2.5		Yes			Ramp	Prev grind
2979	TUSTIN RANCH ROAD	2300	434-441-28	I3	6	1315	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	Prev grind
2972	TUSTIN RANCH ROAD	2300	434-441-28	I3	6	1315	Sidewalk	PCC	Faulting	1/2" to 1"	1		No			Ramp	
2974	TUSTIN RANCH ROAD	2300	434-441-28	I3	6	1315	Sidewalk	PCC	Faulting	1/2" to 1"	3		No			Ramp	
2978	TUSTIN RANCH ROAD	2300	434-441-28	I3	6	1315	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	
2971	TUSTIN RANCH ROAD	2300	434-441-28	I3	6	1315	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
2973	TUSTIN RANCH ROAD	2300	434-441-28	I3	6	1315	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
2975	TUSTIN RANCH ROAD	2300	434-441-28	I3	6	1315	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
2977	TUSTIN RANCH ROAD	2300	434-441-28	I3	6	1315	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
2980	TUSTIN RANCH ROAD	2300	434-441-28	I3	6	1315	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
2981	TUSTIN RANCH ROAD	2300	434-441-28	I3	6	1315	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
2982	TUSTIN RANCH ROAD	2300	434-441-28	I3	6	1315	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
11037	TUSTIN RANCH ROAD	2441	432-471-16	F4	6	1226	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
11038	TUSTIN RANCH ROAD	2441	432-471-16	F4	6	1226	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	25		No			Grind	
11012	TUSTIN RANCH ROAD	2472	432-491-38	G4	6	5008	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	At cox patch
11002	TUSTIN RANCH ROAD	2492	432-491-35	G4	6	5008	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	At manhole
11003	TUSTIN RANCH ROAD	2492	432-491-35	G4	6	5008	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
2983	TUSTIN RANCH ROAD	2500	434-431-35	I3	6	1315	Sidewalk	PCC	Faulting	1" to 2"	5		Yes			Replace Slab	Prev grind
2984	TUSTIN RANCH ROAD	2500	434-431-35	I3	6	1315	Sidewalk	PCC	Faulting	1/2" to 1"	5		Yes			Ramp	Prev grind
2987	TUSTIN RANCH ROAD	2500	434-431-35	I3	6	1315	Sidewalk	PCC	Faulting	1" to 2"	6		No			Replace Slab	
2985	TUSTIN RANCH ROAD	2500	434-431-35	I3	6	1315	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No	Yes		Grind	
2986	TUSTIN RANCH ROAD	2500	434-431-35	I3	6	1315	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No			Grind	
2988				I3	6	1316	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
5827	TUSTIN RANCH ROAD	2500	434-431-35	I3	6	1316	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
5828	TUSTIN RANCH ROAD	2500	434-431-35	I3	6	1316	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
5829	TUSTIN RANCH ROAD	2500	434-431-35	I3	6	1316	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5820	TUSTIN RANCH ROAD	2700	434-431-37	I3	6	1316	Sidewalk	PCC	Faulting	1/2" to 1"	6		No			Ramp	Prev grind
5818	TUSTIN RANCH ROAD	2700	434-431-37	I3	6	1316	Sidewalk	PCC	Buckled Slab	1/4" to 1/2"	3	3	No			Replace Slab	Section of slab buckled
5821	TUSTIN RANCH ROAD	2700	434-431-37	I3	6	1316	Sidewalk	PCC	Corner Break	1/4" to 1/2"	3		No			Grind	
5824	TUSTIN RANCH ROAD	2700	434-431-37	I3	6	1316	Sidewalk	PCC	Faulting	1/2" to 1"	2.5		No			Ramp	
5816	TUSTIN RANCH ROAD	2700	434-431-37	I3	6	1316	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5817	TUSTIN RANCH ROAD	2700	434-431-37	I3	6	1316	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
5819	TUSTIN RANCH ROAD	2700	434-431-37	I3	6	1316	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5822	TUSTIN RANCH ROAD	2700	434-431-37	I3	6	1316	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
5823	TUSTIN RANCH ROAD	2700	434-431-37	I3	6	1316	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
5825	TUSTIN RANCH ROAD	2700	434-431-37	I3	6	1316	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5826	TUSTIN RANCH ROAD	2700	434-431-37	I3	6	1316	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
5815	TUSTIN RANCH ROAD	2700	434-431-37	I3	6	1316	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	10		No			Grind	
1902	TUSTIN RANCH ROAD		430-391-43	H3	6	5007	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	At edison patch
1913	TUSTIN RANCH ROAD		430-391-32	H3	6	5006	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	At manhole
1907	TUSTIN RANCH ROAD		430-391-42	G3	6	5007	Sidewalk	PCC	Faulting	1" to 2"	2.5		No			Replace Slab	At pole
2959	TUSTIN RANCH ROAD		434-021-22	I2	6	1313	Sidewalk	PCC	Patch / Utility Cut	No Displacement			No			Patch	Edison patch has broken edges
1912	TUSTIN RANCH ROAD		430-391-32	H3	6	5006	Sidewalk	PCC	Corner Break	1" to 2"	1.5		No			Replace Slab	
1914	TUSTIN RANCH ROAD		430-391-32	H3	6	5006	Sidewalk	PCC	Faulting	1/2" to 1"	2		No			Ramp	
1903	TUSTIN RANCH ROAD		430-391-43	H3	6	5007	Sidewalk	PCC	Faulting	1/2" to 1"	4		No			Ramp	
11039	TUSTIN RANCH ROAD		432-391-59	F4	6	1226	Sidewalk	PCC	Faulting	1/2" to 1"	2		No			Ramp	
11042	TUSTIN RANCH ROAD		432-391-59	F4	6	1226	Sidewalk	PCC	Faulting	1/2" to 1"	4		No			Ramp	
2962	TUSTIN RANCH ROAD		434-441-17	I2	6	1313	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
2960	TUSTIN RANCH ROAD		434-021-22	I2	6	1313	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
2961	TUSTIN RANCH ROAD		434-021-22	I2	6	1313	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
1910	TUSTIN RANCH ROAD		430-391-32	H3	6	5006	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
1911	TUSTIN RANCH ROAD		430-391-32	H3	6	5006	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
1915	TUSTIN RANCH ROAD		430-391-32	H3	6	5006	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
1916	TUSTIN RANCH ROAD		430-391-32	H3	6	5006	Sidewalk	PCC	Faulting	1/4" to 1/2"	6		No			Grind	
5840	TUSTIN RANCH ROAD		430-381-37	H3	6	5006	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
5841	TUSTIN RANCH ROAD		430-381-37	H3	6	5006	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
5842	TUSTIN RANCH ROAD		430-381-37	H3	6	5006	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
5799	TUSTIN RANCH ROAD		430-381-44	H3	6	5006	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5800	TUSTIN RANCH ROAD		430-381-44	H3	6	5006	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
5801	TUSTIN RANCH ROAD		430-381-44	H3	6	5006	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
5802	TUSTIN RANCH ROAD		430-381-44	H3	6	5006	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
5803	TUSTIN RANCH ROAD		430-381-44	H3	6	5006	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
1901	TUSTIN RANCH ROAD		430-391-43	H3	6	5007	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
1904	TUSTIN RANCH ROAD		430-391-43	H3	6	5007	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
1905	TUSTIN RANCH ROAD		430-391-43	G3	6	5007	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
1906	TUSTIN RANCH ROAD		430-391-42	G3	6	5007	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
1909	TUSTIN RANCH ROAD		430-391-42	G4	6	5007	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
11040	TUSTIN RANCH ROAD		432-391-59	F4	6	1226	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
11009	TUSTIN RANCH ROAD		432-491-05	G4	6	5008	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
11010	TUSTIN RANCH ROAD		432-491-05	G4	6	5008	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
11011	TUSTIN RANCH ROAD		432-491-05	G4	6	5008	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
1908	TUSTIN RANCH ROAD		430-391-42	G3	6	5007	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	2		No			Grind	
11041	TUSTIN RANCH ROAD		432-391-59	F4	6	1226	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	10		No			Grind	
5845	VICTORY ROAD		430-381-62	H3	6	5017	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5846	VICTORY ROAD		430-381-62	H3	6	5017	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5847	VICTORY ROAD		430-381-62	H3	6	5017	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5843	VICTORY ROAD		430-381-37	H3	6	5017	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
5844	VICTORY ROAD		430-381-37	H3	6	5017	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
5795	VICTORY ROAD		430-381-45	H3	6	2021	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
5796	VICTORY ROAD		430-381-45	H3	6	2021	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5797	VICTORY ROAD		430-381-44	H3	6	2021	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5798	VICTORY ROAD		430-381-44	H3	6	2021	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
8429	WALNUT AVENUE	14511	432-473-17	G4	6	1312	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
8430	WALNUT AVENUE	14511	432-473-17	G4	6	1312	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
8431	WALNUT AVENUE	14511	432-473-17	G4	6	1312	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
8434	WALNUT AVENUE	14511	432-473-17	G4	6	1312	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	7		No			Grind	
8432				G4	6	1312	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	8		No			Grind	



3548 Seagate Way, Suite 230
Oceanside, CA 92056
T: (760) 216-6529
www.bucknam-inc.com

Bucknam understands that the City will make all final decisions on sidewalk improvement types and repair locations

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
8433	WALNUT AVENUE	14511	432-473-17	G4	6	1312	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	8		No			Grind	
8389	WALNUT AVENUE	2512	432-491-33	G4	6	1307	Sidewalk	PCC	Corner Break	1/4" to 1/2"	1		No			Grind	
8453	WALNUT AVENUE	2512	432-471-21	G4	6	1308	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
8454	WALNUT AVENUE	2512	432-471-21	G4	6	1308	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
8455	WALNUT AVENUE	2512	432-471-21	G4	6	1308	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
8456	WALNUT AVENUE	2512	432-471-21	G4	6	1308	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
8457	WALNUT AVENUE	2512	432-471-21	G4	6	1308	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
8458	WALNUT AVENUE	2512	432-471-21	G4	6	1308	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
8388	WALNUT AVENUE	2512	432-491-33	G4	6	1307	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
8390	WALNUT AVENUE	2512	432-491-33	G4	6	1307	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
8391	WALNUT AVENUE	2512	432-491-33	G4	6	1307	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
8392	WALNUT AVENUE	2552	432-491-37	G4	6	1307	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	2		No			Grind	
8452	WALNUT AVENUE	2601	432-473-38	G4	6	1310	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
8451	WALNUT AVENUE	2641	432-473-39	G4	6	1310	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
8402	WALNUT AVENUE	2650	432-492-31	G4	6	1309	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
8403	WALNUT AVENUE	2650	432-492-31	G4	6	1309	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
8449	WALNUT AVENUE	2681	432-473-29	G4	6	1310	Sidewalk	PCC	Faulting	1/2" to 1"	2.5		No			Ramp	
8445	WALNUT AVENUE	2681	432-473-29	G4	6	1310	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
8446	WALNUT AVENUE	2681	432-473-29	G4	6	1310	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
8447	WALNUT AVENUE	2681	432-473-29	G4	6	1310	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
8448	WALNUT AVENUE	2681	432-473-29	G4	6	1310	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
8450	WALNUT AVENUE	2681	432-473-29	G4	6	1310	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
8406	WALNUT AVENUE	2682	432-511-01	G4	6	1309	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
8404	WALNUT AVENUE	2682	432-511-01	G4	6	1309	Driveway	PCC	Divided Slab	No Displacement			No			Replace Slab	
8405	WALNUT AVENUE	2682	432-511-01	G4	6	1309	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
8407	WALNUT AVENUE	2682	432-511-01	G4	6	1309	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
8413	WALNUT AVENUE	2722	432-511-07	G4	6	1309	Sidewalk	PCC	Faulting	1/2" to 1"	2		No			Ramp	
8412	WALNUT AVENUE	2722	432-511-07	G4	6	1309	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
8441	WALNUT AVENUE	2741	432-473-46	G4	6	1310	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
8442	WALNUT AVENUE	2741	432-473-46	G4	6	1310	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
8443	WALNUT AVENUE	2741	432-473-46	G4	6	1310	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
8444	WALNUT AVENUE	2741	432-473-46	G4	6	1310	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
8414	WALNUT AVENUE	2752	432-511-08	G4	6	1309	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
8415	WALNUT AVENUE	2752	432-511-08	G4	6	1309	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
8416	WALNUT AVENUE	2752	432-511-08	G4	6	1309	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
8439	WALNUT AVENUE	2761	432-473-47	G4	6	1312	Sidewalk	PCC	Faulting	1/2" to 1"	1		No			Ramp	
8440	WALNUT AVENUE	2761	432-473-47	G4	6	1310	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
8436	WALNUT AVENUE	2761	432-473-47	G4	6	1312	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
8437	WALNUT AVENUE	2761	432-473-47	G4	6	1312	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
8438	WALNUT AVENUE	2761	432-473-47	G4	6	1312	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
8435	WALNUT AVENUE	2761	432-473-47	G4	6	1312	Ramp	PCC	Linear Cracking	1/4" to 1/2"	2		No			Replace Ramp	
8427	WALNUT AVENUE		432-503-44	G4	6	1311	Sidewalk	PCC	Faulting	1/2" to 1"	4		No			Ramp	At manhole
8420	WALNUT AVENUE		432-503-44	G4	6	1311	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"			No			Grind	Lots of linear cracks through driveway. Not much vert
8419	WALNUT AVENUE		432-511-12	G4	6	1311	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Prev grind
8425	WALNUT AVENUE		432-503-44	G4	6	1311	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
8459	WALNUT AVENUE		432-471-30	G4	6	1308	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
8421	WALNUT AVENUE		432-503-44	G4	6	1311	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
8422	WALNUT AVENUE		432-503-44	G4	6	1311	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
8423	WALNUT AVENUE		432-503-44	G4	6	1311	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
8424	WALNUT AVENUE		432-503-44	G4	6	1311	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
8426	WALNUT AVENUE		432-503-44	G4	6	1311	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
8428	WALNUT AVENUE		432-503-44	G4	6	1311	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
8417	WALNUT AVENUE		432-511-12	G4	6	1311	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
8418	WALNUT AVENUE		432-511-12	G4	6	1311	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
5830	WARNER AVENUE	2700	434-431-37	I3	6	1268	Sidewalk	PCC	Corner Break	1/4" to 1/2"	2		No			Grind	
5831	WARNER AVENUE	2700	434-431-37	I3	6	1268	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		No			Ramp	
5832	WARNER AVENUE	2700	434-431-37	I3	6	1268	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
5833	WARNER AVENUE	2700	434-431-37	I3	6	1268	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
5834	WARNER AVENUE	2700	434-431-37	I3	6	1268	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
5835	WARNER AVENUE	2700	434-431-37	I3	6	1268	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5836	WARNER AVENUE	2700	434-431-37	I3	6	1268	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
5837	WARNER AVENUE	2700	434-431-37	I3	6	1268	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No	Yes		Grind	
5838	WARNER AVENUE	2700	434-431-37	I3	6	1268	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
5839	WARNER AVENUE	2700	434-431-37	I3	6	1268	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	6		No			Grind	
Zone 7																	
11625	ARMSTRONG AVE	15991	430-283-19	H2	7	1528	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
11628	ARMSTRONG AVE	15991	430-283-19	H2	7	1528	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
2956	ARMSTRONG AVE		430-271-48	H2	7	5023	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	At CATV patch
11624	ARMSTRONG AVE		430-284-05	H2	7	1528	Sidewalk	PCC	Faulting	1/2" to 1"	3		No			Ramp	At water meter
11615	ARMSTRONG AVE		430-284-04	G3	7	1528	Sidewalk	PCC	Other - Leave Comment	No Displacement			No			N/A	No distress, dummy point
11620	ARMSTRONG AVE		430-284-05	H2	7	1528	Sidewalk	PCC	Corner Break	1/2" to 1"	2.5		No			Ramp	
11619	ARMSTRONG AVE		430-284-05	H2	7	1528	Sidewalk	PCC	Corner Break	1/4" to 1/2"	2		No			Grind	
11621	ARMSTRONG AVE		430-284-05	H2	7	1528	Sidewalk	PCC	Faulting	1/2" to 1"	2		No			Ramp	
2955	ARMSTRONG AVE		430-284-05	H2	7	1528	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
2958	ARMSTRONG AVE		430-271-44	H2	7	5023	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
2957	ARMSTRONG AVE		430-271-48	H2	7	5023	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
11622	ARMSTRONG AVE		430-284-05	H2	7	1528	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
11623	ARMSTRONG AVE		430-284-05	H2	7	1528	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No			Grind	
11626	ARMSTRONG AVE		430-284-05	H2	7	1528	Sidewalk	PCC	Faulting	1/4" to 1/2"	7		No			Grind	
11627	ARMSTRONG AVE		430-284-05	H2	7	1528	Sidewalk	PCC	Faulting	1/4" to 1/2"	8		No			Grind	
11629	ARMSTRONG AVE		430-284-05	H2	7	1528	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
11630	ARMSTRONG AVE		430-284-05	H2	7	1528	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
2923	BARRANCA PARKWAY		430-271-87	I2	7	1281	Sidewalk	PCC	Corner Break	1/4" to 1/2"	6		No			Grind	
2924	BARRANCA PARKWAY		430-271-87	I2	7	1281	Sidewalk	PCC	Corner Break	1/4" to 1/2"	2.5		No			Grind	
2925	BARRANCA PARKWAY		430-271-60	H2	7	1282	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
2921	BARRANCA PARKWAY		430-271-87	I2	7	1281	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
2922	BARRANCA PARKWAY		430-271-87	I2	7	1281	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
11491	BELL AVENUE	1123	430-241-12	G2	7	1544	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
11492	BELL AVENUE	1123	430-241-12	G2	7	1544	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
11493	BELL AVENUE	1123	430-241-12	G2	7	1544	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
3317	BELL AVENUE	15771	430-231-04	G2	7	1544	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
11494	BELL AVENUE	15773	430-241-17	G2	7	1544	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
3270	DEL AMO AVENUE	1100	430-251-12	F2	7	2012	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
3271	DEL AMO AVENUE	1100	430-251-12	F2	7	2012	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
3269	DEL AMO AVENUE	1200	430-253-20	F2	7	2012	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Util cover
3274	DEL AMO AVENUE	15171	430-251-27	F2	7	2012	Sidewalk	PCC	Corner Break	1/4" to 1/2"	3		No			Grind	
3272	DEL AMO AVENUE	15171	430-251-27	F2	7	2012	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
3273	DEL AMO AVENUE	15171	430-251-27	F2	7	2012	Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	4		No			Grind	
3275	DEL AMO AVENUE	15171	430-251-27	F2	7	2012	Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	3		No			Grind	
3152	EDINGER AVENUE	1100	430-251-12	F2	7	1299	Sidewalk	PCC	Faulting	1/2" to 1"	4		No			Ramp	Util cover
3276	EDINGER AVENUE	1100	430-251-12	F2	7	1299	Curb/Gutter	PCC	Spalling	1" to 2"	0.5		No			Patch	
3154	EDINGER AVENUE	1200	430-253-20	F2	7	1297	Sidewalk	PCC	Spalling	Over 2"	2		No			Patch	Util cover
3155	EDINGER AVENUE	1200	430-253-20	F2	7	1297	Sidewalk	PCC	Corner Break	1/4" to 1/2"	1		No			Grind	
3153	EDINGER AVENUE	1200	430-253-20	F2	7	1297	Ramp	PCC	Linear Cracking	1/4" to 1/2"	12		No			Replace Ramp	
1882	EDINGER AVENUE	15012	430-282-21	F3	7	1045	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	At pole
1883	EDINGER AVENUE	15012	430-282-21	F3	7	1045	Sidewalk	PCC	Faulting	1" to 2"	5.5		No			Replace Slab	
1880	EDINGER AVENUE	15012	430-282-21	F3	7	1045	Sidewalk	PCC	Faulting	1/4" to 1/2"	6		No			Grind	
1881	EDINGER AVENUE	15012	430-282-21	F3	7	1045	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
1884	EDINGER AVENUE	15012	430-282-21	F3	7	1045	Sidewalk	PCC	Faulting	1/4" to 1/2"	7		No			Grind	
1874	EDINGER AVENUE	1652	430-282-22	F3	7	1290	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
1876	EDINGER AVENUE	1652	430-282-22	F3	7	1290	Sidewalk	PCC	Faulting	1/4" to 1/2"	6		No			Grind	
1877	EDINGER AVENUE	1652	430-282-22	F3	7	1290	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
1878	EDINGER AVENUE	1652	430-282-22	F3	7	1290	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
1875	EDINGER AVENUE	1652	430-282-22	F3	7	1290	Ramp	PCC	Linear Cracking	1/4" to 1/2"	4		No			Replace Ramp	
1879	EDINGER AVENUE	1652	430-282-22	F3	7	1290	Curb/Gutter	PCC	Spalling	1/4" to 1/2"	1.5		No			Grind	
3163	EDINGER AVENUE		430-261-31	F3	7	1295	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Pole base
1848	EDINGER AVENUE		430-331-01	G3	7	1290	Sidewalk	PCC	Faulting	1/2" to 1"	6		No			Ramp	Prev grind
1851	EDINGER AVENUE		430-331-01	G3	7	1290	Sidewalk	PCC	Faulting	1/2" to 1"	8		No			Ramp	Running parallel with sidewalk. At manhole
1870	EDINGER AVENUE		430-282-05	F3	7	1290	Sidewalk	PCC	Faulting	1/4" to 1/2"	6		No			Grind	Running parallel with sidewalk. At manhole
3164	EDINGER AVENUE		430-261-31	F3	7	1295	Sidewalk	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	Util cover
1849	EDINGER AVENUE		430-331-01	G3	7	1290	Sidewalk	PCC	Corner Break	1/4" to 1/2"	4.5		Yes			Grind	
1852	EDINGER AVENUE		430-331-01	G3	7	1290	Sidewalk	PCC	Corner Break	1/4" to 1/2"	3		No			Grind	
1855	EDINGER AVENUE		430-301-67	G3	7	1290	Sidewalk	PCC	Faulting	1" to 2"	4		Yes			Replace Slab	
1847	EDINGER AVENUE		430-331-01	G3	7	1290	Sidewalk	PCC	Faulting	1/2" to 1"	2		No			Ramp	
1845	EDINGER AVENUE		430-331-01	G3	7	1290	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
1846				G3	7	1290	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
1850	EDINGER AVENUE		430-331-01	G3	7	1290	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
1853	EDINGER AVENUE		430-301-67	G3	7	1290	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
1854	EDINGER AVENUE		430-301-67	G3	7	1290	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		Yes			Grind	
1856	EDINGER AVENUE		430-301-67	G3	7	1290	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
1857	EDINGER AVENUE		430-301-67	G3	7	1290	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
1858	EDINGER AVENUE		430-301-67	G3	7	1290	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
1859	EDINGER AVENUE		430-301-67	G3	7	1290	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
1860	EDINGER AVENUE		430-301-67	G3	7	1290	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
1861	EDINGER AVENUE		430-301-67	G3	7	1290	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		Yes			Grind	
1862	EDINGER AVENUE		430-301-67	G3	7	1290	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
1863	EDINGER AVENUE		430-301-67	G3	7	1290	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
1864	EDINGER AVENUE		430-301-67	G3	7	1290	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
1865	EDINGER AVENUE		430-301-67	G3	7	1290	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
1866	EDINGER AVENUE		430-301-67	G3	7	1290	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
1867	EDINGER AVENUE		430-301-67	G3	7	1290	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
1868	EDINGER AVENUE		430-282-05	F3	7	1290	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
1869	EDINGER AVENUE		430-282-05	F3	7	1290	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
1871	EDINGER AVENUE		430-282-05	F3	7	1290	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
1872	EDINGER AVENUE		430-282-05	F3	7	1290	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
1873	EDINGER AVENUE		430-282-05	F3	7	1290	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
3158	EDINGER AVENUE		430-261-32	F2	7	1295	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No	Yes		Grind	
3159	EDINGER AVENUE		430-261-31	F3	7	1295	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
3156	EDINGER AVENUE		430-261-31	F2	7	1297	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
3160	EDINGER AVENUE		430-261-31	F3	7	1295	Sidewalk	PCC	Linear Cracking	No Displacement	15		No			Joint Seal	
3157	EDINGER AVENUE		430-261-31	F2	7	1297	Sidewalk	PCC	Patch / Utility Cut	1/2" to 1"	4		No			Grind	
3161	EDINGER AVENUE		430-261-31	F3	7	1295	Curb/Gutter	PCC	Spalling	1/2" to 1"	4		No			Replace C&G	
3162	EDINGER AVENUE		430-261-31	F3	7	1295	Sidewalk	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
11495	GATEWAY CIR	15778	430-241-20	G2	7	2020	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
3243	INDUSTRIAL DRIVE	1392	430-262-07	F2	7	1718	Curb/Gutter	PCC	Other - Leave Comment	Over 2"	3		No			Replace C&G	Curb over drain missing
3242	INDUSTRIAL DRIVE	1392	430-262-07	F2	7	1718	Curb/Gutter	PCC	Spalling	1/2" to 1"	3		No			Replace C&G	
3246	INDUSTRIAL DRIVE	15101	430-262-04	F2	7	1718	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Replace Slab	Prev grind and spalled
3250	INDUSTRIAL DRIVE	15101	430-262-04	F2	7	1718	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Util cover
3244	INDUSTRIAL DRIVE	15101	430-262-04	F2	7	1718	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No			Grind	
3245	INDUSTRIAL DRIVE	15101	430-262-04	F2	7	1718	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
3248	INDUSTRIAL DRIVE	15101	430-262-04	F2	7	1718	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
3249	INDUSTRIAL DRIVE	15101	430-262-04	F2	7	1718	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
3247	INDUSTRIAL DRIVE	15101	430-262-04	F2	7	1718	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	2		No			Grind	
3187	INDUSTRIAL DRIVE		430-261-31	F2	7	1718	Curb/Gutter	PCC	Spalling	Over 2"	3		No			Replace C&G	Broken
3193	INDUSTRIAL DRIVE		430-261-31	F2	7	1718	Sidewalk	PCC	Divided Slab	No Displacement			No	Yes		Replace Slab	Low
3194	INDUSTRIAL DRIVE		430-261-31	F2	7	1718	Sidewalk	PCC	Divided Slab	No Displacement			Yes	Yes		Replace Slab	Low
3173	INDUSTRIAL DRIVE		430-261-31	F2	7	1718	Sidewalk	PCC	Faulting	1" to 2"	4		Yes			Replace Slab	Manhole cover
3176	INDUSTRIAL DRIVE		430-261-31	F2	7	1718	Curb/Gutter	PCC	Sidewalk Curb Separation	Over 2"	6		No			Replace C&G	Severe
3190	INDUSTRIAL DRIVE		430-261-31	F2	7	1718	Sidewalk	PCC	Faulting	1/2" to 1"	6		No			Replace Slab	Slab faulted on 3 sides
3203	INDUSTRIAL DRIVE		430-261-31	F2	7	1718	Curb/Gutter	PCC	Divided Slab	1/4" to 1/2"			No			Replace Slab	Spalling bad
3202	INDUSTRIAL DRIVE		430-261-31	F2	7	1718	Driveway	PCC	Divided Slab	1/4" to 1/2"			No			Replace Slab	Spalling bad
3172	INDUSTRIAL DRIVE		430-261-31	F2	7	1718	Sidewalk	PCC	Spalling	1" to 2"	1		No			Patch	Util cover
3199	INDUSTRIAL DRIVE		430-261-31	F2	7	1718	Sidewalk	PCC	Spalling	Over 2"	2		No			Patch	Util cover
3195	INDUSTRIAL DRIVE		430-261-31	F2	7	1718	Sidewalk	PCC	Corner Break	1/2" to 1"	3		No			Ramp	
3184	INDUSTRIAL DRIVE		430-261-31	F2	7	1718	Sidewalk	PCC	Corner Break	1/4" to 1/2"	2		No			Grind	
3201	INDUSTRIAL DRIVE		430-261-31	F2	7	1718	Sidewalk	PCC	Corner Break	1/4" to 1/2"	3		No			Grind	
3188	INDUSTRIAL DRIVE		430-261-31	F2	7	1718	Sidewalk	PCC	Divided Slab	Over 2"			No			Replace Slab(s)	
3175	INDUSTRIAL DRIVE		430-261-31	F2	7	1718	Sidewalk	PCC	Faulting	1" to 2"	4		No			Replace Slab	
3204	INDUSTRIAL DRIVE		430-261-29	F2	7	1718	Sidewalk	PCC	Faulting	1/2" to 1"	5		Yes			Ramp	
3205	INDUSTRIAL DRIVE		430-261-29	F2	7	1718	Sidewalk	PCC	Faulting	1/2" to 1"	5		Yes			Ramp	
3206	INDUSTRIAL DRIVE		430-261-29	F2	7	1718	Sidewalk	PCC	Faulting	1/2" to 1"	5		Yes			Ramp	
3179	INDUSTRIAL DRIVE		430-261-31	F2	7	1718	Sidewalk	PCC	Faulting	1/2" to 1"	4		Yes			Ramp	
3181	INDUSTRIAL DRIVE		430-261-31	F2	7	1718	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
3182	INDUSTRIAL DRIVE		430-261-31	F2	7	1718	Sidewalk	PCC	Faulting	1/2" to 1"	6		Yes			Ramp	
3185	INDUSTRIAL DRIVE		430-261-31	F2	7	1718	Sidewalk	PCC	Faulting	1/2" to 1"	4		No			Ramp	
3170	INDUSTRIAL DRIVE		430-261-31	F2	7	1718	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
3171	INDUSTRIAL DRIVE		430-261-31	F2	7	1718	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
3174	INDUSTRIAL DRIVE		430-261-31	F2	7	1718	Sidewalk	PCC	Faulting	1/4" to 1/2"	6		Yes			Grind	
3191	INDUSTRIAL DRIVE		430-261-31	F2	7	1718	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No	Yes		Grind	
3192				F2	7	1718	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No	Yes		Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
3200	INDUSTRIAL DRIVE		430-261-31	F2	7	1718	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
3178	INDUSTRIAL DRIVE		430-261-31	F2	7	1718	Curb/Gutter	PCC	Linear Cracking	1" to 2"	6		No			Grind	
3198	INDUSTRIAL DRIVE		430-261-31	F2	7	1718	Curb/Gutter	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
3180	INDUSTRIAL DRIVE		430-261-31	F2	7	1718	Curb/Gutter	PCC	Sidewalk Curb Separation	1" to 2"	14		Yes			Replace Curb	
3186	INDUSTRIAL DRIVE		430-261-31	F2	7	1718	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	5		No			Grind	
3177	INDUSTRIAL DRIVE		430-261-31	F2	7	1718	Curb/Gutter	PCC	Spalling	1" to 2"	6		No			Patch	
3189	INDUSTRIAL DRIVE		430-261-31	F2	7	1718	Curb/Gutter	PCC	Spalling	1" to 2"	1		No			Patch	
3196	INDUSTRIAL DRIVE		430-261-31	F2	7	1718	Curb/Gutter	PCC	Spalling	1" to 2"	1		No			Patch	
3183	INDUSTRIAL DRIVE		430-261-31	F2	7	1718	Curb/Gutter	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
3197	INDUSTRIAL DRIVE		430-261-31	F2	7	1718	Curb/Gutter	PCC	Spalling	1/4" to 1/2"	4		No			Grind	
1834	KENSINGTON PARK ROAD		430-341-34	G3	7	1725	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
1835	KENSINGTON PARK ROAD		430-341-34	G3	7	1725	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
1836	KENSINGTON PARK ROAD		430-341-34	G3	7	1725	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
1837	KENSINGTON PARK ROAD		430-341-34	G3	7	1725	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
1838	KENSINGTON PARK ROAD		430-341-34	G3	7	1725	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
1839	KENSINGTON PARK ROAD		430-341-34	G3	7	1725	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
1840	KENSINGTON PARK ROAD		430-341-34	G3	7	1725	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
1841	KENSINGTON PARK ROAD		430-341-34	G3	7	1725	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
1842	KENSINGTON PARK ROAD		430-341-34	G3	7	1725	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
1899	KENSINGTON PARK ROAD		430-391-18	G3	7	1725	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
1900	KENSINGTON PARK ROAD		430-391-18	G3	7	1725	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
1843	KENSINGTON PARK ROAD		430-331-63	G3	7	1725	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
1766	LANSDOWNE ROAD		430-282-12	G2	7	1739	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	At manhole
1767	LANSDOWNE ROAD		430-282-12	G2	7	1739	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	At manhole
1891	LANSDOWNE ROAD		430-282-12	G2	7	1739	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
1889	LANSDOWNE ROAD		430-282-12	G2	7	1739	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No			Grind	Running parallel with sidewalk
1769	LANSDOWNE ROAD		430-282-12	G2	7	1739	Sidewalk	PCC	Faulting	1/2" to 1"	1		No			Ramp	
1768	LANSDOWNE ROAD		430-282-12	G2	7	1739	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
1770	LANSDOWNE ROAD		430-282-12	G2	7	1739	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
1771	LANSDOWNE ROAD		430-282-12	G2	7	1739	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
1772	LANSDOWNE ROAD		430-282-12	G2	7	1739	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
1773	LANSDOWNE ROAD		430-282-12	G2	7	1739	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
1774	LANSDOWNE ROAD		430-282-12	G2	7	1739	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
1776	LANSDOWNE ROAD		430-282-12	G2	7	1739	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
1890	LANSDOWNE ROAD		430-282-12	G2	7	1739	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
1892	LANSDOWNE ROAD		430-282-12	G2	7	1739	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
1775	LANSDOWNE ROAD		430-282-12	G2	7	1739	Curb/Gutter	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
2997	LEGACY RD		430-371-36	H2	7	5031	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No			Grind	Prev grind
2995	LEGACY RD		430-371-36	H2	7	5031	Sidewalk	PCC	Bumps and Sags	1/4" to 1/2"	5		No			Replace Slab	
1832	LEGACY RD		430-391-12	H3	7	5040	Sidewalk	PCC	Divided Slab	1/4" to 1/2"			No			Replace Slab	
3009	LEGACY RD		430-371-50	H2	7	5031	Sidewalk	PCC	Faulting	1/2" to 1"	2		No			Ramp	
2992	LEGACY RD		430-371-49	I2	7	5031	Sidewalk	PCC	Faulting	1/2" to 1"	2		No			Ramp	
2996	LEGACY RD		430-371-36	H2	7	5031	Sidewalk	PCC	Faulting	1/2" to 1"	1.5		No			Ramp	
3008	LEGACY RD		430-371-50	H2	7	5031	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
3010	LEGACY RD		430-371-50	H2	7	5031	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
2993	LEGACY RD		430-371-49	H2	7	5031	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
2994	LEGACY RD		430-371-49	H2	7	5031	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
3007	LEGACY RD		430-371-48	H2	7	5031	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
2998	LEGACY RD		430-371-36	H2	7	5031	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
2999	LEGACY RD		430-371-36	H3	7	5031	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
3000	LEGACY RD		430-371-36	H3	7	5031	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
3001	LEGACY RD		430-371-36	H3	7	5031	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
3002	LEGACY RD		430-371-36	H3	7	5031	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
3003	LEGACY RD		430-371-36	H3	7	5031	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
3004	LEGACY RD		430-371-36	H3	7	5031	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
3006	LEGACY RD		430-371-77	H2	7	5031	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
3005	LEGACY RD		430-371-39	H3	7	5031	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
1833	LEGACY RD		430-391-12	H3	7	5040	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
11489	MOSHER AVENUE	1382	430-233-20	G2	7	1789	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
3265	NEWPORT AVENUE	15121	430-251-35	F2	7	1182	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
3266	NEWPORT AVENUE	15121	430-251-35	F2	7	1182	Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	6		No			Grind	
3264	NEWPORT AVENUE		430-251-33	F2	7	1182	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"			No			Grind	Vegetation growing in gap
3267	NEWPORT AVENUE		430-251-31	F2	7	1182	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
3268				F2	7	1182	Sidewalk	PCC	Linear Cracking	No Displacement	14		No			Joint Seal	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
3307	RED HILL AVENUE	1472	430-233-06	G2	7	2024	Sidewalk	PCC	Other - Leave Comment	1" to 2"	2		No			Ramp	Large hole from down guy anchor
3308	RED HILL AVENUE	1472	430-233-06	G2	7	2024	Sidewalk	PCC	Divided Slab	No Displacement			No			Replace Slab	Low
3306	RED HILL AVENUE	1472	430-233-06	G2	7	2024	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
3310	RED HILL AVENUE	1472	430-233-06	G2	7	2024	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
3305	RED HILL AVENUE	1472	430-233-06	G2	7	2024	Sidewalk	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
3309	RED HILL AVENUE	1472	430-233-06	G2	7	2024	Sidewalk	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
3362	RED HILL AVENUE	1491	430-262-06	G2	7	2023	Sidewalk	PCC	Divided Slab	1/4" to 1/2"	8		No			Replace Slab	By hydrant
3360	RED HILL AVENUE	1491	430-262-06	G2	7	2023	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
3363	RED HILL AVENUE	1491	430-262-06	G2	7	2023	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
3365	RED HILL AVENUE	1491	430-262-06	G2	7	2023	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
3364	RED HILL AVENUE	1491	430-262-06	G2	7	2023	Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	15		No			Replace Slab(s)	
3361	RED HILL AVENUE	1491	430-262-06	G2	7	2023	Curb/Gutter	PCC	Spalling	1/4" to 1/2"	0.5		No			Grind	
3281	RED HILL AVENUE	1492	430-261-05	G2	7	2023	Sidewalk	PCC	Divided Slab	1/4" to 1/2"	10		No			Replace Slab	Low
3282	RED HILL AVENUE	1492	430-261-05	G2	7	2023	Sidewalk	PCC	Divided Slab	No Displacement	10		No			Replace Slab(s)	Low
3277	RED HILL AVENUE	1492	430-261-05	G2	7	2023	Sidewalk	PCC	Faulting	1/2" to 1"	2		No			Ramp	
3278	RED HILL AVENUE	1492	430-261-05	G2	7	2023	Sidewalk	PCC	Faulting	1/2" to 1"	2		No			Ramp	
3279	RED HILL AVENUE	1492	430-261-05	G2	7	2023	Sidewalk	PCC	Faulting	1/2" to 1"	4		No			Ramp	
3283	RED HILL AVENUE	1492	430-261-05	G2	7	2023	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		Yes			Grind	
3280	RED HILL AVENUE	1492	430-261-05	G2	7	2023	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	25		No			Replace Slab	
11612	RED HILL AVENUE	15012	430-282-21	F3	7	1289	Sidewalk	PCC	Other - Leave Comment	No Displacement			No			N/A	Dummy point, no distresses
1885	RED HILL AVENUE	15012	430-282-21	F3	7	1289	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
3358	RED HILL AVENUE	15101	430-262-04	F2	7	2023	Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	2		No			Grind	Pole base
3357	RED HILL AVENUE	15101	430-262-04	F2	7	2023	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	50		No			Grind	
3356	RED HILL AVENUE	15101	430-262-04	F2	7	2023	Sidewalk	PCC	Spalling	1/4" to 1/2"	5		No			Grind	
3302	RED HILL AVENUE	15471	430-261-02	G2	7	2023	Sidewalk	PCC	Linear Cracking	No Displacement	8		No			Joint Seal	No displacement yet
3304	RED HILL AVENUE	15471	430-261-02	G2	7	2023	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	Prev grind
3297	RED HILL AVENUE	15471	430-261-02	G2	7	2023	Driveway	PCC	Corner Break	1/4" to 1/2"	5		No			Grind	
3292	RED HILL AVENUE	15471	430-261-02	G2	7	2023	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
3298	RED HILL AVENUE	15471	430-261-02	G2	7	2023	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
3303	RED HILL AVENUE	15471	430-261-02	G2	7	2023	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
3299	RED HILL AVENUE	15471	430-261-02	G2	7	2023	Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	1		No			Grind	
3300	RED HILL AVENUE	15471	430-261-02	G2	7	2023	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	5		Yes			Replace Slab	
3294	RED HILL AVENUE	15471	430-261-02	G2	7	2023	Curb/Gutter	PCC	Spalling	1" to 2"	1		No			Patch	
3301	RED HILL AVENUE	15471	430-261-02	G2	7	2023	Curb/Gutter	PCC	Spalling	1" to 2"	2		No			Patch	
3293	RED HILL AVENUE	15471	430-261-02	G2	7	2023	Sidewalk	PCC	Spalling	1" to 2"	3		Yes			Patch	
3296	RED HILL AVENUE	15471	430-261-02	G2	7	2023	Driveway	PCC	Spalling	1/2" to 1"	1		No			Replace C&G	
3291	RED HILL AVENUE	15471	430-261-02	G2	7	2023	Curb/Gutter	PCC	Spalling	Over 2"	2		No			Replace C&G	
3295	RED HILL AVENUE	15471	430-261-02	G2	7	2023	Curb/Gutter	PCC	Spalling	Over 2"	1		No			Replace C&G	
3313	RED HILL AVENUE	15551	430-233-05	G2	7	2024	Sidewalk	PCC	Faulting	1/2" to 1"	3		No			Ramp	Util cover
3314	RED HILL AVENUE	15551	430-233-05	G2	7	2024	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	6		No			Grind	
3312	RED HILL AVENUE	15551	430-233-05	G2	7	2024	Curb/Gutter	PCC	Spalling	1" to 2"	1		No			Patch	
3311	RED HILL AVENUE	15551	430-233-05	G2	7	2024	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
3316	RED HILL AVENUE	15661	430-233-19	G2	7	2024	Sidewalk	PCC	Divided Slab	No Displacement			No			Replace Slab	Low
3315	RED HILL AVENUE	15661	430-233-19	G2	7	2024	Curb/Gutter	PCC	Faulting	1/2" to 1"	0.5		No			Replace C&G	
3318	RED HILL AVENUE	15771	430-231-04	G2	7	2025	Sidewalk	PCC	Other - Leave Comment	1/2" to 1"			No			Grind	Raised util cover
3319	RED HILL AVENUE	15901	430-231-25	G2	7	2025	Cross Gutter	PCC	Linear Cracking	1/4" to 1/2"	20		No			Grind	
3320	RED HILL AVENUE	15991	430-231-23	G2	7	2025	Sidewalk	PCC	Faulting	No Displacement	3		No			Joint Seal	
3286	RED HILL AVENUE		430-261-03	G2	7	2023	Sidewalk	PCC	Divided Slab	1/4" to 1/2"	10		Yes			Replace Slab	Low
3287	RED HILL AVENUE		430-261-03	G2	7	2023	Sidewalk	PCC	Divided Slab	1/2" to 1"	10		Yes			Replace Slab(s)	Med
3288	RED HILL AVENUE		430-261-03	G2	7	2023	Driveway	PCC	Punchout	1" to 2"	5		Yes			Replace Slab	Med
3355	RED HILL AVENUE		430-283-06	G2	7	1287	Ramp	PCC	Faulting	1/4" to 1/2"	2		No			Grind Ramp	Minor but on ada ramp
11613	RED HILL AVENUE		430-282-14	G2	7	1288	Sidewalk	PCC	Other - Leave Comment	1/4" to 1/2"			No			Grind	No distress. Dummy point
11618	RED HILL AVENUE		430-271-51	H2	7	1285	Sidewalk	PCC	Other - Leave Comment	No Displacement			No			N/A	No distresses on whole section. Dummy point
3167	RED HILL AVENUE		430-261-31	F3	7	2022	Sidewalk	PCC	Faulting	1/4" to 1/2"	8		Yes			Grind	Prev grind
3359	RED HILL AVENUE		430-262-02	G2	7	2023	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Util cover
2927	RED HILL AVENUE		430-271-01	G2	7	1285	Sidewalk	PCC	Corner Break	1/4" to 1/2"	0.5		No			Grind	
2926	RED HILL AVENUE		430-271-58	H2	7	1284	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
3168	RED HILL AVENUE		430-261-31	F3	7	2022	Sidewalk	PCC	Faulting	1/4" to 1/2"	6		Yes			Grind	
3289	RED HILL AVENUE		430-261-03	G2	7	2023	Driveway	PCC	Linear Cracking	1/2" to 1"	6		Yes			Grind	
3290	RED HILL AVENUE		430-261-03	G2	7	2023	Driveway	PCC	Linear Cracking	1/2" to 1"	6		Yes			Grind	
3284	RED HILL AVENUE		430-261-33	G2	7	2023	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	6		Yes			Grind	
3166	RED HILL AVENUE		430-261-31	F3	7	2022	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	5		No			Grind	
3165	RED HILL AVENUE		430-261-31	F3	7	2022	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	
3169				F2	7	2022	Sidewalk	PCC	Sidewalk Curb Separation	Over 2"	18		No			Replace Slab(s)	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
3354	RED HILL AVENUE		430-283-04	G2	7	1286	Sidewalk	PCC	Spalling	1/2" to 1"	0.5		No			Replace C&G	
3285	RED HILL AVENUE		430-261-03	G2	7	2023	Sidewalk	PCC	Spalling	1/4" to 1/2"	3		No			Grind	
3224	SANTA FE DRIVE	1301	430-262-05	F2	7	1893	Sidewalk	PCC	Divided Slab	No Displacement			Yes			Replace Slab	Low
3227	SANTA FE DRIVE	1301	430-262-05	F2	7	1893	Sidewalk	PCC	Corner Break	1/4" to 1/2"	3		Yes			Grind	
3234	SANTA FE DRIVE	1301	430-262-05	F2	7	1893	Driveway	PCC	Divided Slab	1/4" to 1/2"			Yes			Replace Slab	
3235	SANTA FE DRIVE	1301	430-262-05	F2	7	1893	Sidewalk	PCC	Divided Slab	1/4" to 1/2"			Yes			Replace Slab	
3225	SANTA FE DRIVE	1301	430-262-05	F2	7	1893	Sidewalk	PCC	Faulting	1/2" to 1"	5		Yes			Ramp	
3226	SANTA FE DRIVE	1301	430-262-05	F2	7	1893	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
3228	SANTA FE DRIVE	1301	430-262-05	F2	7	1893	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
3236	SANTA FE DRIVE	1301	430-262-05	F2	7	1893	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
3237	SANTA FE DRIVE	1301	430-262-05	F2	7	1893	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	
3223	SANTA FE DRIVE	1301	430-262-05	F2	7	1893	Curb/Gutter	PCC	Linear Cracking	1/2" to 1"	4		No			Grind	
3233	SANTA FE DRIVE	1301	430-262-05	F2	7	1893	Curb/Gutter	PCC	Linear Cracking	1/2" to 1"	5		No			Grind	
3222	SANTA FE DRIVE	1301	430-262-05	F2	7	1893	Driveway	PCC	Linear Cracking	1/4" to 1/2"	6		No			Grind	
3230	SANTA FE DRIVE	1301	430-262-05	F2	7	1893	Driveway	PCC	Linear Cracking	1/4" to 1/2"	6		No			Grind	
3231	SANTA FE DRIVE	1301	430-262-05	F2	7	1893	Driveway	PCC	Linear Cracking	1/4" to 1/2"	6		No			Grind	
3232	SANTA FE DRIVE	1301	430-262-05	F2	7	1893	Driveway	PCC	Linear Cracking	1/4" to 1/2"	6		No			Grind	
3229	SANTA FE DRIVE	1301	430-262-05	F2	7	1893	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	8		Yes			Grind	
3211	SANTA FE DRIVE	1432	430-261-07	F2	7	1893	Sidewalk	PCC	Faulting	1/2" to 1"	6		No			Ramp	
3212	SANTA FE DRIVE	1432	430-261-07	F2	7	1893	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
3213	SANTA FE DRIVE	1432	430-261-07	G2	7	1893	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		Yes			Grind	
3214	SANTA FE DRIVE	1462	430-261-06	G2	7	1893	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
3215	SANTA FE DRIVE	1462	430-261-06	G2	7	1893	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
3216	SANTA FE DRIVE	1462	430-261-06	G2	7	1893	Driveway	PCC	Linear Cracking	1/4" to 1/2"	6		No			Grind	
3221	SANTA FE DRIVE	1491	430-262-06	F2	7	1893	Sidewalk	PCC	Punchout	Over 2"	8		Yes			Replace Slab(s)	Severe. Drain broken, slab faulted
3220	SANTA FE DRIVE	1491	430-262-06	G2	7	1893	Driveway	PCC	Faulting	1/2" to 1"	5		No			Grind Driveway	
3219	SANTA FE DRIVE	1491	430-262-06	G2	7	1893	Curb/Gutter	PCC	Linear Cracking	1/2" to 1"	4		No			Grind	
3218	SANTA FE DRIVE	1491	430-262-06	G2	7	1893	Driveway	PCC	Linear Cracking	1/2" to 1"	6		No			Grind	
3217	SANTA FE DRIVE	1491	430-262-06	G2	7	1893	Driveway	PCC	Linear Cracking	1/4" to 1/2"	6		No			Grind	
1796	SEVERYNS ROAD	15246	430-362-01	G3	7	1904	Curb/Gutter	PCC	Sidewalk Curb Separation	1/2" to 1"	7		No			Grind	At at&t box
1797	SEVERYNS ROAD		430-284-04	G3	7	1904	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	At utility patch
1798	SEVERYNS ROAD		430-284-04	G3	7	1904	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	At utility patch
1801	SEVERYNS ROAD		430-284-04	G3	7	1904	Sidewalk	PCC	Linear Cracking	No Displacement	10	3"	No			Joint Seal	Prev grind
1791	SEVERYNS ROAD		430-284-04	G3	7	1904	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
1792	SEVERYNS ROAD		430-284-04	G3	7	1904	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
1793	SEVERYNS ROAD		430-284-04	G3	7	1904	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
1794	SEVERYNS ROAD		430-284-04	G3	7	1904	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
1795	SEVERYNS ROAD		430-284-04	G3	7	1904	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
1799	SEVERYNS ROAD		430-284-04	G3	7	1904	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
1800	SEVERYNS ROAD		430-284-04	G3	7	1904	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
1923	TUSTIN RANCH ROAD		430-391-33	H3	7	5005	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	At manhole
1926	TUSTIN RANCH ROAD		430-391-33	H3	7	5005	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	At manhole
1922	TUSTIN RANCH ROAD		430-391-33	H3	7	5005	Sidewalk	PCC	Faulting	1/2" to 1"	4		No			Ramp	
1924	TUSTIN RANCH ROAD		430-391-33	H3	7	5005	Sidewalk	PCC	Faulting	1/2" to 1"	4		No			Ramp	
5810	TUSTIN RANCH ROAD		430-381-65	H3	7	5005	Sidewalk	PCC	Faulting	1/2" to 1"	3		No			Ramp	
5806	TUSTIN RANCH ROAD		430-381-43	H3	7	5005	Sidewalk	PCC	Faulting	1/2" to 1"	2		No			Ramp	
2989	TUSTIN RANCH ROAD		430-371-49	I3	7	1318	Sidewalk	PCC	Faulting	1/4" to 1/2"	7		No			Grind	
2990	TUSTIN RANCH ROAD		430-371-49	I3	7	1318	Sidewalk	PCC	Faulting	1/4" to 1/2"	6		No			Grind	
2991	TUSTIN RANCH ROAD		430-371-49	I3	7	1318	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
1925	TUSTIN RANCH ROAD		430-391-33	H3	7	5005	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No			Grind	
1927	TUSTIN RANCH ROAD		430-391-33	H3	7	5005	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
1928	TUSTIN RANCH ROAD		430-391-33	H3	7	5005	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
1929	TUSTIN RANCH ROAD		430-391-33	H3	7	5005	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5811	TUSTIN RANCH ROAD		430-381-74	H3	7	5005	Sidewalk	PCC	Faulting	1/4" to 1/2"	4.5		No			Grind	
5812	TUSTIN RANCH ROAD		430-381-74	H3	7	5005	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5813	TUSTIN RANCH ROAD		430-381-74	H3	7	5005	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5814	TUSTIN RANCH ROAD		430-381-74	I3	7	5005	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
5804	TUSTIN RANCH ROAD		430-381-43	H3	7	5005	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
5805	TUSTIN RANCH ROAD		430-381-43	H3	7	5005	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
5807	TUSTIN RANCH ROAD		430-381-43	H3	7	5005	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
5809	TUSTIN RANCH ROAD		430-381-65	H3	7	5005	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	10		No			Grind	
5808	TUSTIN RANCH ROAD		430-381-43	H3	7	5005	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	12		No			Grind	
11486	VALENCIA AVENUE	1382	430-233-20	G2	7	1257	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
11487				) G2	7	1257	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
11488	VALENCIA AVENUE	1382	430-233-20	G2	7	1257	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
1822	VALENCIA AVENUE	1462	430-342-63	G3	7	1256	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
1820	VALENCIA AVENUE	1462	430-342-63	G3	7	1256	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	3.5		No			Grind	Prev grinded, running parallel with sidewalk
1819	VALENCIA AVENUE	1462	430-342-63	G3	7	1256	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	4.5		No			Grind	Running parallel with sidewalk
1817	VALENCIA AVENUE	1462	430-342-63	G3	7	1256	Sidewalk	PCC	Faulting	1/2" to 1"	1		Yes			Ramp	
1818	VALENCIA AVENUE	1462	430-342-63	G3	7	1256	Sidewalk	PCC	Faulting	1/2" to 1"	5		Yes			Ramp	
1821	VALENCIA AVENUE	1462	430-342-63	G3	7	1256	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
11490	VALENCIA AVENUE	15442	430-253-16	G2	7	1257	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
1777	VALENCIA AVENUE	15445	430-282-13	G2	7	1320	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	Prev grind
1888	VALENCIA AVENUE	15445	430-282-13	G2	7	1320	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
1778	VALENCIA AVENUE		430-282-12	G2	7	1322	Ramp	PCC	Linear Cracking	1/4" to 1/2"	8	0.5	No			Replace Ramp	.5 ft vert
1783	VALENCIA AVENUE		430-282-11	G2	7	1322	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	At communication box
1786	VALENCIA AVENUE		430-284-04	G3	7	1322	Sidewalk	PCC	Spalling	1/4" to 1/2"	0.5		No			Grind	At hydrant
1830	VALENCIA AVENUE		430-341-34	G3	7	1256	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	At manhole
1932	VALENCIA AVENUE		430-391-38	H3	7	5002	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	At manhole
1931	VALENCIA AVENUE		430-391-34	H3	7	5002	Sidewalk	PCC	Faulting	1/2" to 1"	4		No			Ramp	At manhole, running parallel with sidewalk
1898	VALENCIA AVENUE		430-391-39	G3	7	5002	Ramp	PCC	Patch / Utility Cut	1/4" to 1/2"			No			Grind	At patch. Bumps vert
1785	VALENCIA AVENUE		430-284-04	G3	7	1322	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	At pole
1886	VALENCIA AVENUE		430-282-15	G2	7	1320	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	At utility patch
11616	VALENCIA AVENUE		430-283-09	G3	7	1321	Sidewalk	PCC	Other - Leave Comment	No Displacement			No			N/A	No distress, dummy point
11614	VALENCIA AVENUE		430-283-06	G2	7	1321	Sidewalk	PCC	Other - Leave Comment	No Displacement			No			N/A	No distress, dummy point
1823	VALENCIA AVENUE		430-341-34	G3	7	1256	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	Prev grind
1824	VALENCIA AVENUE		430-341-34	G3	7	1256	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
1826	VALENCIA AVENUE		430-341-34	G3	7	1256	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		Yes			Grind	Prev grind
1828	VALENCIA AVENUE		430-341-34	G3	7	1256	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
1829	VALENCIA AVENUE		430-341-34	G3	7	1256	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	Prev grind
1807	VALENCIA AVENUE		430-351-84	G3	7	1255	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	Prev grind
1809	VALENCIA AVENUE		430-351-84	G3	7	1255	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
1811	VALENCIA AVENUE		430-351-84	G3	7	1255	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	Prev grind
1814	VALENCIA AVENUE		430-351-84	G3	7	1255	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	Prev grind
1815	VALENCIA AVENUE		430-351-84	G3	7	1255	Sidewalk	PCC	Faulting	1/4" to 1/2"	4		No			Grind	Prev grind
1816	VALENCIA AVENUE		430-351-84	G3	7	1255	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Prev grind
1789	VALENCIA AVENUE		430-284-04	G3	7	1322	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	Running parallel with sidewalk
1784	VALENCIA AVENUE		430-282-11	G2	7	1322	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	Sunken gas patch
5909	VALENCIA AVENUE		430-283-06	G2	7	1319	Sidewalk	PCC	Faulting	1/2" to 1"	3.5		No			Ramp	
5905	VALENCIA AVENUE		430-283-06	G2	7	1319	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
5906	VALENCIA AVENUE		430-283-06	G2	7	1319	Sidewalk	PCC	Faulting	1/4" to 1/2"	3.5		No			Grind	
5907	VALENCIA AVENUE		430-283-06	G2	7	1319	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
5910	VALENCIA AVENUE		430-283-06	G2	7	1319	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5982	VALENCIA AVENUE		430-283-06	G2	7	1319	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
1779	VALENCIA AVENUE		430-282-11	G2	7	1322	Sidewalk	PCC	Faulting	1/4" to 1/2"	4.5		No			Grind	
1782	VALENCIA AVENUE		430-282-11	G2	7	1322	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
1787	VALENCIA AVENUE		430-284-04	G3	7	1322	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
1788	VALENCIA AVENUE		430-284-04	G3	7	1322	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
1790	VALENCIA AVENUE		430-284-04	G3	7	1322	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
1825	VALENCIA AVENUE		430-341-34	G3	7	1256	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
1827	VALENCIA AVENUE		430-341-34	G3	7	1256	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
1831	VALENCIA AVENUE		430-341-34	G3	7	1256	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
1808	VALENCIA AVENUE		430-351-84	G3	7	1255	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
1810	VALENCIA AVENUE		430-351-84	G3	7	1255	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
1813	VALENCIA AVENUE		430-351-84	G3	7	1255	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	
1806	VALENCIA AVENUE		430-284-01	G3	7	1255	Sidewalk	PCC	Faulting	1/4" to 1/2"	5		No			Grind	
1802	VALENCIA AVENUE		430-284-04	G3	7	1255	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
1805	VALENCIA AVENUE		430-284-04	G3	7	1255	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
1812	VALENCIA AVENUE		430-284-04	G3	7	1255	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
1930	VALENCIA AVENUE		430-391-34	H3	7	5002	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
1893	VALENCIA AVENUE		430-391-39	H3	7	5002	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
1894	VALENCIA AVENUE		430-391-39	H3	7	5002	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
1895	VALENCIA AVENUE		430-391-39	H3	7	5002	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
1896	VALENCIA AVENUE		430-391-39	H3	7	5002	Sidewalk	PCC	Faulting	1/4" to 1/2"	8		No			Grind	
1897	VALENCIA AVENUE		430-391-39	H3	7	5002	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
1804	VALENCIA AVENUE		430-284-04	G3	7	1255	Curb/Gutter	PCC	Sidewalk Curb Separation	1/4" to 1/2"	4		No			Grind	
1780	VALENCIA AVENUE		430-282-11	G2	7	1322	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	30		No			Grind	
1803				G3	7	1255	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	8		No			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
1887	VALENCIA AVENUE		430-282-15	G2	7	1320	Sidewalk	PCC	Spalling	1/4" to 1/2"	0.5		No			Grind	
1781	VALENCIA AVENUE		430-282-11	G2	7	1322	Sidewalk	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
5940	VICTORY ROAD		430-283-09	G2	7	5033	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	At manhole
5961	VICTORY ROAD		430-283-22	G2	7	5033	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
5966	VICTORY ROAD		430-283-22	G2	7	5033	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5936	VICTORY ROAD		430-283-09	G2	7	5033	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
5928	VICTORY ROAD		430-283-21	G2	7	5033	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5951	VICTORY ROAD		430-283-21	G2	7	5033	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5955	VICTORY ROAD		430-283-21	G2	7	5033	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5919	VICTORY ROAD		430-283-24	G2	7	5033	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
5921	VICTORY ROAD		430-283-24	G2	7	5033	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
5942	VICTORY ROAD		430-283-09	G2	7	5033	Sidewalk	PCC	Linear Cracking	1/4" to 1/2"	1.5		No			Grind	
3345	WARNER AVENUE	1123	430-241-12	G2	7	1263	Sidewalk	PCC	Faulting	1/2" to 1"	2		No			Ramp	Both sides of slab faulted
3344	WARNER AVENUE	1123	430-241-12	G2	7	1263	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		No			Grind	
3346	WARNER AVENUE	1123	430-241-12	G2	7	1263	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
3347	WARNER AVENUE	1123	430-241-12	G2	7	1263	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
3348	WARNER AVENUE	1123	430-241-12	G2	7	1263	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
3342	WARNER AVENUE	1123	430-241-12	G2	7	1266	Cross Gutter	PCC	Linear Cracking	1/4" to 1/2"	7		No			Grind	
3341	WARNER AVENUE	1123	430-241-12	G2	7	1263	Cross Gutter	PCC	Linear Cracking	1/4" to 1/2"	7		No			Grind	
3343	WARNER AVENUE	1123	430-241-12	G2	7	1263	Curb/Gutter	PCC	Sidewalk Curb Separation	1" to 2"	10		No			Replace Curb	
3349	WARNER AVENUE	1123	430-241-12	G2	7	1263	Sidewalk	PCC	Sidewalk Curb Separation	1/4" to 1/2"	6		Yes			Grind	
3337	WARNER AVENUE	1231	430-231-17	G2	7	1266	Sidewalk	PCC	Corner Break	1" to 2"	3		No			Replace Slab	
3334	WARNER AVENUE	1231	430-231-17	G2	7	1266	Driveway	PCC	Faulting	1/2" to 1"	3		No			Grind Driveway	
3336	WARNER AVENUE	1231	430-231-17	G2	7	1266	Curb/Gutter	PCC	Linear Cracking	1/4" to 1/2"	4		No			Grind	
3332	WARNER AVENUE	1231	430-231-17	G2	7	1266	Driveway	PCC	Linear Cracking	1/4" to 1/2"	7		No			Grind	
3333	WARNER AVENUE	1231	430-231-17	G2	7	1266	Driveway	PCC	Linear Cracking	1/4" to 1/2"	7		No			Grind	
3335	WARNER AVENUE	1231	430-231-17	G2	7	1266	Driveway	PCC	Sidewalk Curb Separation	1" to 2"	4		No			Patch	
3322	WARNER AVENUE	15991	430-231-23	G2	7	1266	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
3321	WARNER AVENUE	15991	430-231-23	G2	7	1266	Driveway	PCC	Corner Break	1/2" to 1"	2		No			Ramp	
3352	WARNER AVENUE	15991	430-283-19	H2	7	5025	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No	Yes		Grind	
2929	WARNER AVENUE		430-271-01	G2	7	5024	Sidewalk	PCC	Patch / Utility Cut	No Displacement			No			Patch	20 square ft
2928	WARNER AVENUE		430-271-01	G2	7	5024	Sidewalk	PCC	Patch / Utility Cut	1/4" to 1/2"	8	4.5	No			Grind	35 sqaure ft
11617	WARNER AVENUE		430-271-35	H2	7	5024	Sidewalk	PCC	Other - Leave Comment	No Displacement			No			N/A	Dummy point, no distress
3339	WARNER AVENUE		430-241-21	G2	7	1266	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	Prev grind
3340	WARNER AVENUE		430-241-21	G2	7	1266	Sidewalk	PCC	Other - Leave Comment	1/4" to 1/2"			No			Grind	Util cover loose
2948	WARNER AVENUE		430-371-30	H3	7	5029	Sidewalk	PCC	Faulting	1/2" to 1"	2.5		No			Ramp	
2944	WARNER AVENUE		430-371-49	I3	7	5028	Sidewalk	PCC	Faulting	1/2" to 1"	4.5		No			Ramp	
2945	WARNER AVENUE		430-371-49	I3	7	5028	Sidewalk	PCC	Faulting	1/2" to 1"	2		No			Ramp	
2946	WARNER AVENUE		430-371-49	I3	7	5028	Sidewalk	PCC	Faulting	1/2" to 1"	2.5		No			Ramp	
2937	WARNER AVENUE		430-371-36	H3	7	5028	Sidewalk	PCC	Faulting	1/2" to 1"	2.5		No			Ramp	
3350	WARNER AVENUE		430-241-12	G1	7	1263	Sidewalk	PCC	Faulting	1/2" to 1"	4		No			Ramp	
3328	WARNER AVENUE		430-231-22	G2	7	1266	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		Yes			Grind	
3338	WARNER AVENUE		430-241-21	G2	7	1266	Sidewalk	PCC	Faulting	1/4" to 1/2"	3		Yes			Grind	
3353	WARNER AVENUE		430-283-25	G2	7	5025	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
2930	WARNER AVENUE		430-271-36	H2	7	5024	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	
2934	WARNER AVENUE		430-371-39	H3	7	5026	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
2935	WARNER AVENUE		430-371-39	H3	7	5026	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
2933	WARNER AVENUE		430-371-57	H2	7	5026	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
2931	WARNER AVENUE		430-371-59	H2	7	5026	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
2932	WARNER AVENUE		430-371-59	H2	7	5026	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
2952	WARNER AVENUE		430-371-61	H3	7	5027	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
2953	WARNER AVENUE		430-371-20	H2	7	5027	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
2954	WARNER AVENUE		430-371-20	H2	7	5027	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
2947	WARNER AVENUE		430-371-30	I3	7	5029	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
2949	WARNER AVENUE		430-371-30	H3	7	5029	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
2950	WARNER AVENUE		430-371-27	H3	7	5029	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
2951	WARNER AVENUE		430-371-27	H3	7	5029	Sidewalk	PCC	Faulting	1/4" to 1/2"	1.5		No			Grind	
2938	WARNER AVENUE		430-371-49	H3	7	5028	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
2939	WARNER AVENUE		430-371-49	H3	7	5028	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
2940	WARNER AVENUE		430-371-49	H3	7	5028	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
2941	WARNER AVENUE		430-371-49	H3	7	5028	Sidewalk	PCC	Faulting	1/4" to 1/2"	2		No			Grind	
2942	WARNER AVENUE		430-371-49	I3	7	5028	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		No			Grind	
2943	WARNER AVENUE		430-371-49	I3	7	5028	Sidewalk	PCC	Faulting	1/4" to 1/2"	0.5		No			Grind	
2936				I3	7	5028	Sidewalk	PCC	Faulting	1/4" to 1/2"	2.5		No			Grind	

City of Tustin, CA
Sidewalk Distress Inventory

Sorted by Zone (1-7)

Object ID	Street Name	Address	APN	Mapbook	Zone	PMP Sec ID	Asset Type	Surface Type	Distress Type	Vertical Displacement	Length	Width	Tree	Utility Box	Sensitive Area	Recommendation	Comments
3323	WARNER AVENUE		430-231-22	G2	7	1266	Driveway	PCC	Linear Cracking	1/4" to 1/2"	7		No			Grind	
3324	WARNER AVENUE		430-231-22	G2	7	1266	Driveway	PCC	Linear Cracking	1/4" to 1/2"	7		No			Grind	
3329	WARNER AVENUE		430-231-22	G2	7	1266	Driveway	PCC	Linear Cracking	1/4" to 1/2"	7		No			Grind	
3330	WARNER AVENUE		430-231-22	G2	7	1266	Driveway	PCC	Linear Cracking	1/4" to 1/2"	7		No			Grind	
3326	WARNER AVENUE		430-231-22	G2	7	1266	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	10		No			Replace Slab	
3351	WARNER AVENUE		430-241-12	G1	7	1263	Sidewalk	PCC	Sidewalk Curb Separation	1" to 2"	16		No			Replace Slab	
3327	WARNER AVENUE		430-231-22	G2	7	1266	Sidewalk	PCC	Sidewalk Curb Separation	1/2" to 1"	6		No			Grind	
3325	WARNER AVENUE		430-231-22	G2	7	1266	Curb/Gutter	PCC	Spalling	1" to 2"	1		No			Patch	
3331	WARNER AVENUE		430-231-22	G2	7	1266	Driveway	PCC	Spalling	1/4" to 1/2"	1		No			Grind	
3241	WOODLAWN AVENUE	1301	430-262-05	F2	7	1973	Sidewalk	PCC	Other - Leave Comment	1/4" to 1/2"	20		Yes			Grind	Covered in vegetation, some faulting
3240	WOODLAWN AVENUE	1301	430-262-05	F2	7	1973	Curb/Gutter	PCC	Linear Cracking	1/4" to 1/2"	6		No			Grind	
3238	WOODLAWN AVENUE	1301	430-262-05	F2	7	1973	Sidewalk	PCC	Linear Cracking	No Displacement	4		No			Joint Seal	
3239	WOODLAWN AVENUE	1301	430-262-05	F2	7	1973	Curb/Gutter	PCC	Spalling	1" to 2"	1		No			Patch	
3210	WOODLAWN AVENUE	15201	430-261-10	F2	7	1973	Curb/Gutter	PCC	Other - Leave Comment	1/2" to 1"	8		No			Patch	Scaling/Popouts
3209	WOODLAWN AVENUE	15201	430-261-10	F2	7	1973	Curb/Gutter	PCC	Spalling	Over 2"	1		No			Replace C&G	
3207	WOODLAWN AVENUE		430-261-29	F2	7	1973	Sidewalk	PCC	Faulting	1/2" to 1"	3		Yes			Ramp	
3208	WOODLAWN AVENUE		430-261-29	F2	7	1973	Sidewalk	PCC	Faulting	1/4" to 1/2"	1		Yes			Grind	

Appendix C:

List of Curb Ramps Without Detectable Warning Surface (Supporting Inventories)

Zone	Street Location	No Truncated Domes
ZONE 1		
1	Yorba (N) / Laurie Ln	NWC
1	Yorba (N) / Laurie Ln	SWC
1	Palace Way / Laurie Ln	SWC
1	Palace Way / Laurie Ln	SEC
1	Yorba (N) / Bonner Dr	NWC
1	Yorba (N) / Bonner Dr	NEC
1	Yorba (N) / Bonner Dr	SWC
1	Yorba (N) / Bonner Dr	SEC
1	Loretta Dr / Bonner Dr	NWC
1	Loretta Dr / Bonner Dr	SWC
1	Loretta Dr / Bonner Dr	SEC
1	Loretta Dr / Medford Ave	NWC
1	Loretta Dr / Medford Ave	NEC
1	Loretta Dr / Medford Ave	SWC
1	Yorba (N) / Medford Ave	NWC
1	Yorba (N) / Medford Ave	SWC
1	Medford Ave / Carroll Wy	SWC
1	Medford Ave / Carroll Wy	SEC
1	Marshall Ln / Medford Ave	NEC
1	Marshall Ln / Anglin Dr	NEC
1	Marshall Ln / Anglin Dr	SEC
1	Carroll Wy & Yorba (S) at 17th	NWC
1	Carroll Wy & Yorba (S) at 17th	NEC
1	Carroll Wy & Yorba (S) at 17th	SWC
1	Carroll Wy & Yorba (S) at 17th	SEC
1	Treehaven Dr / 17th	NWC
1	Treehaven Dr / 17th	NEC
1	Malena Dr / Shadel Dr	NWC
1	Malena Dr / Shadel Dr	SWC
1	Yorba (S) / Jacaranda Ave	NEC
1	Yorba (S) / Jacaranda Ave	SEC
1	Yorba (S) / Yorba West CDS #1	NWC
1	Yorba (S) / Yorba West CDS #1	SWC
1	Yorba (S) / Yorba West CDS #2	NWC
1	Yorba (S) / Yorba West CDS #2	SWC
1	Yorba (S) / Norwood Park Pl	NWC
1	Yorba (S) / Norwood Park Pl	SWC
1	Yorba (S) / Norwood Park Pl	NEC
1	Yorba (S) / Norwood Park Pl	SEC
1	Yorba (S) / Parker Dr	NEC
1	Yorba (S) / Parker Dr	SEC
1	Yorba (S) / Village Dr	NEC
1	Yorba (S) / Village Dr	SEC
1	Yorba (S) / Heights Dr	NWC
1	Yorba (S) / Amaganset Wy	NWC
1	Yorba (S) / Amaganset Wy	SWC
1	Yorba (S) / Amaganset Wy	NEC
1	Yorba (S) / Amaganset Wy	SEC
1	Yorba (S) / Bergen Cir	NWC
1	Yorba (S) / Bergen Cir	SWC
1	Yorba (S) / Roseleaf Ave	NWC
1	Yorba (S) / Roseleaf Ave	SWC
1	Yorba (S) / Roseleaf Ave	NEC
1	Yorba (S) / Roseleaf Ave	SEC
1	Yorba (S) / Vinewood Ave	NEC
1	Yorba (S) / Vinewood Ave	SEC
1	Yorba (S) / Irvine Blvd	NWC
1	Acacia Dr / Amaganset Wy	NWC
1	Acacia Dr / Amaganset Wy	NEC

1	Brookline Wy / Amaganset Wy	SWC
1	Brookline Wy / Amaganset Wy	SEC
1	Iverness Wy / Amaganset Wy	SWC
1	Iverness Wy / Amaganset Wy	SEC
1	Amberwick Ln / Sherbrook Dr	NWC
1	Amberwick Ln / Sherbrook Dr	NEC
1	Prospect (S) / Sherbrook Dr	NWC
1	Prospect (S) / Sherbrook Dr	SWC
1	Prospect (S) / Norwood Park Pl	NWC
1	Prospect (S) / Norwood Park Pl	SWC
1	Prospect (S) / Orange Tree Ln	NWC
1	Prospect (S) / Orange Tree Ln	SWC
1	Prospect (S) / Wellington Ave	NWC
1	Prospect (S) / Wellington Ave	SWC
1	Prospect (S) / Fiesta Wy	NWC
1	Prospect (S) / Fiesta Wy	SWC
1	Prospect (S) / Arbolada Wy	NWC
1	Prospect (S) / Arbolada Wy	SWC
1	Prospect (S) / Vandenberg Ln	NWC
1	Prospect (S) / Vandenberg Ln	SWC
1	Prospect (S) / Anglin Ln	NWC
1	Ridgecrest Cir / Anglin Ln	SWC
1	Ridgecrest Cir / Anglin Ln	SEC
1	Malena Dr / Anglin Ln	NEC
1	Malena Dr / Anglin Ln	SEC
1	Malena Dr / Laurie Ln	NWC
1	Malena Dr / Laurie Ln	SWC
1	Shasta Wy / Beneta Wy	NWC
1	Shasta Wy / Beneta Wy	NEC
1	Plaza Dr / Plaza Wy	NWC
1	Plaza Dr / Plaza Wy	SWC
1	Plaza Dr / Irvine Blvd	NWC
1	Plaza Dr / Irvine Blvd	NEC

ZONE 2

2	Yorba (S) / Irvine Blvd	SWC
2	Yorba (S) / Irvine Blvd	SEC
2	Mountain View Dr / Irvine Blvd	SWC
2	Mountain View Dr / Irvine Blvd	SEC
2	"A" St / Irvine Blvd	SWC
2	"A" St / Irvine Blvd	SEC
2	"B" St / Irvine Blvd	SWC
2	"B" St / Irvine Blvd	SEC
2	Myrtle Ave / 1st	NSECWC
2	Yorba & Pacific / 1st	NWC @ island 1
2	Yorba & Pacific / 1st	SEC @ island 1
2	Yorba & Pacific / 1st	SEC @ island 2
2	Mountain View Dr / 1st	NWC
2	Mountain View Dr / 1st	NEC
2	"A" St / 1st	NWC
2	"A" St / 1st	NEC
2	"A" St / 1st	SWC
2	"A" St / 1st	SEC
2	"C" St / 1st	NWC
2	El Camino Real / 1st	NWC
2	El Camino Real / 1st	SWC
2	El Camino Real / 1st	SEC
2	Prospect (S) / 1st	NEC
2	Prospect (S) / 1st	SWC
2	Prospect (S) / 1st	SEC

2	Prospect (S) / Orangewood Ln	NWC
2	Prospect (S) / Orangewood Ln	SWC
2	Centennial Wy / 1st	NWC
2	Centennial Wy / 1st	NEC
2	Williams / Main	SWC
2	Williams / Main	SEC
2	W/O Stoneglass / Main	NWC
2	W/O Stoneglass / Main	NEC
2	Pacific / Main	NWC
2	Pacific / Main	NEC
2	Pacific / Main	SWC
2	Pacific / Main	SEC
2	California / Main	NWC
2	California / Main	NEC
2	"A" St / Main	NWC
2	"A" St / Main	NEC
2	"B" St / Main	NWC
2	"B" St / Main	NEC
2	"B" St / Main	SWC
2	"B" St / Main	SEC
2	"C" St / Main	NWC
2	"C" St / Main	NEC
2	"C" St / Main	SWC
2	"C" St / Main	SEC
2	El Camino Real / Main	NWC
2	El Camino Real / Main	NEC
2	El Camino Real / Main	SWC
2	El Camino Real / Main	SEC
2	Pasadena / 2nd	NEC
2	Pasadena / 2nd	SEC
2	Myrtle St / 2nd	NWC
2	Myrtle St / 2nd	SWC
2	Pacific St / 2nd	NEC
2	Pacific St / 2nd	SEC
2	Pacific St / 3rd	NWC
2	Pacific St / 3rd	NEC
2	Pacific St / 3rd	SWC
2	Pacific St / 3rd	SEC
2	California / 3rd	SWC
2	California / 3rd	SEC
2	"A" St / 3rd	SEC
2	"B" St / 2nd	NWC
2	"B" St / 2nd	SWC
2	"C" St / 2nd	NEC
2	"C" St / 2nd	SWC
2	El Camino Real / 2nd	NWC
2	El Camino Real / 2nd	NEC
2	El Camino Real / 2nd	SWC
2	El Camino Real / 2nd	SEC
2	Prospect (S) / 2nd	NWC
2	Prospect (S) / 2nd	SWC
2	"C" St / 3rd	SEC
2	El Camino Real / 3rd	NWC
2	El Camino Real / 3rd	NEC
2	El Camino Real / 3rd	SWC
2	El Camino Real / 3rd	SEC
2	Prospect (S) / 3rd	NEC
2	Prospect (S) / 3rd	SEC
2	Pacific St / 6th	NWC
2	Pacific St / 6th	SWC
2	"B" / 6th	SEC

2	El Camino Real / 6th	NWC
2	El Camino Real / 6th	NEC
2	El Camino Real / 6th	SWC
2	El Camino Real / 6th	SEC
2	Ambrose Ln / 6th	SWC
2	Ambrose Ln / 6th	SEC
2	Ambrose Ln / Platt Wy	SWC
2	Ambrose Ln / Platt Wy	SEC
2	El Camino Real / El Camino Wy	SWC
2	Pasadena Ave / Medallion	SWC
2	Myrtle Ave / McFadden	NWC
2	Myrtle Ave / McFadden	NEC
2	Myrtle Ave / Medallion	NEC
2	Myrtle Ave / Medallion	SEC
2	Pacific / Medallion	NWC
2	Pacific / Medallion	NEC
2	Myrtle Ave / Corla	NEC
2	Myrtle Ave / Corla	SEC
2	Pacific / Corla	SWC
2	Pacific / Corla	SEC
2	Corla / California	SWC
2	Corla / California	SEC
2	"B" / Mitchell	NWC
2	"B" / Mitchell	NEC
2	"B" / Mitchell	SEC
2	"C" / Mitchell	NEC
2	"C" / Mitchell	NWC
2	Bliss Ln / Altadena	SWC
2	Bliss Ln / Altadena	SEC
2	Myrtle Ave / Altadena	NWC
2	Myrtle Ave / Altadena	SWC

ZONE 3

3	Newport / Wass	SEC
3	Elizabeth Wy / Irvine	NWC
3	Red Hill / Irvine	NWC
3	Red Hill / Irvine	SWC
3	Red Hill / Garland	NWC
3	Red Hill / Garland	SWC
3	Red Hill / 1st	NWC
3	Coral Reef / 1st	SWC
3	Coral Reef / 1st	SEC
3	White Sand Dr / 1st	NWC
3	White Sand Dr / 1st	SWC
3	White Sand Dr / 1st	SEC
3	Red Hill / El Camino Real	NWC
3	Red Hill / El Camino Real	NEC
3	Orange St / El Camino Real	NWC
3	Orange St / El Camino Real	NEC
3	Orange St / El Camino Real	SWC
3	Orange St / Walnut St	NWC
3	Orange St / Walnut St	SWC
3	Orange St / San Juan St	NEC
3	Orange St / San Juan St	SWC
3	Orange St / San Juan St	SEC
3	Charloma Dr / San Juan St	NWC
3	Charloma Dr / San Juan St	NEC
3	Utt Dr / San Juan St	NWC
3	Green Valley Dr / San Juan St	NWC
3	Green Valley Dr / San Juan St	NEC

3	Farmington Rd / San Juan St	NWC
3	Farmington Rd / San Juan St	NEC
3	Browning Ave / Jan Marie Pl	NWC
3	Browning Ave / Jan Marie Pl	SWC

ZONE 4

4	Red Hill / Nisson Rd	NEC
4	Red Hill / Mitchell Ave	NWC
4	Red Hill / Mitchell Ave	NEC
4	Red Hill / Mitchell Ave	SWC
4	Red Hill / Mitchell Ave	SEC
4	Red Hill / Copperfield Dr	NEC
4	Red Hill / Copperfield Dr	SEC
4	Pinebrook Dr / Nisson Rd	SWC
4	Pinebrook Dr / Nisson Rd	SEC
4	Browning Ave / Yolanda Wy	NWC
4	Browning Ave / Yolanda Wy	SWC
4	Browning Ave / Ren Cir	NWC
4	Browning Ave / Ren Cir	SWC
4	Browning Ave / Sandfield Pl	NEC
4	Browning Ave / Sandfield Pl	SEC
4	Browning Ave / Walnut Ave	SEC

ZONE 5

5	Auto Center Dr / El Camino Real	NWC
5	Auto Center Dr / El Camino Real	NEC
5	Myford Rd / El Camino Real	NWC
5	Myford Rd / El Camino Real	NEC
5	Myford Rd / El Camino Real	SWC
5	Myford Rd / El Camino Real	SEC
5	West Dr / El Camino Real	NWC
5	West Dr / El Camino Real	NEC
5	Pioneer Rd / Pioneer Wy	NWC
5	Pioneer Rd / Pioneer Wy	NEC
5	Pioneer Rd / Pioneer Wy	SWC
5	Pioneer Rd / Pioneer Wy	SEC
5	Pioneer Rd / Schwendeman Ave	SWC
5	Pioneer Rd / Schwendeman Ave	SEC
5	Pioneer Rd @ West CDS	NWC
5	Pioneer Rd @ West CDS	SWC
5	Pioneer Rd / Baxter	NEC
5	Pioneer Rd / Baxter	SEC
5	Pioneer Rd @ Cedar Grove Park	NWC
5	Pioneer Rd @ Cedar Grove Park	NEC
5	Pioneer Rd @ Peters Canyon Rd	NWC
5	Pioneer Rd @ Peters Canyon Rd	NEC
5	Pioneer Rd @ Peters Canyon Rd	SWC
5	Pioneer Rd @ Peters Canyon Rd	SEC
5	Peters Canyon Rd / Orchard	NWC
5	Peters Canyon Rd / Orchard	NEC
5	Peters Canyon Rd / Orchard	SWC
5	Peters Canyon Rd / Orchard	SEC
5	Peters Canyon Rd @ North CDS	NWC
5	Peters Canyon Rd @ North CDS	NEC
5	Pioneer Rd / Carlson Ct	NWC
5	Pioneer Rd / Carlson Ct	NEC
5	Pioneer Rd / Carlson Ct	SWC
5	Pioneer Rd / Carlson Ct	SEC
5	Pioneer Rd / Plumb Dr	NEC

5	Pioneer Rd / Plumb Dr	SEC
5	Pioneer Rd / Davis Dr	NEC
5	Pioneer Rd / Davis Dr	SEC
5	Pioneer Rd / Rogue River Bend	NWC
5	Pioneer Rd / Rogue River Bend	SWC
5	Pioneer / Rogue River @ Island	2 ramps
5	Pioneer Rd / Brand Dr	NEC
5	Pioneer Rd / Brand Dr	SEC
5	Pioneer Rd / Patriot Wy	NWC
5	Pioneer Rd / Patriot Wy	NEC
5	Pioneer Rd / Patriot Wy	SEC
5	Pioneer Rd / Casteneda Dr	NEC
5	Pioneer Rd / Casteneda Dr	SEC
5	Costello Dr / Casteneda Dr	NWC
5	Costello Dr / Casteneda Dr	SWC
5	Pioneer Rd / Emerson Bend	NWC
5	Pioneer Rd / Emerson Bend	SWC
5	Pioneer / Emerson Bend @ Island	2 ramps
5	Pioneer Rd / Carson Dr	NEC
5	Pioneer Rd / Carson Dr	SEC
5	Pioneer Rd / Hewes Ave	NWC
5	Pioneer Rd / Hewes Ave	NEC
5	Pioneer Rd / Hewes Ave	SWC

ZONE 6

6	Edinger / Jamboree Plaza	NWC
6	Edinger / Jamboree Plaza	NEC
6	Edinger / DWY E/O Jamboree Plaza	NWC
6	Edinger / DWY E/O Jamboree Plaza	NEC
6	Edinger / Jamboree Rd	12 ramps

ZONE 7

7	Various commercial DWY's - not City	
---	-------------------------------------	--